

TABLE OF CONTENTS

	<u>Page</u>
ABSTRACT	
TABLE OF CONTENTS	i
LIST OF FIGURES	i
LIST OF PHOTOGRAPHS	ii
LIST OF TABLES	ii
1.0 INTRODUCTION	1
1.1 Purpose and Need	1
1.2 Project Description	1
2.0 METHODS	10
2.1 Background Research	10
2.2 Fieldwork	10
3.0 RESULTS	12
3.1 Geomorphology	12
3.2 Standing Structure Assessment	20
4.0 CONCLUSIONS AND RECOMMENDATIONS	28
5.0 REFERENCES CITED	30
APPENDIXES	
APPENDIX A CRS SURVEY UPDATE FORM	
APPENDIX B SOIL PROFILES	

LIST OF FIGURES

<u>Figure No.</u>	<u>Title</u>	<u>Page</u>
1	Project Location	2
2	Plan View	7
3	Area of Potential Effect for Historic Resources	8
4	Soil Profiles, Auger Borings 1 and 2	19
5	Soil Profile, Auger Boring 3	21
6	Soil Profile, Auger Boring 4	22
7	Project Area in 1868	24

LIST OF PHOTOGRAPHS

<u>Photograph No.</u>	<u>Title</u>	<u>Page</u>
1	View of the project APE showing the failing retaining wall, facing northwest.	3
2	View of the south and east elevations of the house (S-4387), facing north. Note failing retaining wall at bottom of photograph.	4
3	View of the north and east elevations of the house (S-4387), facing north. Note Bridge 146 at left bottom of photograph.	4
4	View of the north and west elevations of the house (S-4387), facing north. Note small shed at right of photograph.	5
5	View of one of two pilings located in the south yard of the house (S-4387), facing east	14
6	Close view of one of the two pilings located in the south yard of the house (S-4387), facing south.	15
7	View of the hole containing PVC piping located southwest of the house (S-4387), facing southwest.	17
8	View of the south stream cut bank located southeast of the project APE, facing north.	18

LIST OF TABLES

<u>Table No.</u>	<u>Title</u>	<u>Page</u>
1	Previously Recorded Archaeological Sites Within 3.2 Km (2.0 Mi) of the Bridge 146 Retaining Wall Project APE.	12