
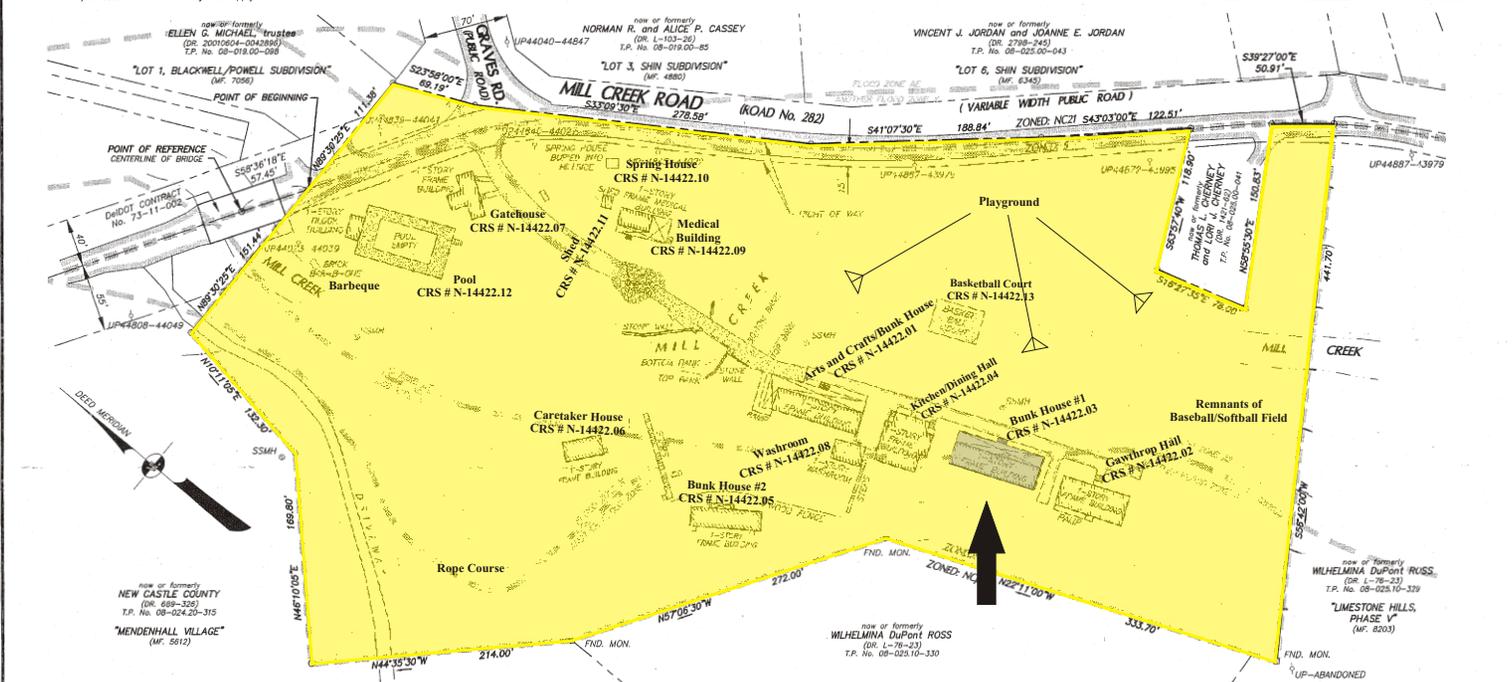


Bunk House #1
(CRS # N-14422.03)

C:\dwg\38083M.dwg, 4/10/2008 10:37:13 AM, Jason Rose, VanDemark & Lynch, Inc.

NOTES:

- Owner: West End Neighborhood House, Inc.
3850 Mill Creek Road
Hockessin, DE 19707
 - Tax Parcel No.: 08-025.00-011
 - Source of Title: Deed Record C, Volume 86, Page 114
 - Area: 7.483± Acres
 - Zoning: New Castle County Unified Development Code
Zoning: S, Suburban (other permitted uses)
Lot Area: 2 acre
Lot Width: 200'
Building Height: 40' MAX.
Building Setbacks: Street - 50'
Rear - 50'
Side - 40'
- Setback lines indicated above per New Castle County Unified Development Code interpretation and must be verified by New Castle County prior to Land Development. Buffer and Green Area and/or other restrictions may also apply.
- This plan was prepared without the benefit of a title commitment, title search or bring down and is subject to easements, validity of chain of title, etc., that a subsequent search may disclose.
 - Date of Field Survey: December 12, 2005
Revision 1 - April 5, 2006 - Located Buildings
 - A portion of the Property described on this survey DOES lie within a Special Flood Hazard Area ("SFHA") as defined by the Federal Emergency Management Agency; the Property lies within Zone "AE", Base Flood Elevation = 10.0', of the Flood Insurance Rate Map identified as Community Panel No. 10003C0045 G, bearing an effective date of October 6, 2000. A portion of this property also lies within Zone X, area of 500-year floodplain and a portion lies within Another Zone X, area determined to be outside the 500-year floodplain.
 - Existing utilities are shown in accordance with what was observed about the boundary line only. Completeness or correctness thereof is not guaranteed. It shall be each contractor's responsibility to contact the utility companies involved in order to secure the most accurate information available as to utility location and elevation. No construction around or adjacent to utilities shall begin without notifying their owners at least 48 hours in advance. Each contractor shall take the necessary precautions to protect the existing utilities. To locate existing utilities in the field prior to construction, the contractor shall contact Miss Utility of Delaware (telephone 800-282-8555).

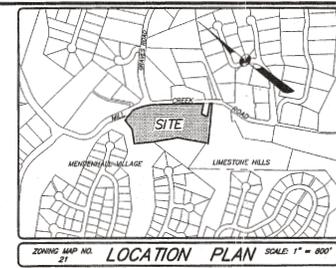

LEGEND:

FND. MON.	Found Concrete Monument
T.P. No.	Tax Parcel Number
D.R.	Deed Record
MF.	Microfilm
○	Sanitary Sewer Manhole
○	Utility Pole
---	Property Line
---	Adjoining Property Line
---	Edge of Pavement
---	Zoning Line
---	Fence Line
---	Flood Zone Limit
---	Concrete

PROPERTY PLAN
3850 MILL CREEK ROAD
 MILL CREEK HUNDRED - NEW CASTLE COUNTY
 DELAWARE
 SCALE: 1"=60'
 DECEMBER 13, 2005

GRAPHIC SCALE
(IN FEET)

NO.	DATE	REVISION	BY	APPROVED
1	4-5-08	Alter Building Location	JLR	

VANDEMARK & LYNCH, INC. IS NOT RESPONSIBLE FOR ANY MODIFICATION MADE TO THIS PLAN AND/OR CAD FILE WITHOUT ITS WRITTEN AUTHORIZATION.

VANDEMARK & LYNCH, INC.
 ENGINEERS - PLANNERS - SURVEYORS
 4305 MILLER RD. #PO BOX 2847
 WILMINGTON, DE 19899/(302) 764-7630

PERMANENT FILE 072/360	QA REVIEW
SURVEYED BY S. S. S. S.	PROJECT MANAGER J. J. J. J.
COURTSHIP BY S. S. S. S.	DRAWN BY L. L. L. L.
PROJECT NO. 21097.07	FILE NO. 38083-M
	1 of 1
	REVISION 1

Camp Wright (TP 08-025.00-011)
 3850 Mill Creek Road
 Mill Creek Hundred
 New Castle County, DE
 Map of Camp Wright

Boundary of Camp Wright

BUNK HOUSE # 1
CRS # N-14422.03
Detailed Building Description

Description

Bunk House # 1 is a rectangular balloon-framed, single story, side gable, seven bay, one pile vernacular cabin with a full porch on the east façade.

Structural History

The main building was constructed first (c. 1925). The porch was built at the same time or soon after. The building was raised on concrete block piers in 1993.

Exterior

Bunk House # 1 has horizontal simple drop siding. The corners are boxed in with 1x4 inch boards. The building is painted hunter green with white trim. The roof is covered with coursed asphalt shingles. There is a porch along the entire east elevation of the building. All of the windows are one-over-one double glazed replacement windows with white vinyl frames. The windows have a 2x4 inch sills, 1x4 inch casings, and cyma recta cornices. All of the doors are replacement steel-safety doors. The frames of the three single steel-safety doors consist of 2x4 inch sills, wood 1.5-inch frames around 2-inch steel frames, and 1x4 inch architraves surmounted by a cyma recta cornices.

North Elevation (Side)

- The north elevation of the main block is 18.25 feet long.
- The main part of Bunk House # 1 is supported by wood sills set on 15-inch square concrete block piers.
- There are only two 1x6 inch boards between the porch pier and the east pier of the building.
- There are only two 1x6 inch boards between the east pier and the center pier of the building.
- There is only one 1x6 inch board between the center pier and the west pier of the building.
- The ground slopes up towards the west side of the building.
- There is a 12-inch wide wood skirt between the wood sills and the horizontal siding.
- There are two windows on the north elevation.
- There is a four louvered wood vent in the gable.
- A 1-inch vent pipe extends through the 2x12 inch skirt 7.15 feet from the west edge.
- The pipe turns and extends up to a point 9 inches above the roofline.
- The porch roof extends 13.5 inches into the gable.
- There is an electrical connection at the west end of the gable.

East Elevation (Façade)

- The east elevation is 72 feet long.
- The east elevation has four windows, three single doors, and one central double door.
- The window frames are 1x4 inch boards on a 2x4 inch sill. The top of the window frame is capped by a 2-inch high crown moulding.
- The window frames are painted white.
- The steel-safety doorframes consist of a 2x4 inch sill, 3.5-inch sides (made of a 2-inch wide steel frame next to a 1.5 inch thick board), and a 5.5-inch wide architrave top (made of a 1.5-inch steel frame and a 4-inch wide wood board). The architraves are capped with the same 2-inch high cyma recta cornice that is also on the window frames.
- Two of the steel-safety doors have small 10-inch square windows. The window in the south door is reinforced with wire.
- The center double steel-safety doors are framed with 2.5-inch wide boards on the top and sides. The area to the left of the steel-safety doors is covered with 6.5-inch wide section of an earlier door made with tongue and groove beaded boards. Three hinges connecting the earlier door to the doorframe are still extant.

Porch

- The porch is on the east elevation of the building.
- The porch is 10 feet wide, 72 feet long and 94 inches high.
- The porch is supported by ten concrete block piers that vary between 15.5 and 16 inches square. The pillars are painted white.
- Between each set of pillars are three 1x6 inch boards set 3 inches apart. These boards are painted white.
- The second bay from the south end has an access to the crawl space. The access is a pair of gates made with the same 1x6 inch boards that fill the other bays.
- On top of the piers is a 2x12 inch skirt set on edge. The skirt is also painted white.
- The deck of the porch is made of 1x4 inch boards running east to west. The deck is painted hunter green.
- The front edge of the porch roof is supported by ten 4x4 inch porch supports set between 90.5 and 93.5 inches apart. The 4x4 inch porch supports are painted white.
- Between the 4x4 inch posts is a railing consisting of a milled handrail top rail, 1x1 inch spindles and a thinner milled handrail bottom. The top of the handrail is painted white and the spindles and bases are painted hunter green.
- There are twin exterior light fixtures mounted on the exterior tops of the north and southern most posts.
- There is a single light fixture mounted centrally on a roof rafter in front of the double door.
- The underside of the porch roof is painted hunter green.
- An additional piece of flashing is positioned on the roof just above the stairs to keep water from dripping across the porch opening.

- The north and south porch eaves are covered with vertical tongue and groove siding.

Stair

- The six steps leading up to the porch are centrally located. The stairs are wood.
- The stairs are 98.5 inches north south, 9 inches front to back, and have a 7-inch rise. The treads are made of two 1x4 inch boards. There are four 1x12 inch stair supports.
- The stairs are painted hunter green over white.
- The stairs have welded 1-inch diameter pipe handrails on both sides.
- The handrails are painted black.
- The handrails are 36 inches high.

South Elevation (Side)

- The south elevation of the main block is 18.25 feet.
- The south elevation is very similar to the north elevation.
- All of the piers are 15.5 inches square.
- There are three 1x6 inch boards between each pier.
- There are two windows on the south elevation.
- There is a four louvered wood vent in the gable.
- A 1-inch vent pipe extends through the 2x12 inch skirt 7 feet from the west edge.
- The pipe turns and extends up 111 inches.
- The porch roof extends 17 inches into the gable.

West Elevation (Rear)

- The west elevation is 72 feet long.
- The west elevation is supported by eighteen block piers that vary between 15.5 and 16 inches wide and 7 to 15 inches high.
- The piers are set between 23 and 36 inches apart.
- The southern piers have two 1x6 inch boards between or in front of them.
- The center piers only have one such board between them.
- A metal vent pipe extends from beneath a board between the piers. The pipe turns and extends up beside the wall to 11 inches below the roof.
- There is an electric meter 24 inches from the south corner of the building.
- There are eight windows on the west elevation.
- The west window frames are painted hunter green.
- The ground slopes to the south.

Interior

Bunk House # 1 is divided into five rooms, Room 1 (South End Bunkroom), Room 2 (Entrance Hall), Room 3 (Bathroom), Room 4 (North End Bunkroom), and Room 5 (North Room).

- All of the rooms are paneled with Masonite faux white wood paneling.
- Rooms 1, part of 2, 4, and 5 have a very short nap dark blue wall-to-wall carpet.
- Window frames are simple, made of 1x4 inch boards painted white.
- Kick stop moulding around the floor perimeter.
- All of the steel doors have automatic closing devices.
- All of the doorframes are finished.

Room 1 (South End Bunkroom)

- Room 1 is 31.3 feet north south and 17.25 feet east west.
- The ceiling tiles follow the contours of the rafters.
- The five rafter tie beams are exposed.
- The tie beams are 1x6 inch unfinished boards.
- The tie beams are set at 6-foot centers.
- There are five surface mounted fluorescent lighting fixtures mounted north south on the ceiling on either side of the room.
- There is a hollow wood door in the middle of the north wall (access to Room 2).
- There are two windows and a steel-safety door on the east wall.
- There are two windows in the south wall.
- A ceiling exhaust fan is mounted in front of the south gable louvered vent.
- There are three windows in the west wall.
- Emergency lights are mounted on the west wall.
- Electric service panel and alarm system is mounted high in the south end of the west wall.
- A hanging propane space heater is in the southwest corner.
- Several steel bunks are present.
- Electrical outlets are recessed and have cover plates.

Room 2 (Entrance Hall)

- Room 2 is 9.25 feet north south and 7.75 feet east west.
- The floor between the north and south walls is covered in Linoleum sheet goods.
- The floor between the two interior doors is covered with a very short nap dark blue carpet.
- Lighting is provided by a single centered overhead incandescent light fixture.
- The drop ceiling, with acoustic tile, is 92 inches high.
- Room 2 is as wide as the original double doors.
- There is a hollow wood interior door in the northwest corner, north wall (access to Room 4).
- The east wall is almost completely filled by exterior double steel-safety doors.
- There is a hollow wood interior door in the southwest corner, south wall (access to Room 1).

- There is a hollow wood interior door in the southwest corner, west wall (access to Room 3).

Room 3 (Bathroom)

- Room 3 is 7.5 feet north south and 7.75 feet east west.
- The floor not under the toilet stalls is covered with 1-foot square linoleum tile.
- The floor under the toilet stalls is covered with linoleum sheet goods with a herringbone brick design.
- There are two adjoining toilet stalls made of 2x4 inch boards and plywood.
- There are two flush toilets.
- There is a counter on the south wall.
- The counter has a Formica veneer.
- There are two sinks mounted in the counter.
- There is a window in middle of west wall.
- There is a propane-powered on demand water-heating device mounted just south of the window.
- There is a single overhead incandescent light fixture.
- The paneled walls on the north and south walls only extend 8 feet high. The rest of the space between the walls and the rafters is covered with heavy duty ½ inch hardware cloth or rat wire.
- The eaves are set at 24-inch centers.
- There is a hollow wood interior door in the southeast corner, east wall (access to Room 2).

Room 4 (North End Bunkroom)


- Room 4 is 17.25 feet north south and 19.4 feet east west.
- The ceiling tiles following the contours of the rafters.
- The rafter tie beams are exposed.
- The tie beams are 1x6 inch unfinished boards.
- The tie beams are set at 6-foot centers.
- There are three surface mounted fluorescent lighting fixtures mounted north south on the ceiling on either side of the room.
- There is a hollow wood door in the northeast corner, north wall (access to Room 5).
- There is one window and a steel-safety door on the east wall.
- There is a hollow wood door in the middle of the south wall (access to Room 2).
- There are two windows in the west wall.
- There is a pair of emergency lights mounted on the west wall.
- A hanging propane space heater is in the northwest corner.
- Several steel bunks are present.

Room 5 (North Room)

- Room 5 is 17.25 feet long and 11.3 feet wide.
- The ceiling is a flat drop ceiling 8 feet high.
- There is one recessed fluorescent light fixture in the middle of the ceiling.
- There are two windows on the north wall.
- There is a steel-safety door in northeast corner, east wall.
- The interior surface of the steel-safety door has a low raised diamond pattern.
- There is a window in the southeast corner east wall.
- There is a hollow wood door in southeast corner, south wall.
- There are two windows on west wall.

BUNK HOUSE #1
CRS # N-14422.03
Black and White Photo Log

- Plate 01: View looking west at the east façade elevation.
Plate 02: View looking northwest at the south side elevation.
Plate 03: View looking north at the west rear elevation.
Plate 04: View looking southwest at the north side and east façade elevations.
Plate 05: View looking south within Room 1. Note exposed tie beams, drop ceiling with acoustic tile, and hanging heater.

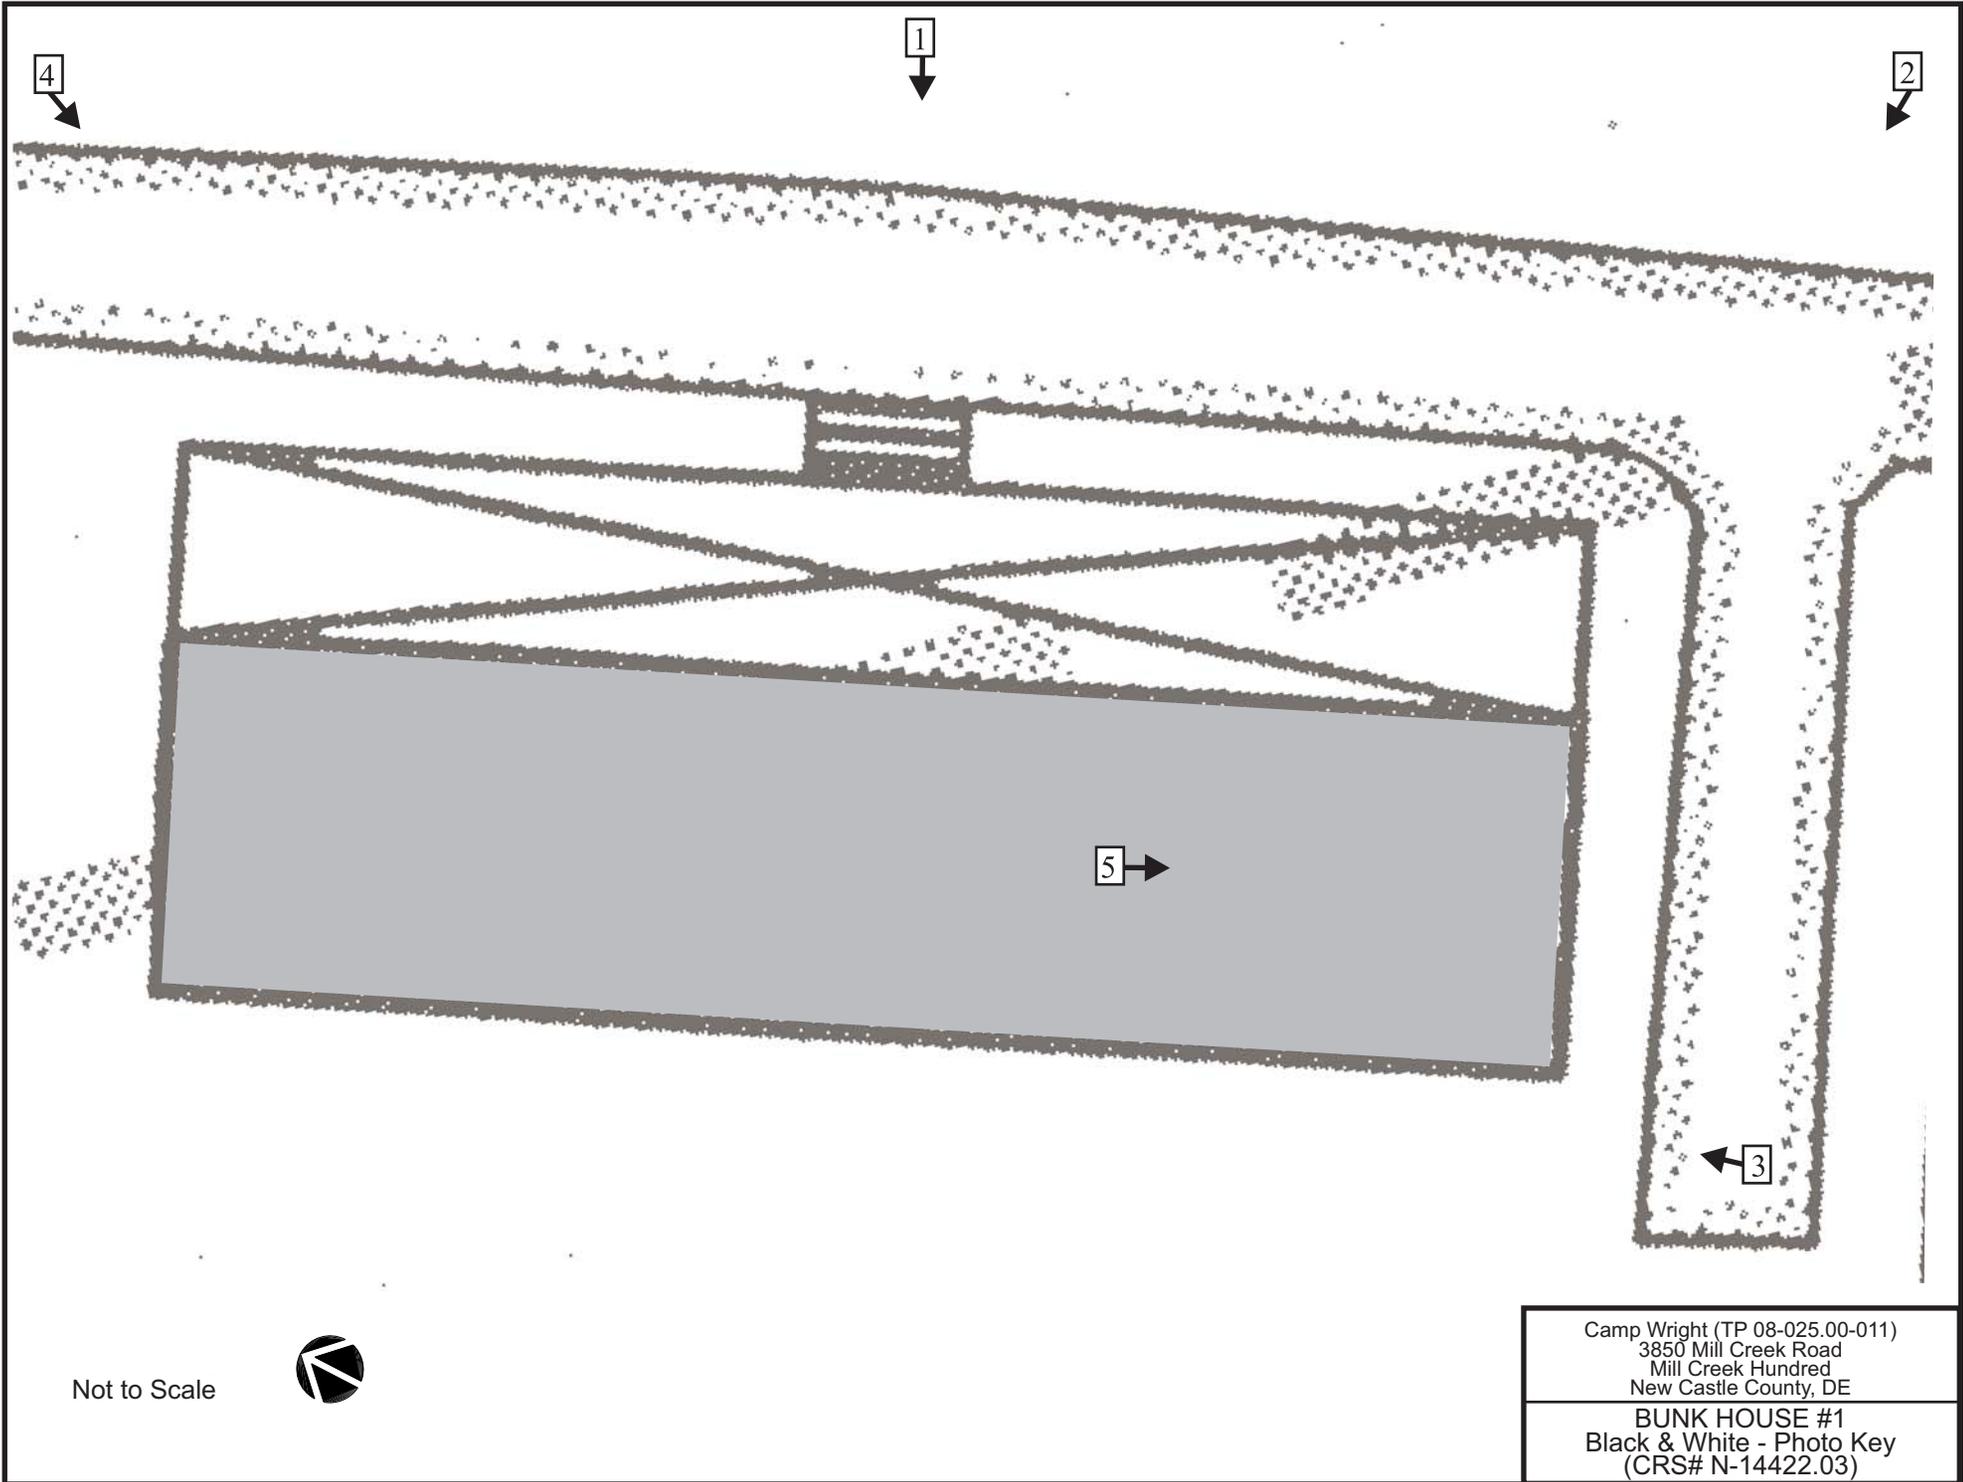

Not to Scale



Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE
BUNK HOUSE #1 Black & White - Photo Key (CRS# N-14422.03)



Plate 01: View looking west at the east facade elevation.



Plate 02: View looking northwest at the south side elevation.



Plate 03: View looking north at the west rear elevation.



Plate 04: View looking southwest at the north side and est facade elevations.



Plate 05: View looking south within Room 1. Note exposed tie beams, drop ceiling, and hanging heater.

Bunk House #1
CRS # N-14422.03
Black and White Photo Index

CONTACT SHEET	DIGITAL IMAGE (JPEG) #	NEGATIVE #	SELECTED PLATE #	DESCRIPTION
1	FL050001	1		View of the ground.
1	FL050002	2	4	View looking southwest at the north side and east façade elevations.
1	FL050003	3	1	View looking west at the east façade elevation.
1	FL050004	4	2	View looking northwest at the south side elevation.
1	FL050005	5		View looking northeast at the foundation for the south side elevation.
1	FL050006	6		View looking northeast at the foundation at the junction of the main block and the porch.
1	FL050007	7		View looking northeast at the south gabel.
1	FL050008	8	3	View looking north at the west rear elevation
1	FL050009	9		Detail of scab material associated with the double door.
1	FL050010	10		Detail of window.
1	FL050011	11		Detail of window.
1	FL050012	12		Detail of door cornice.
1	FL050013	13		Detail of balustrade.
1	FL050014	14		View looking southwest at the profile of the stairs.
1	FL050015	15		View looking southwest at Room 3.
1	FL050016	16		View looking northeast at the double door in Room 2.
1	FL050017	17		View looking northeast within Room 4.
1	FL050018	18		View looking northeast within Room 4.
1	FL050019	19		Detail of heater.
1	FL050020	20		View looking northwest within Room 5.
1	FL050021	21		Detail of interior window cornice.
1	FL050022	22		Detail of metal safety door.
1	FL050023	23		View looking southeast within Room 1.
1	FL050024	24		View looking southwest within Room 1.
1	FL050025	25	5	View looking southwest within Room 1.

Bunk House # 1

INSERT FILM EMULSION SIDE DOWN

MADE IN JAPAN


Qualide NEGATIVE FILE

CRS# N-14422.03
DATE ASSIGNMENT


Camp Wright

NO. 1




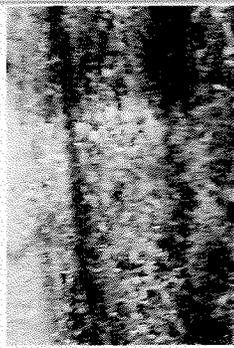


FL050001.jpg

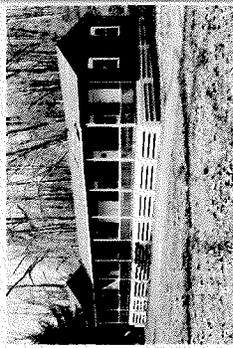


FL050002.jpg

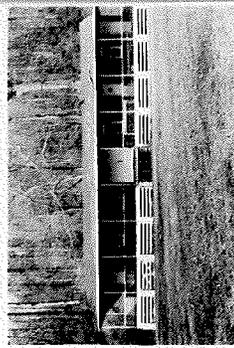

FL050003.jpg

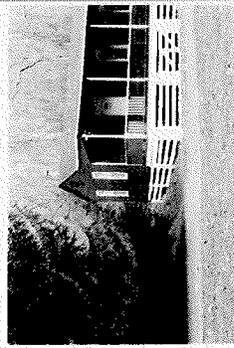

FL050004.jpg

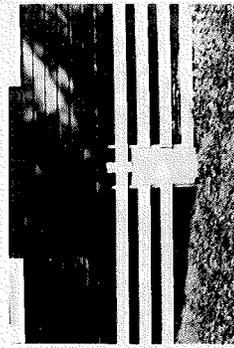

FL050005.jpg




FL050006.jpg




FL050007.jpg



FL050008.jpg

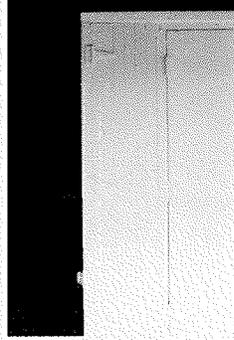


FL050009.jpg

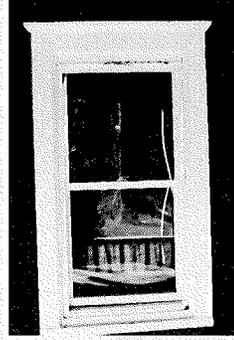

FL050010.jpg



FL050011.jpg

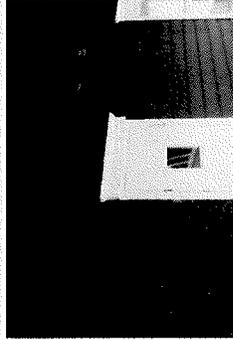

FL050012.jpg



FL050013.jpg



FL050014.jpg



FL050015.jpg




FL050016.jpg



FL050017.jpg



FL050018.jpg

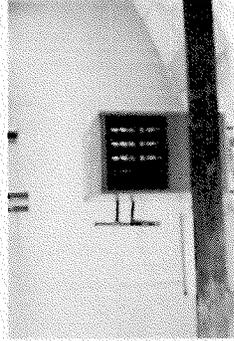


FL050019.jpg



FL050020.jpg



FL050021.jpg

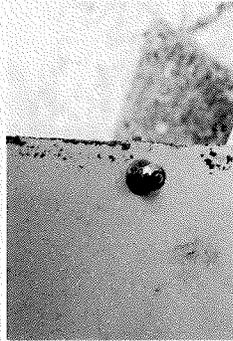

FL050022.jpg



FL050023.jpg



FL050024.jpg



FL050025.jpg

Bunk House #1

CRS # N-14422.03

Black and White Photo Index

CONTACT SHEET	DIGITAL IMAGE (JPEG) #	NEGATIVE #	SELECTED PLATE #	DESCRIPTION
2	FL050026	26		View looking southeast at the foundation of the north side elevation.
2	FL050027	27		View looking southeast at the foundation and the junction of the porch and the main block on the north side elevation.
2	FL050028	28		View looking southeast at the foundation at the corner of the north side and west rear elevations.
2	FL050029	29		Detail of former location of propane tanks.
2	FL050030	30		View looking northeast at the foundation of the south side elevation.
2	FL050031	31		View looking northwest at the foundation at the corner of the south side and west rear elevations.
2	FL050032	32		View looking southwest at the foundation at the corner of the north side elevation and the porch.
2	FL050033	33		Detail of the access to the crawl space.
2	FL050034	34		Detail of the double door.
2	FL050035	35		View looking north at the southwest quadrant of the bridge over Mill Creek.
2	FL050036	36		View looking north at the west side of the bridge over Mill Creek.
2	FL050037	37		Detail of the west side of the bridge.

Bunk House #1

INSERT FILM EMULSION SIDE DOWN

MADE IN JAPAN

Qualide NEGATIVE FILE




CRS # N-14422.03


DATE

ASSIGNMENT

Camp Wright

NO. 2

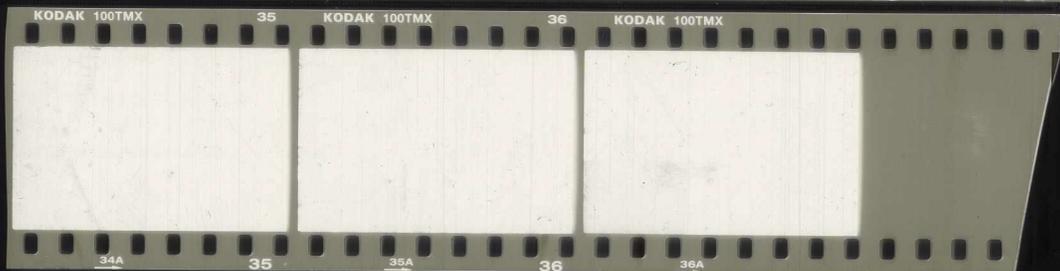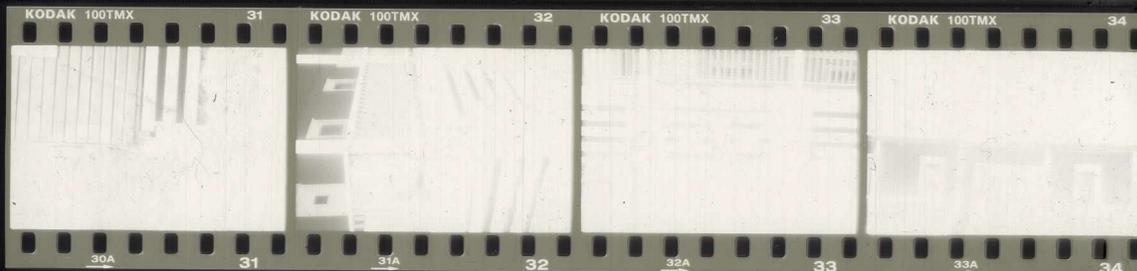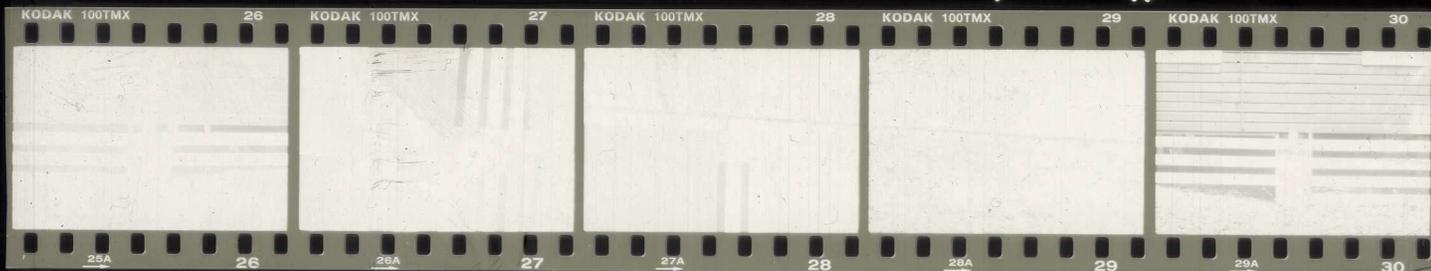


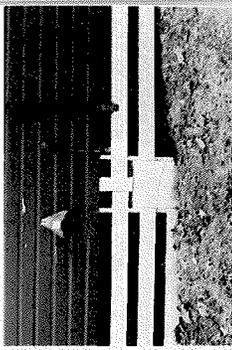


FL050026.jpg




FL050027.jpg

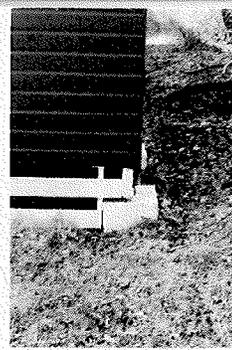

FL050028.jpg

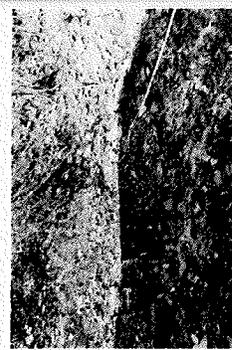


FL050029.jpg

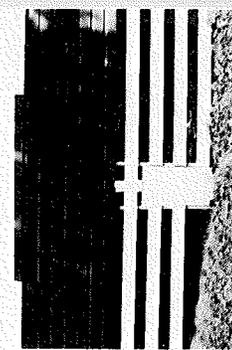

FL050030.jpg



FL050031.jpg

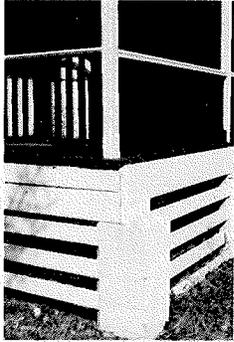


FL050032.jpg




FL050033.jpg




FL050034.jpg

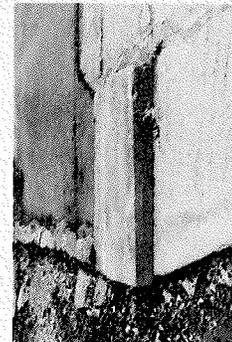

FL050035.jpg

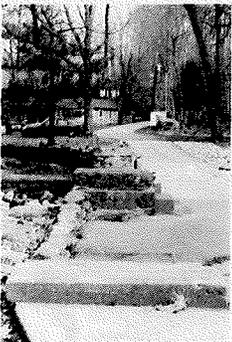


FL050036.jpg

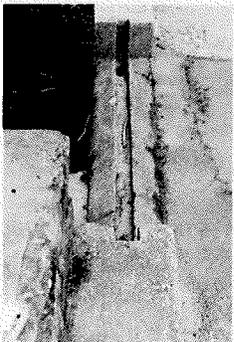

FL050037.jpg

BUNK HOUSE #1
CRS # N-14422.03
Digital Photo Log

- Plate 01: View looking west at east elevation.
Plate 02: View looking southwest at north elevation.
Plate 03: View looking north at west elevation.
Plate 04: View looking northwest at south elevation.
Plate 05: Detail of steps.
Plate 06: Detail of profile of steps.
Plate 07: Detail of east piers.
Plate 08: Detail of west pier.
Plate 09: Detail of south elevation center pier and joists.
Plate 10: Detail of south elevation east pier and joists. Note junction of main structure with porch.
Plate 11: Detail of junction of main structure and porch (exterior).
Plate 12: Detail of junction of main structure and porch (interior).
Plate 13: View looking northeast along porch.
Plate 14: Detail of porch balustrade.
Plate 15: Detail of porch open rafters and sheathing. Note reinforcing scabs.
Plate 16: Detail of simple drop siding.
Plate 17: Detail of double door. Note remnant of original door to photo left.
Plate 18: Detail of window.
Plate 19: Detail of window/door cornice.
Plate 20: View looking north at Room 5 from Room 4.
Plate 21: View looking south within Room 4. Note hardware cloth vent separating Rooms 3 and 4.
Plate 22: View looking north within Room 4. Note doorway to Room 5. Note exposed tie beams and drop ceiling with acoustic tile.
Plate 23: Detail of pipe in Room 3. The pipe is covered exteriorly.
Plate 24: Detail of sinks. Note wall mounted hot water heater.
Plate 25: Detail of two bathroom stalls.
Plate 26: Detail of double door in Room 2.
Plate 27: View looking south within Room 1. Note exposed tie beams and drop ceiling with acoustic tile.
Plate 28: View looking north within Room 1. Note hardware cloth vent separating Rooms 3 and 4.

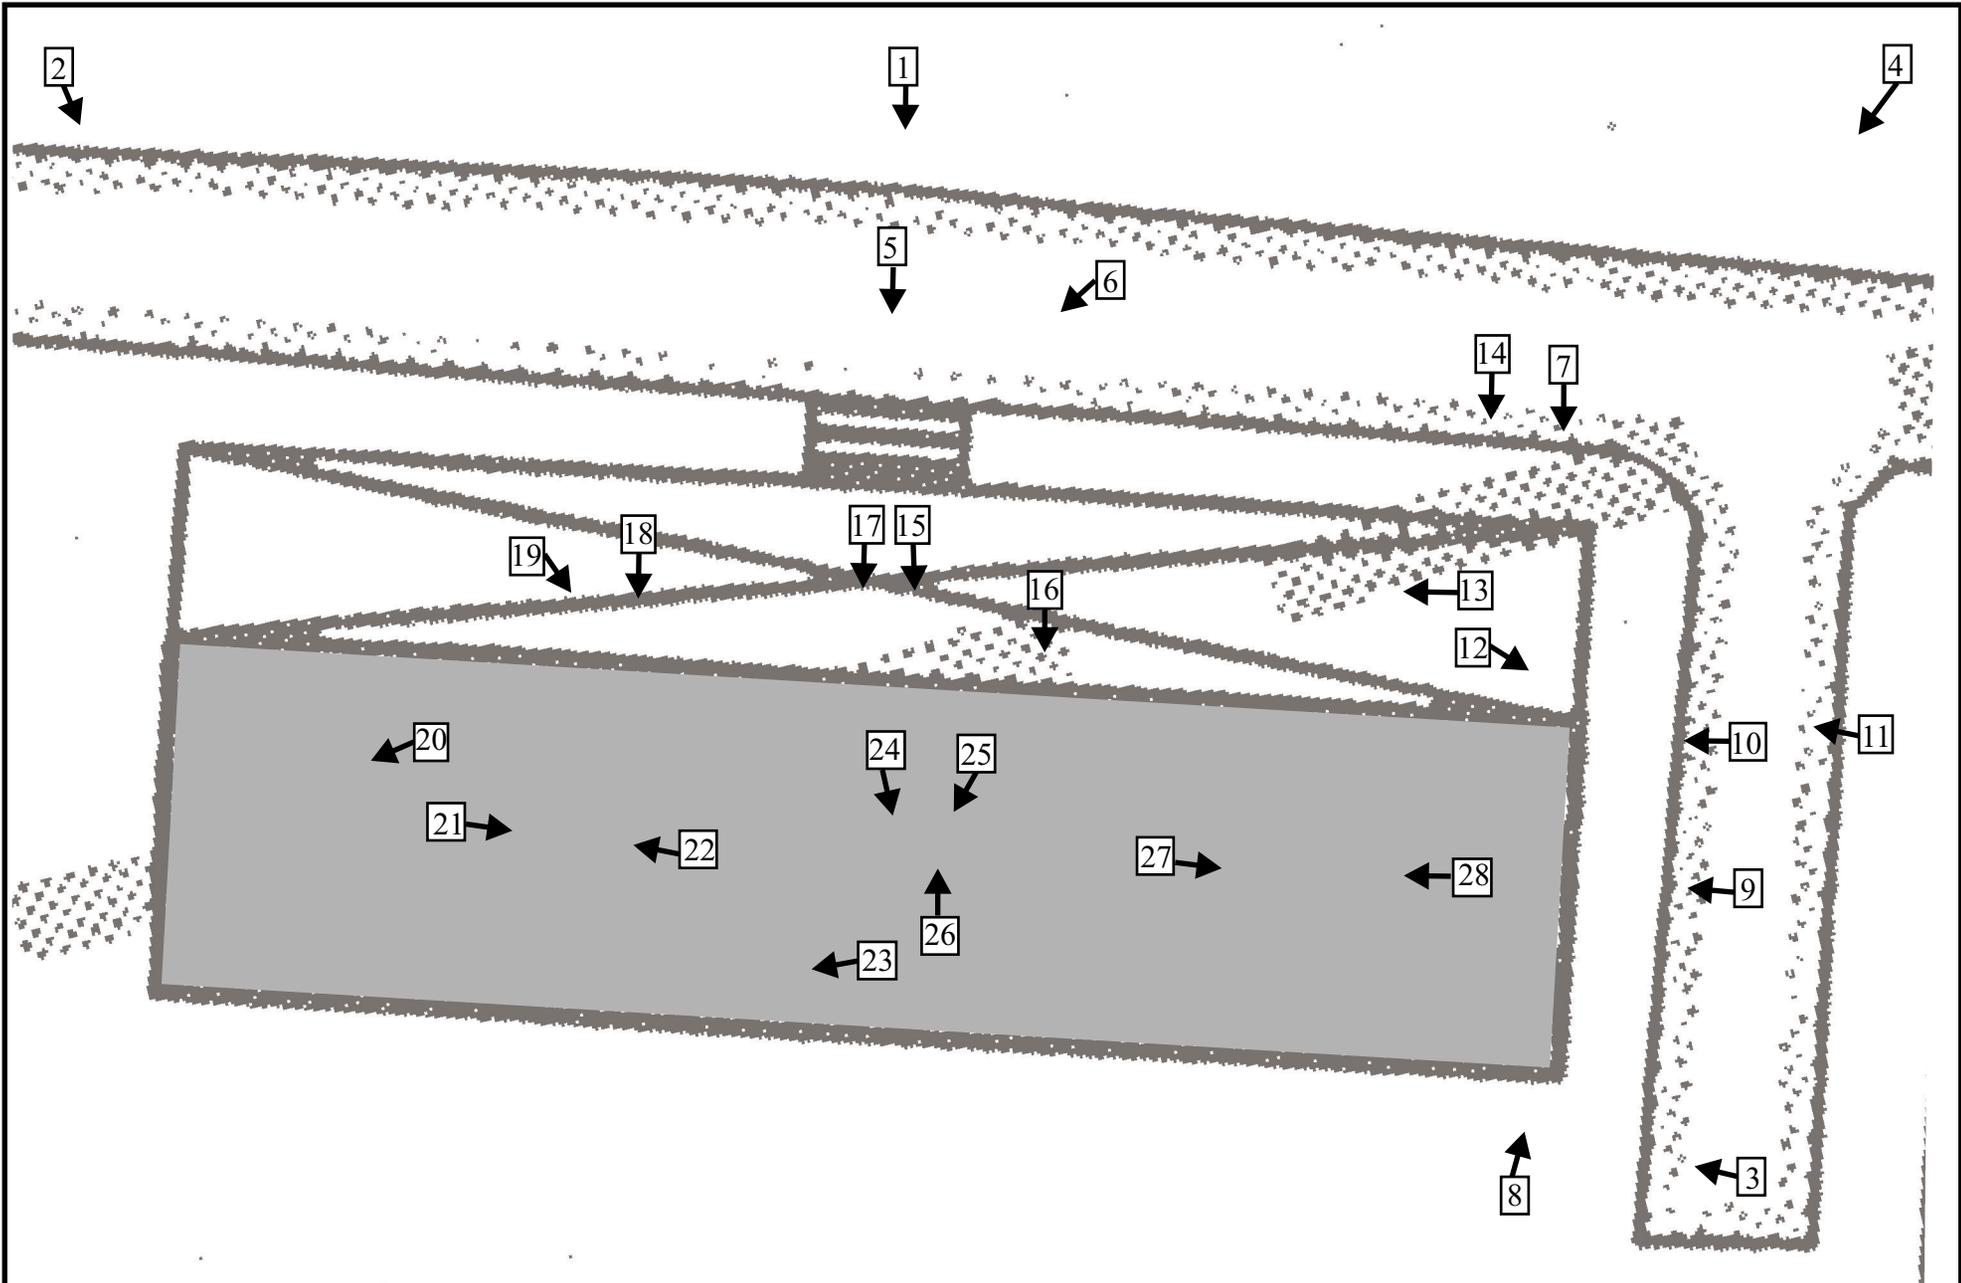

Not to Scale



Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE
BUNK HOUSE #1 Digital - Photo Key (CRS# N-14422.03)



Plate 01: View looking west at east elevation.



Plate 02: View looking southwest at north elevation.



Plate 03: View looking north at west elevation.



Plate 04: View looking northwest at south elevation.



Plate 05: Detail of steps.



Plate 06: Detail of profile of steps.



Plate 07: Detail of east piers.



Plate 08: Detail of west pier.

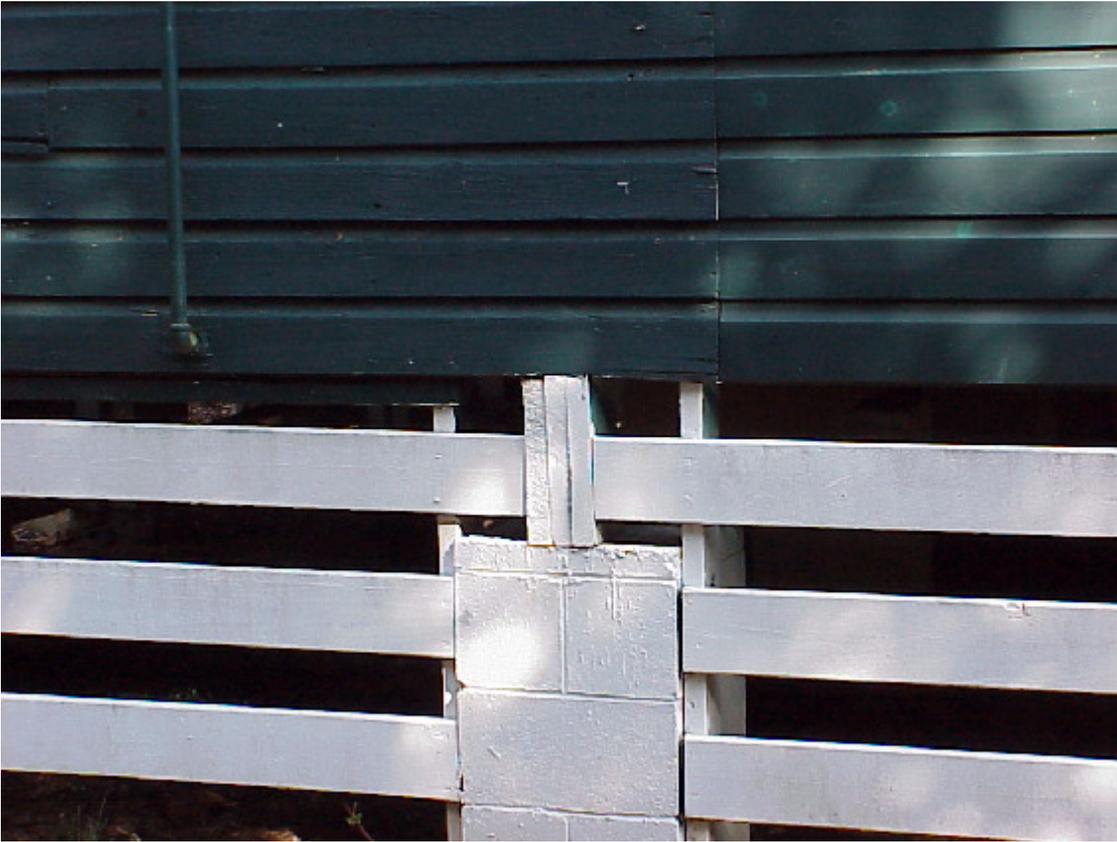


Plate 09: Detail of south elevation center pier and joists.



Plate 10: Detail of south elevation east pier and joists. Note junction of main structure with porch.



Plate 11: Detail of junction of main structure and porch (exterior).



Plate 12: Detail of junction of main structure and porch (interior).



Plate 13: View looking northeast along porch.



Plate 14: Detail of porch balustrade.



Plate 15: Detail of porch open rafters and sheathing. Note reinforcing scabs.



Plate 16: Detail of simple drop siding.



Plate 17: Detail of double door. Note remnant of original door to photo left.



Plate 18: Detail of window.



Plate 19: Detail of window/door cornice.



Plate 20: View looking north at Room 5 from Room 4.



Plate 21: View looking south within Room 4. Note hardware cloth vent separating Rooms 3 and 4.



Plate 22: View looking north within Room 4. Note doorway to Room 5. Note exposed tie beams and drop ceiling with acoustic tile.



Plate 23: Detail of pipe in Room 3. The pipe is covered exteriorly.

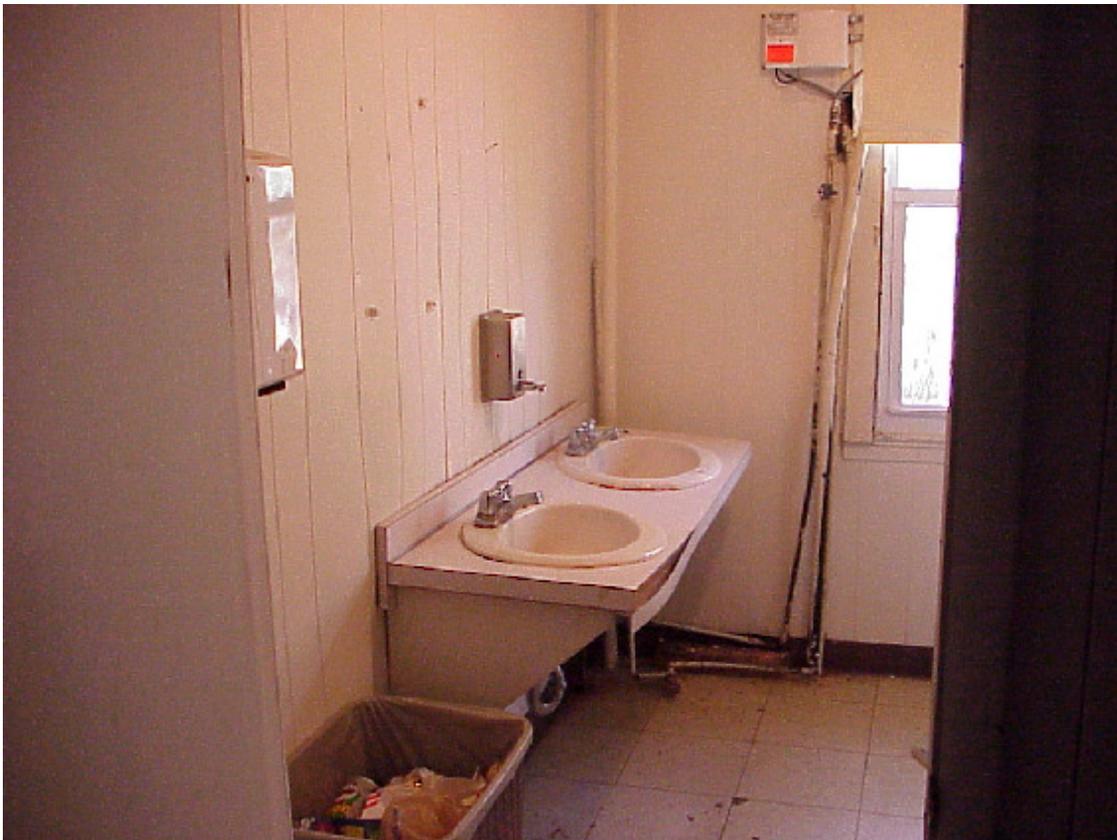


Plate 24: Detail of sinks. Note wall mounted hot water heater.



Plate 25: Detail of two bathroom stalls.



Plate 26: Detail of double door in Room 2.

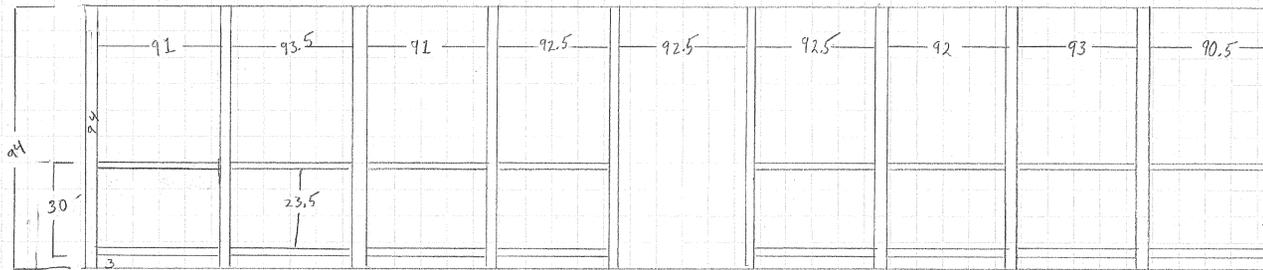


Plate 27: View looking south within Room 1. Note exposed tie beams and drop ceiling with acoustic tile.




Plate 28: View looking north within Room 1. Note hardware cloth vent separating Rooms 3 and 4.

Camp Wright: BunkHouse #1



Porch Railing
(see detail)

Notes: Columns white
Railing: top white,
spindles + bottom rail
Hunter green 1 x 1

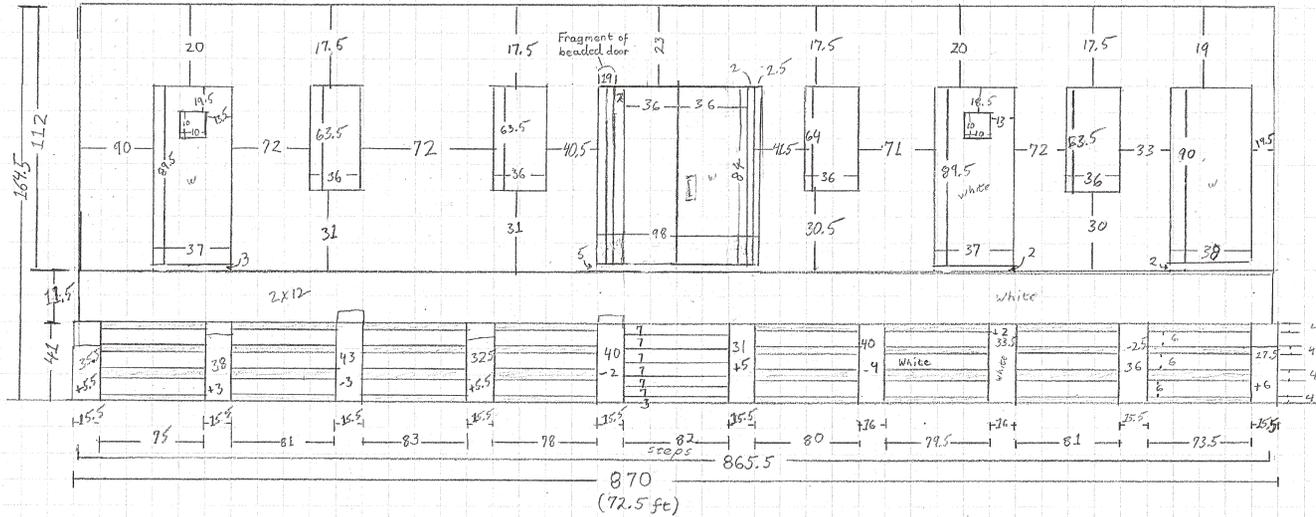

East Elevation

Not to scale.
All measurements in
inches.

Notes: Steps: 6 L. 98.5
W. 9 ; th. 1 ; rise 7
Crawl space planks 4 X 6
support pillars: Block

Hunter green w/ white trim

Slats: Unless otherwise stated, there are 3 slats between each pier.
1 X 6s. 4 inches between each slat.
Slats and pillars are painted white

Footers: Cement block

Not to Scale

Camp Wright (TP 08-025.00-011)
3850 Mill Creek Road
Mill Creek Hundred
New Castle County, DE

Bunk House #1
Facade (east) - Elevation
(CRS# N-14422.03)


Camp Wright: Bunk House #1

Most measurements in inches
unless otherwise noted

Not to scale

South Elevation

North Elevation

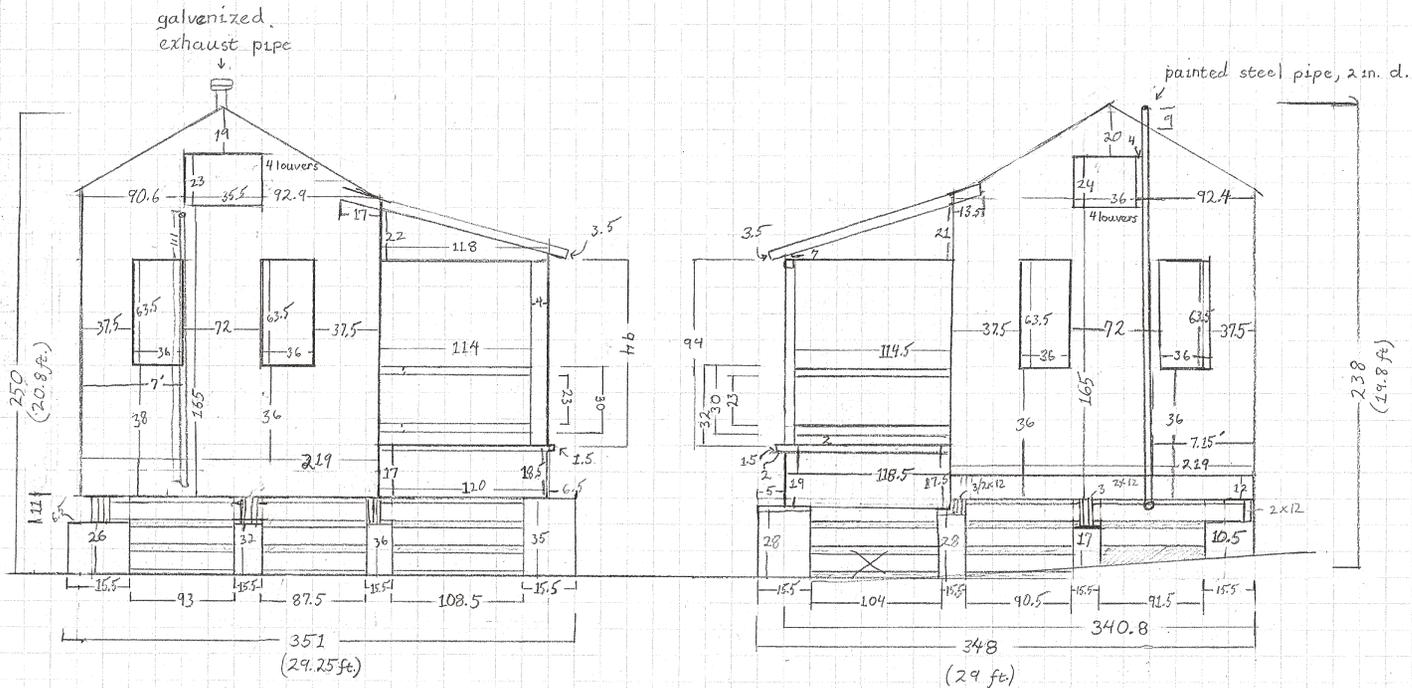


Not to Scale

Camp Wright (TP 08-025.00-011)
3850 Mill Creek Road
Mill Creek Hundred
New Castle County, DE

Bunk House #1
Sides (north and south) - Elevations
(CRS# N-14422.03)

Camp Wright: Bunk House #1

Balustrade Detail

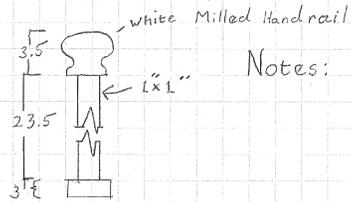


Notes: Not to scale
All measurements in inches.

10 inch wide sill

Ground slopes down to south



West Elevation (rear)

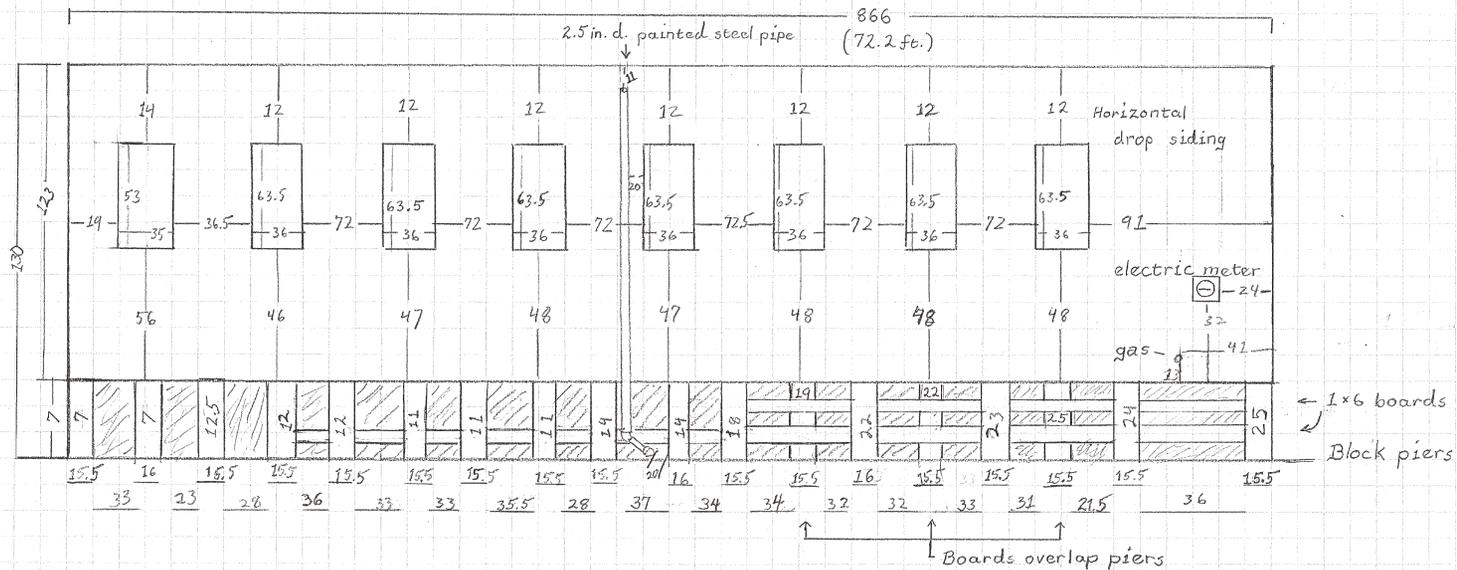


Not to Scale

Camp Wright (TP 08-025.00-011)
3850 Mill Creek Road
Mill Creek Hundred
New Castle County, DE

Bunk House #1
Rear (west) - Elevation
(CRS# N-14422.03)

Camp Wright: Bunk House #1
Floor Plan


Notes: Not to scale
All measurements in inches.

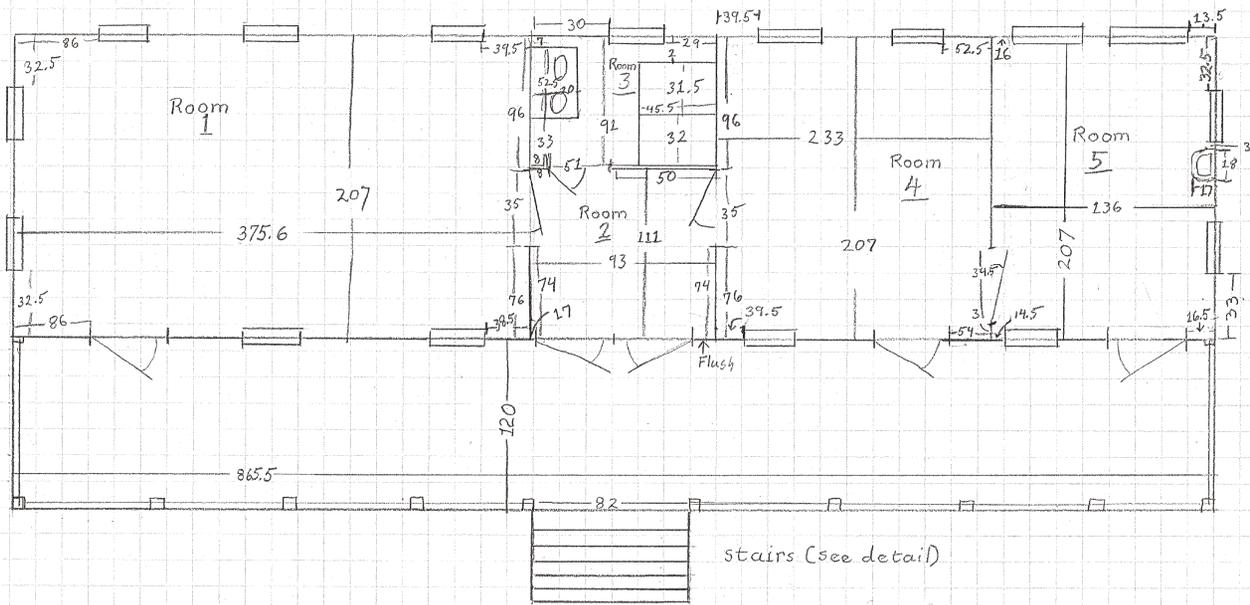


Not to Scale

Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE
Bunk House #1 Floor Plan (CRS# N-14422.03)

Center Door

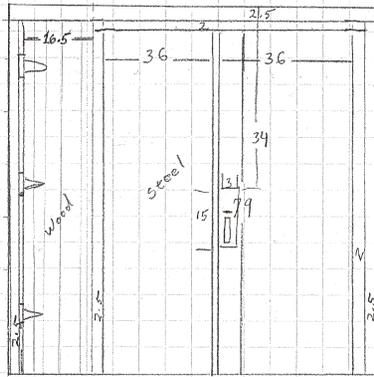


Window

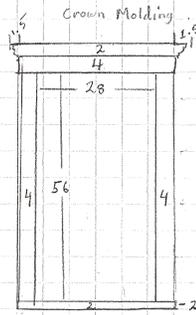

Window is vinyl double pane one-over-one replacement

Bunkhouse #1

Detail: Door & Window

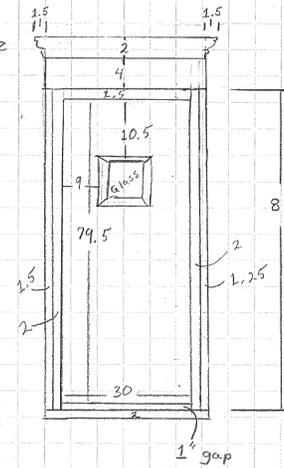


Not to scale
All measurements in inches.

Not to Scale

Camp Wright (TP 08-025.00-011)
3850 Mill Creek Road
Mill Creek Hundred
New Castle County, DE

Bunk House #1
Detail - Door and Window
(CRS# N-14422.03)

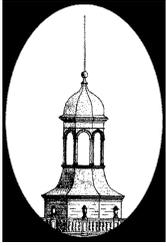

DELAWARE STATE HISTORIC PRESERVATION OFFICE
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM

CRS # N-14422.03

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road
2. FUNCTION(S): historic recreation/bunk house current not in use
3. YEAR BUILT: 1925 CIRCA?: ARCHITECT/BUILDER: unknown
4. STYLE OR FLOOR PLAN: eight-bay, one pile vernacular cabin
5. INTEGRITY: original site moved
 if moved, from where _____ other location's CRS # _____ year _____

<u>list major alterations and additions with years (if known)</u>	<u>year</u>
a. Interior re-modeled	Ca. 1950
b. Raised on piers to prevent flood damage.	1993

6. CURRENT CONDITION: excellent good fair poor
7. DESCRIPTION: (Describe the resource as completely as possible. Use N/A for not applicable; leave no blanks.)
- a. Overall shape: rectangular Stories: one
Additions: N/A
- b. Structural system (if known): frame
- c. Foundation: materials: concrete block piers
basement: full partial not visible no basement
- d. Exterior walls (original if visible & any subsequent coverings): wooden German siding
- e. Roof: shape: gable
materials: asphalt shingles
cornice: closed
dormers: N/A
chimney: location(s): N/A

8. DESCRIPTION OF ELEVATIONS:
- a. Facade: Direction: east
1) Bays eight
2) Windows fenestration four
type one-over-one
trim molded wood
shutters N/A

Facade (cont'd)

- 3) **Door(s)** three
location irregular placement along façade, with centrally located main entrance
type two (2) metal doors with single light window, double central metal door
trim molded wood
- 4) **Porch(es)** full width, single story with wood posts and balustrade

b. Side: Direction: south

- 1) **Bays** two
- 2) **Windows**
fenestration two (2) first floor and one (1) attic level opening
type one over one
trim molded wood trim
shutters N/A
- 3) **Door(s)** N/A
location N/A
type N/A
trim N/A
- 4) **Porch(es)** N/A

c. Side: Direction: north

- 1) **Bays** two
- 2) **Windows**
Fenestration two (2) windows, one (1) attic level louvered opening
type one-over-one
trim N/A
shutters N/A
- 3) **Door(s)** N/A
location N/A
type N/A
trim N/A
- 4) **Porch(es)** N/A

d. Rear: Direction: west

- 1) **Bays** six
- 2) **Windows**
fenestration four (4)
type one-over-one
trim molded wood trim
shutters N/A
- 3) **Door(s)** two (2)
location north and south ends of elevation
type metal
trim molded wood trim
- 4) **Porch(es)** N/A

9. **INTERIOR:** The bunk house has separate quarters for counselors, and wash room/shower directly opposite the main entrance. The interior has artificial wood paneling and wood board flooring.
10. **LANDSCAPING:** Bunk House #1, along with twelve other camp related resources, is located in a wooded setting along the Mill Creek. Mill Creek Road runs along the eastern boundary of the property. Modern residential development mixed with older housing in a wooded setting is found to the north, east, and west. Limestone Hill Park is located to the south.
11. **OTHER COMMENTS:** Bunk House #1 appears to have been constructed ca. 1925. The building was re-modeled in 1950.