
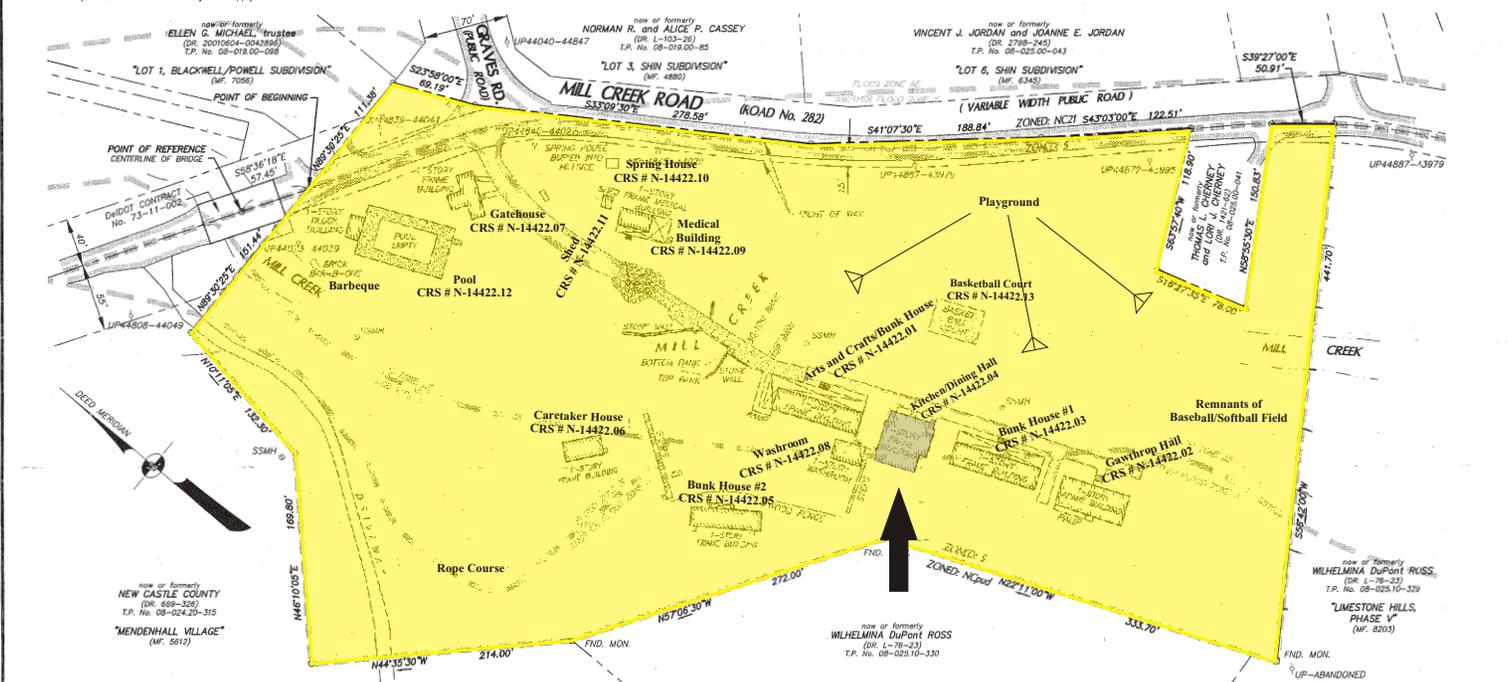


**Kitchen/Dining Hall
(CRS # N-14422.04)**

C:\dwg\38083M.dwg, 4/10/2008 10:37:13 AM, Jason Rose, VanDemark & Lynch, Inc.

NOTES:

- Owner: West End Neighborhood House, Inc.
3850 Mill Creek Road
Hockessin, DE 19707
- Tax Parcel No.: 08-025.00-011
- Source of Title: Deed Record C, Volume 86, Page 114
- Area: 7.483± Acres
- Zoning: New Castle County Unified Development Code
Zoning: S, Suburban (other permitted uses)
Lot Area: 2 acre
Lot Width: 200'
Building Height: 40' MAX.
Building Setbacks: Street - 50'
Rear - 50'
Side - 40'
- Setback lines indicated above per New Castle County Unified Development Code interpretation and must be verified by New Castle County prior to Land Development. Buffer and Green Area and/or other restrictions may also apply.
- This plan was prepared without the benefit of a title commitment, title search or bring down and is subject to easements, validity of chain of title, etc., that a subsequent search may disclose.
- Date of Field Survey: December 12, 2005
Revision 1 - April 5, 2006 - Located Buildings
- A portion of the Property described on this survey DOES lie within a Special Flood Hazard Area ("SFHA") as defined by the Federal Emergency Management Agency; the Property lies within Zone "AE", Base Flood Elevation = 10.0', of the Flood Insurance Rate Map identified as Community Panel No. 10003C0045 G, bearing an effective date of October 6, 2000. A portion of this property also lies within Zone X, area of 500-year floodplain and a portion lies within Another Zone X, area determined to be outside the 500-year floodplain.
- Existing utilities are shown in accordance with what was observed about the boundary line only. Completeness or correctness thereof is not guaranteed. It shall be each contractor's responsibility to contact the utility companies involved in order to secure the most accurate information available as to utility location and elevation. No construction around or adjacent to utilities shall begin without notifying their owners at least 48 hours in advance. Each contractor shall take the necessary precautions to protect the existing utilities. To locate existing utilities in the field prior to construction, the contractor shall contact Miss Utility of Delaware (telephone 800-282-8555).

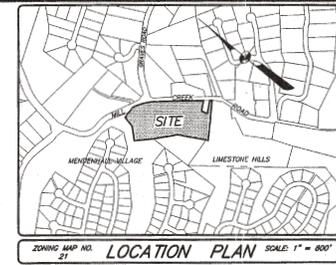

LEGEND:

FND. MON.	Found Concrete Monument
T.P. No.	Tax Parcel Number
D.R.	Deed Record
MF.	Microfilm
○	Sanitary Sewer Manhole
○	Utility Pole
---	Property Line
---	Adjoining Property Line
---	Edge of Pavement
---	Zoning Line
---	Fence Line
---	Flood Zone Limit
---	Concrete

PROPERTY PLAN
3850 MILL CREEK ROAD
 MILL CREEK HUNDRED - NEW CASTLE COUNTY
 DELAWARE
 SCALE: 1"=60'
 DECEMBER 13, 2005
 GRAPHIC SCALE (IN FEET)

NO.	DATE	REVISION	BY	APPROVED
1	4-5-06	Alter Building Location	JLR	

VANDEMARK & LYNCH, INC. IS NOT RESPONSIBLE FOR ANY MODIFICATION MADE TO THIS PLAN AND/OR CAD FILE WITHOUT ITS WRITTEN AUTHORIZATION.

VANDEMARK & LYNCH, INC.
 ENGINEERS - PLANNERS - SURVEYORS
 4305 MILLER RD. BOX 2847
 WILMINGTON, DE 19899/(302) 764-7630

PERMANENT FILE 072/360	QA REVIEW
SURVEYED BY J. Rose	PROJECT MANAGER J. Rose
COURTSHIP BY S. S. S.	DRAWN BY L. P.
PROJECT NO. 21097.07	FILE NO. 38083-M
	1 of 1
	REVISION 1

Camp Wright (TP 08-025.00-011)
 3850 Mill Creek Road
 Mill Creek Hundred
 New Castle County, DE
 Map of Camp Wright

KITCHEN/DINING HALL

CRS # N-14422.04

Detailed Building Description

Description

The Kitchen/Dining Hall is an L shaped, balloon frame, one story, five bay, two pile vernacular cabin with a central protruding addition off the east façade and a lean-to shed addition off the west rear.

Structural History

The main block of the building was constructed in 1922. Sometime later (c 1930s) the rear kitchen wing was added. In the 1940s an addition was added off the east elevation and the gable entrances were sealed and replaced by the east façade entrances. At some point after the kitchen wing was added, the kitchen wing was extended south. The area between the piers of the east elevation was walled in sometime after 1950. The present exterior steps were installed in 1970.

Exterior

The main block and east addition is covered with faux board and batten siding (plywood sheathing with applied wood ribs). The ribs are set on 12-inch centers. The kitchen addition is covered with simple drop siding. The roofs are made with 2x6 inch rafters sheathed with boards. The roof of the main block is covered with coursed asphalt shingles. The roof has open eaves with exposed rafters. The shed roofs of both the kitchen addition and the eastern addition are covered with asphalt sheet goods. All but one of the windows are replacements. The windows are six-over-six double-sash wooden windows with aluminum framed storm/screen windows. The window casings are wood and are painted hunter green. The foundation of the main block is concrete block covered in a skim coat of cement. The eastern addition rests on concrete block piers. The space between the piers is filled in with cement block except the center bay. The center bay is covered with a pair of plywood doors.

North Elevation (Side)

- The north elevation is 42 feet long.
- The eastern addition is set back 68 inches from the main block and the kitchen addition.
- There are four windows and one door in the north elevation.
- There is a set of paired windows in the eastern addition.
- The gable end of the main block has two windows.
- The windows on the north gable end appear to be in former doorways.
- The kitchen addition has a window and a door.
- There is a cast concrete step set on a concrete pad in front of the kitchen door.
- The kitchen door is a steel-safety door with a high mounted single light.
- The kitchen door has a wood framed interior screen door.
- There is a 6-inch diameter galvanized exhaust pipe on the eastern end of the main block. The pipe extends up 169 inches.

- There is a 2-inch diameter steel vent pipe at the junction of the main block and the kitchen addition.
- There is a 21.5-inch square brick chimney located exteriorly between the window and door in the kitchen addition.
- The chimney is 17.25 feet tall.
- There is a stove vent above and to the left of the kitchen addition window.
- There are two 7.5x15 inch metal grilled vents set in the concrete block foundation. One of the metal grilled vents is located in the foundation of the main block and one of the vents is located in the foundation of the kitchen addition.
- The area between Kitchen/Dining Hall and Arts and Crafts/Bunk House is paved with asphalt.

East Elevation (Façade)

- The east elevation is 40 feet long.
- The east addition is 29 feet long and projects out 9 feet from the main block of the building.
- The east addition is centered on the main block.
- There are three sets of paired windows in the eastern addition.
- There is a door at the north and south end of the main block of the building.
- The doors are steel-safety doors with interior wood framed screen doors.
- There is a gutter over each door.
- Wooden stairs and landings lead up to the doors.
- There is a pair of floodlights mounted on the upper north and south corners of the east addition.
- The present steps are replacements. Impressions of earlier stairs are visible in the cement skim coat on the substructure of the east addition.
- The north steps are set in cement. The cement is inscribed "MELA 70".
- There is a stainless steel water fountain next to the north steps.
- The water fountain has flexible PVC drainpipe and woven nylon feeder hose.
- The center bay of the east addition foundation is covered with a pair of plywood doors.
- The plywood doors allow access to the crawl space.

North Stairs

- The north stairs and landing are white painted wood with both metal pipe and wood handrails.
- There are six steps that vary between 9 and 11.5 inches front to back with 7-inch risers.
- The steps are 42 inches north south.
- The supports are 4x4 inch boards.
- The handrail on the landing is a 2x4 inch board.
- The handrail for the steps is welded pipe painted black.
- The landing is 58 inches east west and 48 inches north south.

South Stairs

- The south stairs and landing are hunter green painted wood with wood handrails.
- There are eight steps that are 11 inches front to back with 7.5-inch risers.
- The steps are 47 inches north south.
- The supports are 4x4 inch boards.
- The handrails are 2x4 inch boards.
- The landing is 66 inches east west and 49 inches north south.

Crawl Space

- The crawl space is accessed through plywood doors in the center of the foundation for the east addition.
- The crawl space is used for storage of camp trophies, equipment, and paint.

South Elevation (Side)

- The south elevation is 42.2 feet long.
- The eastern addition is set back 68 inches from the main block and the kitchen addition is set back 69 inches.
- There are seven windows in the south elevation.
- There is a set of paired windows in the eastern addition.
- There are two sets of paired windows in the gable end of the main block.
- The kitchen addition has a window.
- There is a 6-inch diameter galvanized exhaust pipe on the western end of the main block.
- The pipe extends up 13.4 feet.
- There is a metal vent above and to the left of the kitchen addition window.
- There is a hinged metal louvered attic vent in the gable of the main block.
- There are two 7.5x15 inch metal grilled vents set in the concrete block foundation.
- One of the metal grilled vents is in the main block and one is in the kitchen addition.

West Elevation (Rear)

- The west elevation is 40.3 feet long.
- The kitchen addition is 34.6 feet long and projects out 9 feet from the main block of the building.
- There are six windows in the west elevation.
- The five windows in the kitchen addition are sealed.
- The sealed windows have a flat casing surmounted by a cyma recta cornice.
- The sealed windows and their casings are painted hunter green like the rest of the wall.
- The window in the main block appears to have been a former door.
- It appears that the lowest five boards in the kitchen addition are newer than the rest of the siding.

- The west addition has some sort of rubber-coated material extending from under the siding to below grade.
- Aluminum flashing covers the edge of roof.
- There are four, spring tool racks on the west wall between the north corner and first sealed window.
- There is a 2 ½ -inch diameter steel vent pipe that is just to the left of the southern most sealed window in the kitchen addition. The vent pipe extends through the roof for three inches.
- The southern two bays of the kitchen addition are a later addition to the kitchen wing.
- There is concrete block wall on a concrete pad built into the hillside west of the kitchen addition. The concrete pad has a concrete path that leads to the north side of the building.
- The concrete walk, pad, and block wall behind the kitchen was probably for storing trash receptacles.

Interior

The Kitchen/Dining Hall is divided into eight rooms, Room 1, Room 2 (Pantry), Room 3 (Main Kitchen), Room 4 (Dining Hall), Room 5 (Closet), Room 6 (Kitchen/Pantry), Room 7 (Closet), Room 8 (Bathroom).

Room 1

- Room 1 is 14.5 east west by 12.8 feet north south.
- The ceiling is white painted fiberboard with 1-inch wide firing strips over the joints.
- The ceiling is 102 inches high in the east and 94 inches high in the west.
- The south and west edges of the ceiling have quarter round crown moulding.
- The eastern end of the ceiling drops and is boxed in so as to cover the rafters and former roofline of the main block of the building.
- There is off-white fiberboard faux wood paneling on the south and west wall.
- The north wall has horizontal simple drop exterior siding painted light green.
- The floor in Room 1 is 1-inch lower than the floor in adjoining Room 4.
- The floor consists of hardwood boards which are 3 inches wide and run north south.
- The floor is painted at least light grey over medium grey.
- There is a strip of slightly wider floorboards along the south end of Room 1.
- There is a door in the middle of the north wall (access to Room 2).
- The door is made of drop siding cut to make the door.
- There is a closet (Room 7) protruding into the northeast corner of the room made of vertical boards.
- The closet door is a handmade batten door.
- The closet and door is painted light green.
- The east side of Room 1 opens directly into Room 4.
- There is a pair of windows in the south wall.

- Room 8 bathroom projects into the southwest corner of Room 1.
- Room 8's exterior walls are made of the same vertical wood boards that are used to make the closet.
- The bathroom door is a solid wood five-panel door.
- Room 8's walls and door are painted light green.
- Room 1 houses three file cabinets, two chest freezers, and a hutch.

Room 2 (Pantry)

- Room 2 is 4.75 feet north south and 14.5 feet east west.
- The ceiling is fiberboard painted white with 1-inch firing strips on the joints.
- The ceiling is 102 inches high in the east and 94 inches high in the west.
- The ceiling has quarter round moulding as crown moulding.
- The north wall is covered with narrow vertical beaded board painted light green.
- The east wall is made of mixed width pine boards painted light green.
- The south wall is unfinished. The backs of the external paneling are visible and painted light green.
- The west wall has an off-white fiberboard faux wood paneling (same as in Room 1)
- There is a door in the north wall (access to Room 3) opposite the door in the south wall.
- The north door is a solid wood five-panel door.
- The floor is made of 2 ½ -inch wide hardwood boards running north south.
- The floor is painted grey.
- The floor is the same height as floor in Room 1.
- All of the walls are lined with shelves.

Room 3 (Main Kitchen)

- Room 3 is 15 feet north south and 14.5 feet east west.
- The ceiling is plywood with 1-inch firing strips over the seams.
- The ceiling is painted white.
- The ceiling is 102 inches high in the east and 94 inches high in the west.
- The floor is plywood covered with 1-foot square linoleum tiles.
- Quarter round moulding runs along most of the floor's perimeter.
- The north wall is covered with off-white fiberboard faux wood paneling (same as in Rooms 1 and 2).
- There is a door and a window in the north wall.
- The north exterior door is a steel-safety door with high mounted single light.
- The north door has an internal wood-framed screen door that opens inward.
- Both north doors are painted light green.
- The window has sash weights.
- The window has a replacement screen/storm window.
- There is a 3-foot square; 2-inch thick concrete pad in the northwest corner supporting a water heater.

- Asbestos board covers the portion of the north wall between the window, stovetop, and hood.
- Asbestos board also covers the wall behind the stove and deep fat fryer.
- There is a large white enameled high-backed cast iron sink on the north wall between the door and the window.
- Exposed Romex cables run along the top of the north wall and over to the electrical breaker box on the west wall.
- The water heater vents to the exterior chimney above the sink.
- There is a larger sealed vent hole below the current exhaust vent.
- A large black “Vulcan” stove and hood is in the northeast corner against the east wall.
- A two-basket deep fat fryer is to the right of the stove.
- There is a doorway (access to Room 6) to the right of the fryer.
- The southeast corner walls of the kitchen are covered with white painted fiberboard.
- There is a stainless steel sink with a drain board in the southeast corner, south wall.
- There is a door in the south wall (access to Room 2).
- The south door is a solid wood five-panel door.
- The door is painted white.
- The door has late a 19th century box lock with a porcelain knob.
- The doorframe is unfinished.
- There is a bank of simple veneered cabinets and counter along most of the west wall and the west half of the south wall.
- The section of the west wall which is not covered with cabinets is set 1-inch further back than the rest of the west wall.
- The circuit breaker box is mounted high on the wall at the point where the wall is set back.
- There is one surface mounted overhead fluorescent fixture.

Room 4 (Dining Hall)

- Room 4 is irregularly shaped. Its maximum north south length is 39.5 feet and its maximum east west length is 26.4 feet.
- The ceiling is fiberboard (4x8 foot sheets) with 1-inch wide firing strips over the joints.
- The ceiling is 92.5 inches high.
- The ceiling is painted white.
- There is a 2-foot square access to the attic in the ceiling at the southern end of the main block.
- The ceiling has three pairs of surface mounted fluorescent light fixtures.
- The north, east, and south walls are covered with white painted fiberboard paneling.
- Rooms 5 and 6 protrude into the northwest corner of Room 4.

- The walls that separate Room 5 and 6 from Room 4 are vertical variable width boards painted white.
- The northern section of wall that separates Room 4 from Rooms 1 and 7 is framed but not finished.
- The base of the north, east, and south walls have quarter round moulding at the base and ceiling.
- The walls that separate Rooms 5 and 6 from Room 4 also have quarter round moulding at ceiling edge.
- The floor in the main part of Room 4 is made of 3-inch wide hardwood boards running east west.
- The floor in the eastern addition has 3.5-inch wide hardwood boards also running east west.
- Six of the 3.5-inch floorboards have 4-inch long tongues that extend across the seam and into the boards of the main section of Room 4. The six boards with tongues are randomly spaced.
- The floor appears to be untreated.
- There are two steel grates in the floor that cover propane fueled heaters that extend below the floor.
- All of the windows are replacements.
- All of the windows are six-over-six.
- All of the windows have friction fit sashes.
- All of the windows have storm windows and screens.
- All of the windows have simple finished casings and 2.25-inch wide windowsills.
- All of the windows are painted white.
- Both of the exterior doors are steel-safety doors painted light green.
- Both of the exterior doors have wood framed interior screen doors that are painted white.
- There are two 3.5x3.5 inch wood posts supporting a beam that marks the original eastern edge of the main block of the building.
- The beam is a pair of scabbed 2x6 inch boards.
- The room houses four large refrigerators.
- There is a primitive drawing of Camp Wright on a corkboard mounted on the wall between the doorway to Room 6 and the door to Room 7.

Room 5 (Closet)

- Room 5 is 6.3 feet east west and 4.8 feet north south.
- The ceiling is made of wooden boards on top of ceiling joists and is 95 inches high.
- There are three crude shelves on the south side and one on the west side of the closet.
- The door to Room 5 (access to Room 4) is a hand made batten door that fits poorly.
- There is an incandescent light fixture mounted to one of the ceiling joists.

Room 6 (Kitchen/Pantry)

- Room 6 is 14.9 feet north south and 6.3 east west.
- The ceiling is white painted fiberboard with 1-inch wide firing strips over the joints.
- Quarter round moulding is used for crown moulding along all four walls.
- There is a 2-foot square access to the attic near the doorway to Room 4.
- There is a surface mounted fluorescent light fixture in the middle of the ceiling.
- The east, south, and west walls are framed but not finished.
- The vertical wood planks behind the framing are visible.
- The framing and planks are painted light green.
- The north wall is covered with white fiberboard faux wood paneling.
- There is a window in the north wall.
- The window is a replacement with friction fit sashes.
- The window has a simple finished casing.
- There is a long high-backed white enameled cast iron sink with draining boards along the length of the north wall.
- The east and west walls have rough built in shelving which is also painted light green.
- There is a doorway in the east wall (access to Room 4) and a doorway in the west wall (access to Room 3).
- There is a double stainless steel deep sink along the north half of the west wall.
- The fire repression system for the stove in Room 3 is mounted to the wall above the stainless steel sink.
- The floor is covered with linoleum sheet goods with a faux floral/geometric tile design.
- The floor in Room 6 is ½-inch higher than in Rooms 3 and 4.

Room 7 (Closet)

- Room 7 is 1.75 inches north south and 4.29 feet east west.
- The top of Room 7 is 92 inches high and does not reach the ceiling.
- The interior walls are unfinished.
- There is one overhead shelf and clothes bar.
- The door is a hand made batten door made of narrow beaded boards.
- The doorframe is not finished.
- The door fits poorly.

Room 8 (Bathroom)

- Room 8 is 3.75 feet by 4.25 feet.
- The ceiling is white painted fiberboard.
- The ceiling is 94 inches high.
- The interior walls are covered with off-white fiberboard faux wood paneling.
- The bathroom has a porcelain sink mounted on the north wall.
- The door is on the east wall.
- The door is a solid wood five-panel door.


- The south wall has an irregular contour.
- The white porcelain toilet is against the south wall.
- There is an incandescent light fixture mounted on the ceiling.
- Room 8's exterior walls are made of the same vertical wood boards that are used to make the closet.
- Room 8's walls and door are painted light green.
- The bathroom floor is covered with linoleum sheet goods decorated with a herringbone brick pattern.

KITCHEN/DINING HALL

CRS # N-14422.04

Black and White Photo Log

- Plate 01: View looking west at the east façade elevation.
- Plate 02: View looking northwest at the south side elevation.
- Plate 03: View looking north at the south side elevation.
- Plate 04: View looking southeast at the west rear elevation.
- Plate 05: View looking southwest at the north side elevation.

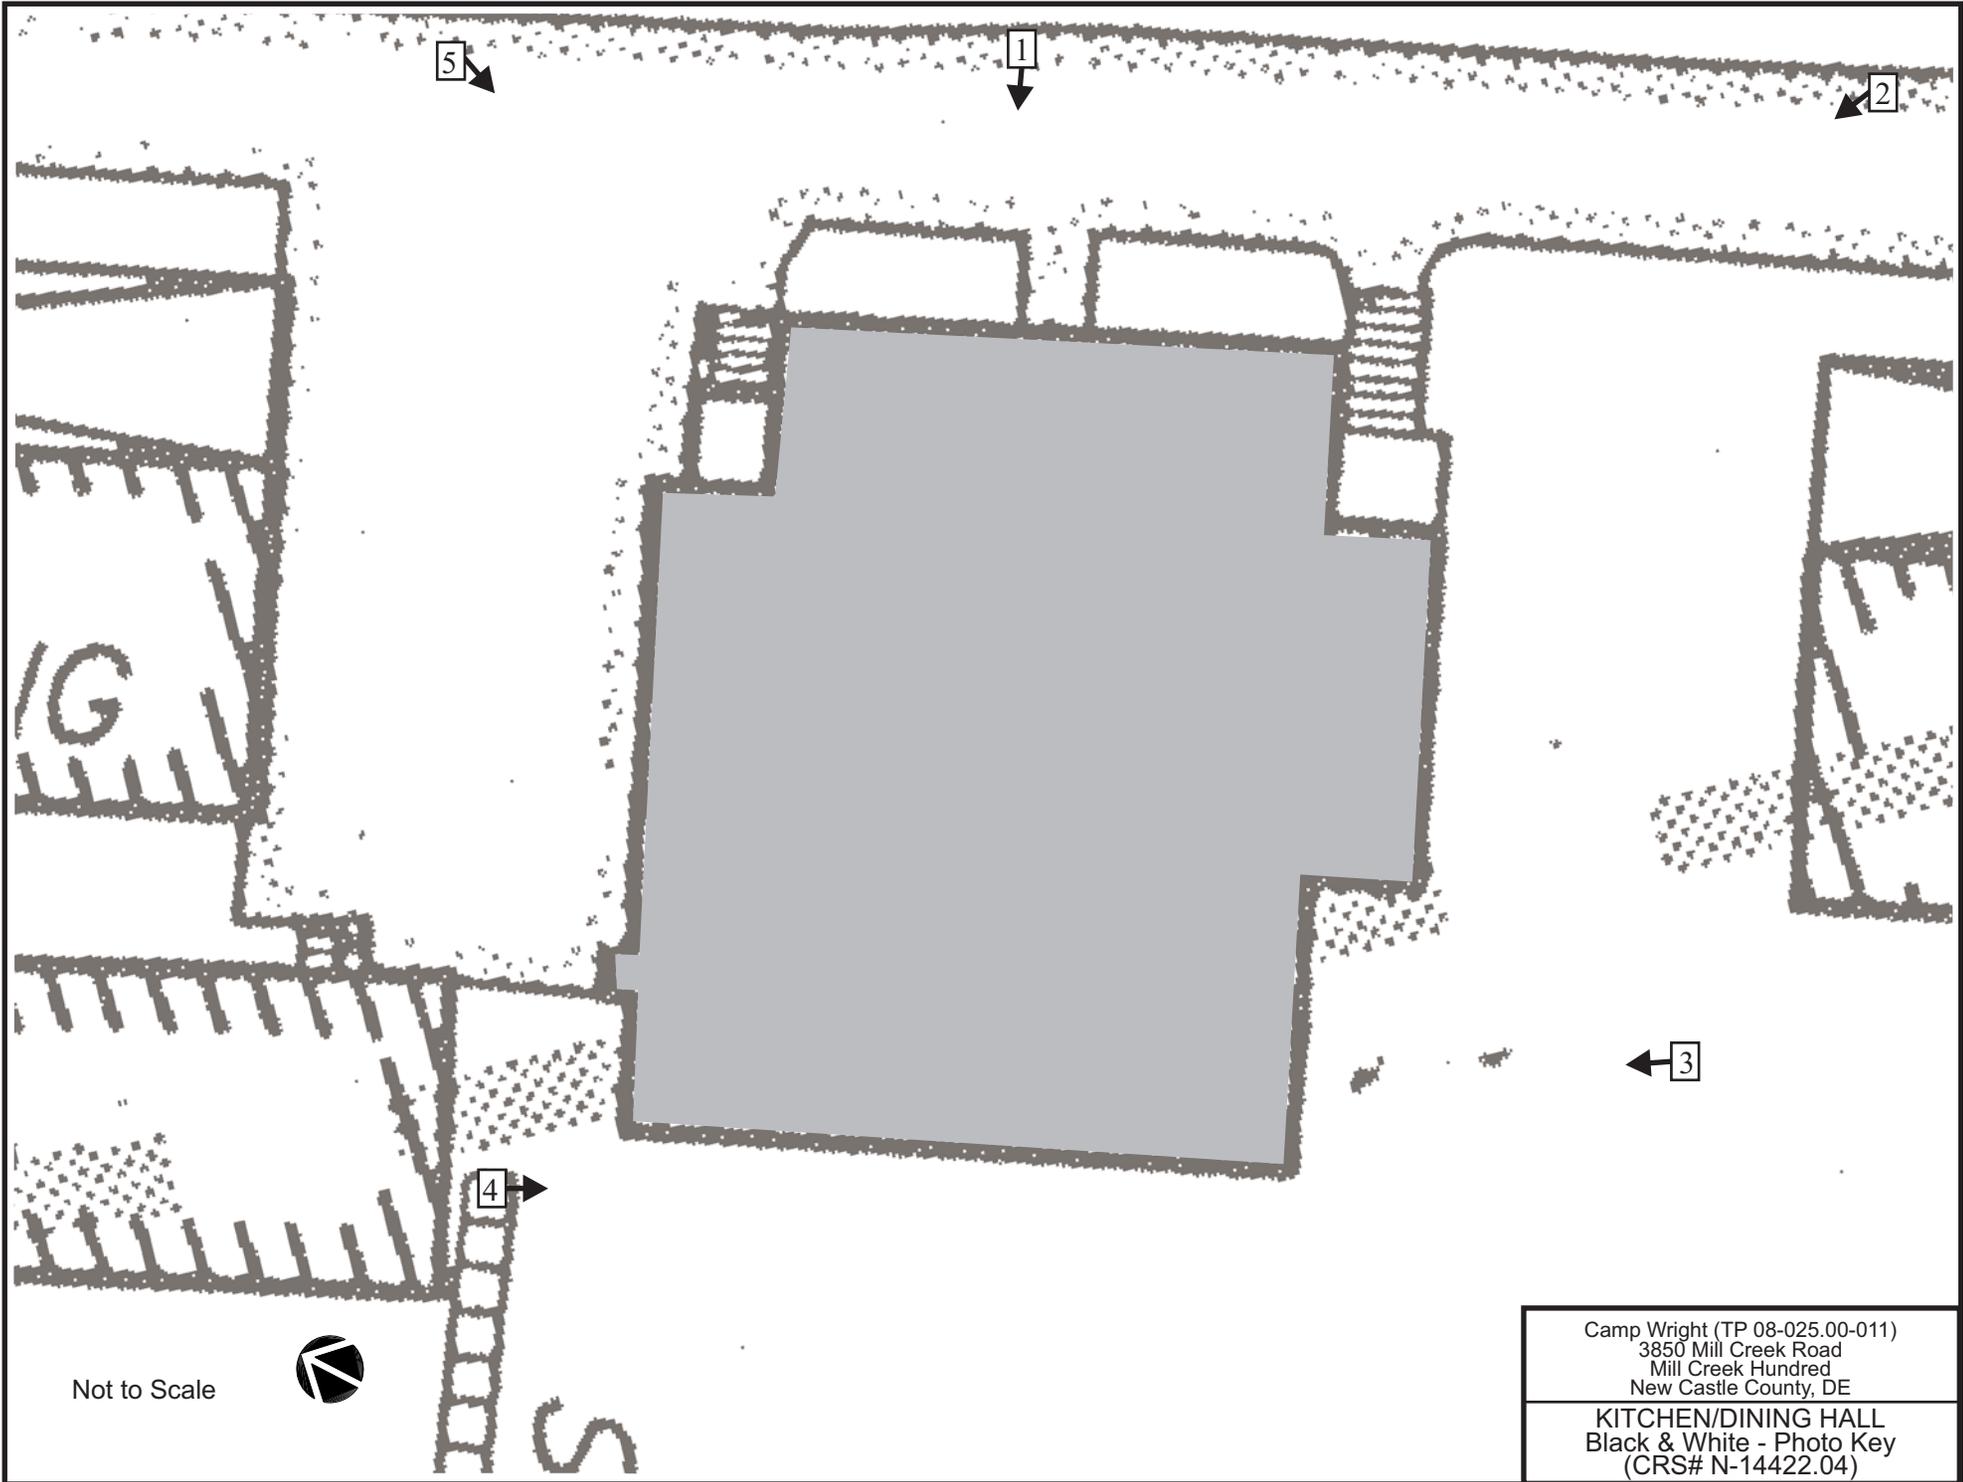

Not to Scale



Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE
KITCHEN/DINING HALL Black & White - Photo Key (CRS# N-14422.04)



Plate 01: View looking west at the east facade elevation.



Plate 02: View looking northwest at the south side elevation.



Plate 03: View looking north at the south side elevation.



Plate 04: View looking southeast at the west rear elevation.



Plate 05: View looking southwest at the north side elevation.

KITCHEN/DINING HALL

CRS # N-14422.04

Black and White Photo Index

CONTACT SHEET	DIGITAL IMAGE (JPEG) #	NEGATIVE #	SELECTED PLATE #	DESCRIPTION
1	FL040024	1		Detail of the north gable of the main block.
1	FL040023	2		Detail of the north elevation of the main block.
1	FL040022	3		Detail of the the junction of the main block and kitchen addition along the north elevation.
1	FL040021	4		View looking southwest at concrete block wall, pad, and path west of kitchen addition.
1	FL040020	5	4	View looking southeast at the west rear elevation.
1	FL040019	6		View looking southwest at concrete block wall, pad, and path west of kitchen addition.
1	FL040018	7		Detail of kitchen door cornice.
1	FL040017	8		Detail of north elevation of the kitchen wing.
1	FL040016	9		Detail of the window replacement. Note the patches on both sides and below the window.
1	FL040015	10		View looking southwest at the north stairs.
1	FL040014	11	5	View looking southwest at the north side elevation.
1	FL040013	12	1	View looking west at the east façade elevation.
1	FL040012	13		View looking west at the east facades of the Kitchen/Dining Hall, Washroom, and Bunk House # 1.
1	FL040011	14		View looking west at the east facades of the Kitchen/Dining Hall, Washroom, and Arts & Crafts/Bunk House.
1	FL040010	15	2	View looking northwest at the south side elevation.
1	FL040009	16		View looking north at the south stairs.
1	FL040008	17	3	View looking north at the south side elevation.
1	FL040007	18		View looking east at the west elevation of the main block of the building.
1	FL040006	19		View looking west at the concrete pad for propane tank.
1	FL040005	20		Detail of attic vent in south gable.
1	FL040004	21		Detail of the foundation at the southeast corner.
1	FL040003	22		Detail of north steps. Note impressions of previous steps in the left wall.
1	FL040002	23		Detail of water fountain and exhaust pipe.
1	FL040001	24		View looking north at the junction of south side elevation of the kitchen addition and the main block.

Kitchen/Dining Hall
Qualide NEGATIVE FILE

INSERT FILM EMULSION SIDE DOWN


MADE IN JAPAN

CRS# N-14422.04
DATE


ASSIGNMENT Camp Wright

NO. 1




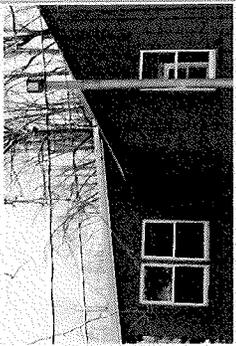

FL040001.jpg

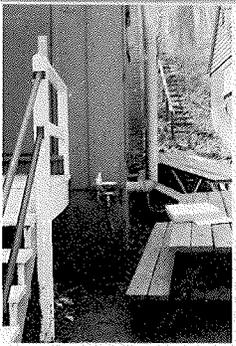


FL040002.jpg

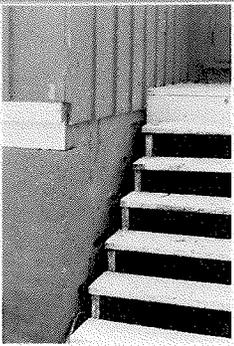

FL040003.jpg



FL040004.jpg

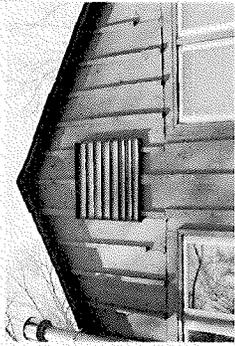


FL040005.jpg



FL040006.jpg




FL040007.jpg

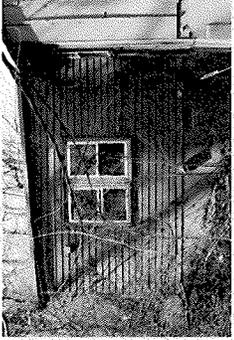


FL040008.jpg



FL040009.jpg

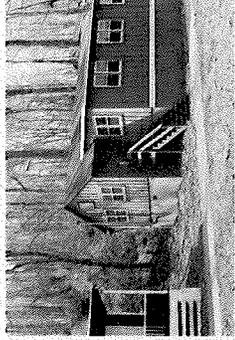


FL040010.jpg

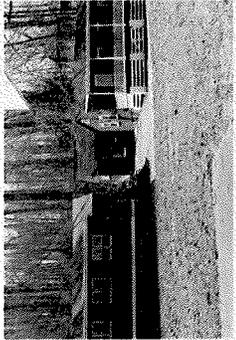

FL040011.jpg




FL040012.jpg

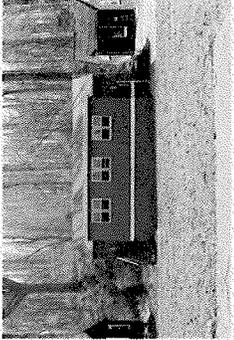

FL040013.jpg




FL040014.jpg

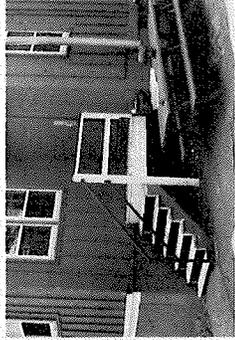

FL040015.jpg




FL040016.jpg

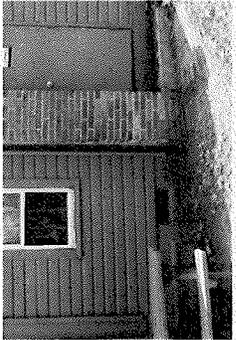


FL040017.jpg



FL040018.jpg

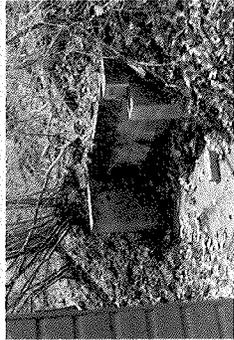

FL040019.jpg

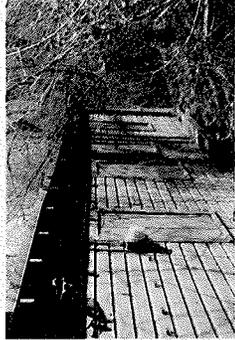


FL040020.jpg



FL040021.jpg



FL040022.jpg

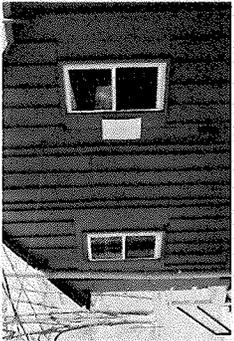

FL040023.jpg



FL040024.jpg

KITCHEN/DINING HALL

CRS # N-14422.04

Black and White Photo Index

CONTACT SHEET	DIGITAL IMAGE (JPEG) #	NEGATIVE #	SELECTED PLATE #	DESCRIPTION
2	FL050001	0		View of ground.
2	FL050002	1		Detail of the junction of the main block and the kitchen addition along the north elevation.
2	FL050003	2		View looking north within Room 3.
2	FL050004	3		View looking northeast within Room 3.
2	FL050005	4		View looking south east within Room 3.
2	FL050006	5		View looking southwest within Room 3.
2	FL050007	6		View looking north within Room 6.
2	FL050008	7		View looking south within Room 6.
2	FL050009	8		View looking southeast within Room 4.
2	FL050010	9		View looking southwest within Room 4.
2	FL050011	10		Detail of large freezer in northwest corner of Room 4.
2	FL050012	11		Primitive depiction of Camp Wright on west wall of Room 4.
2	FL050013	12		View looking west into Room 5.
2	FL050014	13		View looking southwest within Rooms 4 and 1.
2	FL050015	14		Detail of post and joist at the junction of the the main block and the east addition.
2	FL050016	15		Detail of the floor joint at the junction of the the main block and the east addition.
2	FL050017	16		View looking north within Room 4.
2	FL050018	17		Detail of heating vent in floof of Room 4.
2	FL050019	18		View looking northwest into Rooms 1 and 7.
2	FL050020	19		View looking north at Room 7 (closet) from Room 1. Note that the top of Room 7 does not reach the ceiling of Room 1.
2	FL050021	20		Detail of handmade door from Room 1 to Room 2. The door is made of the simple drop molding siding that was formally the exterior of the kitchen addition. The kitchen is visible beyond the far door.
2	FL050022	21		Detail of ceiling and south wall of Room 1 where it meets Room 4.
2	FL050023	22		Detail of the floor joint between Rooms 1 and 4.
2	FL050024	23		View looking west within Room 1 at Room 8 (bathroom).

Kitchen/Dining Hall
Qualide NEGATIVE FILE



CRS # N-14422.04
DATE


INSERT FILM EMULSION SIDE DOWN

ASSIGNMENT **Camp Wright**

MADE IN JAPAN

NO. **2**

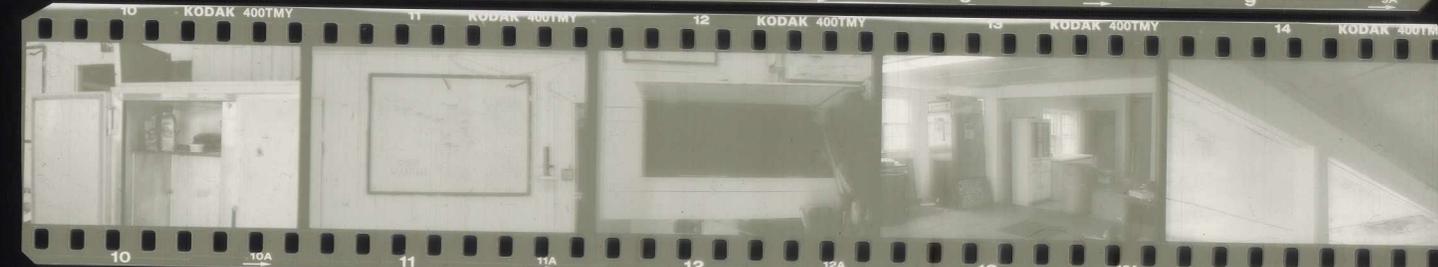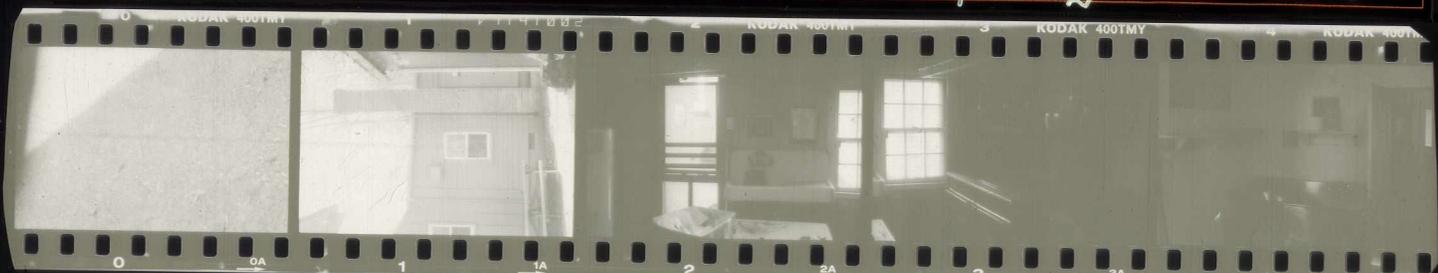

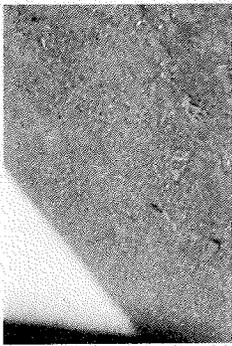

FL050001.jpg



FL050002.jpg



FL050003.jpg



FL050004.jpg




FL050005.jpg



FL050006.jpg



FL050007.jpg

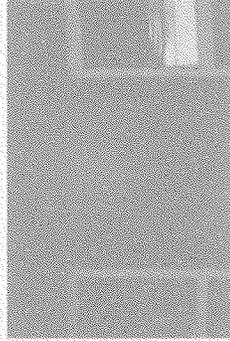


FL050008.jpg




FL050009.jpg



FL050010.jpg

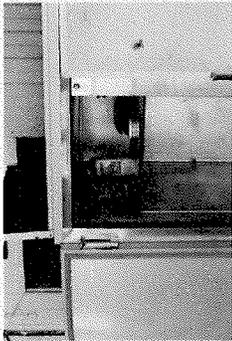

FL050011.jpg

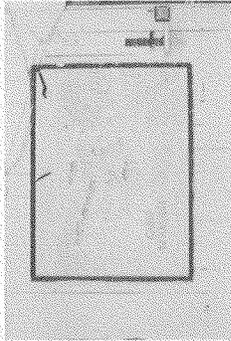


FL050012.jpg




FL050013.jpg



FL050014.jpg

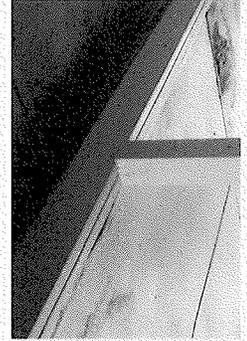

FL050015.jpg

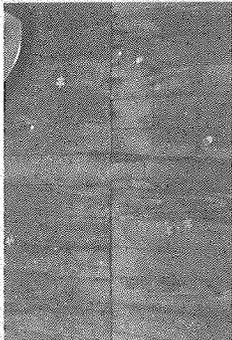

FL050016.jpg




FL050017.jpg




FL050018.jpg



FL050019.jpg

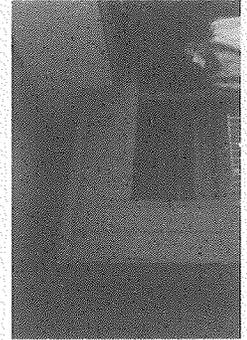

FL050020.jpg

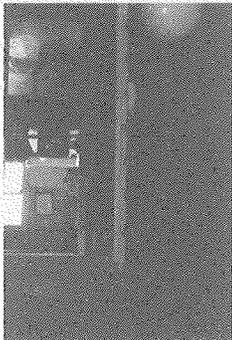

FL050021.jpg



FL050022.jpg



FL050023.jpg



FL050024.jpg

KITCHEN/DINING HALL

CRS # N-14422.04

Digital Photo Log

- Plate 01: View looking west at the east elevation.
Plate 02: View looking northwest at the south elevation.
Plate 03: View looking northeast at the south elevation.
Plate 04: View looking north at the south elevation.
Plate 05: View looking southeast at the west elevation.
Plate 06: View looking southeast from Bunk House #2. Note the kitchen addition of the Kitchen/Dining Hall is below the grey shed roof in the center of the photo.
Plate 07: Looking east at the west elevation of the main block of the building.
Plate 08: View looking southwest at the north elevation.
Plate 09: Detail of the foundation of the east elevation. Note the access doors to the crawl space and the three cleats attached to the vertical siding.
Plate 10: Detail of the foundation at the southeast corner. Note the treads for the south stairs at photo left.
Plate 11: Detail of foundation of main block at the south stairs. Note the porch for the south stairs at photo right.
Plate 12: View of the foundation of the south elevation.
Plate 13: Detail of the foundation at the northwest corner.
Plate 14: Detail of the foundation of the north elevation.
Plate 15: View looking southwest at the north stairs.
Plate 16: View looking northwest at the south stairs.
Plate 17: Detail of the step for the kitchen door along the north elevation.
Plate 18: Detail of the junction of the main block and the kitchen addition along the south elevation.
Plate 19: Detail of the junction of the main block and the kitchen addition along the north elevation.
Plate 20: Detail of the junction of the main block and the kitchen addition along the north elevation.
Plate 21: Detail of the window replacement. Note the patch on both sides and below the window.
Plate 22: Detail of in-filled window along west elevation. Kitchen cabinets are located along the interior of this wall.
Plate 23: Detail of window cornice.
Plate 24: Detail of double window.
Plate 25: Detail of the exhaust vent for the kitchen.
Plate 26: Detail of door cornice.
Plate 27: Detail of the chimney stack.
Plate 28: View looking southwest at a concrete block wall and pad behind the kitchen.
Plate 29: View looking west at Room 1 from Room 4.
Plate 30: Detail of the floors between Room 1 and Room 4. Note Room 1 is in the foreground.


KITCHEN/DINING HALL

CRS # N-14422.04

Digital Photo Log

Continued

- Plate 31: Detail of the slope of the ceiling in Room 1.
- Plate 32: Detail of ceiling and south wall of Room 1 where it meets Room 4.
- Plate 33: Detail of hand made door from Room 1 to Room 2.
- Plate 34: Detail of hand made door from Room 1 to Room 2. The door is made from the simple drop siding that was formally the exterior of the kitchen addition. Note the profile of the siding boards. Kitchen is visible through the doorway.
- Plate 35: View looking west within Room 2 (Pantry).
- Plate 36: View looking east within Room 2 (Pantry).
- Plate 37: View looking southwest within Room 3.
- Plate 38: View looking southeast within Room 3.
- Plate 39: View looking northeast within Room 3 showing sink, *Vulcan* stove, hood, and fire suppression nozzles.
- Plate 40: View looking northwest at exterior entrance, water heater, sink, and cabinets.
- Plate 41: Detail of jog in interior wall beside circuit breaker box.
- Plate 42: View looking south within Room 4.
- Plate 43: View looking northeast within Room 4.
- Plate 44: View looking northwest within Room 4.
- Plate 45: View looking southwest within Room 4.
- Plate 46: Detail of floor vent and heater within Room 4.
- Plate 47: View looking west at Room 5 (Closet) from Room 4. Note hand made door.
- Plate 48: Detail of west wall within Room 5. Note the exposed framing of the walls and ceiling.
- Plate 49: View looking south within Room 6.
- Plate 50: View looking north within Room 6.
- Plate 51: Detail of the exposed framing of Room 6. Note the modification to the width of the doorway, wiring, shelving, and fire suppression system.
- Plate 52: View looking north at Room 7 (closet) from Room 1. Note that the top of Room 7 does not reach the ceiling in Room 1.
- Plate 53: Detail of Room 7 (closet). Note simple drop siding in the back of the closet.
- Plate 54: Detail of Room 7 (closet).
- Plate 55: View looking southwest at Room 8 from Room 1.
- Plate 56: Detail of the roof and joists through an access hatch in Room 6.

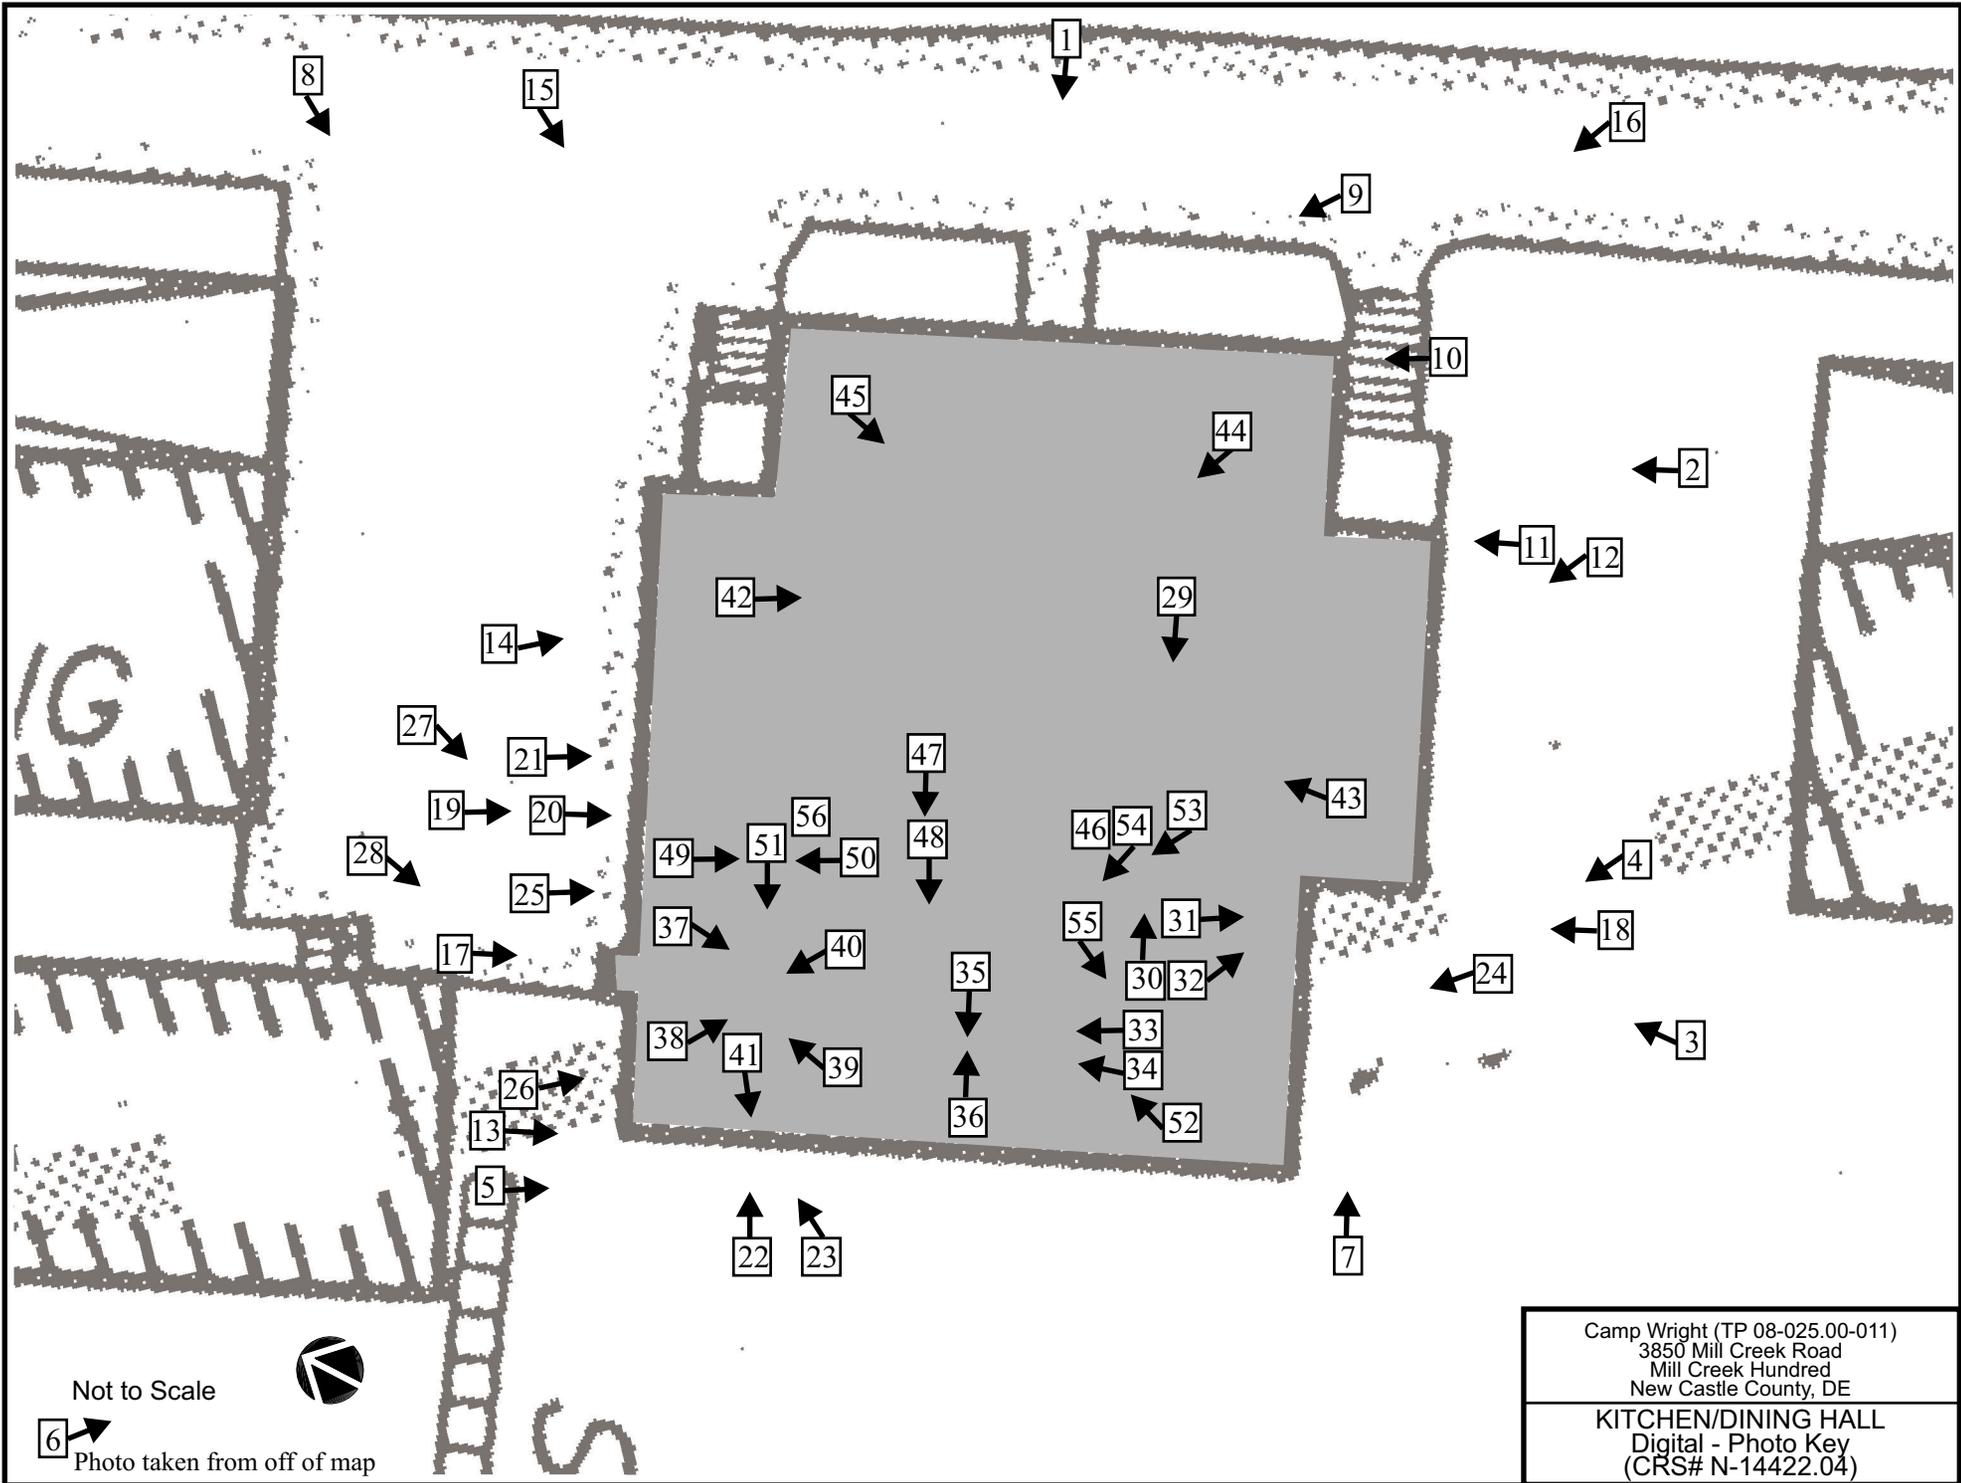

Not to Scale



6 Photo taken from off of map

Camp Wright (TP 08-025.00-011)
3850 Mill Creek Road
Mill Creek Hundred
New Castle County, DE

KITCHEN/DINING HALL
Digital - Photo Key
(CRS# N-14422.04)



Plate 01: View looking west at the east elevation.



Plate 02: View looking northwest at the south elevation.



Plate 03: View looking northeast at the south elevation.



Plate 04: View looking north at the south elevation.



Plate 05: View looking southeast at the west elevation.



Plate 06: View looking southeast from Bunk House #2. Note the kitchen addition of the Kitchen/Dining Hall is below the grey shed roof in the center of the photo.



Plate 07: Looking east at the west elevation of the main block of the building.



Plate 08: View looking southwest at the north elevation.



Plate 09: Detail of the foundation of the east elevation. Note the access doors to the crawl space and the three cleats attached to the vertical siding.



Plate 10: Detail of the foundation at the southeast corner. Note the treads for the south stairs at photo left.



Plate 11: Detail of foundation of main block at the south stairs. Note the porch for the south stairs at photo right.



Plate 12: View of the foundation of the south elevation.



Plate 13: Detail of the foundation at the northwest corner.



Plate 14: Detail of the foundation of the north elevation.



Plate 15: View looking southwest at the north stairs.



Plate 16: View looking northwest at the south stairs.



Plate 17: Detail of the step for the kitchen door along the north elevation.



Plate 18: Detail of the junction of the main block and the kitchen addition along the south elevation.



Plate 19: Detail of the junction of the main block and the kitchen addition along the north elevation.



Plate 20: Detail of the junction of the main block and the kitchen addition along the north elevation.



Plate 21: Detail of the window replacement. Note the patch on both sides and below the window.



Plate 22: Detail of in-filled window along west elevation. Kitchen cabinets are located along the interior of this wall.



Plate 23: Detail of window cornice.



Plate 24: Detail of double window.



Plate 25: Detail of the exhaust vent for the kitchen.



Plate 26: Detail of door cornice.



Plate 27: Detail of the chimney stack.



Plate 28: View looking southwest at a concrete block wall and pad behind the kitchen.



Plate 29: View looking west at Room 1 from Room 4.



Plate 30: Detail of the floors between Room 1 and Room 4. Note Room 1 is in the foreground.



Plate 31: Detail of the slope of the ceiling in Room 1.



Plate 32: Detail of ceiling and south wall of Room 1 where it meets Room 4.



Plate 33: Detail of hand made door from Room 1 to Room 2.



Plate 34: Detail of hand made door from Room 1 to Room 2. The door is made from the simple drop siding that was formally the exterior of the kitchen addition. Note the profile of the siding boards. Kitchen is visible through the doorway.



Plate 37: View looking southwest within Room 3.



Plate 38: View looking southeast within Room 3.



Plate 39: View looking northeast within Room 3 showing sink, *Vulcan* stove, hood, and fire suppression nozzles.



Plate 40: View looking northwest at exterior entrance, water heater, sink, and cabinets.



Plate 41: Detail of jog in interior wall beside circuit breaker box.



Plate 42: View looking south within Room 4.



Plate 43: View looking northeast within Room 4.



Plate 44: View looking northwest within Room 4.



Plate 45: View looking southwest within Room 4.



Plate 46: Detail of floor vent and heater within Room 4.



Plate 47: View looking west at Room 5 (Closet) from Room 4. Note hand made door.



Plate 48: Detail of west wall within Room 5. Note the exposed framing of the walls and ceiling.



Plate 49: View looking south within Room 6.



Plate 50: View looking north within Room 6.



Plate 51: Detail of the exposed framing of Room 6. Note the modification to the width of the doorway, wiring, shelving, and fire suppression system.



Plate 52: View looking north at Room 7 (closet) from Room 1. Note that the top of Room 7 does not reach the ceiling in Room 1.



Plate 53: Detail of Room 7 (closet). Note simple drop siding in the back of the closet.



Plate 54: Detail of Room 7 (closet).



Plate 55: View looking southwest at Room 8 from Room 1.

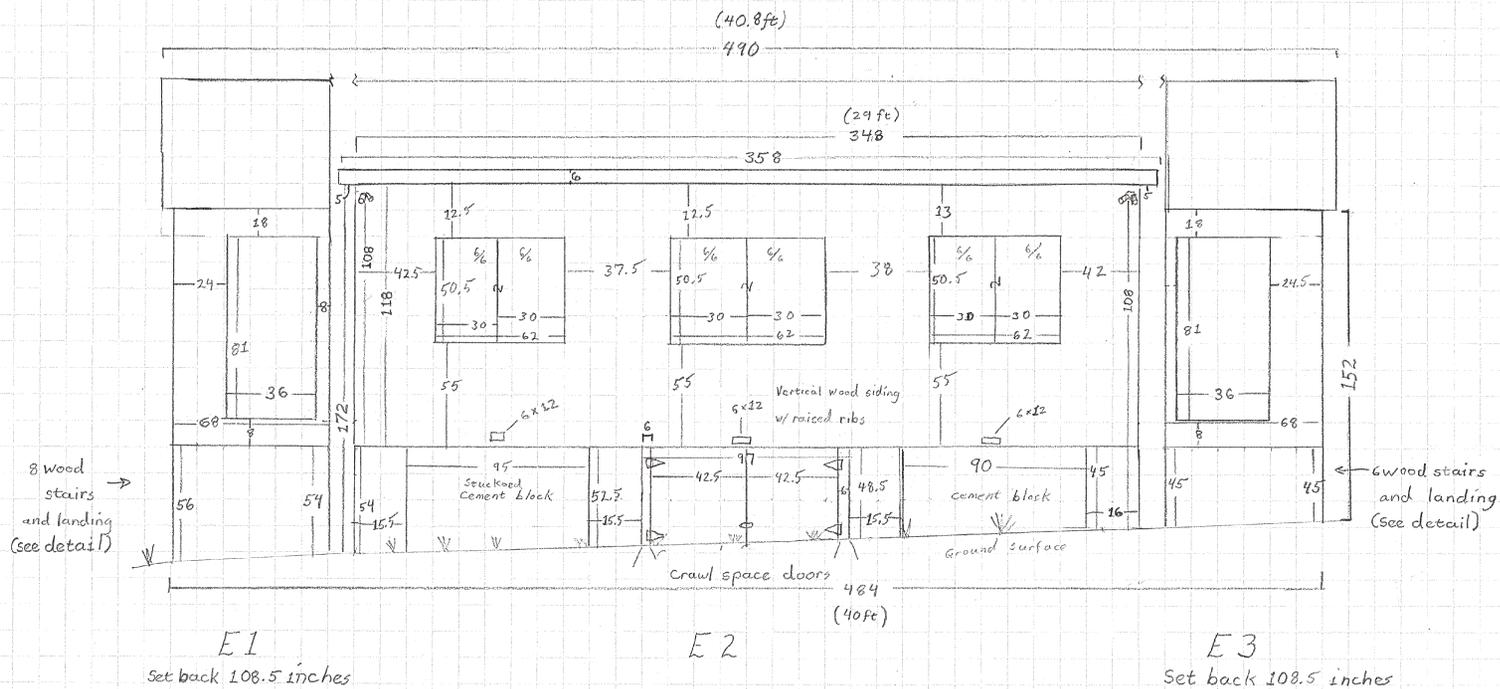


Plate 56: Detail of the roof and joists through an access hatch in Room 6.

Handwritten notes or signatures in the top right corner of the drawing area.

Notes: Crawl space doors are plywood.
 Doors
 All measurements in inches
 Not to scale

East Elevation




Not to Scale

Camp Wright (TP 08-025.00-011)
 3850 Mill Creek Road
 Mill Creek Hundred
 New Castle County, DE
 Kitchen/Dining Hall
 Facade (east) - Elevation
 (CRS# N-14422.04)

Camp Wright:
Kitchen/Dining Hall

West Elevations

All windows on W1 Boarded up + painted
Not to Scale
All measurements in inches.
W2, Main Block is set back 180 inches

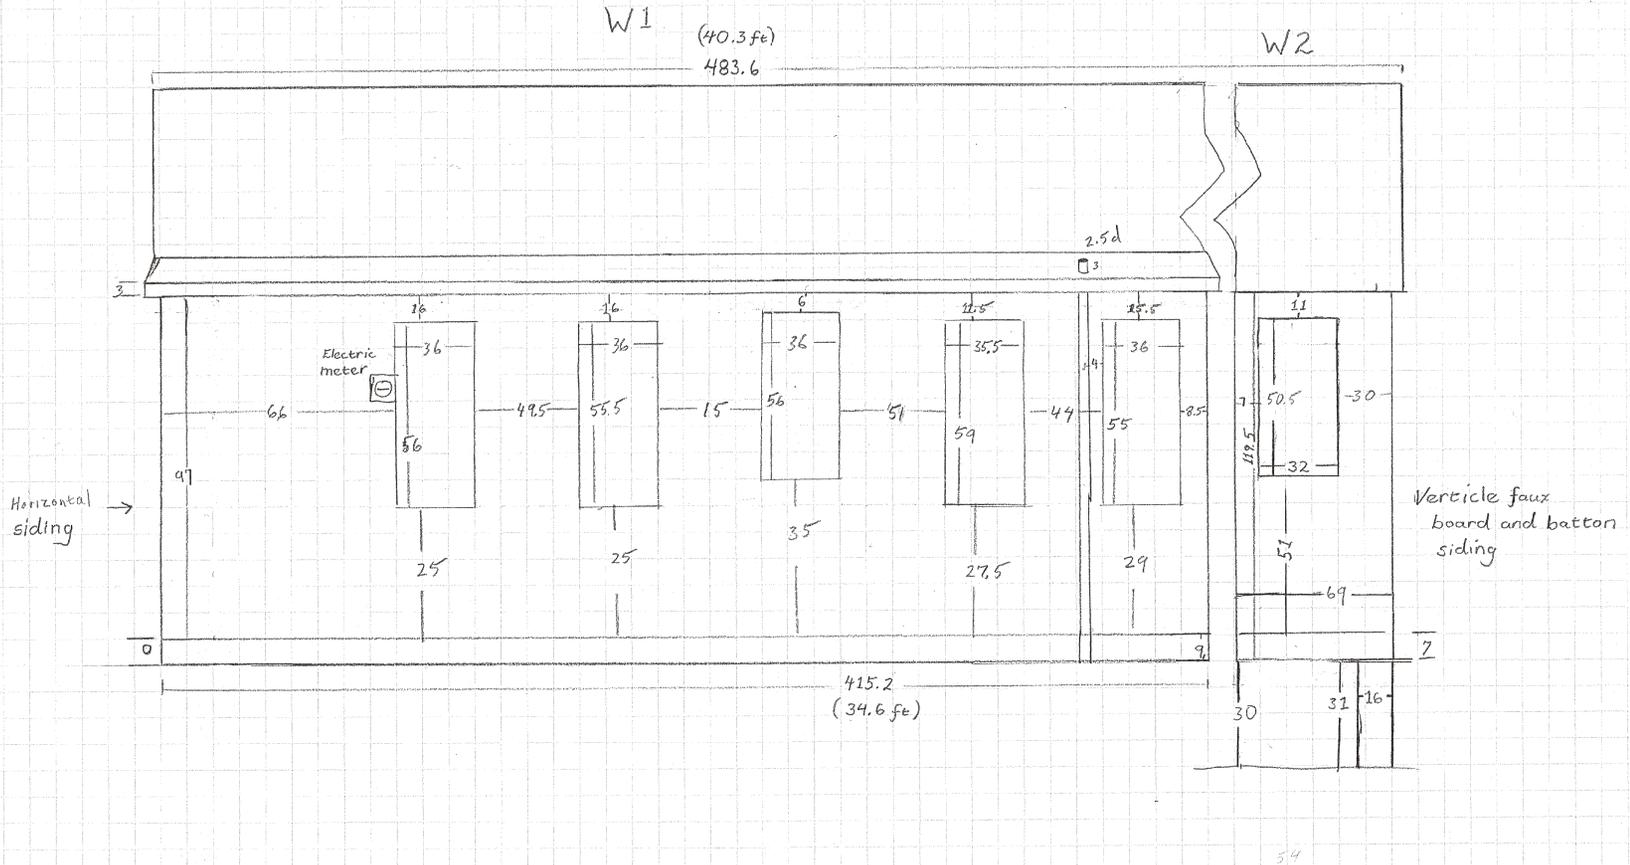


Not to Scale

<p>Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE</p>
<p>Kitchen/Dining Hall Rear (west) - Elevation (CRS# N-14422.04)</p>

Camp Wright:
Kitchen/Dining Hall


Notes: Stairs on page
Ribs set on 12 centers
Not to scale
All measurements in inches

North Elevation

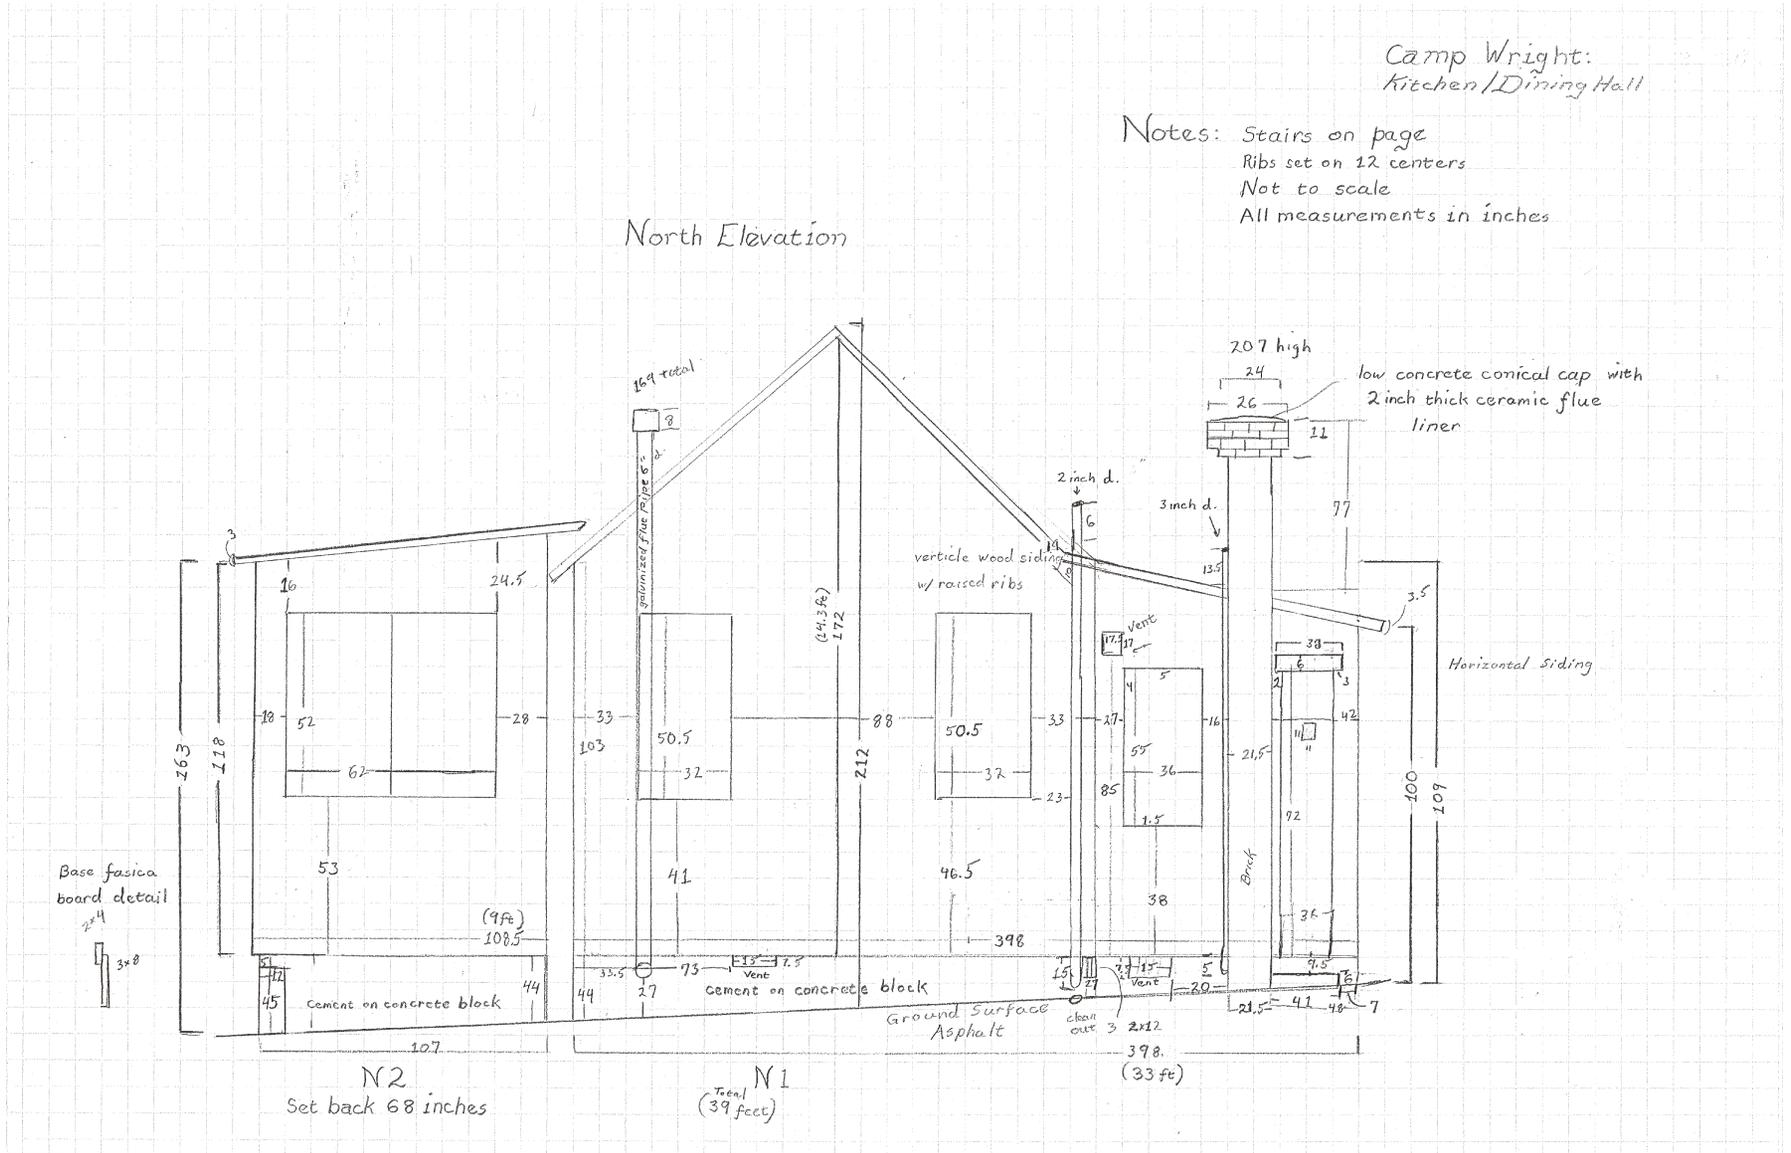

Not to Scale

<p>Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE</p>
<p>Kitchen/Dining Hall Side (north) - Elevation (CRS# N-14422.04)</p>

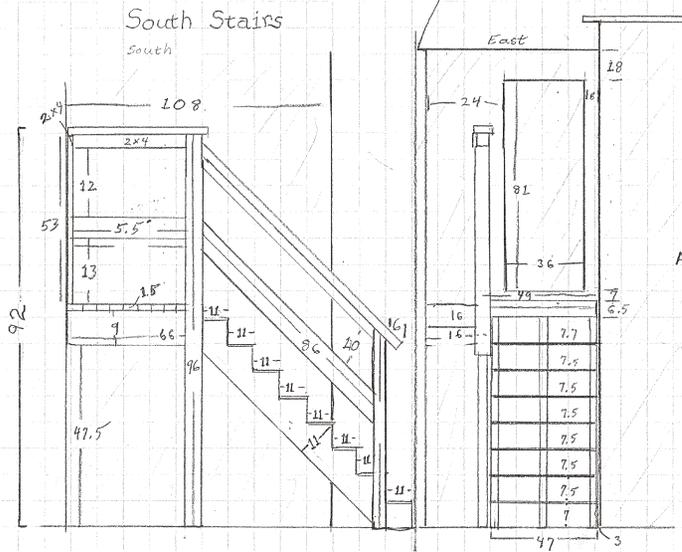


Camp Wright:
Kitchen/Dining Hall

Stair Details

Not to Scale

All measurements in inches

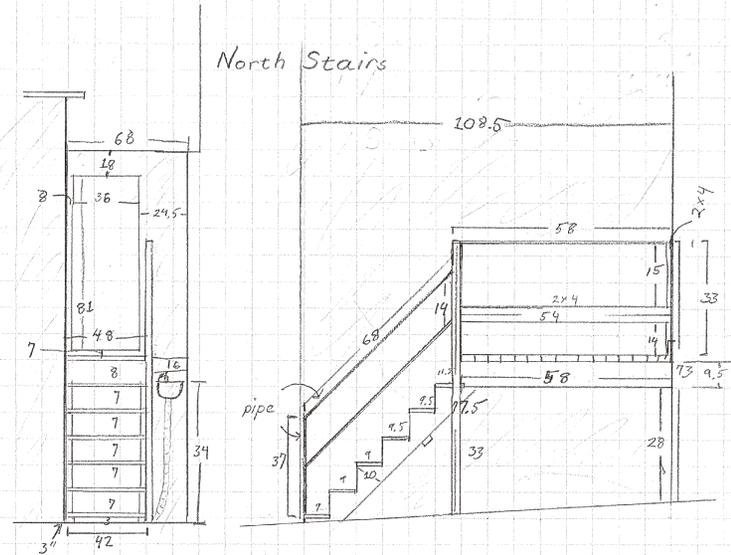

Notes: Wood stairs: overall length: 85"
treads: W 11 ; T 1.5 ; L 47 ; # 8
risers: H mostly 7.5
Columns: 4 x 4
Hand rail: 2 x 4
Stretcher: 2 x 6
Hunter green

Landing: overall L 58.5 ; W 49 ; T 1.5
planks: 1.5 x 5.5
support: 1.5 x 9 (2x10)

Notes: Wood stairs: overall length 55"
treads: W 9.5 ; T 1 ; L 42 ; # 6
risers: H mostly 7
column: 4 x 4
handrail: metal 2"d. pipe painted black
wood 2x4 " white


Wood: White Pipe: Black 2"d.

Landing: overall L 58 ; W 48 ; T 1.5
planks: 1.5 x 5.5
support: 4 x 4

Door: 2" w metal frame

Not to Scale

<p>Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE</p>
<p>Kitchen/Dining Hall Detail - North and South Stairs (CRS# N-14422.04)</p>

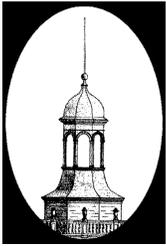

DELAWARE STATE HISTORIC PRESERVATION OFFICE
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM

CRS # N-14422.04

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road
2. FUNCTION(S): historic kitchen/dining hall current not in use
3. YEAR BUILT: 1922 CIRCA?: ARCHITECT/BUILDER: unknown
4. STYLE OR FLOOR PLAN: five-bay, two pile building with Craftsman details
5. INTEGRITY: original site moved
 if moved, from where _____ other location's CRS # _____ year _____

<u>list major alterations and additions with years (if known)</u>	<u>year</u>
a. shed-roof addition to front	Ca. 1955
b. shed-roof addition to northwest corner	Ca. 1955

6. CURRENT CONDITION: excellent good fair poor
7. DESCRIPTION: (Describe the resource as completely as possible. Use N/A for not applicable; leave no blanks.)
- a. Overall shape: L-shaped with extension on east elevation Stories: one
 Additions: N/A
- b. Structural system (if known): frame
- c. Foundation: materials: concrete block piers
 basement: full partial not visible no basement
- d. Exterior walls (original if visible & any subsequent coverings): wood board and batten siding
- e. Roof: shape: side gable
 materials: asphalt shingles
 cornice: open
 dormers: N/A
 chimney: location(s): exterior brick chimney at northwest corner

8. DESCRIPTION OF ELEVATIONS:
- a. Facade: Direction: east
 1) Bays five
 2) Windows fenestration three (3) paired windows within extension
 type paired six-over-six double hung with wood sashes
 trim wood
 shutters N/A

Facade (cont'd)

- 3) **Door(s)** two
location east and west ends of main block and basement level
type metal
trim N/A
- 4) **Porch(es)** N/A

b. Side: Direction: south

- 1) **Bays** two
- 2) **Windows**
fenestration two sets of (2) paired
type six-over-six double hung with wood sashes
trim wood
shutters N/A
- 3) **Door(s)** N/A
location N/A
type N/A
trim N/A
- 4) **Porch(es)** N/A

c. Side: Direction: north

- 1) **Bays** four
- 2) **Windows**
fenestration three first floor
type six-over-six double hung with wood sashes
trim wood
shutters N/A
- 3) **Door(s)** N/A
location N/A
type N/A
trim N/A
- 4) **Porch(es)** N/A

d. Rear: Direction: west

- 1) **Bays** not accessible
- 2) **Windows** not accessible
fenestration not accessible
type not accessible
trim not accessible
shutters not accessible
- 3) **Door(s)** not accessible
location not accessible
type not accessible
trim not accessible
- 4) **Porch(es)** not accessible

9. **INTERIOR:** Combination plaster and wood board interior walls. Wood board flooring.

10. **LANDSCAPING:** The Kitchen/Dining Hall, along with twelve other camp related resources, is located in a wooded setting along the Mill Creek. Mill Creek Road runs along the eastern boundary of the property. Modern residential development mixed with older housing in a wooded setting is found to the north, east, and west. Limestone Hill Park is located to the south.

11. **OTHER COMMENTS:** The building appears to have been constructed in 1922 and was used as a kitchen/dining area.