
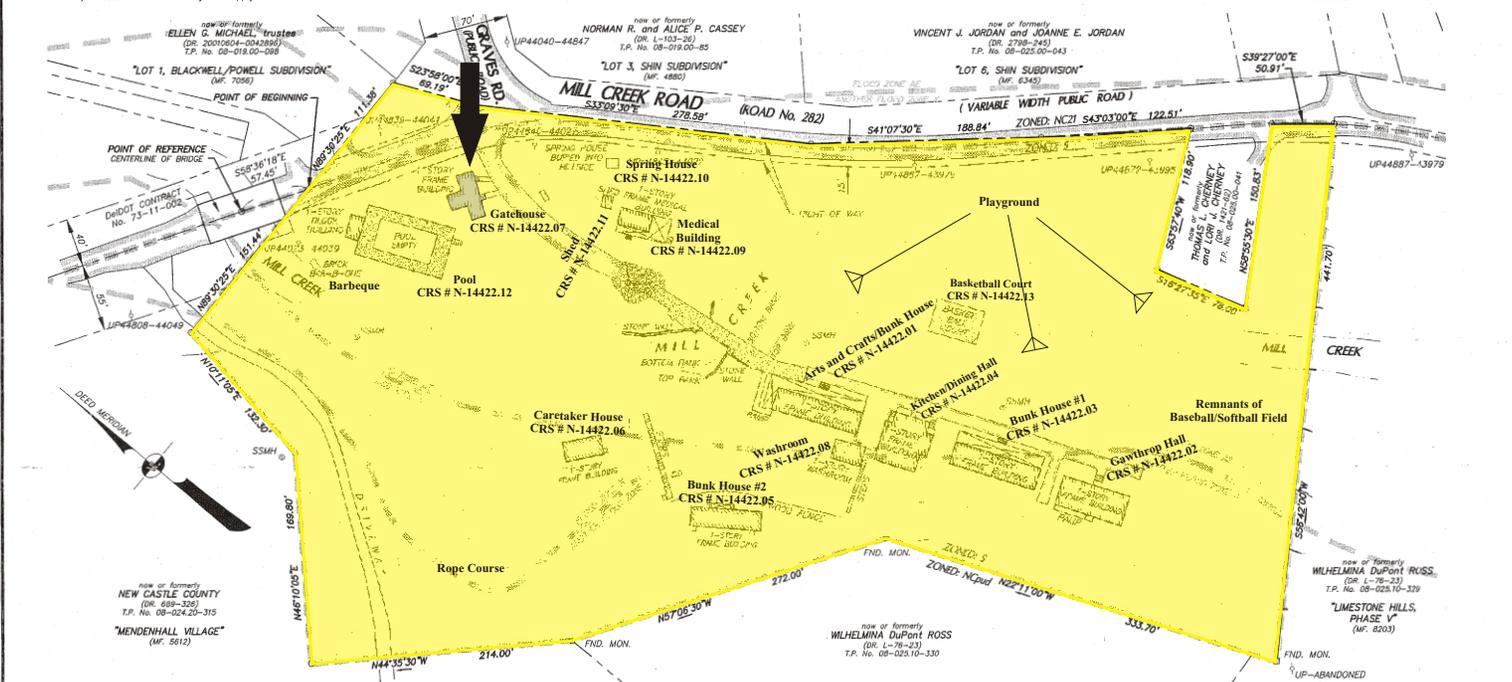


Gatehouse
(CRS # N-14422.07)

C:\dwg\38083M.dwg, 4/10/2008 10:37:13 AM, Jason Rose, VanDemark & Lynch, Inc.

NOTES:

- Owner: West End Neighborhood House, Inc.
3850 Mill Creek Road
Hockessin, DE 19707
- Tax Parcel No.: 08-025.00-011
- Source of Title: Deed Record C, Volume 86, Page 114
- Area: 7.483± Acres
- Zoning: New Castle County Unified Development Code
Zoning: S, Suburban (other permitted uses)
Lot Area: 2 acre
Lot Width: 200'
Building Height: 40' MAX.
Building Setbacks: Street - 50'
Rear - 50'
Side - 40'
- Setback lines indicated above per New Castle County Unified Development Code interpretation and must be verified by New Castle County prior to Land Development. Buffer and Green Area and/or other restrictions may also apply.
- This plan was prepared without the benefit of a title commitment, title search or bring down and is subject to easements, validity of chain of title, etc., that a subsequent search may disclose.
- Date of Field Survey: December 12, 2005
Revision 1 - April 5, 2006 - Located Buildings
- A portion of the Property described on this survey DOES lie within a Special Flood Hazard Area ("SFHA") as defined by the Federal Emergency Management Agency; the Property lies within Zone "AE", Base Flood Elevation = 10.0', of the Flood Insurance Rate Map identified as Community Panel No. 10003C0045 G, bearing an effective date of October 6, 2000. A portion of this property also lies within Zone X, area of 500-year floodplain and a portion lies within Another Zone X, area determined to be outside the 500-year floodplain.
- Existing utilities are shown in accordance with what was observed about the boundary line only. Completeness or correctness thereof is not guaranteed. It shall be each contractor's responsibility to contact the utility companies involved in order to secure the most accurate information available as to utility location and elevation. No construction around or adjacent to utilities shall begin without notifying their owners at least 48 hours in advance. Each contractor shall take the necessary precautions to protect the existing utilities. To locate existing utilities in the field prior to construction, the contractor shall contact Miss Utility of Delaware (telephone 800-282-8555).

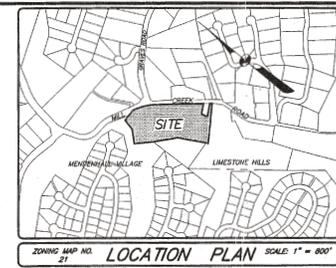

LEGEND:

FND. MON.	Found Concrete Monument
T.P. No.	Tax Parcel Number
D.R.	Deed Record
MF.	Microfilm
○	Sanitary Sewer Manhole
○	Utility Pole
---	Property Line
---	Adjoining Property Line
---	Edge of Pavement
---	Zoning Line
---	Fence Line
---	Flood Zone Limit
---	Concrete

PROPERTY PLAN
3850 MILL CREEK ROAD
 MILL CREEK HUNDRED - NEW CASTLE COUNTY
 DELAWARE
 SCALE: 1"=60' DECEMBER 13, 2005
 GRAPHIC SCALE (IN FEET)

NO.	DATE	REVISION	BY	APPROVED
1	4-5-08	Alter Building Location	JLR	

VANDEMARK & LYNCH, INC.
 ENGINEERS - PLANNERS - SURVEYORS
 4305 MILLER RD. BOX 2847
 WILMINGTON, DE 19899-7052 764-7630

PERMANENT FILE 072/360	QA REVIEW
SURVEYED BY S. S. S. S.	PROJECT MANAGER J. J. J. J.
COURTSHIP BY S. S. S. S.	DRAWN BY L. L. L. L.
PROJECT NO. 21097.07	FILE NO. 38083-M
	1 of 1
	REVISION 1

Camp Wright (TP 08-025.00-011)
 3850 Mill Creek Road
 Mill Creek Hundred
 New Castle County, DE
 Map of Camp Wright

Boundary of Camp Wright

GATEHOUSE

CRS # N-14422.07

Detailed Building Description

Description

The Gatehouse is a T-shaped, one-story, side gable, balloon-frame, one pile, four bay building that consists of the main block (two rooms and a bathroom) and two one-room additions.

Structural History

The main three bay block of the Gatehouse was constructed first (c. 1925). At some later date a one room two bay addition was constructed off the northwest end of the main block. Later, a lean-to shed addition was constructed off of the west elevation of the main block.

Exterior

The main block and the north addition are covered with simple drop siding with boxed corners. The lean-to shed addition has faux board-and-batten siding with some simple wood drop siding below the roof on the north and south elevations. The lean-to shed addition is set back 8-inches from the main block of the building. The Gatehouse sits on concrete block piers. The space between the piers is covered with plywood. The house is painted light blue grey with some white trim. The gable roof is covered in coursed asphalt shingles. This roof also has open eaves with exposed rafters made of 2x6 inch boards. Round gutter hooks are extant on some of the rafters. The roof of the lean-to shed addition is covered with asphalt sheet goods and edged with aluminum flashing.

North Elevation (Rear)

Main Block

- The main block is 13 feet long.
- There are two windows on the north elevation of the main block.
- The windows are six-over-six, double hung, wood sash windows.
- The windows are covered with aluminum framed storm/screen windows.
- The windows have unadorned white wood window casings.
- Below the roofline is a 6-inch wide fascia board that ends in a cornice return.
- The main block rests on three piers.
- The northern end is on an 11-inch high, 8-inch wide concrete block pier
- The middle pier is 19.5 inches high and at least 8 inches wide.
- The southern pier is 39.5 inches high and at least 8 inches wide.

North Wing (Two Bay).

- The north wing two bay addition is 13 feet long.
- There are two windows located on the north elevation of the north wing.
- The east window is a six-over-six, double hung, wood sash window with an aluminum framed storm/screen window.
- The west window is a two-over-two double hung vinyl sash window.
- The windows have unadorned white wood window casings.
- The north elevation of the north wing rests on two concrete block piers.

- The eastern pier is 28.5 inches high and the western pier is 39 inches high.
- There is a 6-inch diameter galvanized exhaust pipe protruding from the crawl space cover. The exhaust pipe comes out of a 7-inch diameter ceramic pipe.
- The exhaust pipe bends upward and extends 24.5 inches above the roofline.
- Below the roofline is a 6-inch wide fascia board that ends in a cornice return.
- There is a gas meter to the right of the northern pier.
- There is a six wood louvered vent in the gable.
- There is a pair floodlights at the top of the gable. The floodlights are positioned to illuminate the pool area.

Lean-to Shed Addition

- The lean-to shed addition is 11.8 feet long.
- The addition is covered with faux board-and-batten siding made of plywood with vertical 1-inch wide ribs set at 17.5-inch centers.
- There is one set of paired one-over-one, double hung, wood sash windows with aluminum storm/screen windows in the east wall.
- The lean-to shed addition rests on two 15.5-inch square cement-block piers.
- The eastern pier is 36 inches high and the western pier is 41 inches high.

East Elevation (Side)

Main Block

- The main block is 13 feet long.
- There is one set of paired six-over-six, double hung, wood sash windows centrally located in the east elevation.
- There is a wooden six louvered vent in the gable.
- Below the roofline is a 6-inch fascia board that ends in a cornice return.
- The southern end of the north elevation is at grade. The northern end is on a 9-inch high, 15.5-inch square concrete block pier.

North Wing (Two Bay)

- The north wing is 12.5 feet long.
- There are two windows located on the east elevation of the north wing.
- The windows are six-over-six double hung wood sash windows.
- The windows are covered with aluminum framed storm/screen windows.
- The windows have unadorned white wood window casings.
- The east elevation of the north wing is on two concrete block piers.
- The southern pier is 19.5 inches high and the northern pier is 28 inches high.

South Elevation (Façade)

Main Block

- The main block is 19 feet long.
- There are two doors and a window on the south elevation.
- Both doors are three panel wood doors with nine lights and have aluminum framed storm doors.

- The lights over the west door are boarded up.
- There is an incandescent light mounted to the left of the east door.
- The window is a six-over-six, double hung, wood sash window.
- The window has an unadorned white wood casing.
- There is a double mounted flood light mounted between window and east door.
- There is a water spigot protruding through the crawl space cover centrally located between the doors.
- There is a metal hose rack mounted below the window.
- There are brick covered concrete block stairs leading up to both doors.
- There are two steps in front of the east door and three steps in front of the west door.
- The middle step of the west stair is made of firebrick marked: WOODLAWN.
- The main block rests on at least two 15.5-inch wide concrete block pillars.
- The east end is at grade, the middle pier is 12 inches high, and the west pier is 32 inches high.
- There is a round gutter along the length of the roof of the main block.
- The downspout is on the west edge of the main block.
- There are brick walks up to both doors from asphalt driveway.
- The brick paths are bordered by 2x4 inch boards.

Lean-to Shed Addition

- The lean-to shed addition is 11.8 feet long.
- The addition is covered with faux board-and-batten siding made of plywood with vertical 1-inch wide ribs set at 17.5-inch centers.
- There is one paired one-over-one wood double sash window with aluminum storm/screen window in the east wall.
- The lean-to shed addition rests on two 15.5-inch square cement-block piers.

West Elevation (Side)

Main Block

- Little of the main block's west elevation is visible. The lean-to shed addition covers most of the elevation except for the gable.
- There is a wooden five louvered vent near the top of the gable.
- There is a 6-inch wide fascia board under the roofline.
- The electrical service is connected to a 4x4 inch post attached to the gable.

Lean-to Shed Addition

- The lean-to shed addition is 11.7 feet long.
- The addition is covered with faux board-and-batten siding made of plywood with vertical 1-inch wide ribs set at 17.5-inch centers.
- There is one set of paired one-over-one, double hung, wood sash windows with aluminum storm/screen windows centered in the east wall.
- The lean-to shed addition rests on two 15.5-inch square cement-block piers.
- The northern pier is 40 inches high and the southern pier is 34.5 inches high.
- The roof has a 7-inch over hang.

North Wing (Two Bay).

- The two-bay addition is 12.5 feet long.
- There are two windows located on the west elevation of the north wing.
- The windows are six-over-six double hung wood sash windows.
- The windows are covered with aluminum framed storm/screen windows.
- The windows have unadorned white wood window casings.
- The east elevation of the north wing is on two concrete block piers.
- The southern pier is 39 inches high and the northern pier is 39.5 inches high.

Interior

The interior of the Gatehouse is divided into eight rooms, Room 1 (Bedroom), Room 2 (Kitchen), Room 3 (Living Room/Office), Room 4 (Lean-to Shed Addition), Room 5 (Bathroom), Room 6 (Pantry), Room 7 (Hall Closet), and Room 8 (Hall).

Room 1 (Bedroom)

- Room 1 is 12 feet north south and 11.9 feet east west.
- The ceiling is white painted fiberboard and is 7 feet high.
- The floor is 2.5-inch wide hardwood boards.
- The north, east, and west walls are covered with white painted fiberboard paneling.
- The south wall is covered with untreated vertical beaded pine boards.
- The top of the walls have a standard crown moulding around the perimeter.
- The bottom perimeter of the walls has 3.5-inch wide kick stop moulding.
- The north, east, and west walls have two windows each.
- The window casings, sills, and sashes are stained.
- The bottom sashes have brass inset finger-slots.
- The windows average 29 inches above floor.
- There is a doorway at either end of the south wall.
- The east door (access to Room 8) is a solid wood six-panel door.
- The west door (access to Room 2) is missing.
- Neither doorway has a surround.
- There is a surface mounted fluorescent overhead light.
- The north, east, and west walls have surface mounted electrical wiring in armored cable running down from ceiling.
- The south wall has interior wiring.
- There is a queen size bed against the north wall and an electric range against the south wall.

Room 2 (Kitchen)

- Room 2 is 12 feet north south and 8.9 feet east west.
- The ceiling is white painted fiberboard and is 7 feet high.
- A simple varnished crown moulding runs along entire ceiling perimeter.
- The north, west, and south walls are covered with unpainted pine paneling.

- The east wall has narrow beaded board paneling.
- There is unpainted kick stop moulding along the base of the north, south, and walls.
- The floor is 2.5-inch wide hardwood boards.
- The center of the floor is covered with linoleum sheet good which is tacked into place.
- The wood floor that is not covered by the linoleum is painted red brown.
- There is doorway (access to Room 1) with no surround in the north wall.
- There is a hallway (Room 8) in the northeast corner, east wall.
- There are two doors in the east wall, one in the center and one on the south end.
- The central door (access to Room 6) is a narrow solid wood two-panel door.
- The southern door (access to Room 5) is a solid wood six-panel door.
- None of the doorframes have a surround.
- Between the two doors is a cast iron sink with a high back.
- The south wall has a door to the exterior. The door is a three panel wood door with nine lights.
- To the right of the door is a partial wall forming a broom closet in the southwest corner of the room.
- The interior of the broom closet is unfinished.
- There is a doorway (access to Room 4) in the southern portion of the west wall.
- The west door way appears to be an original exterior doorway.
- There is a c.1950's gas stove and range marked "Caloric" against the west wall. The stove is white and has four burners.
- The electrical supply box is between the stove and the broom closet.

Room 3 (Living Room/Office)

- Room 3 is 12 feet east west and 11.8 feet north south.
- The ceiling is white painted fiberboard and is 7 feet high.
- There is simple, unpainted crown moulding along the edge of the ceiling.
- The north, east, and south walls have vertical unpainted pine paneling.
- The west wall has unpainted narrow beaded board paneling.
- There is unpainted kick stop moulding along the north, east, and south walls as well as the shower exterior.
- Floor is covered with linoleum sheet goods with a hard wood floor pattern.
- There are two windows in the north wall.
- There is a set of paired windows in the middle of the east wall.
- There is a crude built-in closet in the northeast corner.
- There is a door to the exterior in the south wall. The south door is a three panel wood door with nine lights.
- The door is identical to the exterior door in Room 2.
- The southwest corner of Room 3 is partially taken up with the walled off back and side of the shower stall of Room 5.
- There is a door (access to Room 8) in the north corner of the west wall.
- The west door is a solid wood 6-panel door.
- Neither door has a surround.
- There is an enameled cast iron sink to the right of the west door.

- The electrical wiring consists of armored cable on surface of walls and ceiling.
- The windows, as in Room 1, are stained and have brass inset finger-slots.
- Room 3 has several full filing cabinets.

Room 4 (Lean-to Shed Addition)

- Room 4 is 11.4 feet east west and 10.75 inches north south.
- The ceiling is white painted sheet rock.
- The height of the ceiling varies from 97 inches in the east to 82 inches in the west.
- The north, south, and west walls have quarter round moulding as crown moulding.
- The north, south, and west walls are covered with white painted Masonite paneling.
- The east wall is the original exterior of the building and is covered with simple drop siding.
- There is 1x4 inch kick stop moulding at the base of the north, south, and west walls.
- The southwest and northwest corners have quarter round moulding.
- The floor is 7 inches lower than the floor in Room 2.
- The floor is made of 2.5-inch wide hardwood boards running east to west.
- The floor is painted light grey.
- There is a set of paired windows in the north, south and west walls.
- The windows are one-over-one, double hung, wood sash windows in aluminum friction frames.
- The windows have a simple wood casing.
- There is a doorway (access to Room 2) in the east wall.
- The doorframe has a simple flat .5-inch wide wood frame.
- The doorframe is painted dark green.
- The electrical wiring is armored cable on top of kick stop moulding.
- There is a single surface mounted fluorescent light fixture on the ceiling.
- Room 4 has a metal desk and some exercise equipment.

Room 5 (Bathroom)

- Room 5 is 4.9 feet north south and 3.5 feet east west not including the shower stall.
- The room is unfinished.
- There is no ceiling; the bathroom opens on to the rafters and attic.
- The floor is made of 2.5-inch wide hardwood boards which are painted red brown.
- The floorboards run north south.
- The lower eight feet of the north wall is paneled with vertical beaded boards.
- Above the beaded boards is attic space.
- A water heater is visible in the attic above the closet.
- There is an unfinished closet in the northeast corner. The closet shares walls with Rooms 3, 6, and 7.
- The closet door is an unfinished solid wood two-panel door.
- There is a metal shower stall projecting off the southeast corner.
- There is a window in the south wall.
- The window is a six-over-six, double hung, wood sash window.
- The window is unpainted with brass inset finger-slots.

- There is a door (access to Room 2) in the southwest corner, west wall.

Room 6 (Pantry)

- Room 6 is 24 inches east west and 18 inches north south.
- There are three shelves in the pantry.

Room 7 (Hall Closet)

- Room 7 is 19.5 inches north south and 45.5 inches east west.
- The closet door is a solid wood six-panel door.
- The façade of the closet is 8 feet high.
- The area above the closet is open attic space.
- A water heater is visible above the closet.

Room 8 (Hall)

Room 8 is a short hallway between Rooms 2 and 3.


- Room eight is 42.5 inches east west and 35 inches north south.
- There is a door on the north wall (access to Room 1).
- There is door in the east wall (access to Room 3).
- There is door in the south wall (access to Room 8).
- There is a doorway in the west wall (access to Room 2)
- The floor in Room 8 is almost completely covered by the metal grill which covers the propane heater.

Miscellaneous

- The fiberglass roof insulation is held in place with chicken wire.

GATEHOUSE
CRS # N-14422.07
Black and White Photo Log

- Plate 01: View looking northeast at the south façade and west side elevation.
Plate 02: View looking northeast at the west side elevation.
Plate 03: View looking southeast at the north rear elevation.
Plate 04: View looking southwest at the east elevation.
Plate 05: Detail of the junction of the north and west additions to the main block of the Gatehouse.

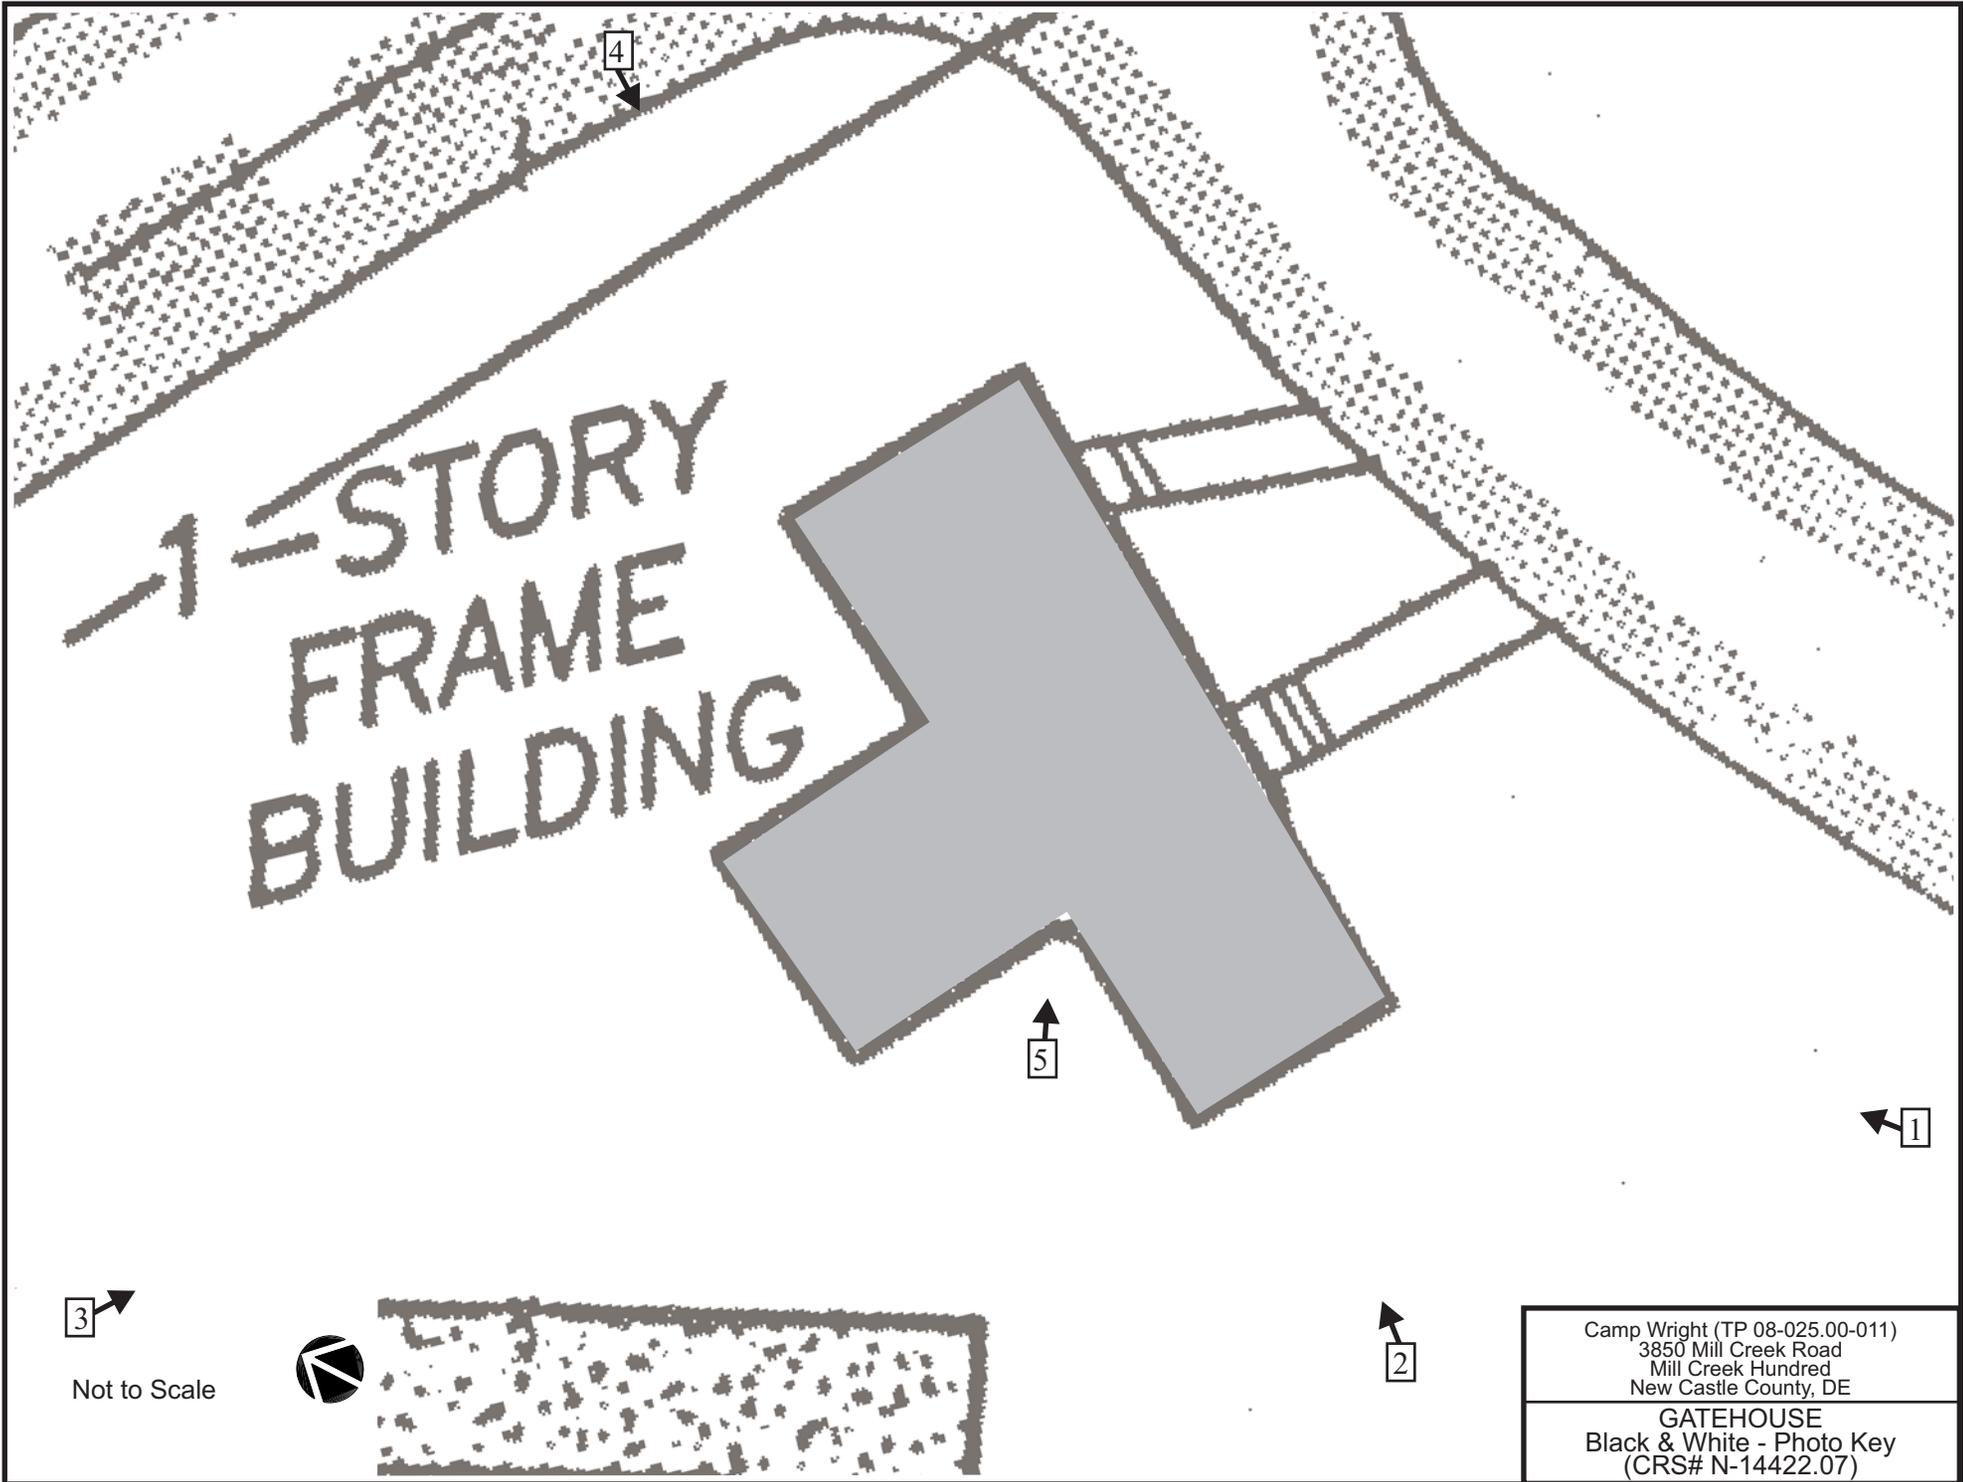

Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE
GATEHOUSE Black & White - Photo Key (CRS# N-14422.07)



Plate 01: View looking northeast at the south facade and west side elevations.



Plate 02: View looking northeast at the west elevation.



Plate 03: View looking southeast at the north rear elevation.



Plate 04: View looking southwest at the east elevation.



Plate 05: Detail of the junction of the north and west additions to the main block of the Gatehouse.

GATEHOUSE
CRS # N-14422.07
Black and White Photo Index

CONTACT SHEET	DIGITAL IMAGE (JPEG) #	NEGATIVE #	SELECTED PLATE #	DESCRIPTION
1	FL020018	1		View looking north of the Pool Building after the pool was razed.
1	FL020017	2		View looking northwest of the Pool Building after the pool was razed.
1	FL020016	3		View looking northeast of the Pool Building after the pool was razed.
1	FL020015	4		View looking south of the Pool Building after the pool was razed.
1	FL020014	5		View looking west at the bar-b-que.
1	FL020013	6		View of the interior of the Pool Building.
1	FL020012	7		View looking north of the Pool Building after the pool was razed.
1	FL020011	8		View looking west of the north pillar of the entrance gate.
1	FL020010	9		View looking southwest at the entrance gate.
1	FL020009	10		View looking southeast at the south pillar of the entrance gate.
1	FL020008	11		View looking southwest at the "Camp Wright" sign.
1	FL020007	12		View looking south at the bridge over Mill Creek. Note the Arts & Crafts/Bunk House in the background.
1	FL020006	13		View looking southeast at the electrical shed.
1	FL020005	14		View looking northeast at the electrical shed.
1	FL020004	15	1	View looking north at the south façade and the west side elevations.
1		16		Overexposed negative.
1	FL020003	17		View looking east at the electrical shed and the Shed.
1	FL020002	18		View looking northeast at the entrance gate.
1	FL020001	19		View looking west across Mill Creek at the location of the concrete pad.

Gate house

Qualide NEGATIVE FILE

CRS # N-14422.07

DATE

ASSIGNMENT





Camp Wright


NO.

1

INSERT FILM EMULSION SIDE DOWN

MADE IN JAPAN

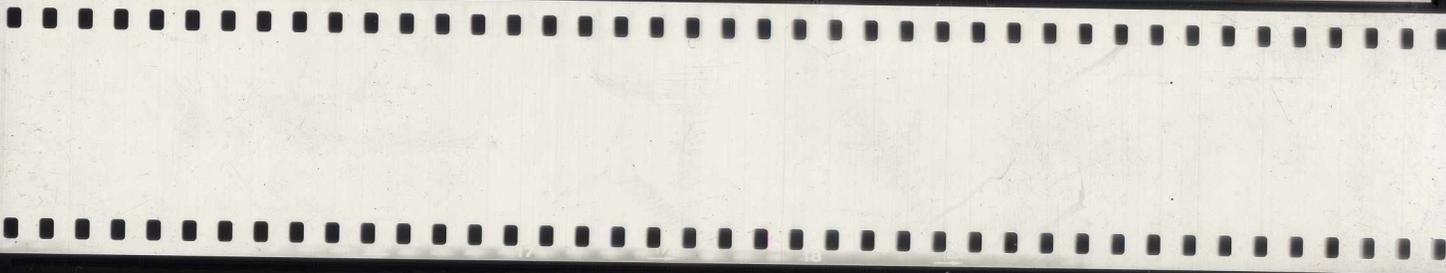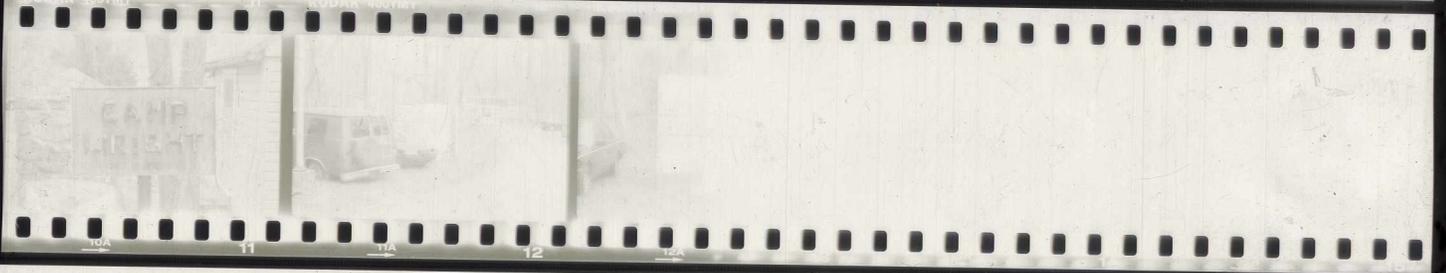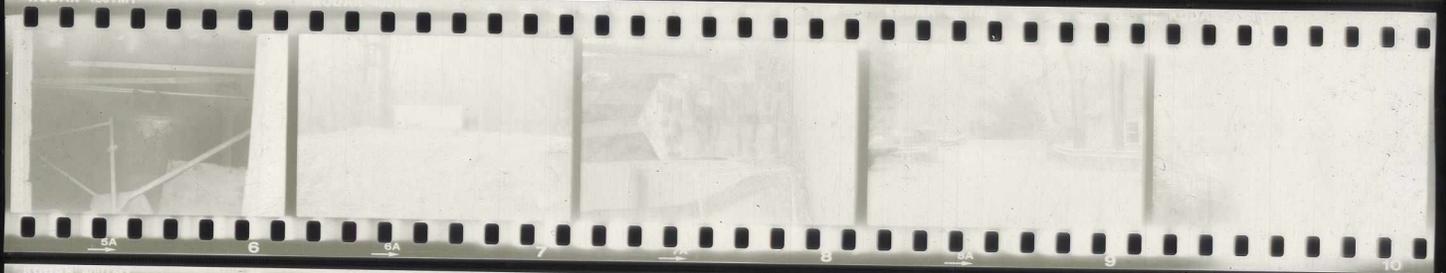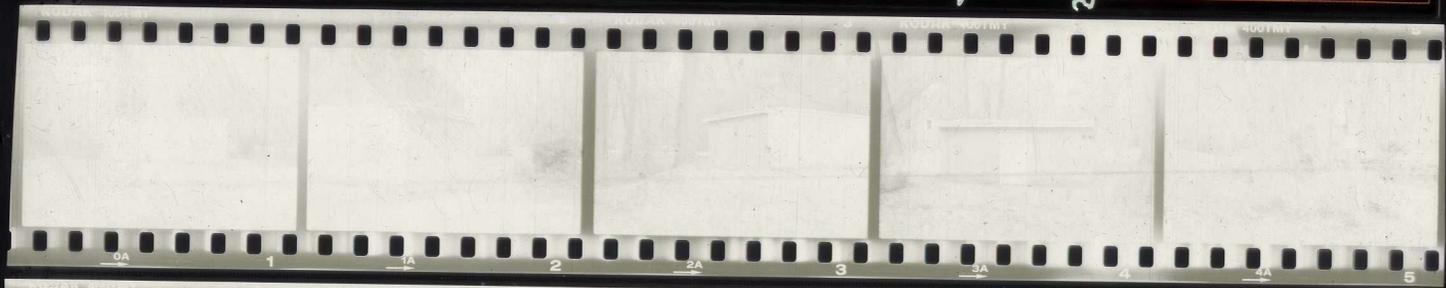


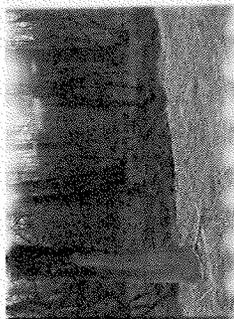

FL020001.jpg



FL020002.jpg

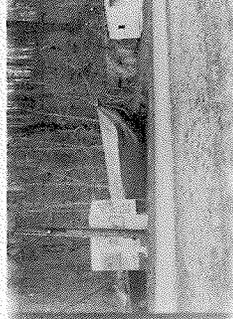


FL020003.jpg




FL020004.jpg




FL020005.jpg

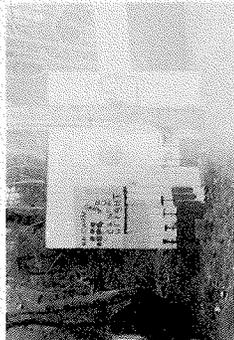

FL020006.jpg

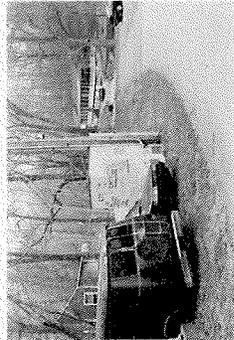

FL020007.jpg

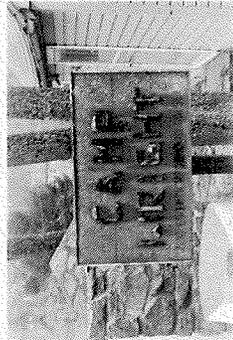


FL020008.jpg




FL020009.jpg



FL020010.jpg

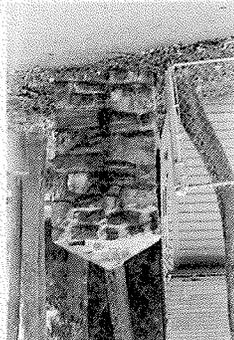


FL020011.jpg

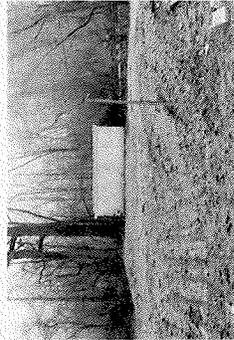


FL020012.jpg



FL020013.jpg

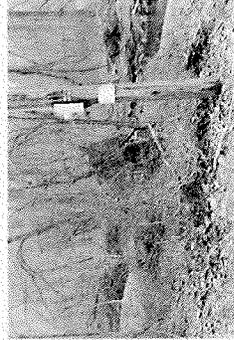


FL020014.jpg

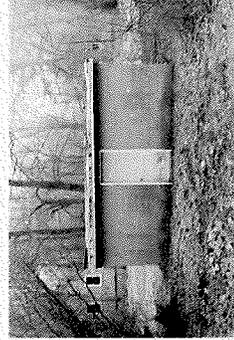


FL020015.jpg



FL020016.jpg

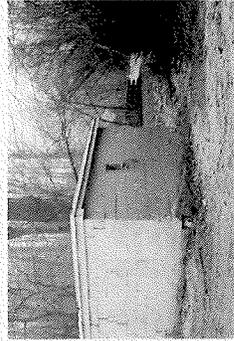

FL020017.jpg

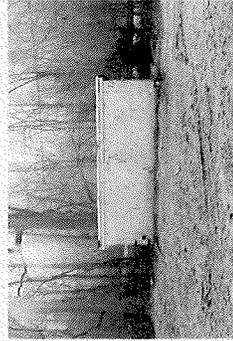

FL020018.jpg

GATEHOUSE
CRS # N-14422.07
Black and White Photo Index

CONTACT SHEET DIGITAL IMAGE (JPEG) #	NEGATIVE #	SELECTED PLATE #	DESCRIPTION	
2	FL020022	2	View looking north at the south façade and the west side elevations.	
2	FL020021	3	2	View looking southeast at the east side elevation.
2	FL020020	4	3	View looking southwest at the north rear elevation.
2	FL020019	5		View looking southeast at the north rear elevation.
2	FL020018	6	4	View looking southwest at the east side elevation.
2	FL020017	7		Detail of the west steps.
2	FL020016	8		Detail of the junction of the main block and the west addition of the Gatehouse.
2	FL020015	9	5	Detail of the junction of the north and west additions to the main block of the Gatehouse.
2	FL020014	10		Detail of the doorway from the west addition (Room 4) to the main block (Room 2) of the Gatehouse.
2	FL020013	11		Detail of the wall within Room 4.
2		12		Overexposed negative.
2	FL020012	13		View looking southeast from Room 1 through Room 2 to the outside.
2	FL020011	14		View looking northeast from Room 1 into Room 3.
2	FL020010	15		View looking southwest from Room 3 into Room 1.
2	FL020009	16		View looking southeast within Room 3.
2	FL020008	17		Detail of the front door.
2	FL020007	18		View looking northeast within Room 5.
2	FL020006	19		Detail of the eaves and the gutter.
2	FL020005	20		Detail of the eaves at the junction of the west addition and the main block of the Gatehouse.
2	FL020004	21		Detail of the eaves at the junction of the north and west additions to the main block of the Gatehouse.
2	FL020003	22		Detail of a window.
2	FL020002	23		Detail of the cornice return.
2	FL020001	24		Detail of the attic vent, pool lights, and the heater vent.

Gatehouse

INSERT FILM EMULSION SIDE DOWN

MADE IN JAPAN






Qualide NEGATIVE FILE


CRS # N-14422.07

DATE

ASSIGNMENT Camp Wright

NO. 2

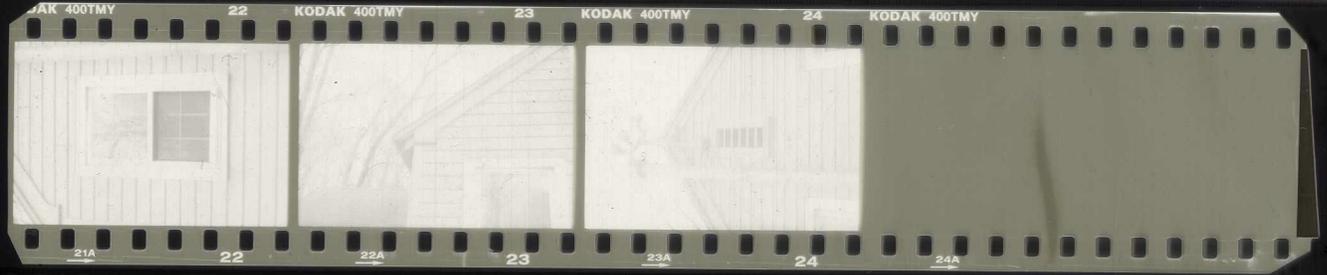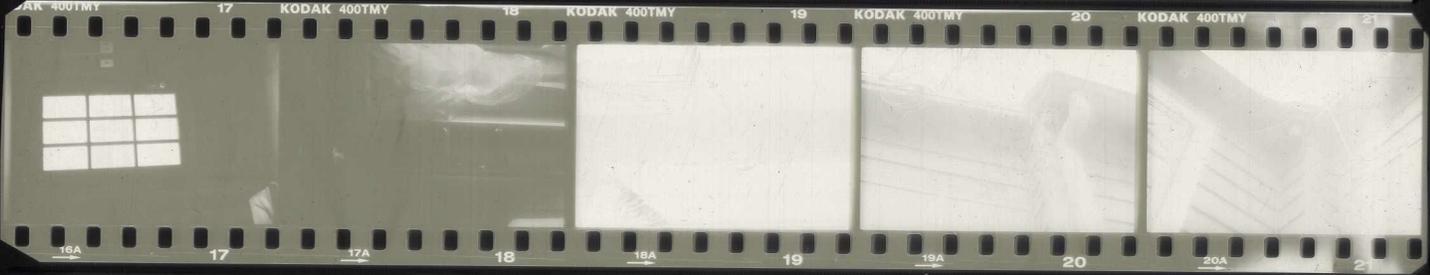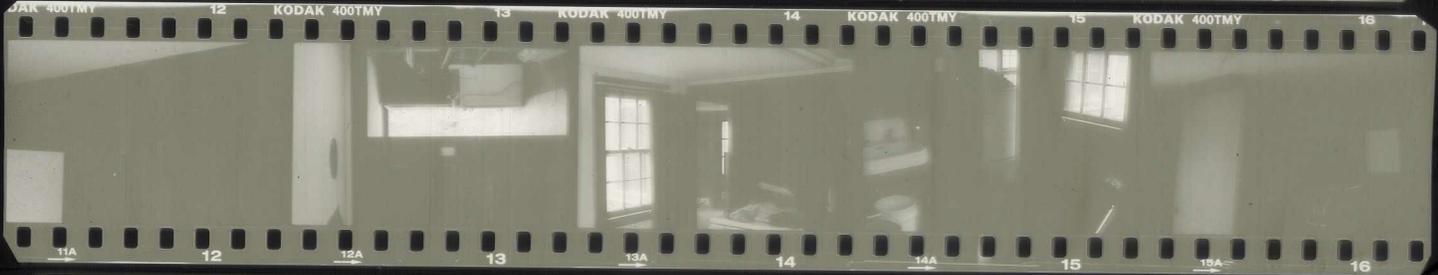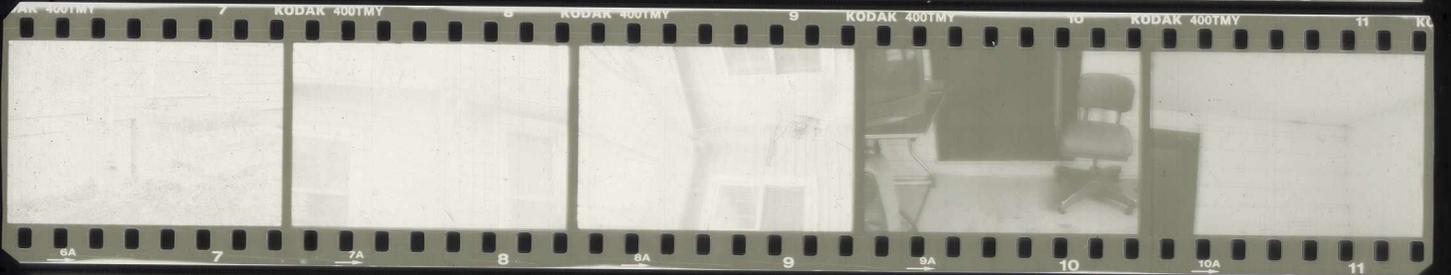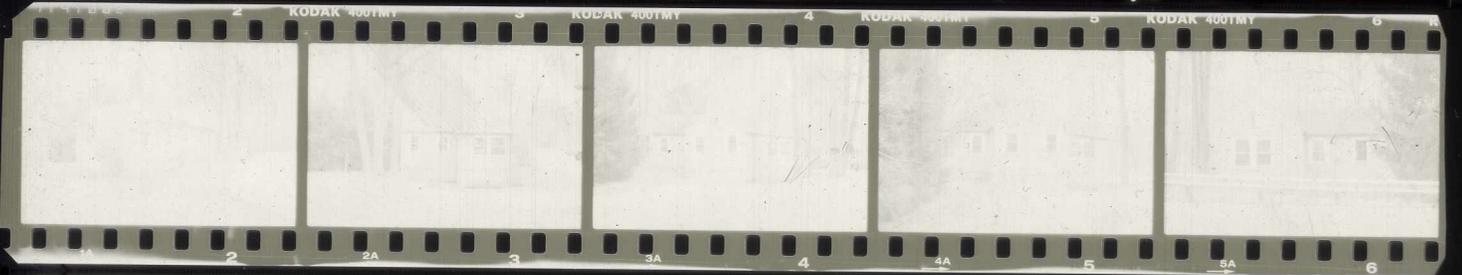

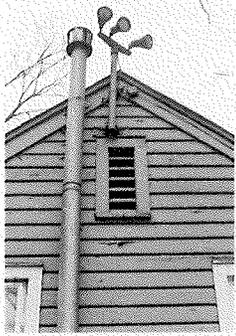


FL020001.jpg



FL020002.jpg



FL020003.jpg

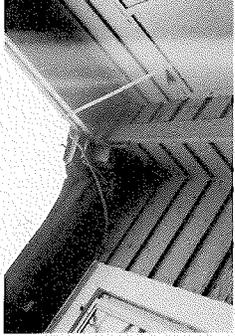

FL020004.jpg




FL020005.jpg




FL020006.jpg




FL020007.jpg

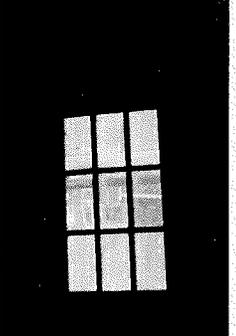

FL020008.jpg

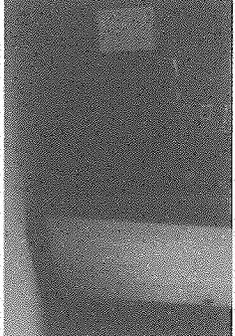

FL020009.jpg

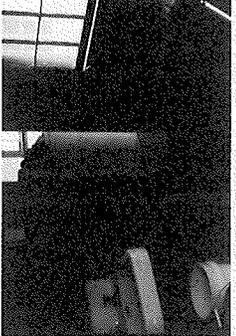


FL020010.jpg



FL020011.jpg




FL020012.jpg

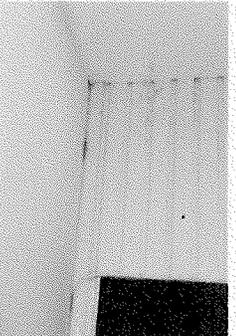

FL020013.jpg




FL020014.jpg

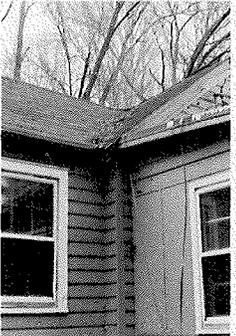

FL020015.jpg




FL020016.jpg

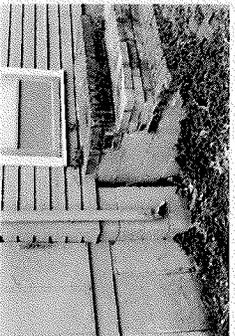


FL020017.jpg




FL020018.jpg

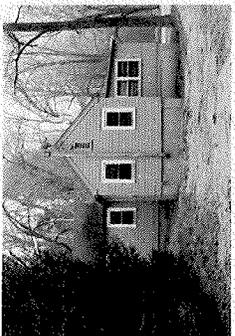


FL020019.jpg

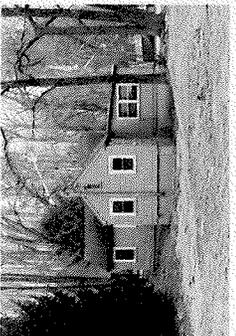

FL020020.jpg

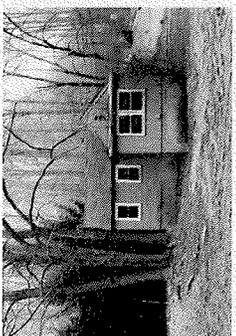

FL020021.jpg

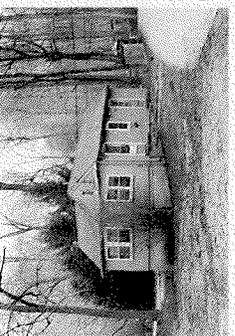

FL020022.jpg

GATEHOUSE
CRS # N-14422.07
Digital Photo Log

- Plate 01: View looking northwest at south elevation.
- Plate 02: View looking northeast at west elevation.
- Plate 03: View looking southeast at north elevation.
- Plate 04: View looking south at east elevation.
- Plate 05: View of foundation at the junction of the main structure and the shed addition.
- Plate 06: View of the eaves at the junction of the main structure and the shed addition.
- Plate 07: View of the foundation at the junction of the main structure, the two bay, and shed additions.
- Plate 08: View of the eaves at the junction of the main structure, the two bay, and the shed additions.
- Plate 09: Detail of the eaves at the junction of the main structure, the two bay, and the shed additions.
- Plate 10: View of the foundation at the junction of the main structure and the two bay addition.
- Plate 11: Detail of the eaves at the junction of the main structure and the two bay addition.
- Plate 12: Profile of the west steps.
- Plate 13: Profile of the east steps.
- Plate 14: Detail of the cornice return.
- Plate 15: Detail of window.
- Plate 16: Detail of double windows of shed addition.
- Plate 17: View looking north within Room 1.
- Plate 18: View looking west within Room 1.
- Plate 19: View looking east within Room 1.
- Plate 20: View looking northwest within Room 2.
- Plate 21: View looking southeast within Room 2.
- Plate 22: View looking east within Room 2.
- Plate 23: View looking northeast within Room 3.
- Plate 24: View looking southeast within Room 3.
- Plate 25: Detail of sink within Room 3.
- Plate 26: Detail of closet/shelf within Room 3.
- Plate 27: Detail of the difference in floor height between Room 4 and Room 2.
- Plate 28: Detail of slope of interior ceiling in Room 4.
- Plate 29: Detail of junction of main building and shed addition (interior).
- Plate 30: View looking northeast toward Room 5 from Room 2.
- Plate 31: View looking northwest within Room 5.
- Plate 32: View looking northeast within Room 5.
- Plate 33: View looking northeast from Room 2 toward Room 6.
- Plate 34: View looking northeast from Room 2 toward Room 6.
- Plate 35: View looking southeast into Room 7 from Room 1.


GATEHOUSE

CRS # N-14422.07

Digital Photo Log

Continued

- Plate 36: View looking southeast toward Room 7 from Room 1.
Plate 37: Detail of rafters at junction of Room 1, Room 3, and Room 7.
Plate 38: Detail of hot water heater above Room 5, Room 6, and Room 7.
Plate 39: Detail of heating unit in Room 8.

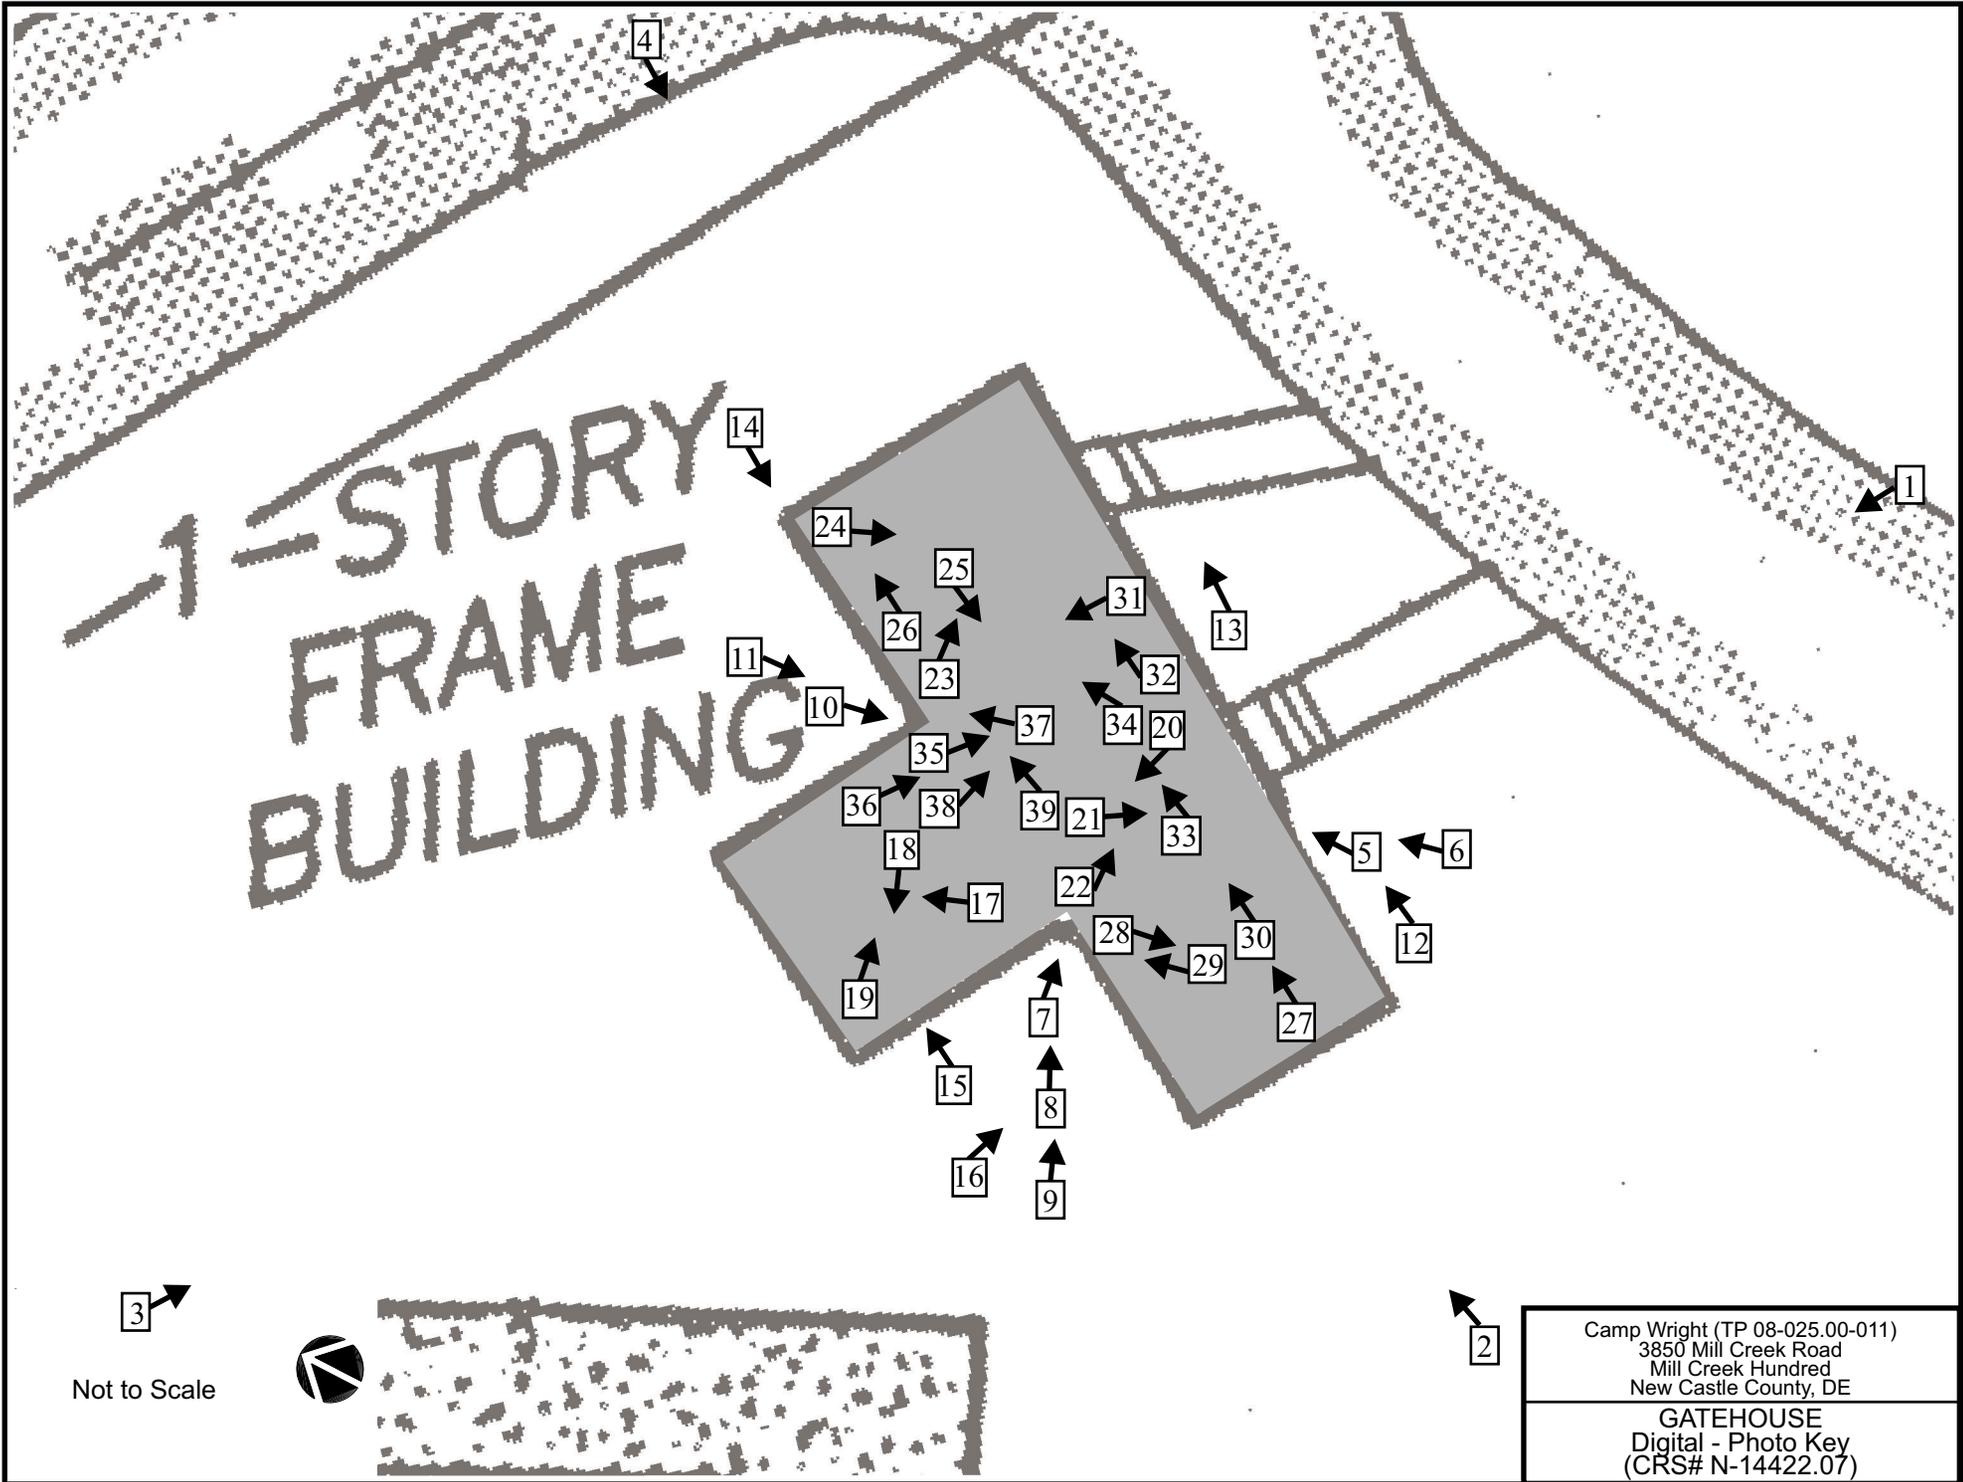

3 ↗
Not to Scale

2 ↗

Camp Wright (TP 08-025.00-011)
3850 Mill Creek Road
Mill Creek Hundred
New Castle County, DE

GATEHOUSE
Digital - Photo Key
(CRS# N-14422.07)



Plate 01: View looking northwest at south elevation.



Plate 02: View looking northeast at west elevation.



Plate 03: View looking southeast at north elevation.



Plate 04: View looking southwest at east elevation.



Plate 05: View of foundation at the junction of the main structure and the shed addition.



Plate 06: View of the eaves at the junction of the main structure and the shed addition.



Plate 07: View of the foundation at the junction of the main structure, the two bay, and shed additions.



Plate 08: View of the eaves at the junction of the main structure, the two bay, and the shed additions.



Plate 09: Detail of the eaves at the junction of the main structure, the two bay, and the shed additions.



Plate 10: View of the foundation at the junction of the main structure and the two bay addition.

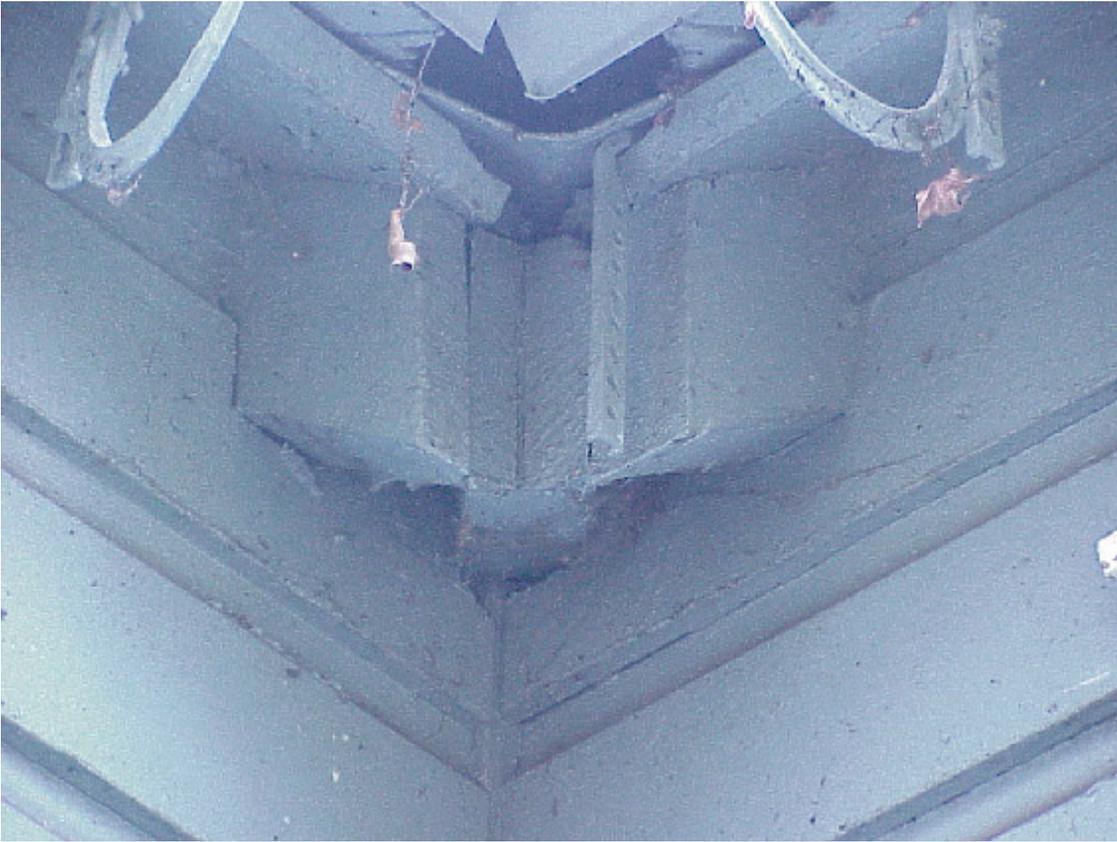


Plate 11: Detail of the eaves at the junction of the main structure and the two bay addition.



Plate 12: Profile of the west steps.



Plate 13: Profile of the east steps.



Plate 14: Detail of the cornice return.



Plate 15: Detail of window.



Plate 16: Detail of double windows of shed addition.



Plate 17: View looking north within Room 1.



Plate 18: View looking west within Room 1.



Plate 19: View looking east within Room 1.



Plate 20: View looking northwest within Room 2.



Plate 21: View looking southeast within Room 2.



Plate 22: View looking east within Room 2.



Plate 23: View looking northeast within Room 3.



Plate 24: View looking southeast within Room 3.



Plate 25: Detail of sink within Room 3.



Plate 26: Detail of closet/shelf within Room 3.



Plate 27: Detail of the difference in floor height between Room 4 and Room 2.



Plate 28: Detail of slope of interior ceiling in Room 4.



Plate 29: Detail of junction of main building and shed addition (interior).



Plate 30: View looking northeast toward Room 5 from Room 2.



Plate 31: View looking northwest within Room 5.



Plate 32: View looking northeast within Room 5.



Plate 33: View looking northeast from Room 2 toward Room 6.



Plate 34: View looking northeast from Room 2 toward Room 6.



Plate 35: View looking southeast into Room 7 from Room 1.



Plate 36: View looking southeast toward Room 7 from Room 1.



Plate 37: Detail of rafters at junction of Room 1, Room 3, and Room 7.




Plate 38: Detail of hot water heater above Room 5, Room 6, and Room 7.



Plate 39: Detail of heating unit in Room 8.

Notes: Blue grey w/ white trim
 Not to Scale
 All measurements in inches

Gatehouse
 South Elevation

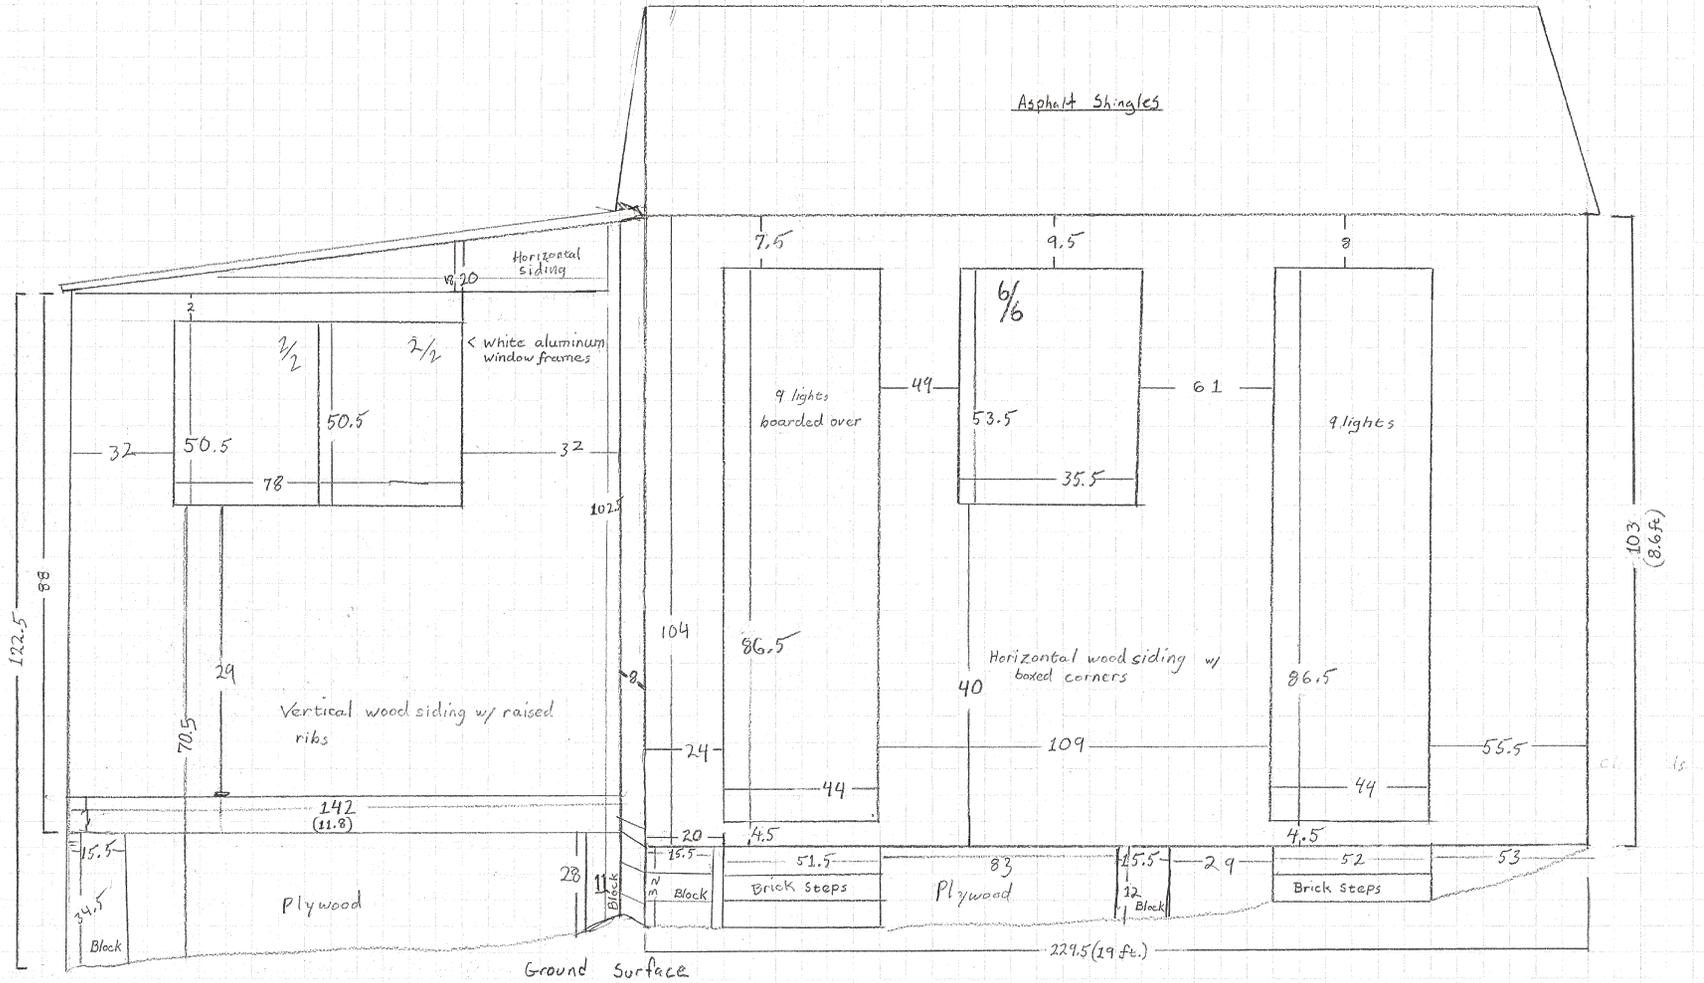

Not to Scale


Camp Wright (TP 08-025.00-011)
 3850 Mill Creek Road
 Mill Creek Hundred
 New Castle County, DE

Gatehouse
 Facade (south) - Elevation
 (CRS# N-14422.07)

North Elevations

Camp Wright
Gate House

Painted Blue grey w/ white trim
Not to Scale
All measurements in inches

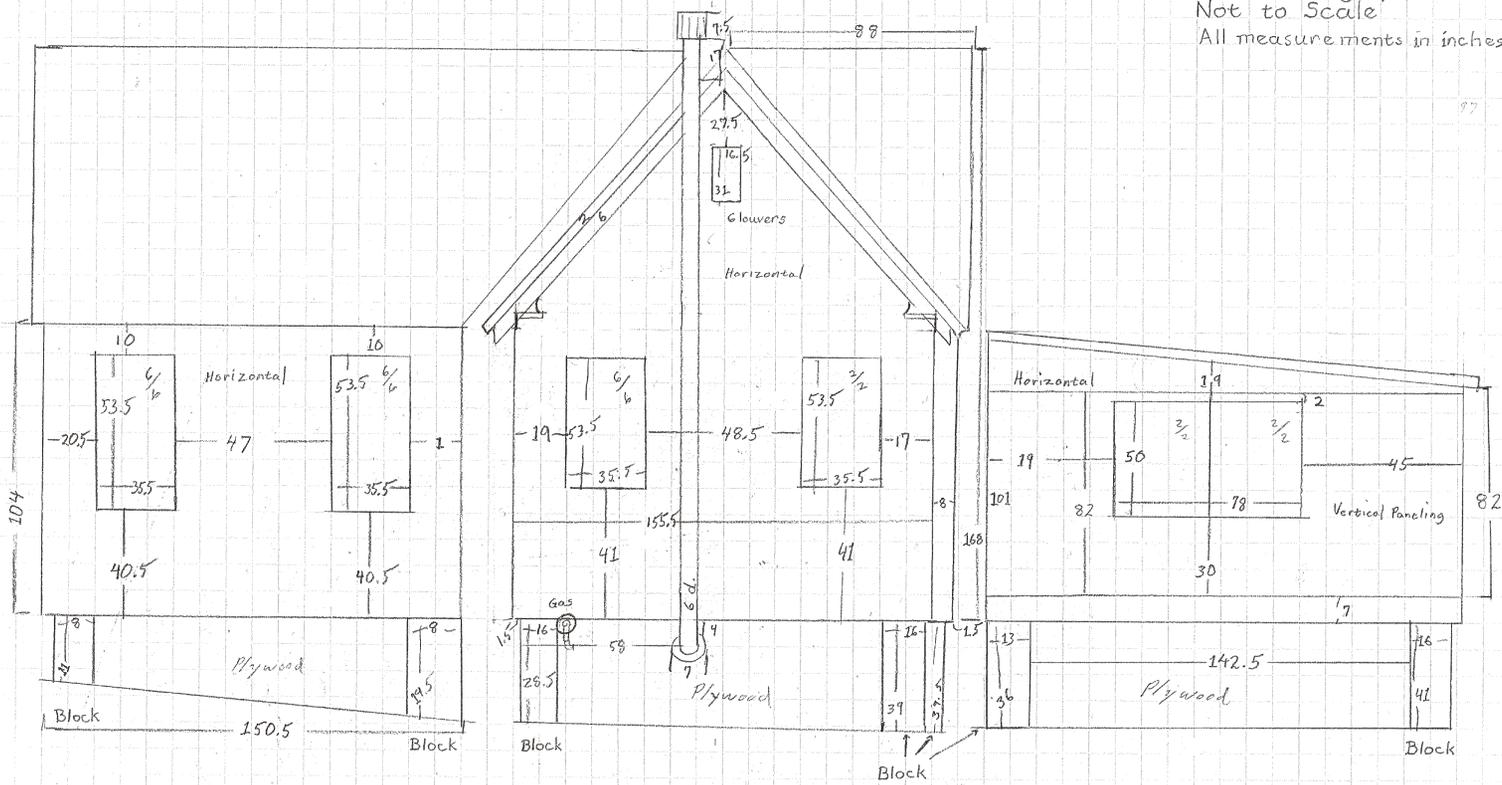


Not to Scale

<p>Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE</p>
<p>Gatehouse Rear (north) - Elevation (CRS# N-14422.07)</p>

Camp Wright:
Gate House


East Elevation

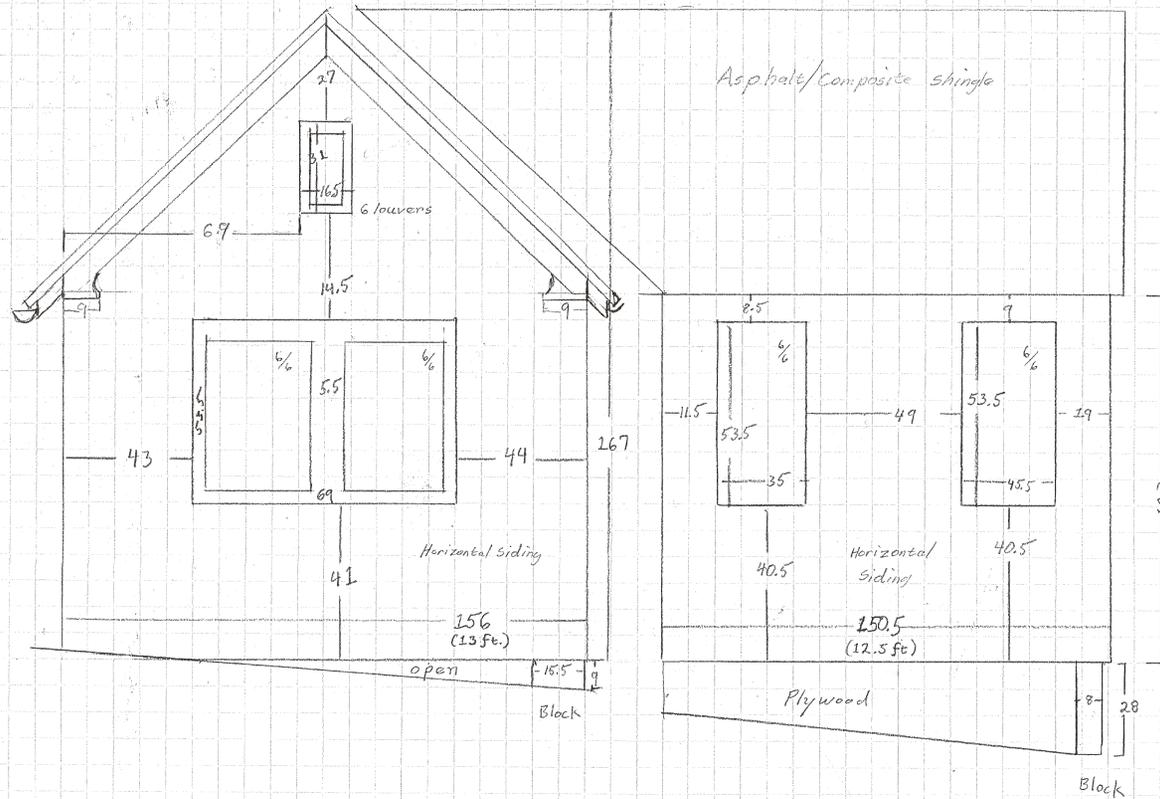

Notes: Blue-grey w/ white Trim
and doors
Not to scale
All measurements in
inches

Not to Scale

Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE
Gatehouse Side (east) - Elevation (CRS# N-14422.07)

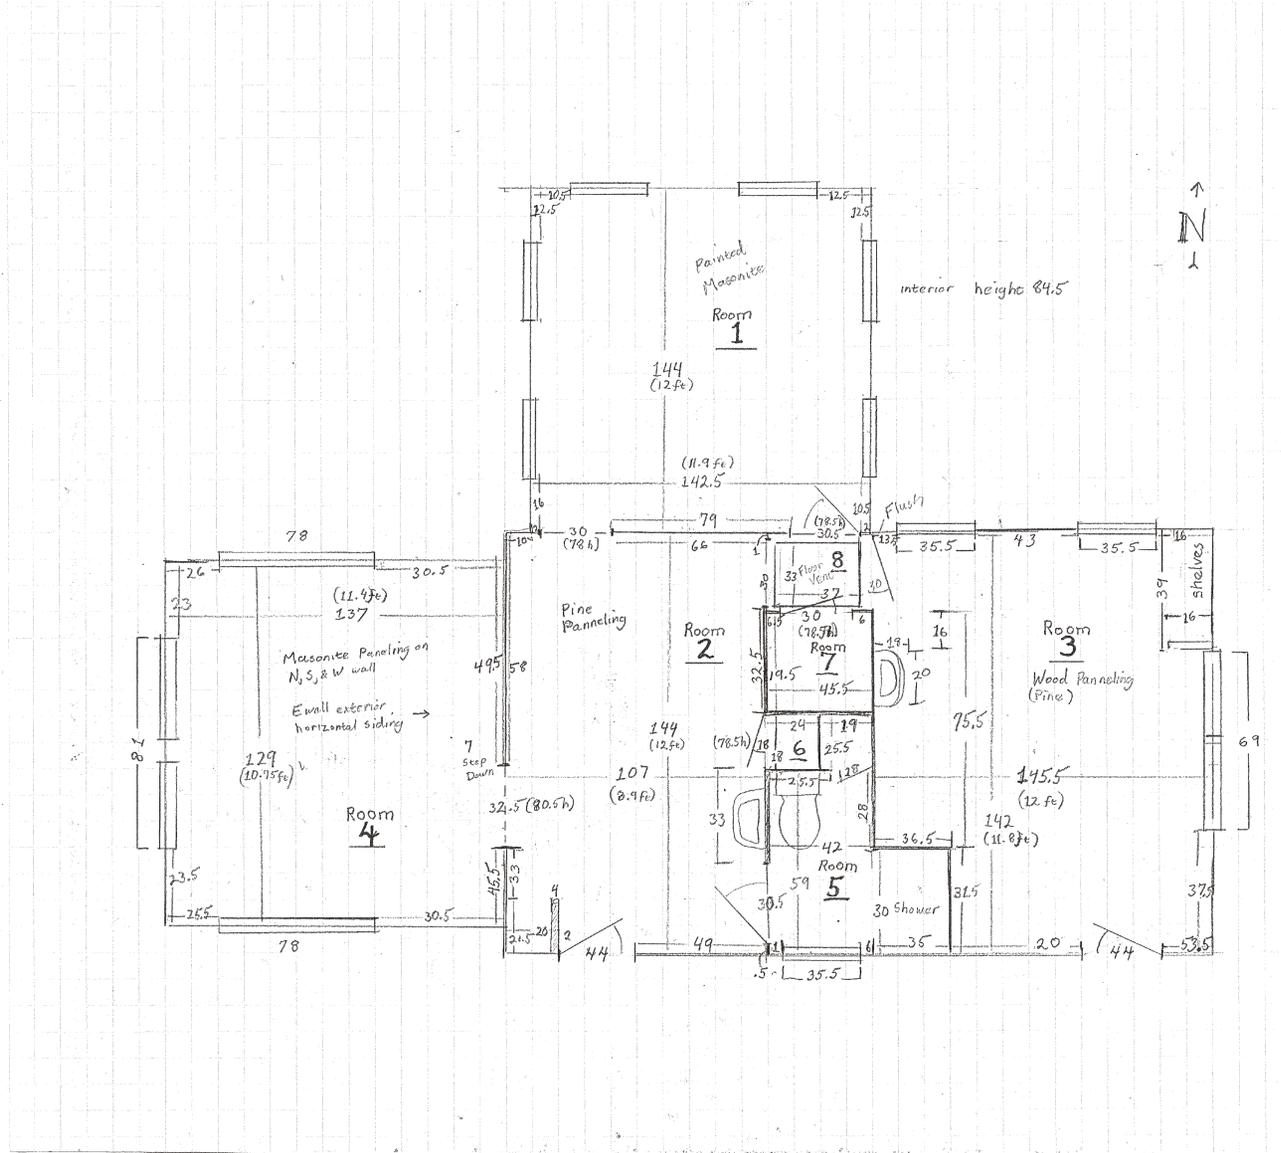

Camp Wright:
Gate House
Floor Plan
Not to scale
All measurements
in inches

Not to Scale


Camp Wright (TP 08-025.00-011)
3850 Mill Creek Road
Mill Creek Hundred
New Castle County, DE
Gatehouse
Floor Plan
(CRS# N-14422.07)

Notes: Brick on Block.
Middle stair made of fire brick marked "WOODLAND". (3 courses)
Not to scale
All measurements in inches
West Stair


Camp Wright:
Gate House
Stair Detail

South Elevation

East Elevation

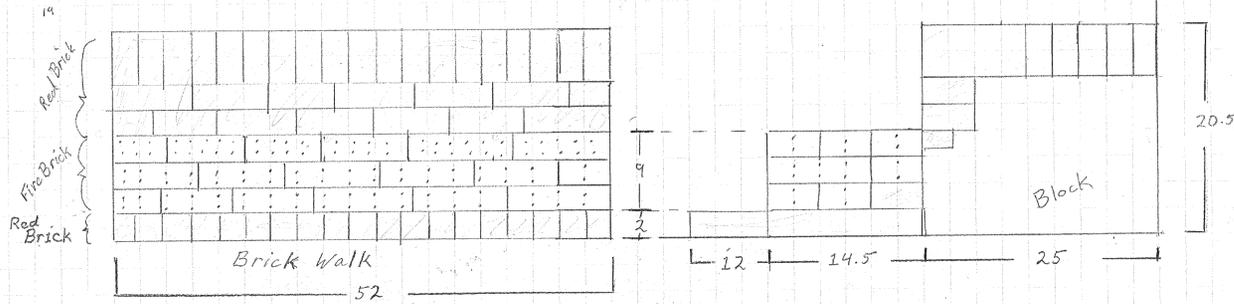


East Stair

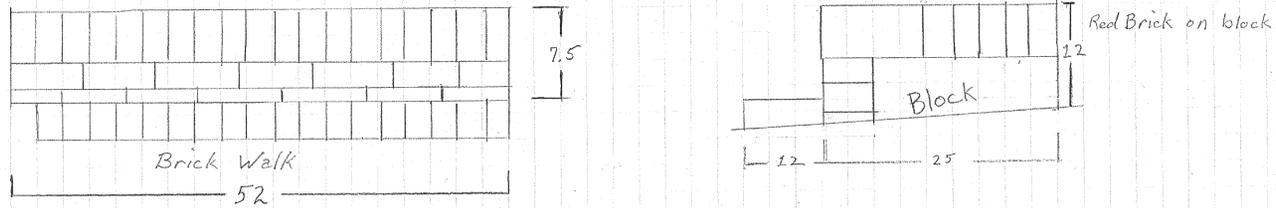

Not to Scale

Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE
Gatehouse Details - Stairs (CRS# N-14422.07)

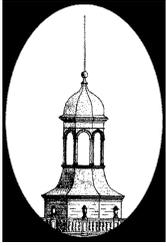

DELAWARE STATE HISTORIC PRESERVATION OFFICE
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM

CRS # N-14422.07

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road

2. FUNCTION(S): historic gatehouse current not in use

3. YEAR BUILT: 1925 CIRCA?: ARCHITECT/BUILDER: unknown

4. STYLE OR FLOOR PLAN: T shaped plan

5. INTEGRITY: original site moved
if moved, from where other location's CRS # year

<u>list major alterations and additions with years (if known)</u>	<u>year</u>
a. Raised on piers to prevent flood damage	1993
b.	

6. CURRENT CONDITION: excellent good fair poor

7. DESCRIPTION: (Describe the resource as completely as possible. Use N/A for not applicable; leave no blanks.)

- a. Overall shape: T shaped Stories: one
Additions: shed roof addition along west elevation
- b. Structural system (if known): frame
- c. Foundation: materials: concrete block
basement: full partial not visible no basement
- d. Exterior walls (original if visible & any subsequent coverings): wood board siding
- e. Roof: shape: side gable
materials: asphalt shingles
cornice: box cornice
dormers: N/A
chimney: location(s): N/A

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: Direction: south
 - 1) Bays three
 - 2) Windows
 - fenestration one centrally located window
 - type six-over-six with wooden sash
 - trim wood
 - shutters N/A

Facade (cont'd)

3) **Door(s)** two
location located at the east and west ends of the façade
type one (1) wood paneled door with nine light window, one (1) wood panel with glazing
trim wood surround

4) **Porch(es)** N/A

b. **Side: Direction:** east

1) **Bays** one

2) **Windows**

fenestration two (2) windows on first floor, one (1) attic level opening

type two (2) six-over-six double hung with wood sash, one (1) louvered attic level opening

trim wood

shutters N/A

3) **Door(s)** N/A

location N/A

type N/A

trim N/A

4) **Porch(es)** N/A

c. **Side: Direction:** west

1) **Bays** one

2) **Windows**

fenestration two (2) paired windows

type two (2) one-over-one modern windows

trim wood

shutters N/A

3) **Door(s)** N/A

location N/A

type N/A

trim N/A

4) **Porch(es)** N/A

d. **Rear: Direction:** north

1) **Bays** not accessible

2) **Windows**

fenestration not accessible

type not accessible

trim not accessible

shutters not accessible

3) **Door(s)** not accessible

location not accessible

type not accessible

trim not accessible

4) **Porch(es)** N/A

9. **INTERIOR:** The Gatehouse has been divided into four separate rooms. The interior has wood board flooring and artificial wood wall covering.

10. **LANDSCAPING:** The Gatehouse, along with twelve other camp related resources, is located in a wooded setting along the Mill Creek. Mill Creek Road runs along the eastern boundary of the property. Modern residential development is found to the north, east, and west. Limestone Hill Park is located to the south. The gatehouse is set at the entrance to Camp Wright, at the intersection of Graves and Mill Creek Roads

11. **OTHER COMMENTS:** The Gatehouse appears to have been constructed ca. 1925.