

Table 2. Newly Surveyed Pre-1952 Architectural Properties Located within the Study Area

Name (if known)	Address	Property #	Photo #	Description	Integrity	Comments
	Intersection of Brenford Road and Route 15	1	1-3	Enlarged, one-and-one-half story, wood-framed bungalow with deep shed-roofed, wraparound porch and front gabled dormer. Fenestration consists of one-over-one, double hung, sash windows. Sheathed in vinyl siding. Outbuildings include contemporary and older sheds and an older, sheet metal-clad barn. House. c. 1940.	Additions and alterations have compromised architectural integrity.	
	West side, Commerce Street, three houses south of New Street, Cheswold	2	4	Two-story, three bay, stuccoed, wood-framed house with single story, gabled rear ell. Full-width, shed, front porch enclosed with latticework. Fenestration consists primarily of one-over-one, double hung, sash windows. Central chimney main block; second chimney rear ell. Side shed porch off rear ell. Late 19 th century.	Windows appear to be replacements. Possesses architectural integrity.	
	117 Commerce Street, Cheswold	3	5	Two-story, three bay, side-gabled, wood-framed house with central front cross gable, two-story, gabled rear ell and one story rear addition. Full-width shed-roofed porch. Fenestration consists of one-over-one, double hung, sash windows. c. 1880.	New porch, siding, and windows have compromised architectural integrity.	
	House, west side of DuPont Highway	4	6	House apparently serves as office for adjacent motel. Wood-framed, two-story, three bay, side-gabled dwelling with central gabled front porch. Fenestration consists of one-over-one, double hung, sash windows. Sheathed in aluminum siding. Early 20 th century.	Despite replacement siding, house appears to retain architectural integrity.	
	5132 DuPont Highway	5	7	Two-story, side-gabled, wood-framed house with south side shed addition and single story rear ell. Hipped stoop contains front entry. Fenestration consists of one-over-one, double hung, sash windows. Sheathed in aluminum siding. Early 20 th century.	Additions and alterations have compromised its architectural integrity.	

Table 2. Continued.

Name (if known)	Address	Property #	Photo #	Description	Integrity	Comments
	5272 DuPont Highway	6	8	One-story, shallow gabled roof, wood-framed cottage with shed front vestibule and rear shed addition. Fenestration consists of one-over-one, double hung, sash windows. Sheathed in cement asbestos siding. c. 1940.	House retains architectural integrity.	
Harmic's Antique Gallery	5409 DuPont Highway	7	9	Gabled, single-story, concrete block commercial building with stepped parapet brick façade, central two-leaf glass doors, and display windows. Side walls defined by concrete block pilasters. Shed-roofed loading dock projects from north wall. c. 1940.	Commercial building retains architectural integrity.	
Gari's Greenhouses	West side, DuPont Highway	8	10	Building consists of single-story, gabled front, wood-framed block with wraparound porch. Rear wall adjoins taller, gabled former barn. Property also includes greenhouses and plant racks. c. 1940.	The main block and rear ell retains architectural integrity.	
	East side, DuPont Highway	9	11	Gabled roof, brick and concrete block garage partially sheathed in metal sheets. Fenestration includes one-over-one, double hung, sash windows. Roof sheathed in corrugated metal. c. 1940.	Alterations have compromised architectural integrity.	
	5539 DuPont Highway (Route 13)	10	12	Two-story, gabled front, two-bay, wood-framed house with hipped enclosed front porch. Primarily fenestrated with one-over-one, double hung, sash windows. Sheathed in cement-asbestos siding. Corbeled chimney rises from roof ridge. Early 20 th century.	Retains architectural integrity.	

Table 2. Continued.

Name (if known)	Address	Property #	Photo #	Description	Integrity	Comments
	61 Fulton Street, Cheswold	11	13	Small, two-story, two-bay, gabled roof, wood-framed house with one-story, shed-roofed front porch, two-story gabled rear ell, and one-story, shed-roofed rear addition. Front porch is enclosed. Fenestration consists predominantly of one-over-one, double hung, sash windows. Main block is sheathed in asphalt siding in brick pattern. c. 1900; later additions.	Additions and alterations have compromised its architectural integrity.	
	77 Fulton Street, Cheswold	12	14	The original block of this building is similar in form to the original block of 61 Fulton Street. This block is two stories in height and two bays wide. To this block has been added a hipped roof, enclosed front porch, a two-story, shed, side addition, and several other additions to the rear of the house. Fenestration consists primarily of one-over-one, double hung, sash windows, and the building is sheathed largely in vinyl siding. c. 1900; mid-20 th century additions.	Additions and alterations have compromised its architectural integrity.	
	143 Fulton Street, Cheswold	13	15	One-story, three bay, jerkinhead gable front, wood-framed house with gabled side addition. A gabled stoop projects from the center of the east façade. Fenestration consists largely of one-over-one, double hung, sash windows. The main block is sheathed in aluminum siding. c. 1925.	Additions and alterations have compromised its architectural integrity.	
	4578 Kenton Road	14	16	One-story, hipped roof, wood-framed, dwelling with front shed-roofed addition. Fenestration consists of one-over-one and two-over-two, double hung, sash windows. House is sheathed in cement-asbestos siding. c. 1940.	Additions and alterations have compromised its architectural integrity.	

Table 2. Continued.

Name (if known)	Address	Property #	Photo #	Description	Integrity	Comments
	4721 Kenton Road	15	17	One-story, oblong, gabled roof, wood-framed house with end cross gable and exposed rafter tails. Fenestration includes two-over-two, double hung sashes, a picture window, and top-hinged windows. c. 1930.	House retains architectural integrity.	
	145 Lynnburly Woods Road	16	18	Two-story, two-bay, gabled front, wood-framed house with hipped roof porch across façade. Fenestration consists of one-over-one, double hung, replacement windows. House has a cast stone foundation and is sheathed in modern siding. c. 1900. Associated agricultural outbuildings.	Alterations have compromised architectural integrity.	
	434 Lynnburly Woods Road	17	19-20	Two-story, wood-framed, gabled roof house with partially enclosed wraparound porch and rear additions. Fenestration consists primarily of one-over-one, double hung replacement windows. Early 20 th century.	Additions and alterations have compromised its architectural integrity.	
	165 Messina Hill Road	18	21	Three-bay, one-and-one-half story, Cape Cod house. Central entry flanked by six-over-six window and group of three, one-over-one windows. Gabled front dormers. Sheathed in modern siding. c. 1950.	House retains architectural integrity.	
	338 Messina Hill Road	19	22	Three-bay, wood-framed, side-gabled cottage with central gabled front stoop. Fenestration consists of two-over-two, double hung, sash windows and multi-light picture window. Sheathed in aluminum siding. Associated garage. c. 1945.	House retains architectural integrity.	
Bethel Cemetery	Intersection of Messina Hill Road and Lynnburly Woods Road	20	23-24	Cemetery containing clusters of grave markers, generally granite slabs with smaller numbers of obelisks, contains burials from the mid-nineteenth century to the present.	Retains integrity but does not appear to meet significance criteria for National Register eligibility.	

Table 2. Continued.

Name (if known)	Address	Property #	Photo #	Description	Integrity	Comments
Percheron Farm	Percheron Road	21	25-26	Two-story, wood-framed, gabled front, two-bay house with hipped roof, single story side addition and hipped front porch.. Concrete foundation, one-over-one, double hung, sash windows. House is sheathed in vinyl siding. Early 20 th century. Outbuildings include several barns and sheds.	Additions and alterations have compromised its architectural integrity.	Farm is owned by Amish family.
Immanuel Union UMC Church	765 Route 42	22	27	Brick-faced, gabled front church with side, gabled and shed-roofed wing. Fenestrated with double hung windows with triangular transoms. The north sanctuary wall is sheathed in modern siding as is the west building wall. c. 1920.	Despite some alterations, church retains architectural integrity.	
	2460 Route 42	23	28	Five-bay, center hall, stuccoed, gabled roof house. Central front door is surmounted by three-light transom. Fenestration includes nine-over six, first floor windows and six-over-nine second floor windows. Interior end chimneys with corbeled caps. c. 1800.	House retains integrity.	
	2747 Route 42	24	29	Two-story, side-gabled, wood-framed house with major, character-defining additions. Wraparound, hipped roof, enclosed porch, gabled rear ell behind porch. Fenestration consists of one-over-one, double hung, sash windows and single-light casement windows. House sheathed in vinyl siding. Early 20 th century, late 20 th century alterations.	Additions and alterations have compromised architectural integrity.	

Table 2. Continued.

Name (if known)	Address	Property #	Photo #	Description	Integrity	Comments
	2879 Route 42	25	30	Two-story, wood-framed, elongated T-plan house with gable end facing road. Main entry placed in east gable, sheltered by hipped porch with wrought iron posts. Enclosed shed-roof porches flank east gable. Fenestrated with variety of window types including newer six-over six and older two-over-two, double hung sashes. Sheathed in aluminum siding. Late 19 th century; 20 th century alterations.	Additions and alterations have compromised its architectural integrity.	
	Opposite 3546 Route 42	26	31	Modest, single story, wood-framed, gabled roof cottage with shed rear ell. Door placed in east wall of rear ell. Fenestration consists of one-over-one, double hung, sash windows. Sheathed in clapboards, central chimney. c. 1930.	House retains architectural integrity.	
	3923 Route 42	27	32	One-and-one-half story, three-bay, wood-framed, gabled roof house with shed rear ell. Entry centered on south façade. Windows are largely one-over-one, double hung sashes. Shed dormer projects from south roof slope. Sheathed in aluminum siding. c. 1930.	Alterations have compromised architectural integrity.	
	North side, Route 42	28	33	Gable over hip, one-story, wood-framed cottage. Front door sheltered by shed hood. Fenestration consists of two-over-two, double hung sashes and a multi-light picture window. Sheathed in aluminum siding. c. 1920s.	Alterations have compromised architectural integrity.	
	4153 Route 42	29	34	One-story, wood-framed, gabled front cottage with hipped roof, enclosed front porch. Fenestration consists of six-over-one and one-over-one, double hung sashes. Sheathed in modern siding materials. Brick chimney rises from west roof slope. c. 1920s.	House retains architectural integrity.	

Table 2. Continued.

Name (if known)	Address	Property #	Photo #	Description	Integrity	Comments
	4201 Route 42	30	35	Two-and-one-half story, pyramidal hipped roof, American four square with full-width, enclosed, hipped roof front porch. Fenestration consists primarily of one-over-one and two-over-two, double hung, sash windows. Hipped dormers. Concrete foundation, sheathed in aluminum siding. c. 1920s.	House retains architectural integrity.	
	5188 Route 42	31	36-37	Three-bay, two-story, side-gabled, wood-framed house with two-story, gabled rear ell, and enclosed, single-story, shed roofed porch off ell. Partial width front porch. Fenestration consists primarily of one-over-one, double hung, sash windows. Sheathed in cement-asbestos shingles. c. 1900.	House retains architectural integrity.	
	3593 Salisbury Road	32	38	Two-story, three bay, side-gabled, wood-framed house with gabled, single-story rear addition. Hipped, screened porch with brick plinths and battered posts extends across the façade. Fenestration consists of two-over-two, double hung, sash windows. Sheathed in modern siding materials. Early 20 th century.	Additions and alterations have compromised its architectural integrity.	
	3699 Salisbury Road	33	39	Two-story, three bay, side-gabled, wood-framed house with rear addition. A hipped roof enclosed porch extends the width of the façade. Fenestration includes six-over-one and one-over-one, double hung, sash windows. Sheathed in peeling asphalt sheets printed to resemble shingles. c. 1900.	Additions and alterations have compromised its architectural integrity.	

Table 2. Continued.

Name (if known)	Address	Property #	Photo #	Description	Integrity	Comments
	n. of 3699 Salisbury Road	34	40	The rear portion of this house appears to have been built as an outbuilding for the adjacent house at #3699. Altered with replacement of windows, it is sheathed in asphalt siding and has several original six-over-six, double hung, sash windows. A modified, one-and-one-half story, Cape Cod dwelling has been appended to the east side of this block. This three bay block features a central gabled stoop and paired front dormers. Rear block: early 20 th century; front block: mid-20 th century.	Additions and alterations have compromised its architectural integrity.	
	3701 Salisbury Road	35	41	Two-story, gabled roof, L-plan, wood-framed dwelling with wraparound porch with box columns and south shed addition. Fenestration consists primarily of one-over-one, double hung, sash windows. Two corbeled interior chimneys rise from the roof ridge. Sheathed in cement-asbestos shingles. c. 1910.	House retains architectural integrity.	
	3791 Salisbury Road	36	42	Two-story, three-bay, rectangular, wood-framed house with gabled rear ell and shed, side, rear addition. Hipped, screened porch extends across façade. Fenestration consists primarily of one-over-one, double hung, sash windows. Early 20 th century.	Alterations and additions have compromised its architectural integrity	
	3815 Salisbury Road	37	43	Two-story, side-gabled, three bay house with two-story gabled rear ell. Façade has a gabled stoop in the north bay and a south bay window. A hipped roof addition is appending to its south wall. Sheathed in asphalt sheets scored to resemble stone. Early 20 th century.	Alterations and additions have compromised its architectural integrity.	

Table 2. Continued.

Name (if known)	Address	Property #	Photo #	Description	Integrity	Comments
	3865 Salisbury Road	38	44	Altered, two-story, Builders Queen Anne house with cut away front gable, hipped corner stoop and cross gables. Rear and south additions. Fenestration consists primarily of modern, one-over-one, double hung, sash windows. Sheathed in vinyl siding. c. 1900.	Due to alterations and additions, lacks architectural integrity.	
	South side, Simms Woods Road	39	45	Probably built as an outbuilding for the house to its west, it now apparently functions as an independent dwelling. Concrete block construction, rainbow roof with gabled dormers. Fenestration consists of one-over-one, double hung, sash windows. Shed vestibule attached to east wall. c. 1940.	Alterations have compromised its architectural integrity.	
	90 Simms Woods Road	40	46	Wood-framed, single-story, jerkinhead gabled front cottage with cross gables. Main entry placed near center of west façade and sheltered by off-center, gabled front stoop. Fenestration consists of one-over-one, double hung, sash windows. c. 1930.	Despite modern siding, the house appears to retain architectural integrity.	

Table 2 Photographic Captions

- Photo 1. House, intersection of Brenford Road and Route 15. East façade toward northwest.
- Photo 2. Recently constructed outbuildings, intersection of Brenford Road and Route 15. South elevation toward northwest.
- Photo 3. Older outbuildings, intersection of Brenford Road and Route 15. South and east elevations toward northwest.
- Photo 4. House, southwest side of Commerce Street, Cheswold. Northeast façade and northwest elevation toward southwest.
- Photo 5. House, 117 Commerce Street. Northeast façade and northwest elevation toward southwest.
- Photo 6. House, west side of DuPont Highway. East façade and north elevation toward southwest.
- Photo 7. House, 5132 DuPont Highway. West façade and north elevation toward east.
- Photo 8. House, 5272 DuPont Highway. West façade and north elevation toward southeast.
- Photo 9. Harmic's Antique Gallery. 5409 DuPont Highway. East façade and south elevation toward northwest.
- Photo 10. Gari's Greenhouses. West side of DuPont Highway. General view toward southwest.
- Photo 11. Garage, east side of DuPont Highway. West and south elevations toward northeast.
- Photo 12. House, 5539 DuPont Highway. East and south elevations toward northwest.
- Photo 13. House, 61 Fulton Street. Northeast façade and southeast elevation toward northwest.
- Photo 14. House, 77 Fulton Street. Northeast façade and southeast elevation toward northwest.
- Photo 15. House, 143 Fulton Street. Northeast façade and southeast elevation toward southwest.
- Photo 16. House, 4578 Kenton Road. Southwest and northwest elevations toward southeast.
- Photo 17. House, 4721 Kenton Road. Northeast façade and southeast elevation toward northwest.
- Photo 18. House, 145 Lynnbury Woods Road. Southeast façade and southwest elevation toward northeast.
- Photo 19. House, 434 Lynnbury Woods Road. Northwest and southwest elevations toward southeast.

- Photo 20. House, 434 Lynnbury Woods Road. Northwest and northeast elevations toward southwest.
- Photo 21. House, 165 Messina Hill Road. Northeast façade toward southwest.
- Photo 22. House, 338 Messina Hill Road. Southwest façade and southeast elevation toward northeast.
- Photo 23. General view toward southwest showing Bethel Cemetery.
- Photo 24. General view toward southwest showing Bethel Cemetery.
- Photo 25. Northeast façade and northwest elevation of house, Percheron Farm. View toward southeast.
- Photo 26. Barns and other outbuildings, Percheron Farm. General view toward southwest
- Photo 27. Immanuel Union United Methodist Church. Northwest façade and southwest elevation toward southeast.
- Photo 28. House, 2460 Route 42. North façade toward south.
- Photo 29. House, 2747 Route 42. South and west elevations toward northeast.
- Photo 30. House, 2879 Route 42. East façade and south elevation toward northwest.
- Photo 31. House, north side, Route 42. Southeast façade and northeast elevation toward northwest.
- Photo 32. House, 3923 Route 42. Southeast façade and southwest elevation toward northeast.
- Photo 33. House, north side, Route 42. Southeast façade and southwest elevation toward northeast.
- Photo 34. House, 4153 Route 42. Southeast and southwest elevations toward northeast.
- Photo 35. House, 4201 Route 42. Southeast façade and southwest elevation toward north.
- Photo 36. House, 5188 Route 42. Northwest façade and southwest elevation toward southeast.
- Photo 37. House, 5188 Route 42. Northeast elevation and northwest façade toward southwest.
- Photo 38. House, 3593 Salisbury Road. Northeast façade and northwest elevation toward southwest.
- Photo 39. House, 3699 Salisbury Road. Northeast façade and southeast elevation toward west.
- Photo 40. House, north of 3699 Salisbury Road. Northeast façade and southeast elevation toward northwest.

- Photo 41. House, 3701 Salisbury Road. Northeast façade and southeast elevation toward southwest.
- Photo 42. House, 3791 Salisbury Road. Northeast façade and southeast elevation toward northwest.
- Photo 43. House, 3815 Salisbury Road. Northeast façade and southeast elevation toward southwest.
- Photo 44. House, 3865 Salisbury Road. Northeast façade and southeast elevation toward northwest.
- Photo 45. House, south side of Simms Woods Road. North and east elevations toward southwest.
- Photo 46. House, 90 Simms Woods Road. West façade and north elevation toward east.

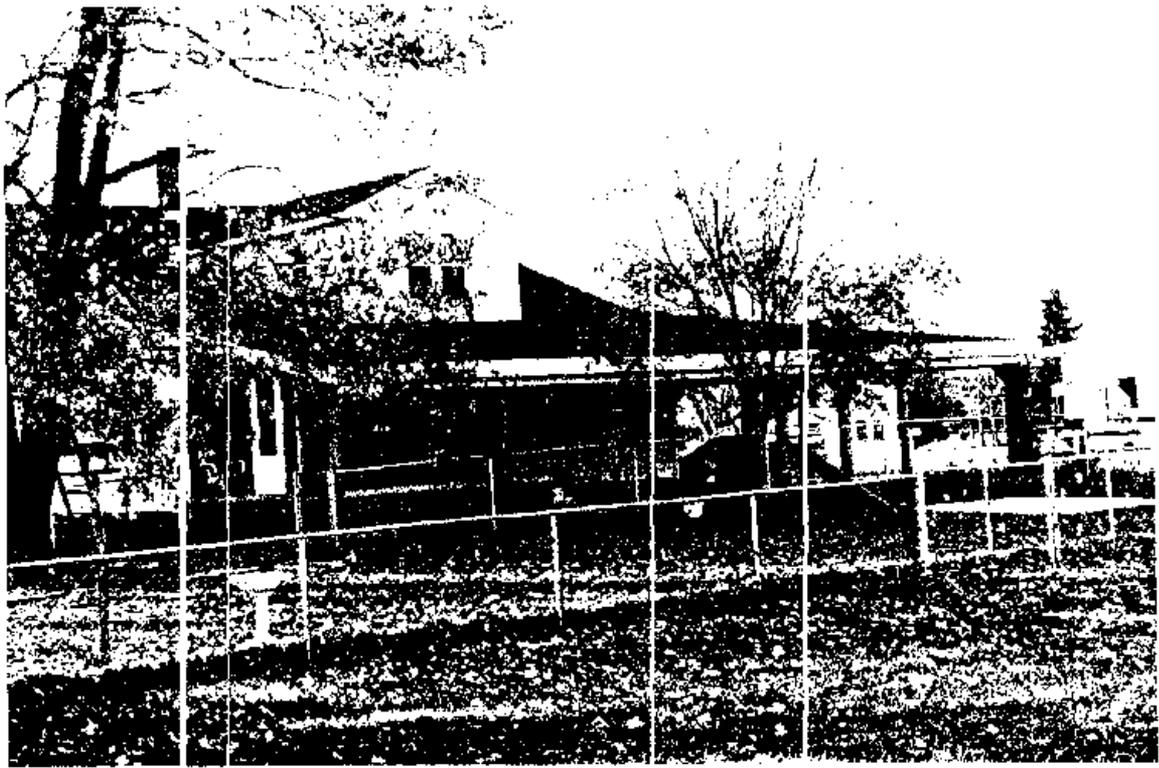


Photo 1. House, intersection of Brenford Road and Route 15. East façade toward northwest.



Photo 2. Recently constructed outbuildings, intersection of Brenford Road and Route 15. South elevation toward northwest.

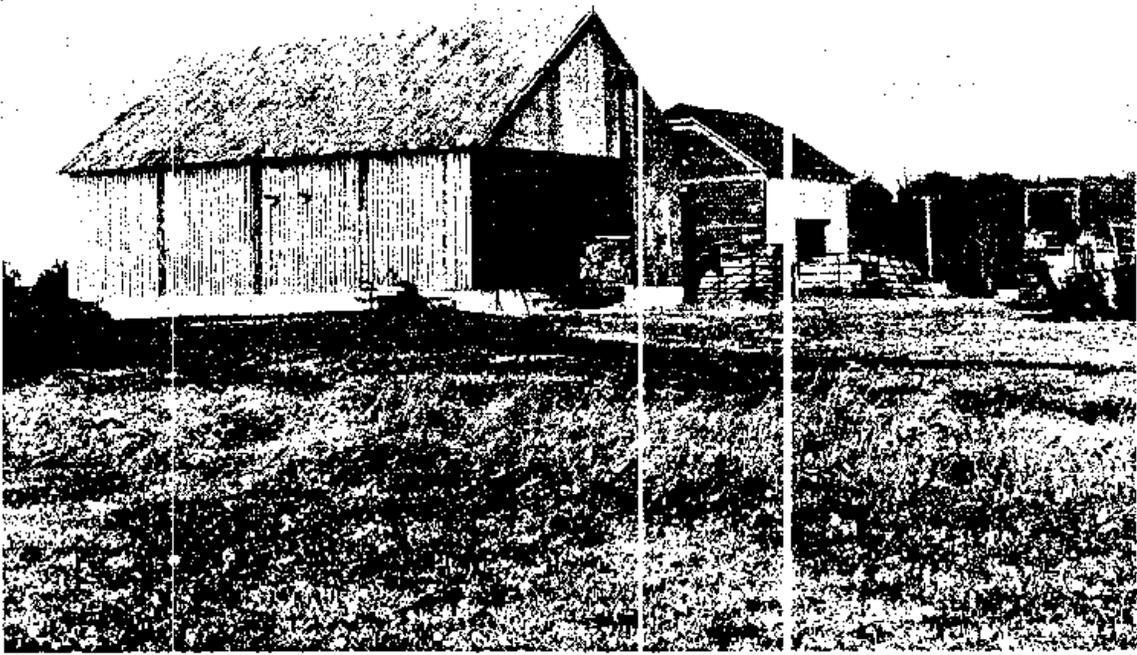


Photo 3. Older outbuildings, intersection of Brenford Road and Route 15. South and east elevations toward northwest.



Photo 4. House, southwest side of Commerce Street, Cheswold. Northeast façade and northwest elevation toward southwest.



Photo 5 House, 117 Commerce Street. Northeast façade and northwest elevation toward southwest.



Photo 6. House, west side of DuPont Highway. East façade and north elevation toward southwest.



Photo 7. House, 5132 DuPont Highway. West façade and north elevation toward east.



Photo 8. House, 5272 DuPont Highway. West façade and north elevation toward southeast.

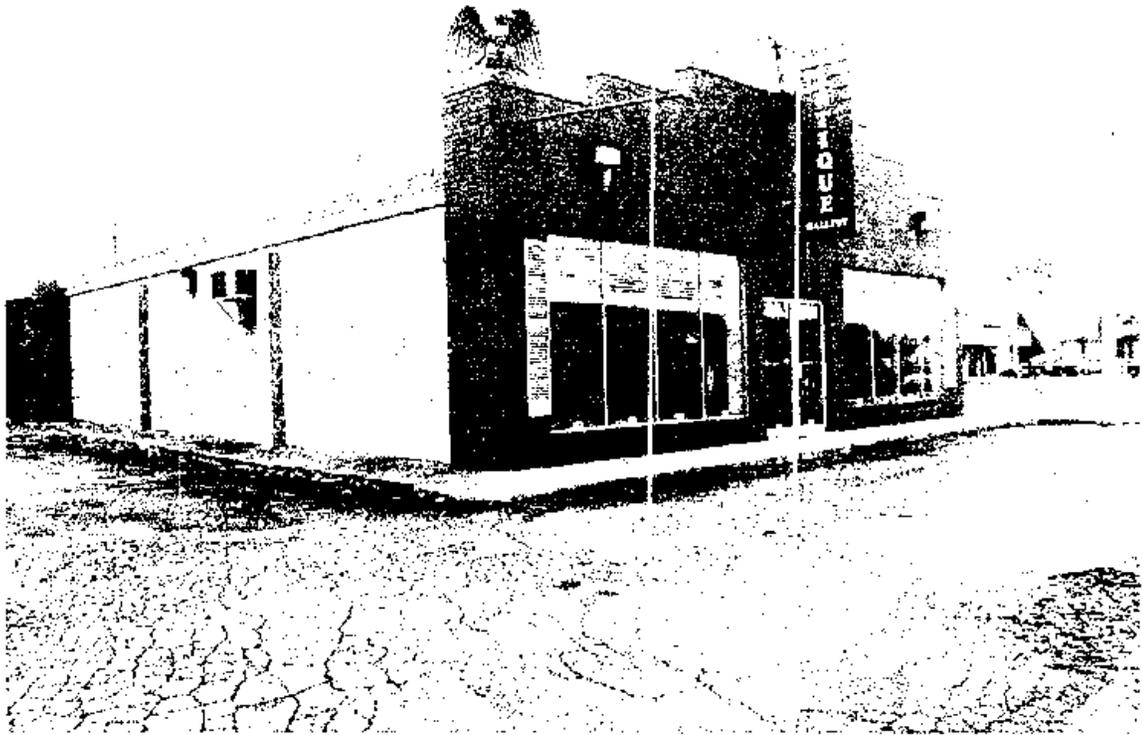


Photo 9. Harnie's Antique Gallery, 5409 DuPont Highway. East façade and south elevation toward northwest.

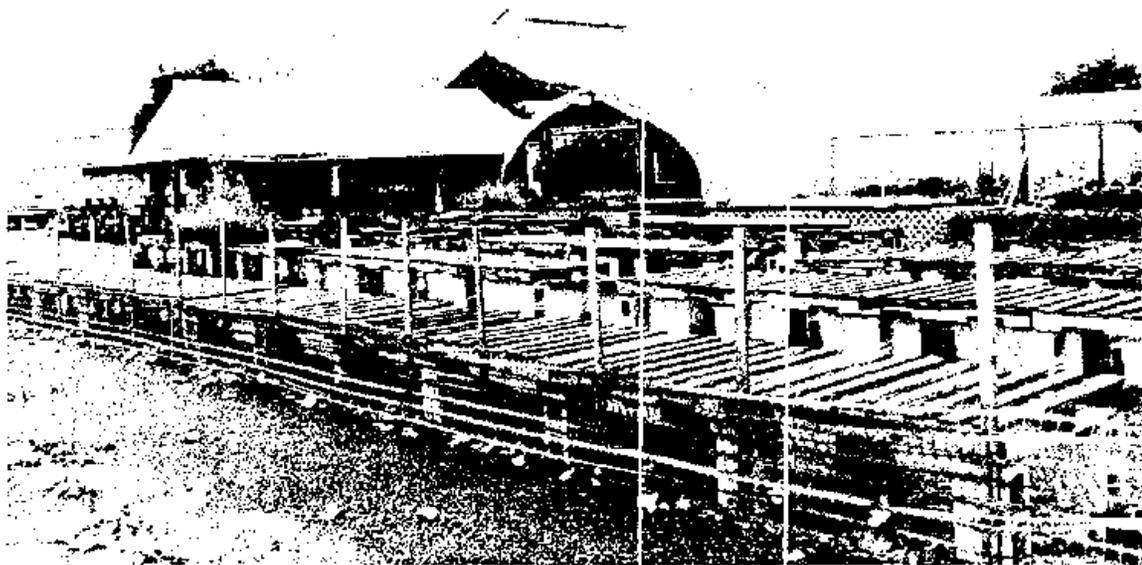


Photo 10. Gari's Greenhouses, West side of DuPont Highway. General view toward southwest.



Photo 11. Garage, east side of DuPont Highway. West and south elevations toward northeast.



Photo 12. House, 5539 DuPont Highway. East and south elevations toward northwest.

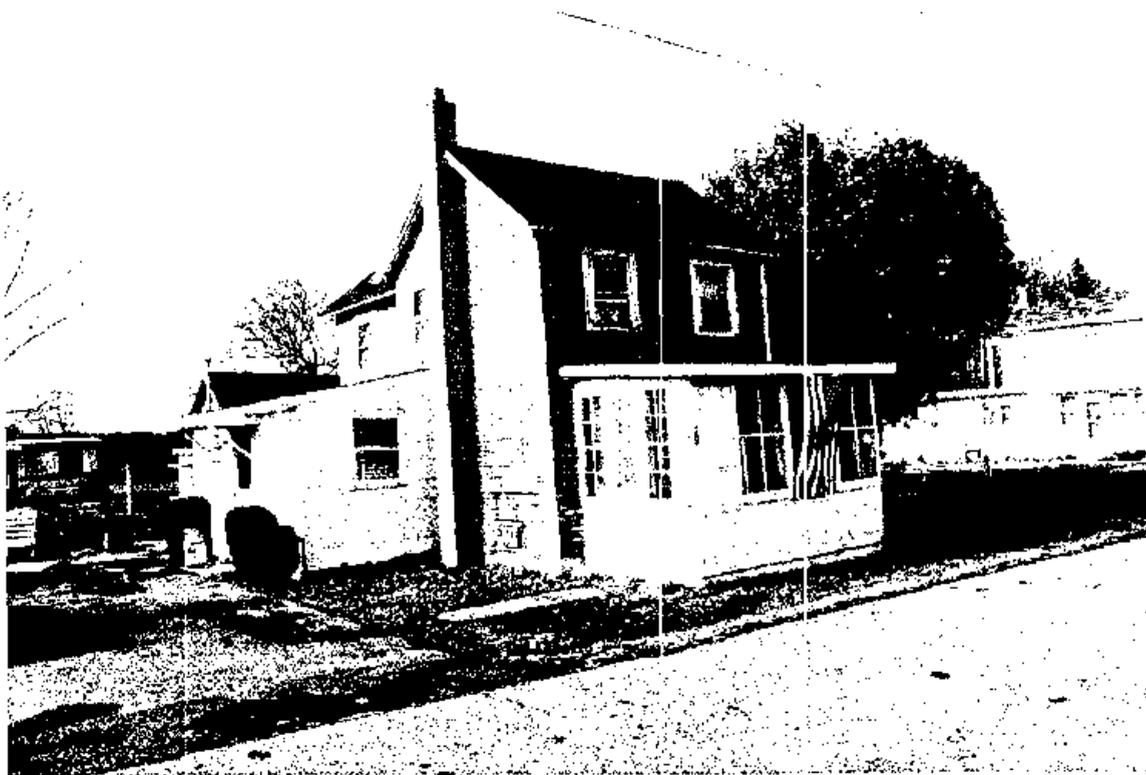


Photo 13. House, 61 Fulton Street. Northeast façade and southeast elevation toward northwest.

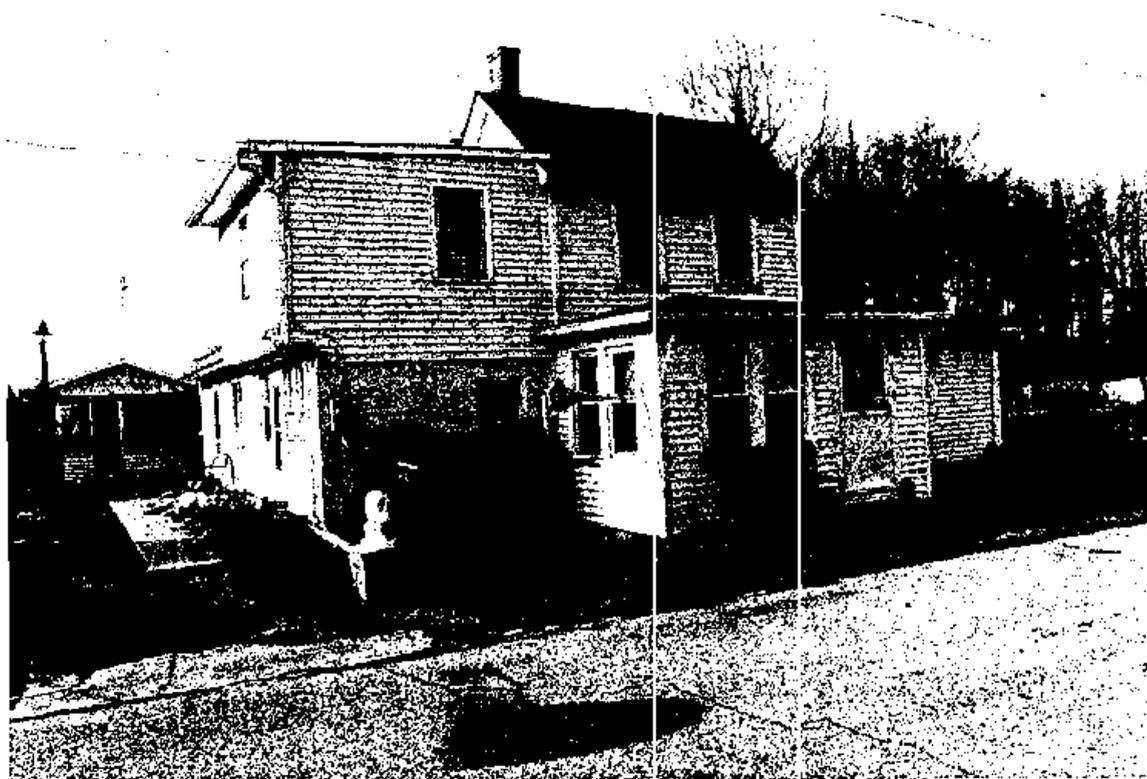


Photo 14. House, 77 Fulton Street. Northeast façade and southeast elevation toward northwest.



Photo 15. House, 143 Fulton Street. Northeast façade and southeast elevation toward southwest.

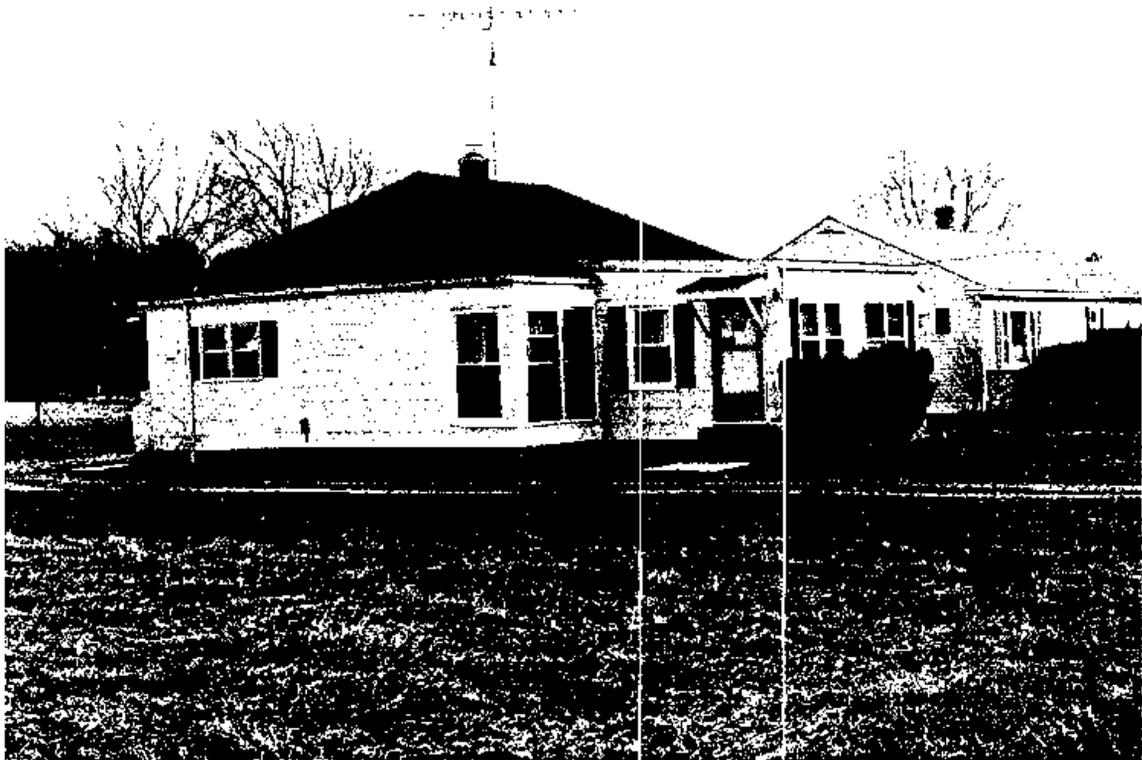


Photo 16. House, 4578 Kenton Road. Southwest and northwest elevations toward southeast.



Photo 17. House, 4721 Kenton Road. Northeast façade and southeast elevation toward northwest.



Photo 18. House, 145 Lynnbury Woods Road. Southeast façade and southwest elevation toward northeast.

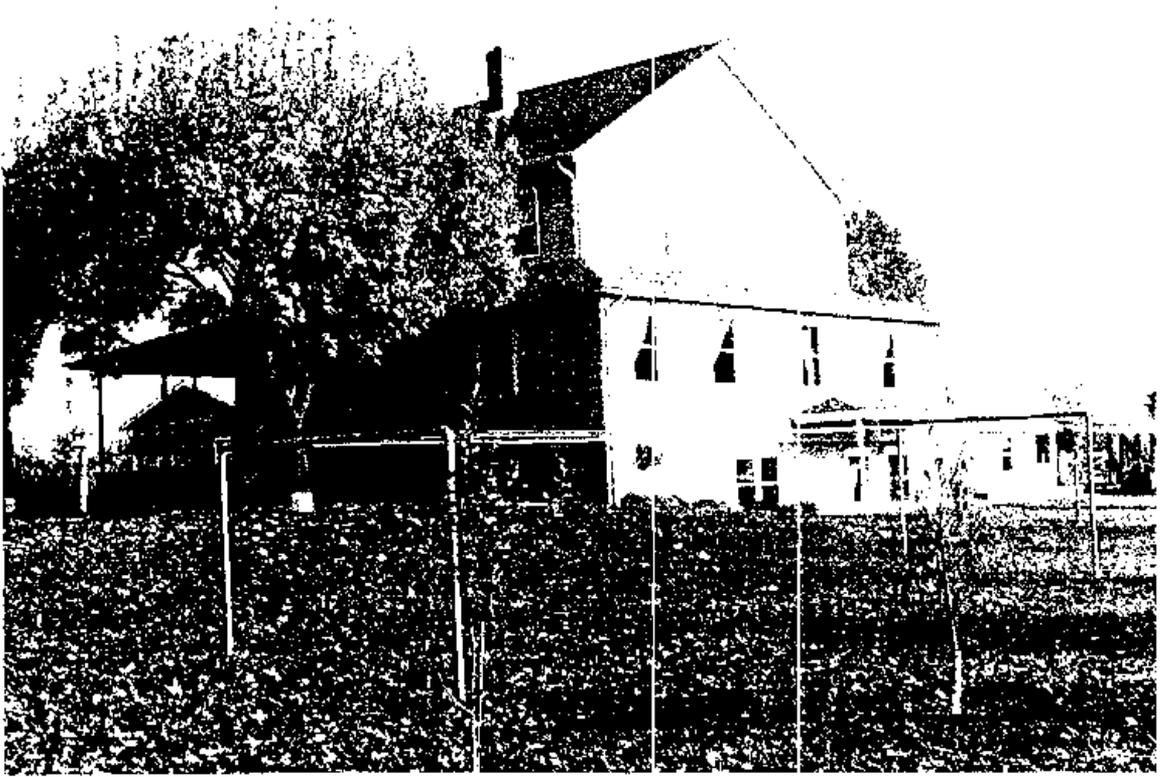


Photo 19. House, 434 Lynnbury Woods Road. Northwest and southwest elevations toward southeast.



Photo 20. House, 434 Lynnbury Woods Road. Northwest and northeast elevations toward southwest.



Photo 21. House, 165 Messina Hill Road. Northeast façade toward southwest.

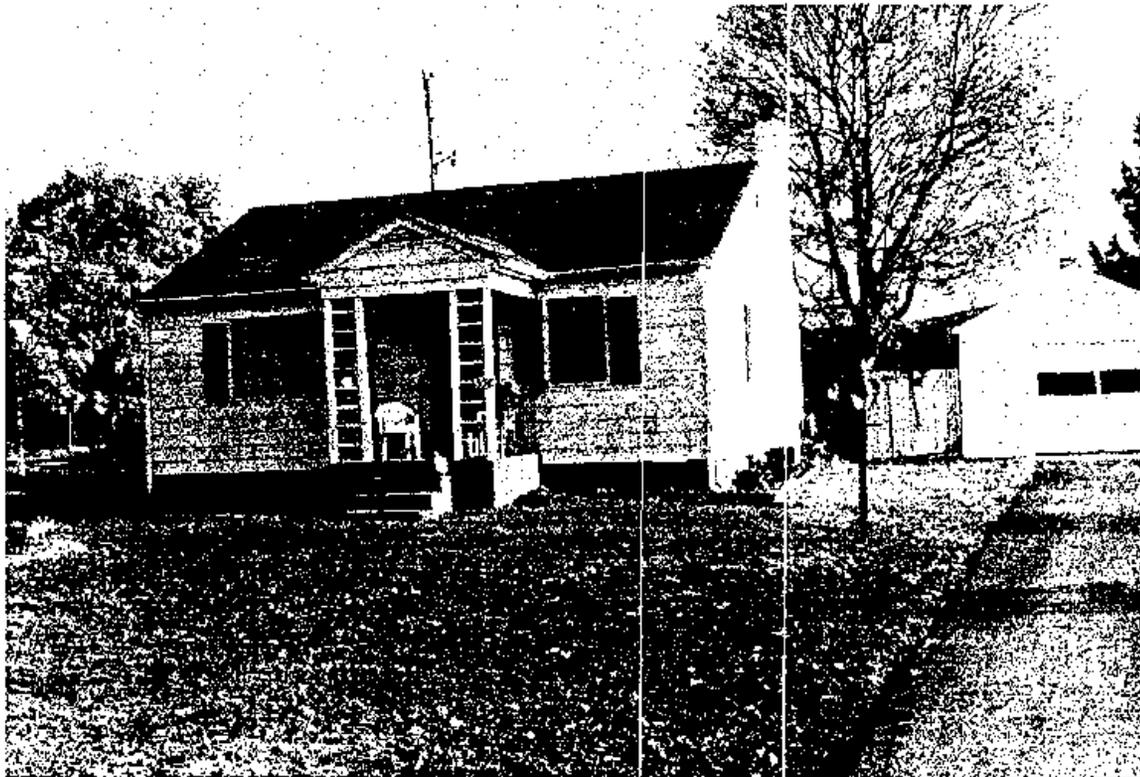


Photo 22. House, 338 Messina Hill Road. Southwest façade and southeast elevation toward northeast.



Photo 23. General view toward southwest showing Bethel Cemetery.



Photo 24. General view toward southwest showing Bethel Cemetery.



Photo 25. Northeast façade and northwest elevation of house, Percheron Farm. View toward southeast.

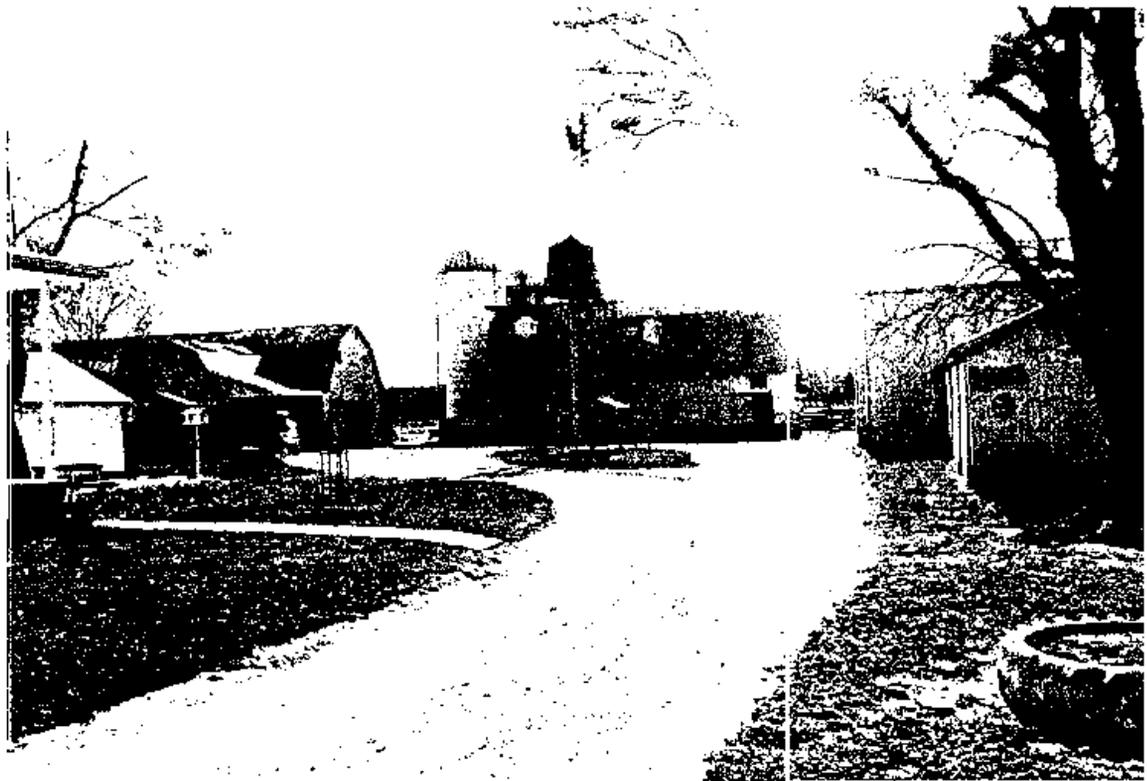


Photo 26. Barns and other outbuildings, Percheron Farm. General view toward southwest



Photo 27. Immanuel Union United Methodist Church. Northwest façade and southwest elevation toward southeast.



Photo 28. House, 2460 Route 42. North façade toward south.

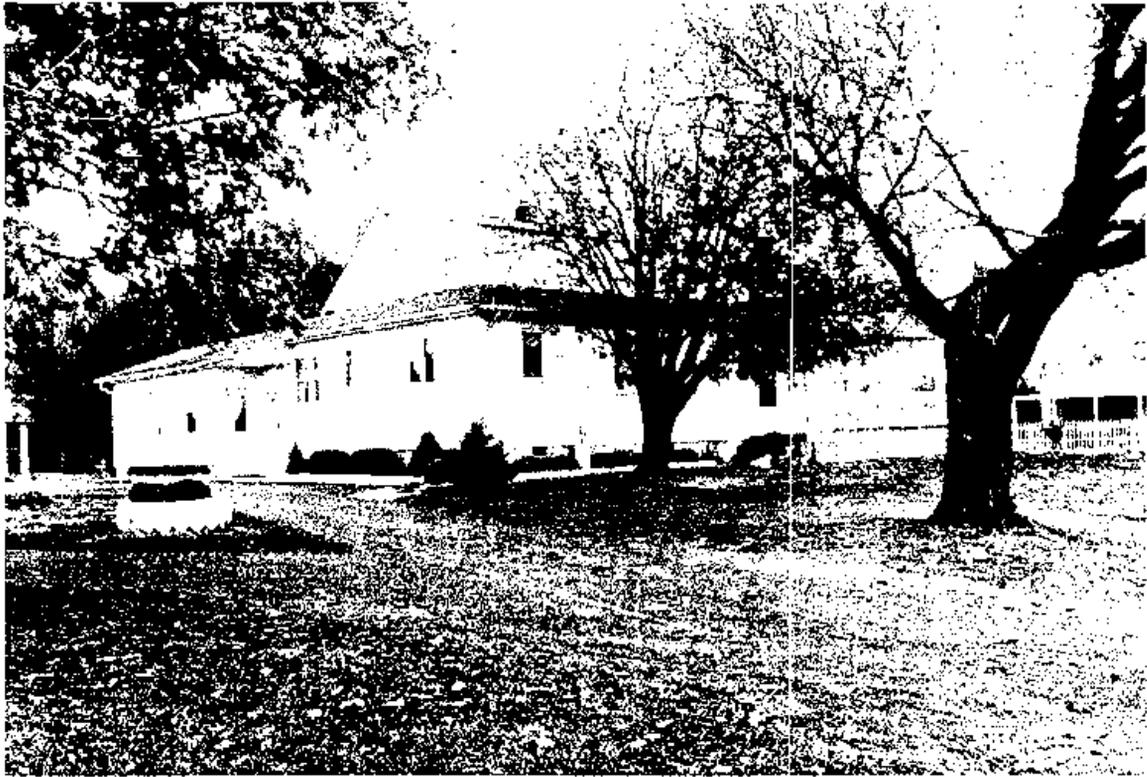


Photo 29. House, 2747 Route 42. South and west elevations toward northeast.



Photo 30. House, 2879 Route 42. East façade and south elevation toward northwest.

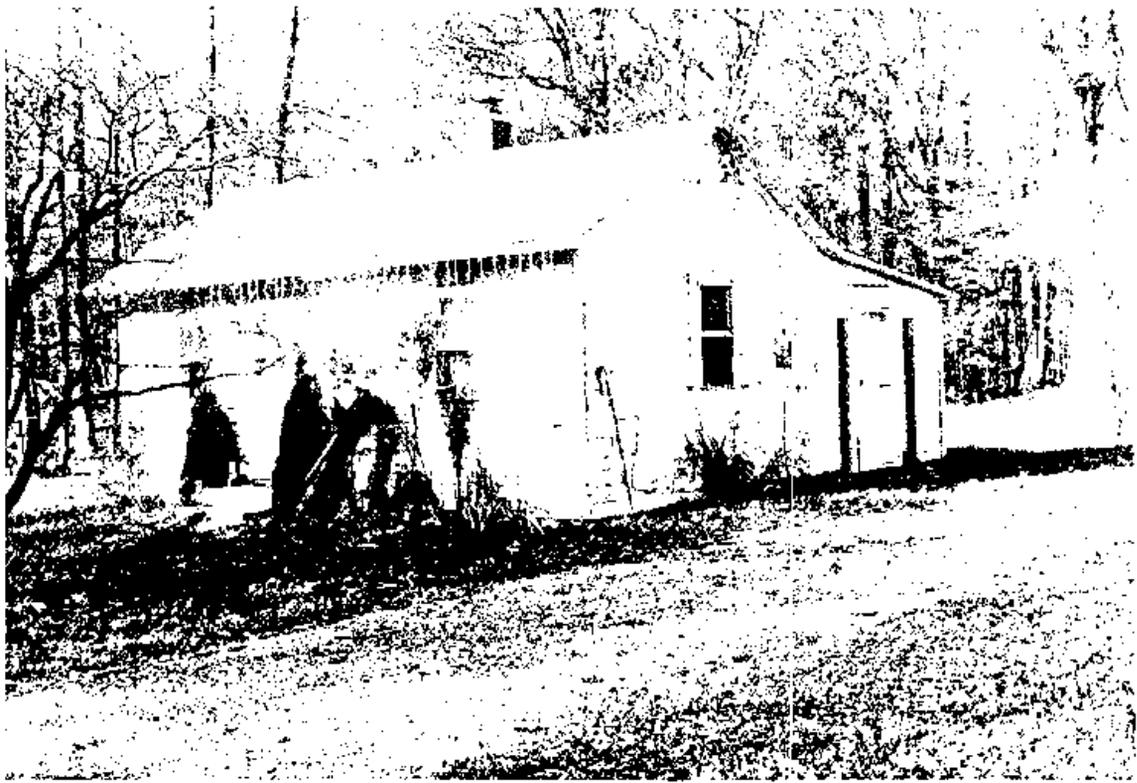


Photo 31. House, north side, Route 42. Southeast façade and northeast elevation toward northwest.



Photo 32. House, 3923 Route 42. Southeast façade and southwest elevation toward northeast.



Photo 33. House, north side, Route 42. Southeast façade and south west elevation toward northeast.

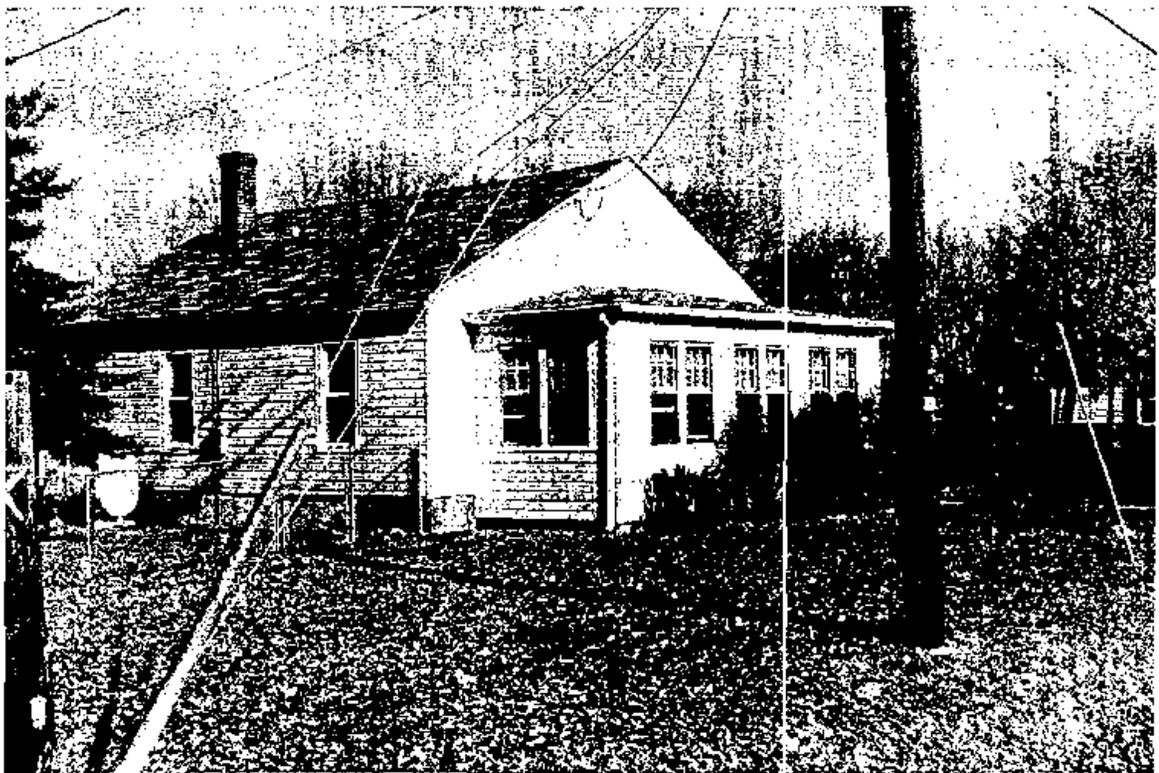


Photo 34. House, 4153 Route 42. Southeast and southwest elevations toward northeast.



Photo 35. House, 4201 Route 42. Southeast façade and southwest elevation toward north.



Photo 36. House, 5188 Route 42. Northwest façade and southwest elevation toward southeast.



Photo 37. House, 5188 Route 42. Northeast elevation and northwest façade toward southwest.



Photo 38. House, 3593 Salisbury Road. Northeast façade and northwest elevation toward southwest.



Photo 39. House, 3699 Salisbury Road. Northeast façade and southeast elevation toward west.



Photo 40. House, north of 3699 Salisbury Road. Northeast façade and southeast elevation toward northwest.



Photo 41. House, 3701 Salisbury Road. Northeast façade and southeast elevation toward southwest.



Photo 42. House, 3791 Salisbury Road. Northeast façade and southeast elevation toward northwest.



Photo 43. House, 3815 Salisbury Road. Northeast façade and southeast elevation toward southwest.

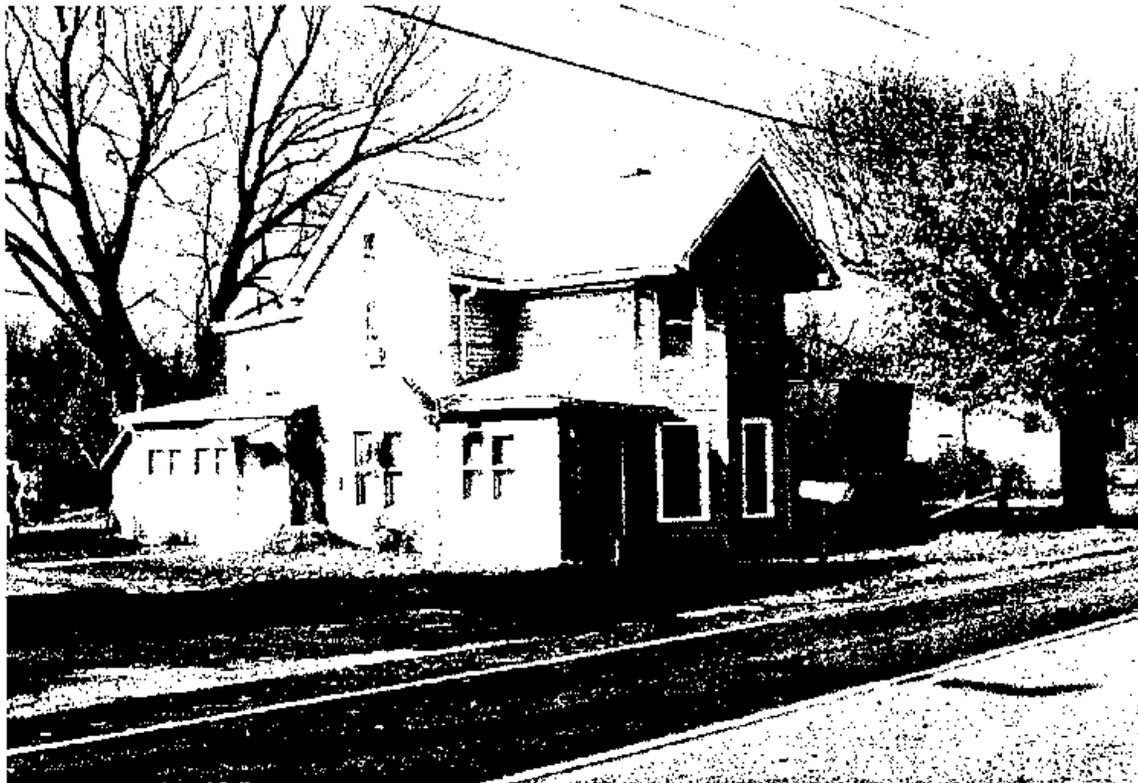


Photo 44. House, 3865 Salisbury Road. Northeast façade and southeast elevation toward northwest.



Photo 45. House, south side of Simms Woods Road. North and east elevations toward southwest.



Photo 46. House, 90 Simms Woods Road. West façade and north elevation toward east.