




LAST REVISED: 06/03/2014
 PA:60213789 - DELDOT AGR 1558 BRIDGE DESIGN SERVICES\TASK 0008 - REHAB BR 1-393 ODESSA\900 WORK\910 CAD\20-SHEETS\STRUCTURE\SD001.DGN

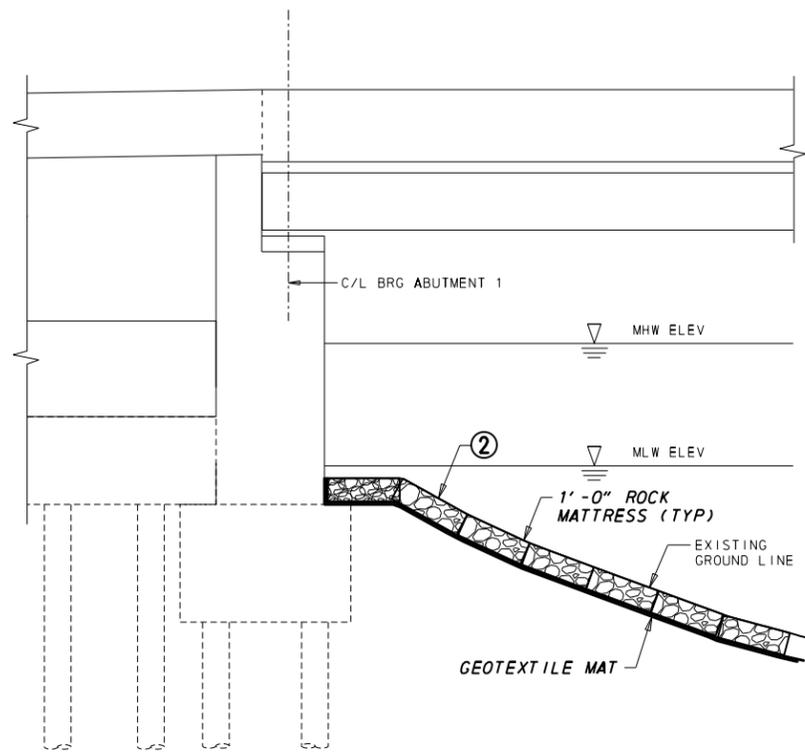


SECTION AT ABUTMENT 1

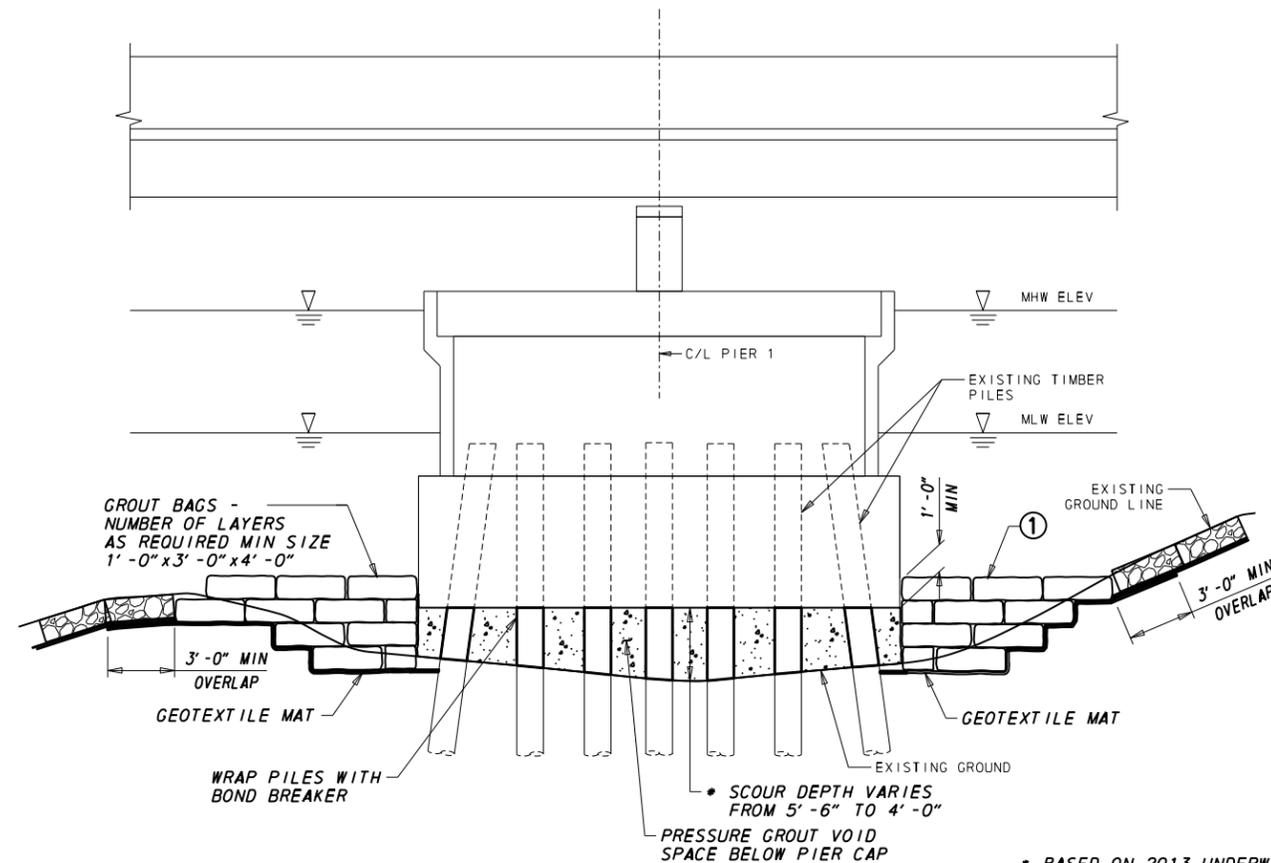


SECTION AT PIER 1

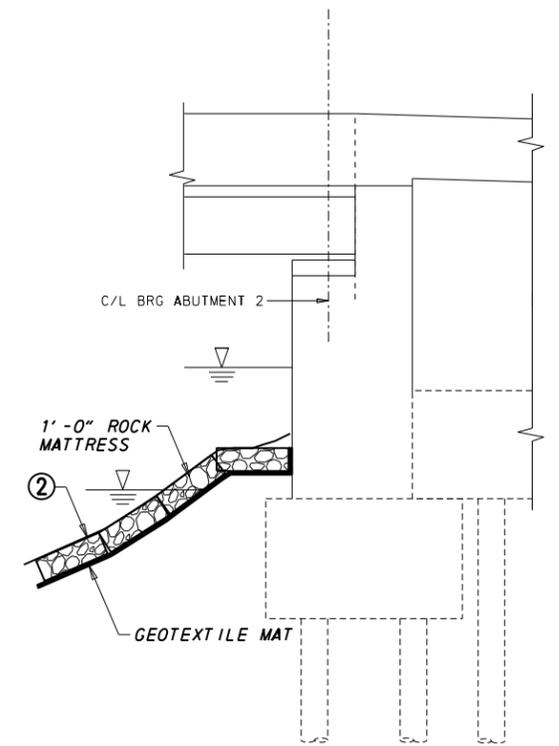

SECTION AT ABUTMENT 2

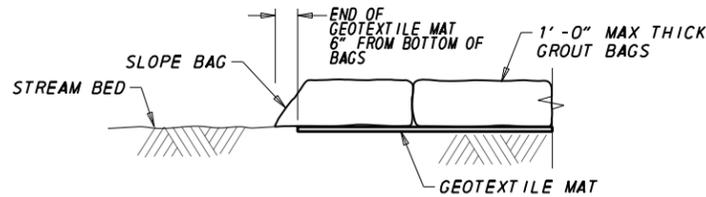

SECTION A-A

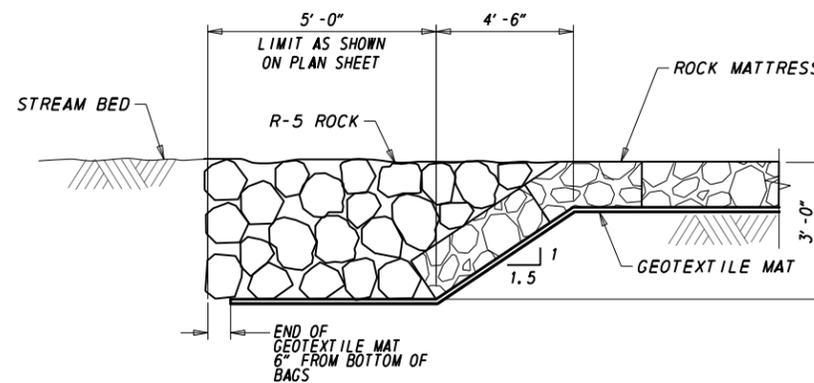

SECTION B-B

* BASED ON 2013 UNDERWATER INSPECTION REPORT. TO BE VERIFIED IN FIELD.

REPAIR ① NOTES

- OVERLAP JOINTS OF THE PRECEEDING GROUT BAG LAYER.
- DO NOT OVERFILL THE BAGS OR ALLOW GROUT TO BE POURED BETWEEN THE SEAMS OF TWO BAGS.

REPAIR ② NOTES

- HYDRAULICALLY EXCAVATE STREAMBED APPROXIMATELY 1'-0". FINAL STREAMBED ELEVATION WITH ROCK MATTRESS IS APPROXIMATELY THE SAME AS EXISTING.

NOTES

FOR LOCATION OF SECTIONS A-A & B-B, SEE SHEET 5.