


**APPENDIX IV**  
**Delaware State Historic**  
**Preservation Office:**  
**Cultural Resource**  
**Survey Forms**

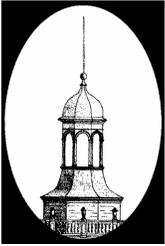

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
PROPERTY IDENTIFICATION FORM

CRS # N-14422  
SPO Map 06-07-36  
Hundred Mill Creek  
Kennett Square, PA-DE  
Quad \_\_\_\_\_  
Other 08-025.00-011

- HISTORIC NAME/FUNCTION: Camp Wright Historic District
- ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road
- TOWN/NEAREST TOWN: Hockessin, Delaware vicinity?
- MAIN TYPE OF RESOURCE: building  structure  site  object   
landscape  district
- MAIN FUNCTION OF PROPERTY: recreation/camp
- PROJECT TITLE/ REASON FOR SURVEY (if applicable):  
Cultural Resource Survey of Camp Wright, Mill Creek Hundred, New Castle County, Delaware

7. ADDITIONAL FORMS USED:

#:	Form:	List property types:
7	CRS 2 Main Building Form	Gatehouse, Arts & Crafts Building, Kitchen/Dining Hall, Bunk House #1, Gawthrop Hall, Bunk House # 2, Caretaker's House
4	CRS 3 Secondary Building Form	Medical Building, Spring House, Washroom, Shed
	CRS 4 Archaeological Site Form	
2	CRS 5 Structure (Building-Like) Form	Swimming Pool, Basketball Court
	CRS 6 Structure (Land Feature) Form	
	CRS 7 Object Form	
	CRS 8 Landscape Elements Form	
1	CRS 9 Map Form	N/A
1	CRS 14 Potential District Form	Camp Wright Historic District

8. SURVEYOR INFORMATION:

Surveyor name: Jerry Clouse

Principal Investigator name: Jerry Clouse

Principal Investigator signature:

Organization: McCormick Taylor, Inc. Date: 10.13.06


**9. OTHER NOTES OR OBSERVATIONS:**

**CRS#** N-14422

On October 27, 1884 three Wilmington, Delaware aid societies, Friends Benevolent Society, St. Vincent de Paul Society, and Provident Society, joined to form the Associated Charities of Wilmington. Associated Charities developed programs to assist distressed members of the Wilmington community, including work relief, education, daycare, and summer playground programs. The success of the summer playground camp eventually led to the decision to establish a permanent camp. Emily P. Bissell coordinated efforts to purchase a campsite, and funds were provided by the proceeds from the Wilmington Flower Market sales. Emily Bissell was a noted community activist in Wilmington. She was also active in the Anti-Suffragette movement and was most noteworthy as the individual responsible for the creation of Easter Seals in the United States. The Wilmington Flower Market was presided over by Mrs. A. Felix DuPont. The camp was opened in 1922 and was named in honor of Peter T. Wright, a supporter of youth programs and Associated Charities. Gawthrop Hall, one of the original structures built at the camp, appears to have been named in honor of S. McGill Gawthrop, who served as president and a board member of both the West End Neighborhood House and Family Services of Northern Delaware. In 1931 Associated Charities was reorganized as Family Society, Inc., which became Family Service of Northern Delaware, Inc in 1956. The West End Neighborhood House obtained a lease of Camp Wright beginning in 1954 to operate the camp, which was owned by the Family Society of Delaware. Activities at the camp included swimming, softball, hiking, crafts, and others. During the 1970s the camp offered daytime programs for children and senior citizens. Improvements to the camp were made during the mid 1970s with financial assistance from private contributors and organizations, including the United Way of Delaware. The facilities continued to be used by various organizations, including the Boy Scouts and West End Neighborhood House into the 1990s.

**10. STATE HISTORIC CONTEXT FRAMEWORK (check all appropriate boxes; refer to state management plan(s)):**

- a) Time period(s)
- Pre-European Contact
  - Paleo-Indian
  - Archaic
  - Woodland I
  - Woodland II
  
  - 1600-1750± Contact Period (Native American)
  - 1630-1730± Exploration and Frontier Settlement
  - 1730-1770± Intensified and Durable Occupation
  - 1770-1830± Early Industrialization
  - 1830-1880± Industrialization and Early Urbanization
  - 1880-1940± Urbanization and Early Suburbanization
  - 1940-1960± Suburbanization and Early Ex-urbanization
- b) Geographical zone
- Piedmont
  - Upper Peninsula
  - Lower Peninsula/Cypress Swamp
  - Coastal
  - Urban (City of Wilmington)
- c) Historic period theme(s)
- |  |   |
|--|---|
| <input type="checkbox"/> Agriculture           | <input type="checkbox"/> Transportation and Communication                         |
| <input type="checkbox"/> Forestry              | <input type="checkbox"/> Settlement Patterns and Demographic Changes              |
| <input type="checkbox"/> Trapping/Hunting      | <input checked="" type="checkbox"/> Architecture, Engineering and Decorative Arts |
| <input type="checkbox"/> Mining/Quarrying      | <input type="checkbox"/> Government   |
| <input type="checkbox"/> Fishing/Oystering     | <input type="checkbox"/> Religion   |
| <input type="checkbox"/> Manufacturing         | <input type="checkbox"/> Education  |
| <input type="checkbox"/> Retailing/Wholesaling | <input checked="" type="checkbox"/> Community Organizations                       |
| <input type="checkbox"/> Finance               | <input type="checkbox"/> Occupational Organizations                               |
| <input type="checkbox"/> Professional Services | <input type="checkbox"/> Major Families, Individuals and Events                   |

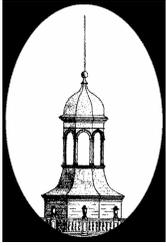

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
MAIN BUILDING FORM

CRS # N-14422.01

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road

2. FUNCTION(S): **historic** arts and crafts/bunk house **current** not in use

3. YEAR BUILT: 1925 **CIRCA?**  **ARCHITECT/BUILDER:** unknown

4. STYLE OR FLOOR PLAN: eight-bay, one pile vernacular cabin

5. INTEGRITY: **original site**  **moved**   
if moved, from where other location's CRS # year

<u>list major alterations and additions with years (if known)</u>	<u>year</u>
a. Raised on piers to prevent flooding damage.	1993
b.	

6. CURRENT CONDITION: **excellent**  **good**  **fair**  **poor**

7. DESCRIPTION: (Describe the resource as completely as possible. Use N/A for not applicable; leave no blanks.)

- a. Overall shape: rectangular **Stories:** one  
Additions: ramp
- b. Structural system (if known): frame
- c. Foundation: **materials:** concrete piers and concrete block  
**basement:** full  partial  not visible  no basement
- d. Exterior walls (original if visible & any subsequent coverings): wood siding
- e. Roof: **shape:** side gable  
**materials:** asphalt shingles  
**cornice:** open with exposed rafters  
**dormers:** N/A  
**chimney: location(s):** N/A

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: **Direction:** east
  - 1) **Bays** eight
  - 2) **Windows**
    - Fenestration** six
    - type** six-over-six with wood sash
    - trim** wood molding
    - shutters** N/A

**Facade (cont'd)**

- 3) **Door(s)** three  
**location** one central double door and one at both the northern and southern ends  
**type** metal and wood paneled  
**trim** wood molding

- 4) **Porch(es)** full-width, one-story porch with wood posts and square spindle railing

**b. Side: Direction:** north

- 1) **Bays** two

2) **Windows**

- fenestration** one (1) on first floor, one (1) on attic level  
**type** six-over-six on first floor, louvered on attic level  
**trim** wood molding  
**shutters** N/A

- 3) **Door(s)** one  
**location** northeast corner of elevation  
**type** paneled wood  
**trim** wood molding

- 4) **Porch(es)** wrap around, full width, one-story with wood posts and square spindle railing

**c. Side: Direction:** south

- 1) **Bays** two

2) **Windows**

- fenestration** two (2) windows on first floor, one (1) opening on attic level  
**type** six-over-six with wood sash on first floor, louvered opening on attic level  
**trim** wood molding  
**shutters** N/A

- 3) **Door(s)** N/A  
**location** N/A  
**type** N/A  
**trim** N/A

- 4) **Porch(es)** N/A

**d. Rear: Direction:** west

- 1) **Bays** six


2) **Windows**

- fenestration** four  
**type** six-over-six with wood sash  
**trim** wood molding  
**shutters** N/A

- 3) **Door(s)** two  
**location** one located at both the north and south ends of elevation  
**type** metal  
**trim** wood molding

- 4) **Porch(es)** N/A

9. **INTERIOR:** The Arts & Crafts Building has wood board flooring, artificial wood paneled walls, and exposed rafters. The separate arts & crafts room is located along the north elevation. Showers and washroom are centrally located, flanked by sleeping quarters.
10. **LANDSCAPING:** The Arts & Crafts Building, along with twelve other camp related resources, is located in a wooded setting along the Mill Creek. Mill Creek Road runs along the eastern boundary of the property. Modern residential development mixed with older housing in a wooded setting is found to the north, east, and west. Limestone Hill Park is located to the south.
11. **OTHER COMMENTS:** The Arts & Crafts Building appears to have been constructed ca. 1925.

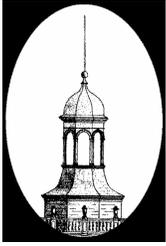

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
MAIN BUILDING FORM

CRS # N-14422.02

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road
2. FUNCTION(S): historic recreation **current** not in use
3. YEAR BUILT: 1922 CIRCA?:  ARCHITECT/BUILDER: unknown
4. STYLE OR FLOOR PLAN: seven-bay, one pile vernacular cabin
5. INTEGRITY: **original site**  **moved**   
if moved, from where other location's CRS # year

<u>list major alterations and additions with years (if known)</u>	<u>year</u>
<u>a. Interior re-modeled.</u>	<u>Ca 1950</u>
<u>b. Raised on piers to prevent flood damage.</u>	<u>1993</u>

6. CURRENT CONDITION: **excellent**  **good**  **fair**  **poor**
7. DESCRIPTION: (Describe the resource as completely as possible. Use N/A for not applicable; leave no blanks.)
- a. Overall shape: rectangular **Stories:** one  
Additions: N/A
- b. Structural system (if known): frame
- c. Foundation: **materials:** stone, concrete  
**basement:** full  partial  not visible  no basement
- d. Exterior walls (original if visible & any subsequent coverings): wood siding
- e. Roof: **shape:** side gable  
**materials:** asphalt  
**cornice:** open with exposed rafters  
**dormers:** N/A  
**chimney: location(s):** N/A

8. DESCRIPTION OF ELEVATIONS:
- a. Facade: Direction: east
- 1) Bays seven
- 2) Windows  
**fenestration** six windows  
**type** one-over-one  
**trim** aluminum  
**shutters** N/A

**Facade (cont'd)**

- 3) **Door(s)**  
     **location** central  
     **type** double, metal  
     **trim** metal
- 4) **Porch(es)** N/A

**b. Side: Direction: south**

- 1) **Bays** one
- 2) **Windows**  
     **fenestration** one attic level  
     **type** louvered  
     **trim** wood  
     **shutters** N/A
- 3) **Door(s)**  
     **location** N/A  
     **type** N/A  
     **trim** N/A
- 4) **Porch(es)** N/A

**c. Side: Direction: north**

- 1) **Bays** one
- 2) **Windows**  
     **fenestration** one attic level  
     **type** louvered  
     **trim** wood  
     **shutters** N/A
- 3) **Door(s)**  
     **location** N/A  
     **type** N/A  
     **trim** N/A
- 4) **Porch(es)** N/A


**d. Rear: Direction: west**

- 1) **Bays** seven
- 2) **Windows**  
     **fenestration** four  
     **type** one-over-one  
     **trim** aluminum  
     **shutters** N/A
- 3) **Door(s)** one  
     **location** central  
     **type** metal  
     **trim** metal
- 4) **Porch(es)** N/A

9. **INTERIOR:** Single room with artificial wood siding on interior walls.

10. **LANDSCAPING:** The Gawthrop Hall, along with twelve other camp related resources, is located in a wooded setting along the Mill Creek. Mill Creek Road runs along the eastern boundary of the property. Modern residential development mixed with older housing in a wooded setting is found to the north, east, and west. Limestone Hill Park is located to the south.

11. **OTHER COMMENTS:** The cabin is known as the Gawthrop Hall and served as a temporary dwelling for camp attendees. Gawthrop Hall was constructed in 1922 and was re-modeled in 1950. The building was named in honor of the Gawthrop family of Wilmington, Delaware.

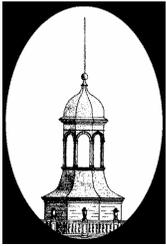

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
MAIN BUILDING FORM

CRS # N-14422.03

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road

2. FUNCTION(S): historic recreation/bunk house current not in use

3. YEAR BUILT: 1925 CIRCA?:  ARCHITECT/BUILDER: unknown

4. STYLE OR FLOOR PLAN: eight-bay, one pile vernacular cabin

5. INTEGRITY: original site  moved   
if moved, from where other location's CRS # year

<u>list major alterations and additions with years (if known)</u>	<u>year</u>
a. Interior re-modeled	Ca. 1950
b. Raised on piers to prevent flood damage.	1993

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION: (Describe the resource as completely as possible. Use N/A for not applicable; leave no blanks.)

a. Overall shape: rectangular Stories: one  
Additions: N/A

b. Structural system (if known): frame

c. Foundation: materials: concrete block piers  
basement: full  partial  not visible  no basement

d. Exterior walls (original if visible & any subsequent coverings): wooden German siding

e. Roof: shape: gable  
materials: asphalt shingles  
cornice: closed  
dormers: N/A  
chimney: location(s): N/A

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: east  
1) Bays eight  
2) Windows  
fenestration four  
type one-over-one  
trim molded wood  
shutters N/A

**Facade (cont'd)**

- 3) **Door(s)** three  
**location** irregular placement along façade, with centrally located main entrance  
**type** two (2) metal doors with single light window, double central metal door  
**trim** molded wood
- 4) **Porch(es)** full width, single story with wood posts and balustrade

**b. Side: Direction:** south

- 1) **Bays** two
- 2) **Windows**  
**fenestration** two (2) first floor and one (1) attic level opening  
**type** one over one  
**trim** molded wood trim  
**shutters** N/A
- 3) **Door(s)** N/A  
**location** N/A  
**type** N/A  
**trim** N/A
- 4) **Porch(es)** N/A


**c. Side: Direction:** north

- 1) **Bays** two
- 2) **Windows**  
**Fenestration** two (2) windows, one (1) attic level louvered opening  
**type** one-over-one  
**trim** N/A  
**shutters** N/A
- 3) **Door(s)** N/A  
**location** N/A  
**type** N/A  
**trim** N/A
- 4) **Porch(es)** N/A

**d. Rear: Direction:** west

- 1) **Bays** six
- 2) **Windows**  
**fenestration** four (4)  
**type** one-over-one  
**trim** molded wood trim  
**shutters** N/A
- 3) **Door(s)** two (2)  
**location** north and south ends of elevation  
**type** metal  
**trim** molded wood trim
- 4) **Porch(es)** N/A

9. **INTERIOR:** The bunk house has separate quarters for counselors, and wash room/shower directly opposite the main entrance. The interior has artificial wood paneling and wood board flooring.
10. **LANDSCAPING:** Bunk House #1, along with twelve other camp related resources, is located in a wooded setting along the Mill Creek. Mill Creek Road runs along the eastern boundary of the property. Modern residential development mixed with older housing in a wooded setting is found to the north, east, and west. Limestone Hill Park is located to the south.
11. **OTHER COMMENTS:** Bunk House #1 appears to have been constructed ca. 1925. The building was re-modeled in 1950.

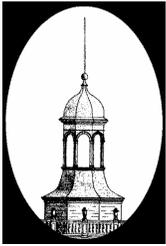

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
MAIN BUILDING FORM

CRS # N-14422.04

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road
2. FUNCTION(S): historic kitchen/dining hall current not in use
3. YEAR BUILT: 1922 CIRCA?:  ARCHITECT/BUILDER: unknown
4. STYLE OR FLOOR PLAN: five-bay, two pile building with Craftsman details
5. INTEGRITY: original site  moved   
 if moved, from where \_\_\_\_\_ other location's CRS # \_\_\_\_\_ year \_\_\_\_\_

<u>list major alterations and additions with years (if known)</u>	<u>year</u>
a. shed-roof addition to front	Ca. 1955
b. shed-roof addition to northwest corner	Ca. 1955

6. CURRENT CONDITION: excellent  good  fair  poor
7. DESCRIPTION: (Describe the resource as completely as possible. Use N/A for not applicable; leave no blanks.)
- a. Overall shape: L-shaped with extension on east elevation Stories: one  
 Additions: N/A
- b. Structural system (if known): frame
- c. Foundation: materials: concrete block piers  
 basement: full  partial  not visible  no basement
- d. Exterior walls (original if visible & any subsequent coverings): wood board and batten siding
- e. Roof: shape: side gable  
 materials: asphalt shingles  
 cornice: open  
 dormers: N/A  
 chimney: location(s): exterior brick chimney at northwest corner

8. DESCRIPTION OF ELEVATIONS:
- a. Facade: Direction: east  
 1) Bays five  
 2) Windows fenestration three (3) paired windows within extension  
 type paired six-over-six double hung with wood sashes  
 trim wood  
 shutters N/A

**Facade (cont'd)**

- 3) **Door(s)** two  
**location** east and west ends of main block and basement level  
**type** metal  
**trim** N/A
- 4) **Porch(es)** N/A

**b. Side: Direction: south**

- 1) **Bays** two
- 2) **Windows**  
**fenestration** two sets of (2) paired  
**type** six-over-six double hung with wood sashes  
**trim** wood  
**shutters** N/A
- 3) **Door(s)** N/A  
**location** N/A  
**type** N/A  
**trim** N/A
- 4) **Porch(es)** N/A

**c. Side: Direction: north**

- 1) **Bays** four
- 2) **Windows**  
**fenestration** three first floor  
**type** six-over-six double hung with wood sashes  
**trim** wood  
**shutters** N/A
- 3) **Door(s)** N/A  
**location** N/A  
**type** N/A  
**trim** N/A
- 4) **Porch(es)** N/A


**d. Rear: Direction: west**

- 1) **Bays** not accessible
- 2) **Windows** not accessible  
**fenestration** not accessible  
**type** not accessible  
**trim** not accessible  
**shutters** not accessible
- 3) **Door(s)** not accessible  
**location** not accessible  
**type** not accessible  
**trim** not accessible
- 4) **Porch(es)** not accessible

9. **INTERIOR:** Combination plaster and wood board interior walls. Wood board flooring.

10. **LANDSCAPING:** The Kitchen/Dining Hall, along with twelve other camp related resources, is located in a wooded setting along the Mill Creek. Mill Creek Road runs along the eastern boundary of the property. Modern residential development mixed with older housing in a wooded setting is found to the north, east, and west. Limestone Hill Park is located to the south.

11. **OTHER COMMENTS:** The building appears to have been constructed in 1922 and was used as a kitchen/dining area.

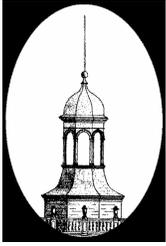

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
MAIN BUILDING FORM

CRS # N-14422.05

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road

2. FUNCTION(S): historic recreation/bunk house current not in use

3. YEAR BUILT: 1925 CIRCA?:  ARCHITECT/BUILDER: unknown

4. STYLE OR FLOOR PLAN: four bay, one pile vernacular cabin

5. INTEGRITY: original site  moved   
if moved, from where other location's CRS # year

<u>list major alterations and additions with years (if known)</u>	<u>year</u>
a. shed roof addition to south gable end	
b. Interior renovated	2003

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION: (Describe the resource as completely as possible. Use N/A for not applicable; leave no blanks.)

- a. Overall shape: rectangular Stories: one  
Additions: shed roof addition to north elevation
- b. Structural system (if known): frame
- c. Foundation: materials: concrete block piers  
basement: full  partial  not visible  no basement
- d. Exterior walls (original if visible & any subsequent coverings): wooden German siding
- e. Roof: shape: gable  
materials: asphalt shingles  
cornice: open  
dormers: N/A  
chimney: location(s): N/A

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: Direction: east
  - 1) Bays four
  - 2) Windows
    - Fenestration two windows
    - type infilled with wood board
    - trim plain wood
    - shutters N/A

**Facade (cont'd)**

- 3) **Door(s)** two  
**location** centrally located  
**Type** paneled wood  
**trim** wood molding
- 4) **Porch(es)** one-story, partial width with wood posts and shed roof, steps at each end

**b. Side: Direction:** north

- 1) **Bays** one
- 2) **Windows** one  
**fenestration** one (1) centrally located window  
**type** enclosed  
**trim** aluminum  
**shutters** N/A
- 3) **Door(s)** N/A  
**location** N/A  
**type** N/A  
**trim** N/A
- 4) **Porch(es)** N/A


**c. Side: Direction:** south

- 1) **Bays** one
- 2) **Windows** one  
**fenestration** one (1) centrally located  
**type** moveable battened  
**trim** wood  
**shutters** N/A
- 3) **Door(s)** N/A  
**location** N/A  
**type** N/A  
**trim** N/A
- 4) **Porch(es)** N/A

**d. Rear: Direction:** west

- 1) **Bays** four
- 2) **Windows** two  
**fenestration** two  
**type** enclosed  
**trim** wood  
**shutters** N/A
- 3) **Door(s)** N/A  
**location** northwest corner  
**type** wood  
**trim** wood
- 4) **Porch(es)** N/A

9. **INTERIOR:** A single room except shed-roof addition. Modern carpet and ceiling, composite wood panel walls.
10. **LANDSCAPING:** Bunk House #2, along with twelve other camp related resources, is located in a wooded setting along the Mill Creek. Mill Creek Road runs along the eastern boundary of the property. Modern residential development mixed with older housing in a wooded setting is found to the north, east, and west. Limestone Hill Park is located to the south.
11. **OTHER COMMENTS:** Bunk House #2 appears to have been constructed ca. 1925.

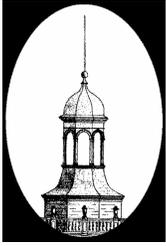

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
MAIN BUILDING FORM

CRS # N-14422.06

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road

2. FUNCTION(S): historic caretaker house current not in use

3. YEAR BUILT: 1925 CIRCA?:  ARCHITECT/BUILDER: unknown

4. STYLE OR FLOOR PLAN: two-bay, front gable cabin

5. INTEGRITY: original site  moved   
if moved, from where other location's CRS # year

<u>list major alterations and additions with years (if known)</u>	<u>year</u>
a. Raised on piers to prevent flood damage	1993
b.	

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION: (Describe the resource as completely as possible. Use N/A for not applicable; leave no blanks.)

- a. Overall shape: rectangular Stories: one  
Additions: N/A
- b. Structural system (if known): frame
- c. Foundation: materials: concrete block piers  
basement: full  partial  not visible  no basement
- d. Exterior walls (original if visible & any subsequent coverings): 1/3 board & batten, 2/3 German siding
- e. Roof: shape: gable  
materials: asphalt shingle  
cornice: open with exposed rafters  
dormers: N/A  
chimney: location(s): N/A

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: Direction: south
  - 1) Bays two
  - 2) Windows
    - fenestration one (1) window on first floor and opening on attic level
    - type one (1) one-over-one on first floor, and one (1) louvered opening on the attic level
    - trim aluminum on first floor and wood on attic level
    - shutters N/A

**Facade (cont'd)**

- 3) **Door(s)** one (1) modern door  
**location** SW corner of façade  
**type** unknown  
**trim** aluminum
- 4) **Porch(es)** N/A

**b. Side: Direction: east**

- 1) **Bays** five
- 2) **Windows**  
**fenestration** five (5) windows along east elevation  
**type** modern one-over-one  
**trim** aluminum  
**shutters** N/A
- 3) **Door(s)** N/A  
**location** N/A  
**type** N/A  
**trim** N/A
- 4) **Porch(es)** N/A

**c. Side: Direction: west**

- 1) **Bays** four
- 2) **Windows**  
**fenestration** three (3) windows along west elevation  
**type** modern one-over-one  
**trim** aluminum  
**shutters** N/A
- 3) **Door(s)** N/A  
**location** N/A  
**type** N/A  
**trim** N/A
- 4) **Porch(es)** N/A

**d. Rear: Direction: north**

- 1) **Bays** two
- 2) **Windows**  
**fenestration** not accessible  
**type** not accessible  
**trim** not accessible  
**shutters** not accessible
- 3) **Door(s)** not accessible  
**location** not accessible  
**type** not accessible  
**trim** not accessible
- 4) **Porch(es)** N/A

9. **INTERIOR:** Not accessed

10. **LANDSCAPING:** The Caretaker's House, along with twelve other camp related resources, is located in a wooded setting along the Mill Creek. Mill Creek Road runs along the eastern boundary of the property. Modern residential development mixed with older housing in a wooded setting is found to the north, east, and west. Limestone Hill Park is located to the south.

11. **OTHER COMMENTS:** The Caretaker's House appears to have been constructed ca. 1925.



DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
MAIN BUILDING FORM

CRS # N-14422.07

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road

2. FUNCTION(S): historic gatehouse current not in use

3. YEAR BUILT: 1925 CIRCA?:  ARCHITECT/BUILDER: unknown

4. STYLE OR FLOOR PLAN: T shaped plan

5. INTEGRITY: original site  moved   
if moved, from where other location's CRS # year

<u>list major alterations and additions with years (if known)</u>	<u>year</u>
a. Raised on piers to prevent flood damage	1993
b.	

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION: (Describe the resource as completely as possible. Use N/A for not applicable; leave no blanks.)

- a. Overall shape: T shaped Stories: one  
Additions: shed roof addition along west elevation
- b. Structural system (if known): frame
- c. Foundation: materials: concrete block  
basement: full  partial  not visible  no basement
- d. Exterior walls (original if visible & any subsequent coverings): wood board siding
- e. Roof: shape: side gable  
materials: asphalt shingles  
cornice: box cornice  
dormers: N/A  
chimney: location(s): N/A

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: Direction: south
  - 1) Bays three
  - 2) Windows
    - fenestration one centrally located window
    - type six-over-six with wooden sash
    - trim wood
    - shutters N/A

**Facade (cont'd)**

3) **Door(s)** two  
**location** located at the east and west ends of the façade  
**type** one (1) wood paneled door with nine light window, one (1) wood panel with glazing  
**trim** wood surround

4) **Porch(es)** N/A

b. **Side: Direction:** east

1) **Bays** one

2) **Windows**

**fenestration** two (2) windows on first floor, one (1) attic level opening

**type** two (2) six-over-six double hung with wood sash, one (1) louvered attic level opening

**trim** wood

**shutters** N/A

3) **Door(s)** N/A

**location** N/A

**type** N/A

**trim** N/A

4) **Porch(es)** N/A

c. **Side: Direction:** west

1) **Bays** one

2) **Windows**

**fenestration** two (2) paired windows

**type** two (2) one-over-one modern windows

**trim** wood

**shutters** N/A

3) **Door(s)** N/A

**location** N/A

**type** N/A

**trim** N/A

4) **Porch(es)** N/A

d. **Rear: Direction:** north

1) **Bays** not accessible

2) **Windows**

**fenestration** not accessible

**type** not accessible

**trim** not accessible

**shutters** not accessible

3) **Door(s)** not accessible

**location** not accessible

**type** not accessible


**trim** not accessible

4) **Porch(es)** N/A

9. **INTERIOR:** The Gatehouse has been divided into four separate rooms. The interior has wood board flooring and artificial wood wall covering.

10. **LANDSCAPING:** The Gatehouse, along with twelve other camp related resources, is located in a wooded setting along the Mill Creek. Mill Creek Road runs along the eastern boundary of the property. Modern residential development is found to the north, east, and west. Limestone Hill Park is located to the south. The gatehouse is set at the entrance to Camp Wright, at the intersection of Graves and Mill Creek Roads

11. **OTHER COMMENTS:** The Gatehouse appears to have been constructed ca. 1925.

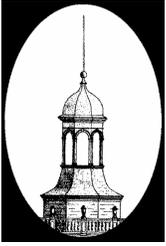

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # N-14422.08

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road

2. FUNCTION(S): historic washroom current not in use

3. YEAR BUILT: 1960 CIRCA?:  ARCHITECT/BUILDER: unknown

4. STYLE/FLOOR PLAN: Two-bay, single pile vernacular structure

5. INTEGRITY: original site  moved   
if moved, from where original location's CRS # year

list major alterations and additions with years (if known) year  
a.  
b.

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

- a. Structural system concrete block
- b. Number of stories one
- c. Wall coverings concrete block and vertical wood board
- d. Foundation concrete block
- e. Roof
  - structural system frame
  - coverings asphalt shingles
  - openings N/A


8. DESCRIPTION OF ELEVATIONS:

- a. Facade: direction: east
  - 1) bays: two
  - 2) windows: paired one-over-one
  - 3) door(s): wood paneled
  - 4) other: concrete steps to entrance

- b. **Side: direction:** north
  - 1) **bays:** one
  - 2) **windows:** not accessible
  - 3) **door(s):** not accessible
  - 4) **other:** N/A
  
- c. **Side: direction:** south
  - 1) **bays:** one
  - 2) **windows:** paired one-over-one
  - 3) **door(s):** N/A
  - 4) **other:** N/A
  
- d. **Rear: direction:** west
  - 1) **bays:** two
  - 2) **windows:** not accessible
  - 3) **door(s):** not accessible
  - 4) **other:** N/A

9. **INTERIOR (if accessible):**

- a) **Floor plan**            not accessible
  
- b) **Partition/walls**        not accessible
  
- c) **Finishes**                not accessible
  
- d) **Furnishings/machinery**    not accessible

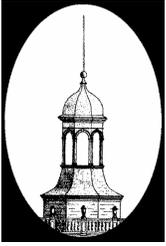

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # N-14422.09

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road

2. FUNCTION(S): historic medical building current not in use

3. YEAR BUILT: 1925 CIRCA?:  ARCHITECT/BUILDER: unknown

4. STYLE/FLOOR PLAN: five-bay, two pile vernacular cabin

5. INTEGRITY: original site  moved

if moved, from where original location's CRS # year

list major alterations and additions with years (if known)

a. Raised on piers to prevent flood damage year 1993

b.

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

a. Structural system frame

b. Number of stories one

c. Wall coverings vertical wood board siding

d. Foundation concrete block piers

e. Roof

structural system frame

coverings asphalt shingles

openings N/A

8. DESCRIPTION OF ELEVATIONS:

a. Facade: direction: west

1) bays: five

2) windows: three (3) six-over-six double hung windows with wood sashes

3) door(s): two (2) wood paneled doors and one (1) enclosed door

4) other: one story wrap around porch with wood posts and asphalt shingle covered roof

**b. Side: direction:** south

- 1) **bays:** two
- 2) **windows:** two (2) enclosed window openings
- 3) **door(s):** N/A
- 4) **other:** N/A

**c. Side: direction:** north

- 1) **bays:** two
- 2) **windows:** two (2) six-over-six double hung windows with wood sashes and trim
- 3) **door(s):** N/A
- 4) **other:** N/A

**d. Rear: direction:** east

- 1) **bays:** not accessible
- 2) **windows:** not accessible
- 3) **door(s):** not accessible
- 4) **other:** N/A


**9. INTERIOR (if accessible):**

**a) Floor plan**            central parlor with three adjoining rooms

**b) Partition/walls**

**c) Finishes**            wood board flooring, artificial wood board interior walls

**d) Furnishings/machinery**            N/A

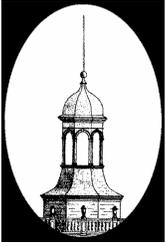

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # N-14422.10

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road

2. FUNCTION(S): historic spring house current not in use

3. YEAR BUILT: 1830 CIRCA?:  ARCHITECT/BUILDER: unknown

4. STYLE/FLOOR PLAN: one bay, single pile Mid 19<sup>th</sup> century spring house

5. INTEGRITY: original site  moved   
if moved, from where original location's CRS # year

list major alterations and additions with years (if known) year  
a.  
b.

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

a. Structural system masonry

b. Number of stories one

c. Wall coverings stucco

d. Foundation stone

e. Roof  
structural system masonry  
coverings concrete  
openings N/A

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: direction: west  
1) bays: one  
2) windows: N/A  
3) door(s): central wood door  
4) other: brick cornice and arch above door

**b. Side: direction: north**

- 1) **bays:** one
- 2) **windows:** N/A
- 3) **door(s):** N/A
- 4) **other:** N/A

**c. Side: direction: south**

- 1) **bays:** one
- 2) **windows:** N/A
- 3) **door(s):** N/A
- 4) **other:** small door located at center of south elevation

**d. Rear: direction: east**

- 1) **bays:** one
- 2) **windows:** N/A
- 3) **door(s):** N/A
- 4) **other:** N/A


**9. INTERIOR (if accessible):**

**a) Floor plan**            not accessible

**b) Partition/walls**        not accessible

**c) Finishes**            not accessible

**d) Furnishings/machinery**    not accessible

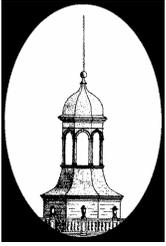

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # N-14422.11

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road

2. FUNCTION(S): historic shed current shed

3. YEAR BUILT: 1975 CIRCA?:  ARCHITECT/BUILDER: unknown

4. STYLE/FLOOR PLAN: one-bay, single pile shed

5. INTEGRITY: original site  moved   
if moved, from where original location's CRS # year

list major alterations and additions with years (if known) year  
a.  
b.

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

- a. Structural system frame
- b. Number of stories one
- c. Wall coverings vinyl siding
- d. Foundation N/A
- e. Roof
  - structural system frame
  - coverings vinyl siding
  - openings N/A

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: direction: west
  - 1) bays: one
  - 2) windows: N/A
  - 3) door(s): wood paneled
  - 4) other: N/A

**b. Side: direction: south**

- 1) **bays:** one
- 2) **windows:** N/A
- 3) **door(s):** N/A
- 4) **other:** N/A

**c. Side: direction: north**

- 1) **bays:** one
- 2) **windows:** N/A
- 3) **door(s):** N/A
- 4) **other:** N/A

**d. Rear: direction: east**

- 1) **bays:** one
- 2) **windows:** N/A
- 3) **door(s):** N/A
- 4) **other:** N/A


**9. INTERIOR (if accessible):**

**a) Floor plan**            not accessible

**b) Partition/walls**        not accessible

**c) Finishes**            not accessible

**d) Furnishings/machinery**        documentation states the Shed is used as storage for the camp ceramic kiln

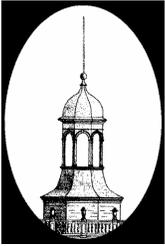

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
STRUCTURE (BUILDING-LIKE) FORM

CRS # N-14422.12

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road

2. FUNCTION: swimming pool IN USE?

3. YEAR BUILT: 1975 CIRCA?:  ARCHITECT/BUILDER: unknown

4. STYLE/PLAN: swimming pool

5. INTEGRITY: original site  moved

if moved, from where original location's CRS # year

list major alterations and additions with dates (if known) year

- a.
- b.

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION (describe the structure as completely as possible):

- a) Overall shape rectangular
- height N/A
- length approx. 48 ft.
- width approx. 26 ft.

b) Structural system: N/A

c) Foundation: concrete


d) Exterior covering: N/A

7. DESCRIPTION (cont'd):

CRS # N-14422.12

e) Openings N/A

**f) Other features.** The Swimming Pool is surrounded by a concrete walk. A chain link fence enclosing the entire pool. A small, one-story concrete block structure is located immediately north of the Swimming Pool, outside the chain link fence. The concrete block structure houses the machinery associated with maintenance of the Swimming Pool. The Swimming Pool is not currently in use.

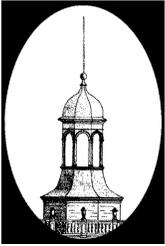

**CULTURAL RESOURCE SURVEY  
STRUCTURE (BUILDING-LIKE) FORM**

CRS # N-14422.13

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road

2. FUNCTION: basketball court IN USE?

3. YEAR BUILT: 1975 CIRCA?:  ARCHITECT/BUILDER: unknown

4. STYLE/PLAN: basketball court

5. INTEGRITY: original site  moved   
if moved, from where original location's CRS # year

list major alterations and additions with dates (if known) year

a.

b.

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION (describe the structure as completely as possible):

- a) Overall shape Rectangular
- height N/A
- length approx. 45 ft.
- width approx. 30 ft.

b) Structural system: N/A

c) Foundation: concrete foundation

d) Exterior covering: asphalt

7. DESCRIPTION (cont'd):


CRS # N-14422.13


e) Openings N/A

f) Other features none



INDICATE NORTH ON PLAN

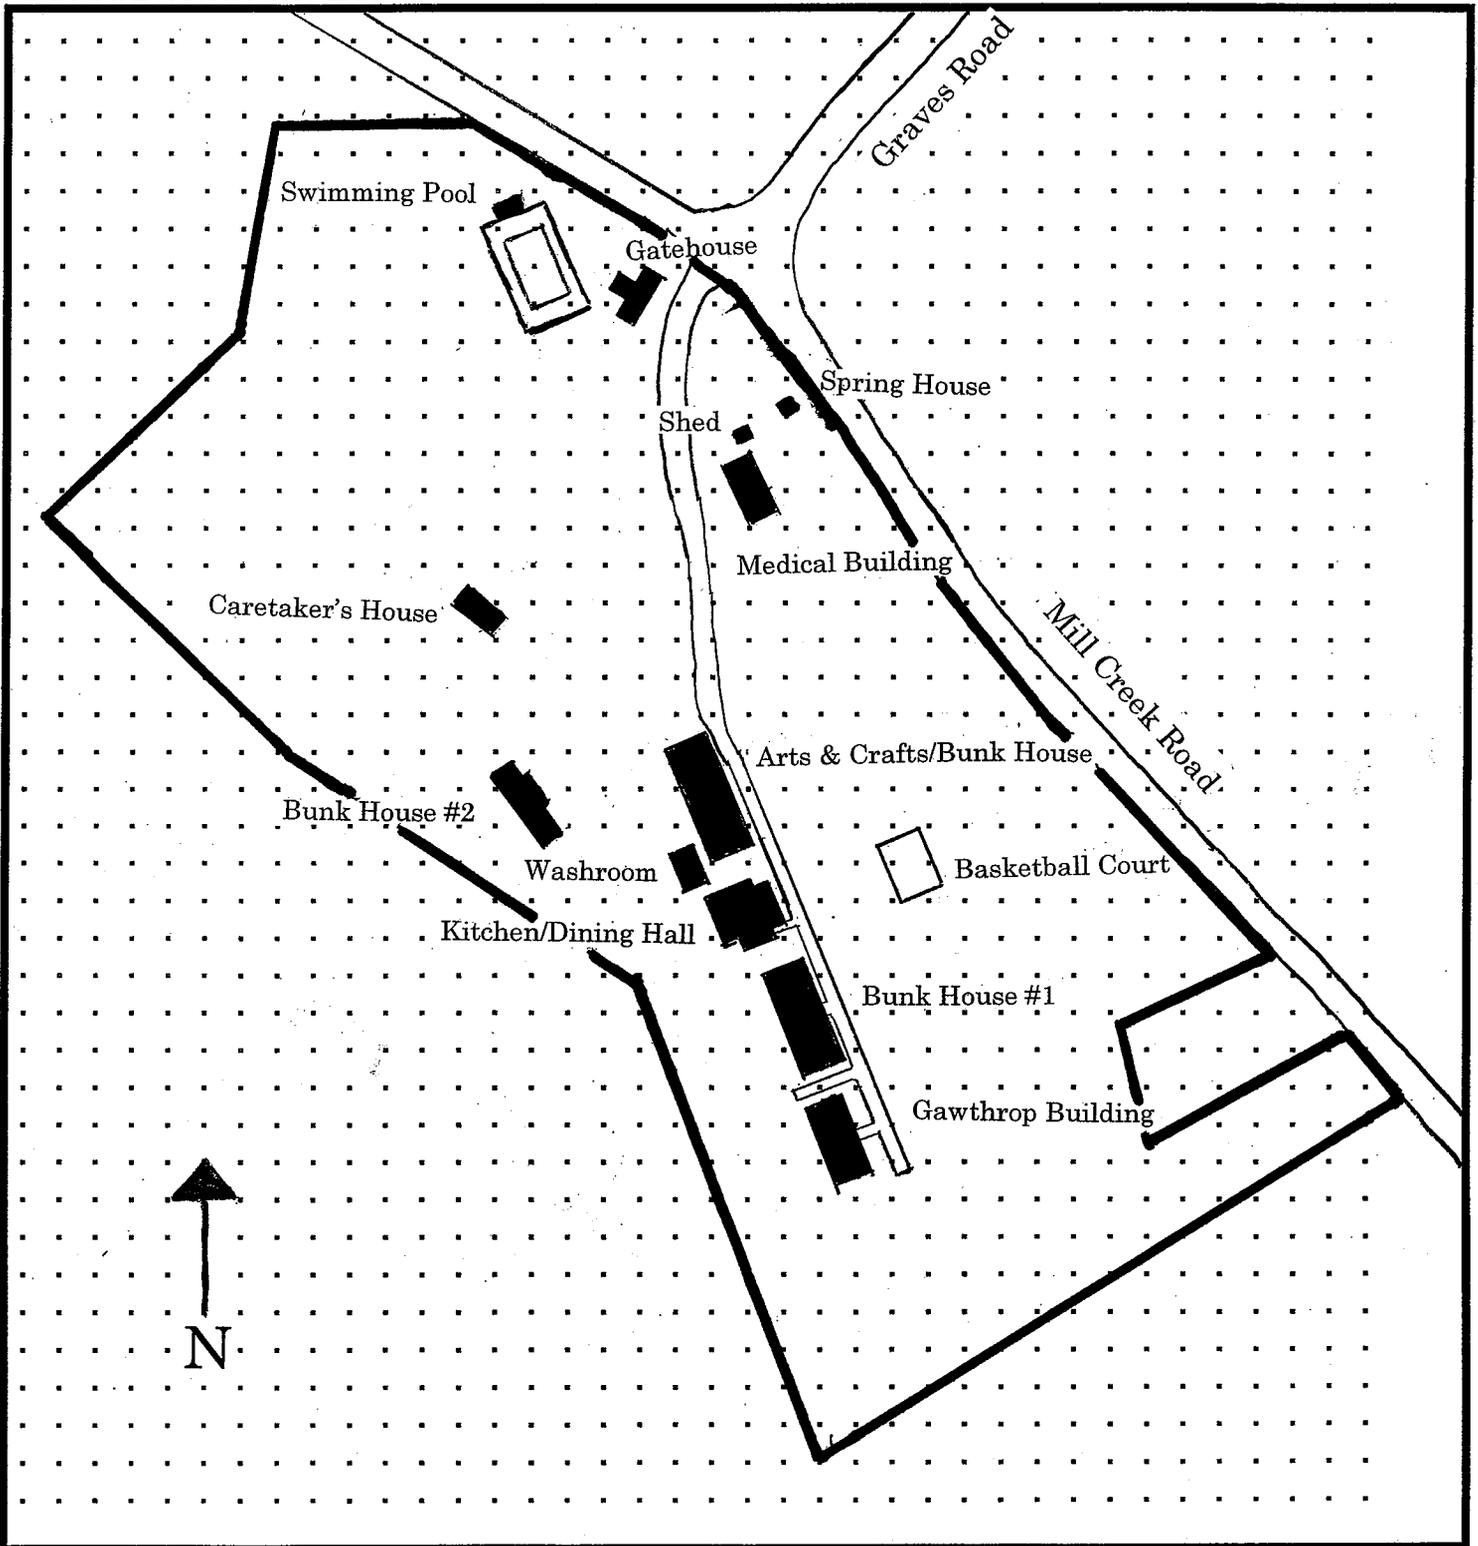

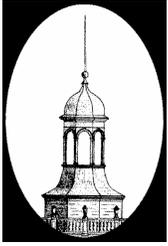

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
POTENTIAL DISTRICT FORM

CRS #           N-14422          

1. **NAME OF DISTRICT:**           Camp Wright Historic District          

2. **BOUNDARY:** The Camp Wright Historic District boundary follows the tax parcel boundary along the north, south, and west property lines. The eastern boundary is formed by the west side of Mill Creek Road.

3. **FUNCTION:**      residential:       commercial:       religious:       archaeological:   
                         recreational:       industrial:       governmental:       educational:   
                         other:       describe:           Social: Camp Wright provided camping opportunities to inner-city youth.          

4. **REASON FOR SURVEY:** \_\_\_\_\_

5. **DOCUMENTATION:**

a) **Report title:**           Cultural Resource Survey of Camp Wright, Mill Creek Hundred, New Castle County, Delaware          

b) **Map showing boundary:**      attached

c) **Cross-reference list of individual CRS#s (use ranges only for sequential numbers):**

- N-14422.01 Arts & Crafts Building
- N-14422.02 Gawthrop Hall
- N-14422.03 Bunk House #1
- N-14422.04 Kitchen/Dining Hall
- N-14422.05 Bunk House #2
- N-14422.06 Caretaker's House
- N-14422.07 Gatehouse
- N-14422.08 Washroom
- N-14422.09 Medical Building
- N-14422.10 Spring House
- N-14422.11 Shed
- N-14422.12 Swimming Pool
- N-14422.13 Basketball Court

6. **SURVEYOR INFORMATION:**

**Surveyor name:**           Jerry Clouse          

**Principal Investigator name:**           Jerry Clouse          

**Principal Investigator signature:**           *Jerry H. Clouse*          

**Organization:**           McCormick Taylor, Inc.                **Date:**           10.11.06



Taylor2-001.Tif



Taylor2-002.Tif



Taylor2-003.Tif



Taylor2-004.Tif



Taylor2-005.Tif



Taylor2-006.Tif



Taylor2-007.Tif



Taylor2-008.Tif



Taylor2-009.Tif



Taylor2-010.Tif



Taylor2-011.Tif



Taylor2-012.Tif



Taylor2-013.Tif



Taylor2-014.Tif



Taylor2-015.Tif




Taylor2-016.Tif



Taylor2-017.Tif



Taylor2-018.Tif

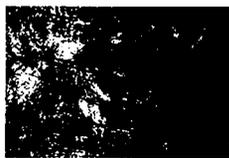

Taylor2-019.Tif




Taylor2-020.Tif



Taylor2-021.Tif



Taylor2-022.Tif

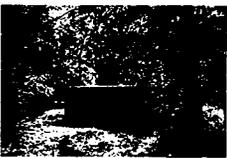

Taylor2-023.Tif



Taylor2-024.Tif



Taylor1-001.Tif



Taylor1-002.Tif



Taylor1-003.Tif



Taylor1-004.Tif



Taylor1-005.Tif



Taylor1-006.Tif



Taylor1-007.Tif



Taylor1-008.Tif



Taylor1-009.Tif



Taylor1-010.Tif



Taylor1-011.Tif



Taylor1-012.Tif



Taylor1-013.Tif



Taylor1-014.Tif



Taylor1-015.Tif



Taylor1-016.Tif



Taylor1-017.Tif



Taylor1-018.Tif



Taylor1-019.Tif



Taylor1-020.Tif



Taylor1-021.Tif



Taylor1-022.Tif



Taylor1-023.Tif



Taylor1-024.Tif