
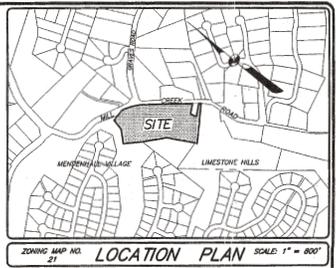


**Medical Building  
(CRS # N-14422.09)**

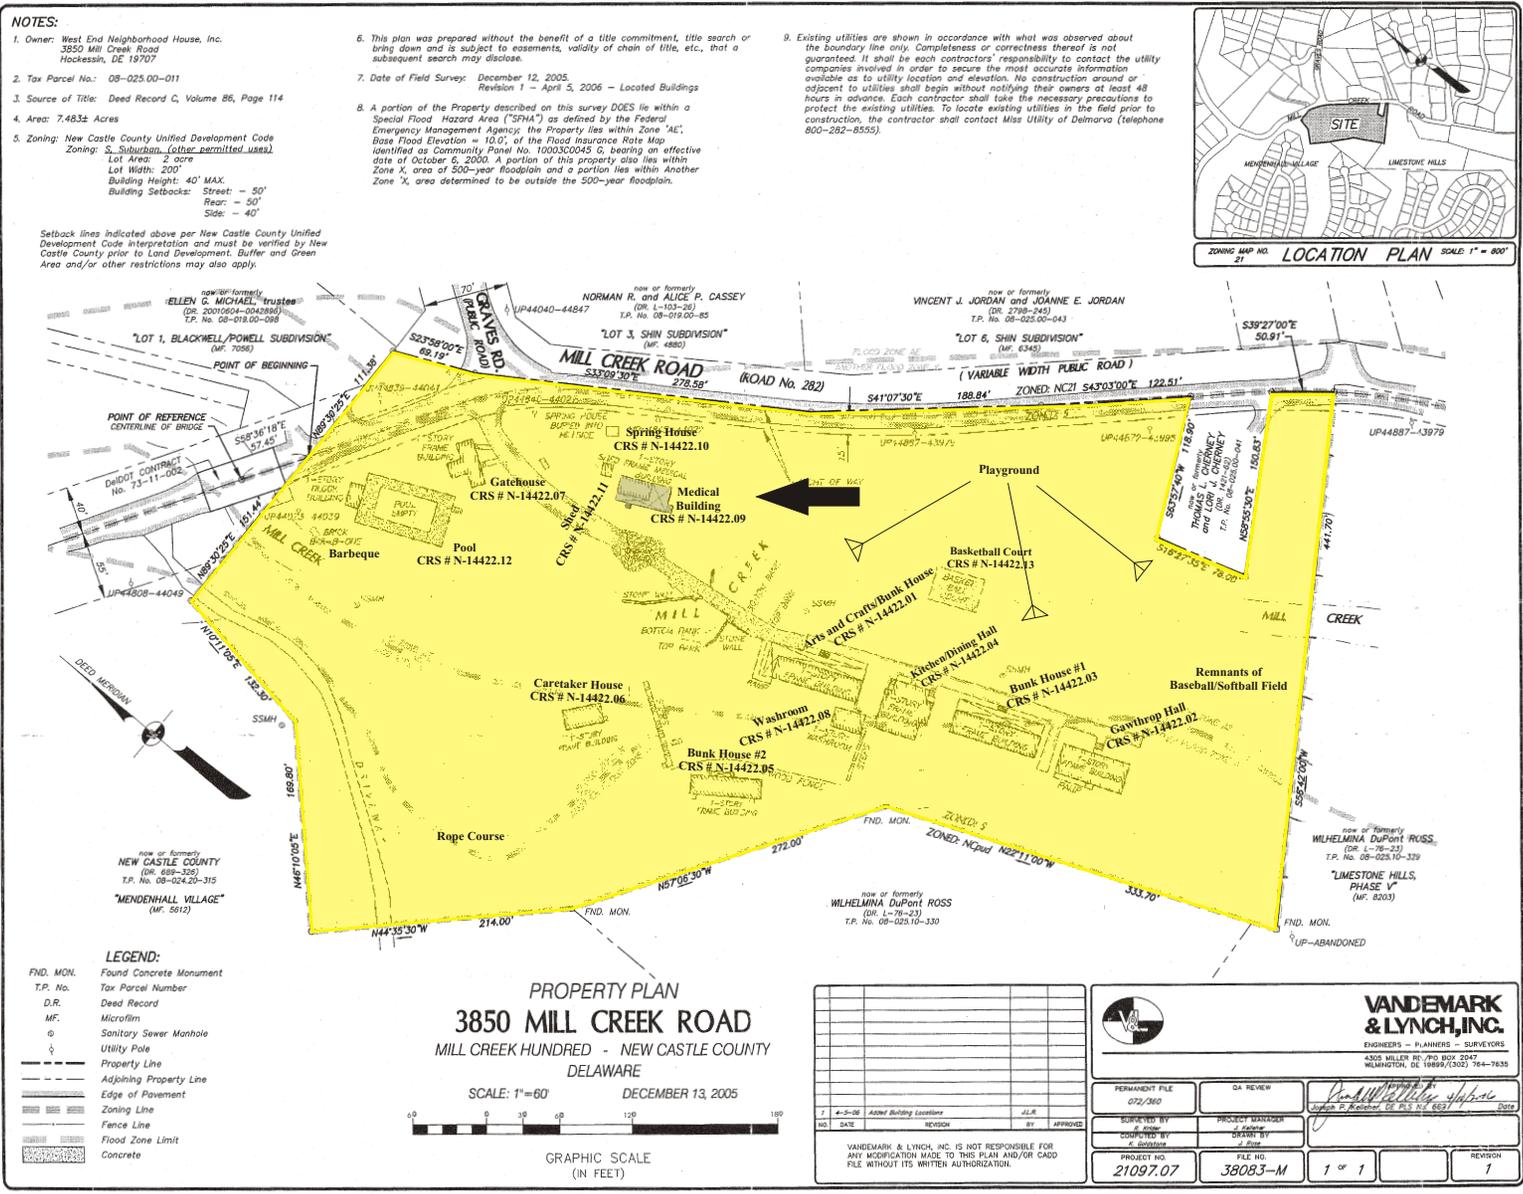

C:\dwg\38083M.dwg, 4/10/2006 10:37:13 AM, Jason Rose, VanDemark & Lynch, Inc.

Boundary of Camp Wright

Camp Wright (TP 08-025.00-011)  
 3850 Mill Creek Road  
 Mill Creek Hundred  
 New Castle County, DE  
 Map of Camp Wright

# MEDICAL BUILDING

CRS # N-14422.09

## Detailed Building Description

### Description

The Medical Building is a rectangular, balloon frame, side gable, one-story, five-bay, one-pile vernacular cabin with a wraparound porch.

### Structural History

The main block of the building was constructed first (c. 1925). The porch along the length of the west elevation was constructed at the same time or soon after. Later still, the southern portion of the porch was constructed. The building was raised on piers in 1993.

### Exterior

The Medical Building is painted hunter green with white trim. The building has simple drop horizontal siding. The corners are boxed in with white painted 1x3 inch boards. The roof is made of 2x8 inch rafters set on 24-inch centers. The rafters are sheathed with 1x5.5 inch tongue and groove boards along the length of the main block of the building with plywood over the southern porch. The roof is covered with coursed asphalt shingles. The west porch roof is covered with asphalt sheet goods. The wooden double sash windows are six-over-six in friction fit metal frames. The windows have simple casings. The building rests on unpainted concrete block and poured concrete piers. Most of the concrete block piers are set on concrete pads. A porch extends the entire length of the west and south elevations. The porch deck is painted grey. The balustrade and porch supports are painted white. The underside of the roof is painted hunter green. There are stairs to the porch on the north end of the west elevation and the west end of the south elevation.

### North Elevation (Side)

- The north elevation of the main block is 14.3 feet long.
- The height of the north elevation above the pillars is 165 inches
- The north elevation rests on three 11-inch diameter piers and one 20-inch square concrete block pier.
- The piers increase in height from 19 inches in the east to 29 inches in the west.
- The piers under the building are set 68.5 and 67 inches apart.
- There are two windows in the north elevation.
- Electrical service is attached to the gable.

### East Elevation (Rear)

- The east elevation is 26.7 feet long.
- The height of the east elevation above the pillars to the roof is 109 inches.
- The north elevation rests on four 11-inch diameter piers and two 20-inch square concrete block piers.
- The piers vary in height between 17 inches in the north and 28 inches in the south.
- The piers under the building are set 76 and 89.5 inches apart.
- There are two windows and one door in the north elevation.

- The frames of the windows and doors are painted hunter green.
- The central window is smaller (28x24 inches) than the other windows as it is a bathroom window.
- The central window is boarded up.
- The door is a solid wood two-panel door with a wood-frame screen door.
- Both the door and the frame of the screen door are painted green.
- There is a stoop of pressure treated lumber outside the door. The stoop is made of 2x4 inch boards supported by 4x4 inch posts.
- The stoop is 48 inches long and 47 inches wide.
- The stoop is on a mound of soil.
- The east elevation of the southern porch addition is much like the west elevation.
- The exposed eaves are 2x6 inch boards set at 24-inch centers.

#### South Elevation (Side)

- The south elevation of the building is 14.3 feet long.
- The height of the north elevation between the deck and the roof is 153 inches.
- There are no openings on the south elevation of the main block.

#### West Elevation (Façade)

- The west elevation is 26.2 feet long.
- The height of the wall between the porch deck and the roof is 99 inches (8.25 ft.).
- There are three doors and three windows on the west elevation.
- The center window is a double window.
- Two of the doors are solid wood, two panel doors with wood-framed screen doors.
- One doorway is covered with plywood.
- The roof has open eaves with exposed rafters.

#### Porch

##### West Porch

- The west elevation of the porch is supported on wooden wood beams on top of six concrete block piers that range between 19.5 and 20 inches square.
- The piers range in height from 30 inches at the north end to 39 inches at the south end.
- Between the wood beams and the deck is a 2x6 inch fascia board.
- The porch deck is made of 2x6 inch boards running east west.
- The roof of the west elevation of the porch is made of 2x6 inch boards set at 24-inch centers.
- The roof is sheathed with 1x5.5 inch tongue and groove boards along the length of the main block of the building.
- The continuation of the west roof along the southern porch addition is sheathed in plywood.
- The porch supports are 4x4 inch boards.
- The entire balustrade is made from 2x4 inch boards.
- The height of the porch ceiling from the deck is 98 inches against the building and 81 inches at the outer edge.

- The north and south end of the porch eaves are covered with simple drop horizontal siding.
- There is a sink mounted on an enclosed cabinet under the northern most window.

#### Southern Porch Addition

- The southern porch addition is single open bay extension that continues both the porch roof and the gable of the building profile.
- The southern porch addition is 16.5 feet north south and 20.75 feet east west.
- The southern extension of the west porch's rear support is made from a 4x4 inch beam scabbed with a 2x6 inch board front and back.
- The southern extension of the west porch's rear support is sagging as there is no center support.
- The southern porch addition is supported by six concrete block piers that range between 20 and 20.5 inches square.
- The heights of the piers range from 39 inches in the southwest corner to 26 inches in the middle of the north elevation.
- The southern porch addition has 2x8 inch ridge.
- The southern porch addition rafters are 2x8 inch boards on 24-inch centers.
- The rafters have a 2x4 inch board collar beams.
- The rafters are sheathed with plywood.
- The porch supports are 4x4 inch boards.
- The entire balustrade is made from 2x4 inch boards.
- The end gable of the porch is covered in simple drop horizontal siding backed by 2x4 inch board framing.
- The porch supports are 4x4 inch boards.
- The entire balustrade is made from 2x4 inch boards.
- A 12-inch wide fascia board is between the porch deck and the piers on the south end.
- A 14-inch wide fascia board is between the porch deck and the piers on the east side.
- A 6 inch wide fascia board is between the porch deck and the piers on the west side.

#### Below Porch

In the southern three bays beneath the porch, there are wooden racks suspended from the floor joists. The racks are used to store additional simple drop siding boards and other lumber.

#### West Stair

- There are six steps.
- The west stair sits on a concrete pad.
- The stairs are green painted wood.
- The steps are 48 inches north south with treads 11 inches front to back.
- The rise of each step varies from 5.5 to 9 inches.
- The stairs have three supports.
- The handrails and posts are made of 2x4 inch boards.
- The handrails and posts are painted white.
- The handrails are attached to the stairs.

### South Stair

- There are five steps.
- The base of the south stair is on poured concrete pads.
- The stairs are green painted wood.
- The steps are 70 inches east west with treads that are 9 inches front to back.
- The risers are 8 inches high.
- The stairs have three supports.
- The handrails are made of welded 1 ½-inch steel pipe.
- The handrails are painted white.
- The bases of the handrails are set in poured concrete.

### **Interior**

All five rooms have a ceiling of 4x8 foot sheets of Masonite 95.5 inches (almost 8 feet) high. The crown moulding is simple.5-inch quarter round moulding. Most interior corners are also covered with the same moulding. The floors are 2x6 inch boards covered with mottled linoleum sheet goods. The walls are painted a pale light green. All doorways and windows have moulded casings.

### Room 1

- Room 1 is 13.7 feet east west and 9 feet north south.
- Room 1 runs the entire width of the building.
- The walls are covered with plywood panels.
- The north wall has two windows.
- There is a porcelain sink mounted between the two windows.
- There is an electric outlet above the sink.
- The east wall has one window.
- The east wall has a built in tool rack and workbench.
- The south wall has a door in the east (access to Room 2) and a doorway in the west end (access to room 3).
- The east door is a solid wood two-panel door with a box lock and separate surface mounted dead bolt.
- The west wall has one window and one exterior door.
- The windows are 31 inches above floor.
- There is one surface mounted fluorescent light fixture.
- This room is filled with tools, assorted camp related equipment, and possessions of the caretaker.

### Room 2 (Bathroom)

- Room 2 is 5.6 feet long and 7.7 feet wide.
- The walls are covered with plywood panels.
- The north wall has a door (access to Room 1).
- The north door is a solid wood two-panel door with a box lock.
- There is a white enameled metal shower stall in the northeast corner.
- The shower stall is 75 inches tall and 32 inches square.

- The east wall has one boarded up window.
- There is a toilet under the window.
- There is a small water heater in the southeast corner beside the toilet.
- The south wall has a door (access to Room 3).
- The south door is a solid wood two-panel door with a box lock and separate surface mounted dead bolt.
- The east wall has a porcelain sink opposite the toilet.
- There is an incandescent light fixture on the ceiling.
- This room is filled with assorted camp related equipment and possessions of the caretaker.

### Room 3

- Room 3 is L shaped and wraps around the south and west walls of Room 2.
- The southern part of the room runs the entire width of the building.
- The maximum dimensions for Room 3 are 13.7 feet east west and 11.4 feet north south.
- The walls are covered with plywood panels.
- There is a doorway (access to Room 1) in the northwest corner, north wall.
- There is a doorway (access to Room 2) in the northeast corner, north wall.
- The door is a solid wood two-panel door with a box lock.
- There is an exterior door in the southeast corner, east wall.
- The east door is a solid wood two-panel door with a box lock and separate surface mounted dead bolt.
- There is a window on the west wall.
- The window is 31 inches from the floor.
- There is an exterior door near the north end of the west wall.
- There is a surface mounted fluorescent light on the ceiling with an exposed conduit from Room 1.
- Taped on the east wall opposite the exterior door is a piece of paper with hand written note. The note states: *“This building is being used by the current tenant of the camp. All items belonging to Darren Kraatz. Please do not touch. Thanks, Darren (302) 234-6690”*
- Many cans of paint and painting supplies are stored in this room.

### Room 4 (storage alcove)

- The room is 4.8 feet north south long and almost 3 feet east west.
- The east and south walls are unfinished.
- The balloon framing consists of 2x4 inch studs set at 24-inch centers.
- The north wall is paneled in plywood.
- There is no light fixture.

### Room 5 (storage closet)

Access Denied. Room 5 is sealed. A local informant, Darren Kraatz the caretaker, informed us that Room 5 is a storage closet.

- The estimated size of the room is 10.7 feet east west and 4.75 feet north-south.


# **MEDICAL BUILDING**

**CRS # N-14422.09**

## **Black and White Photo Log**

- Plate 01: View looking east at west façade elevation.  
Plate 02: View looking southeast at the north side elevation.  
Plate 03: View looking south along the east rear elevation.  
Plate 04: View looking southwest at the east rear elevation.  
Plate 05: View looking north at the south side elevation.

# 1-STORY SHED FRAME MEDICAL BUILDING

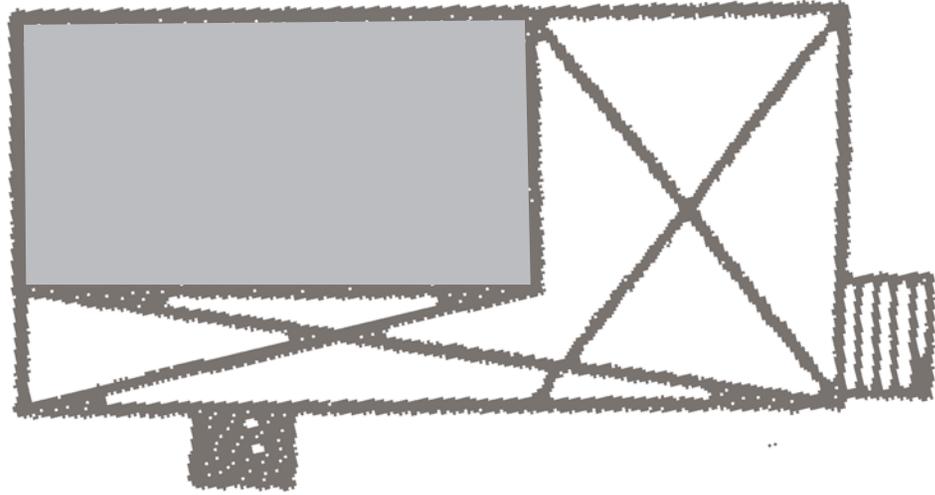

Not to Scale



Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE
MEDICAL BUILDING Black & White - Photo Key (CRS# N-14422.09)



Plate 01: View looking east at the west facade elevation.



Plate 02: View looking southeast at the north side elevation.



Plate 03: View looking south along east rear elevation.



Plate 04: View looking southwest at the east rear elevation.



Plate 05: View looking north at the south side elevation.

# MEDICAL BUILDING

CRS # N-14422.09

## Black and White Photo Index

CONTACT SHEET	DIGITAL IMAGE (JPEG) #	NEGATIVE #	SELECTED PLATE #	DESCRIPTION
1	FL010022	0	1	View looking east at west façade elevation.
1	FL010021	1		View looking southeast at the north side elevation.
1	FL010020	2	5	View looking north at the south side elevation.
1	FL010019	3		Detail of the junction of the west porch and the main block.
1	FL010018	4	3	View looking south along the east rear elevation.
1	FL010017	5		Detail of the two different styles of piers.
1	FL010016	6		Detail of the junction of the west and south porches.
1	FL010015	7		View looking southeast at the profile of the west stairs.
1	FL010014	8		View looking northeast at the profile of the south stairs.
1	FL010013	9		View looking northeast from the south porch.
1	FL010012	10		Detail of west façade doors.
1		11		Overexposed negative.
1		12		Overexposed negative.
1		13		Overexposed negative.
1	FL010011	14		Detail of south porch roof.
1	FL010010	15		View looking southwest along the east rear elevation.
1	FL010009	16		View looking southwest along the north side elevation.
1	FL010008	17	4	View looking southwest at the east rear elevation.
1	FL010007	18		Detail of window.
1	FL010006	19		Detail of covered over small window.
1	FL010005	20	2	View looking southeast at the north side elevation.
1	FL010004	21		View looking east at west façade elevation.
1	FL010003	22		View looking northeast at west façade elevation.
1	FL010002	23		View looking southeast at north side and east façade elevations.
1	FL010001	24		View looking southeast at north side and east façade elevations.

Medical Building  
Qualide NEGATIVE FILE

INSERT FILM EMULSION SIDE DOWN


MADE IN JAPAN

CRS# N-14422.09  
DATE


ASSIGNMENT Camp Wright

NO. 1




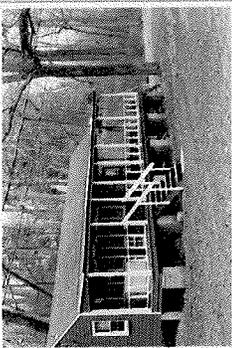

FL010001.jpg

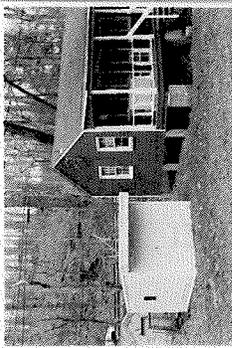


FL010002.jpg

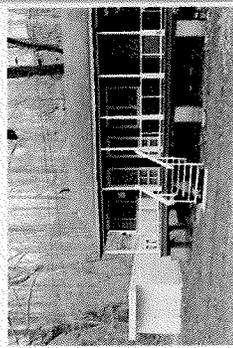


FL010003.jpg



FL010004.jpg

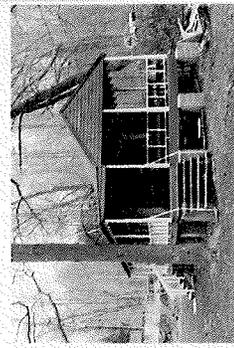


FL010005.jpg

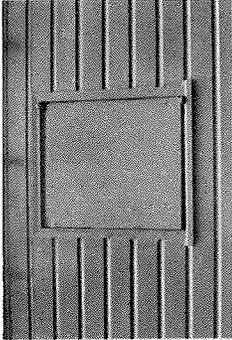


FL010006.jpg




FL010007.jpg

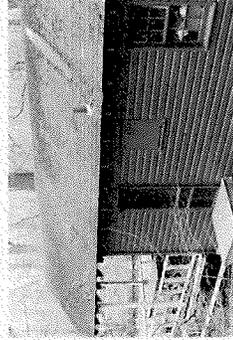


FL010008.jpg

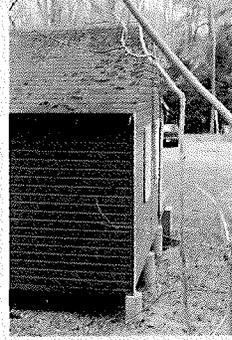


FL010009.jpg

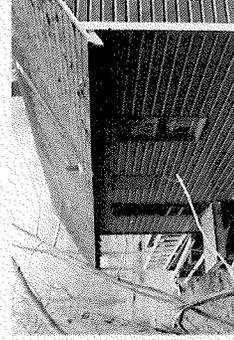

FL010010.jpg

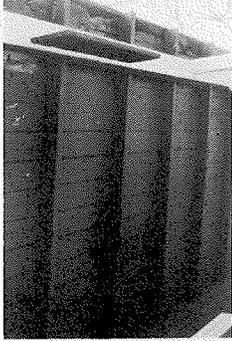


FL010011.jpg

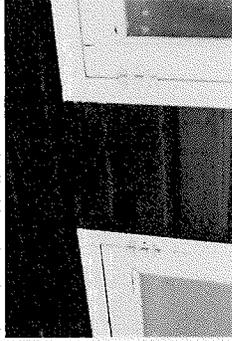


FL010012.jpg



FL010013.jpg

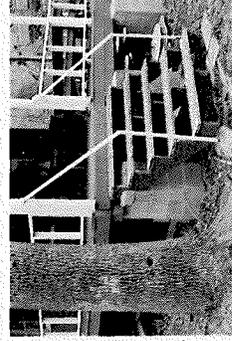


FL010014.jpg

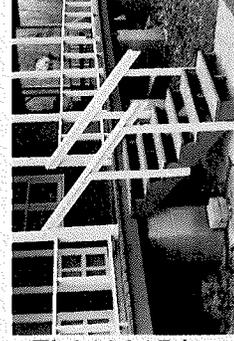

FL010015.jpg



FL010016.jpg

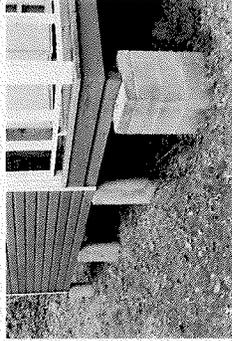


FL010017.jpg




FL010018.jpg



FL010019.jpg

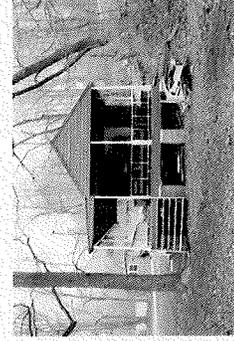

FL010020.jpg

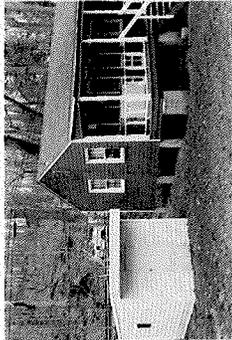

FL010021.jpg



FL010022.jpg

# MEDICAL BUILDING

CRS # N-14422.09

## Digital Photo Log

- Plate 01: View looking east at west elevation.
- Plate 02: View looking southwest at the northern elevation.
- Plate 03: View looking southeast at the west elevation.
- Plate 04: View looking north at the south elevation.
- Plate 05: Detail of two different pillar styles.
- Plate 06: Detail of rear stoop.
- Plate 07: Detail of west steps.
- Plate 08: Detail showing profile of west steps.
- Plate 09: Detail of south steps.
- Plate 10: Detail showing profile of south steps.
- Plate 11: Detail of east elevation window.
- Plate 12: Detail of north elevation window.
- Plate 13: Detail of junction of main structure with west porch.
- Plate 14: Detail of junction south porch with west porch.
- Plate 15: Detail of junction south porch with west porch and main structure. Note simple drop wood siding along interior of main structure junction with south porch.
- Plate 16: Detail of gable of main structure junction with exposed rafters of south porch.
- Plate 17: Detail of interior of gable of south porch.
- Plate 18: Detail of exposed rafters of west porch. Note various styles of sheathing. Note south porch in background.
- Plate 19: Detail of deck of west porch.
- Plate 20: View looking south west within Room 1. Note exterior door and doorway to Room 3.
- Plate 21: View looking south west within Room 1. Note exterior door and doorway to Room 3.
- Plate 22: View looking west within Room 1.
- Plate 23: View looking northeast within Room 1.
- Plate 24: View looking south from Room 1 into Room 2.
- Plate 25: View looking north from Room 2 into Room 1. Note shower stall.
- Plate 26: View looking south within Room 3.
- Plate 27: View looking northeast within Room 3 at southern door to Room 2.
- Plate 28: View looking south at Room 4. Note unfinished south wall.
- Plate 29: View looking southeast from Room 3 at east exterior door (covered in plastic) and Room 4.
- Plate 30: Detail of junction of main structure with west porch. Note cast concrete pier.
- Plate 31: Detail of pier. Note 4x4 inch porch support goes through deck and resting on top of pier.
- Plate 32: Detail of balustrade on north end of west porch.

# 1-STORY SHED FRAME MEDICAL BUILDING



2

3

11

6

20

24

21

25

28

27

17

16

4

12

30

13

22

23

26

29

15

14

32

18

9

5

8

7

19

31

10

1

Not to Scale



Camp Wright (TP 08-025.00-011)  
3850 Mill Creek Road  
Mill Creek Hundred  
New Castle County, DE

MEDICAL BUILDING  
Digital - Photo Key  
(CRS# N-14422.09)



**Plate 01: View looking east at west elevation.**



**Plate 02: View looking southwest at the northern elevation.**



**Plate 03: View looking southeast at the west elevation.**



**Plate 04: View looking north at the south elevation.**



**Plate 05: Detail of two different pillar styles.**



**Plate 06: Detail of rear stoop.**



**Plate 07: Detail of west steps.**



**Plate 08: Detail showing profile of west steps.**



**Plate 09:** Detail of south steps.



**Plate 10:** Detail showing profile of south steps.



**Plate 11:** Detail of east elevation window.



**Plate 12:** Detail of north elevation window.



**Plate 13: Detail of junction of main structure with west porch.**



**Plate 14: Detail of junction south porch with west porch.**



**Plate 15:** Detail of junction south porch with west porch and main structure. Note simple drop wood siding along interior of main structure junction with south porch.



**Plate 16:** Detail of gable of main structure junction with exposed rafters of south porch.



**Plate 17:** Detail of interior of gable of south porch.



**Plate 18:** Detail of exposed rafters of west porch. Note various styles of sheathing. Note south porch in background.



**Plate 19:** Detail of deck of west porch.



**Plate 20:** View looking south west within Room 1. Note exterior door and doorway to Room 3.



**Plate 21:** View looking south west within Room 1. Note exterior door and doorway to Room 3.



**Plate 22:** View looking west within Room 1.



**Plate 23:** View looking northeast within Room 1.



**Plate 24:** View looking south from Room 1 into Room 2.



Plate 25: View looking north from Room 2 into Room 1. Note shower stall.



Plate 26: View looking south within Room 3.



**Plate 27:** View looking northeast within Room 3 at southern door to Room 2.



**Plate 28:** View looking south at Room 4. Note unfinished south wall.



**Plate 29:** View looking southeast from Room 3 at east exterior door (covered in plastic) and Room 4.



**Plate 30:** Detail of junction of main structure with west porch. Note cast concrete pier.



**Plate 31:** Detail of pier. Note 4x4 inch porch support goes through deck and resting on top of pier.

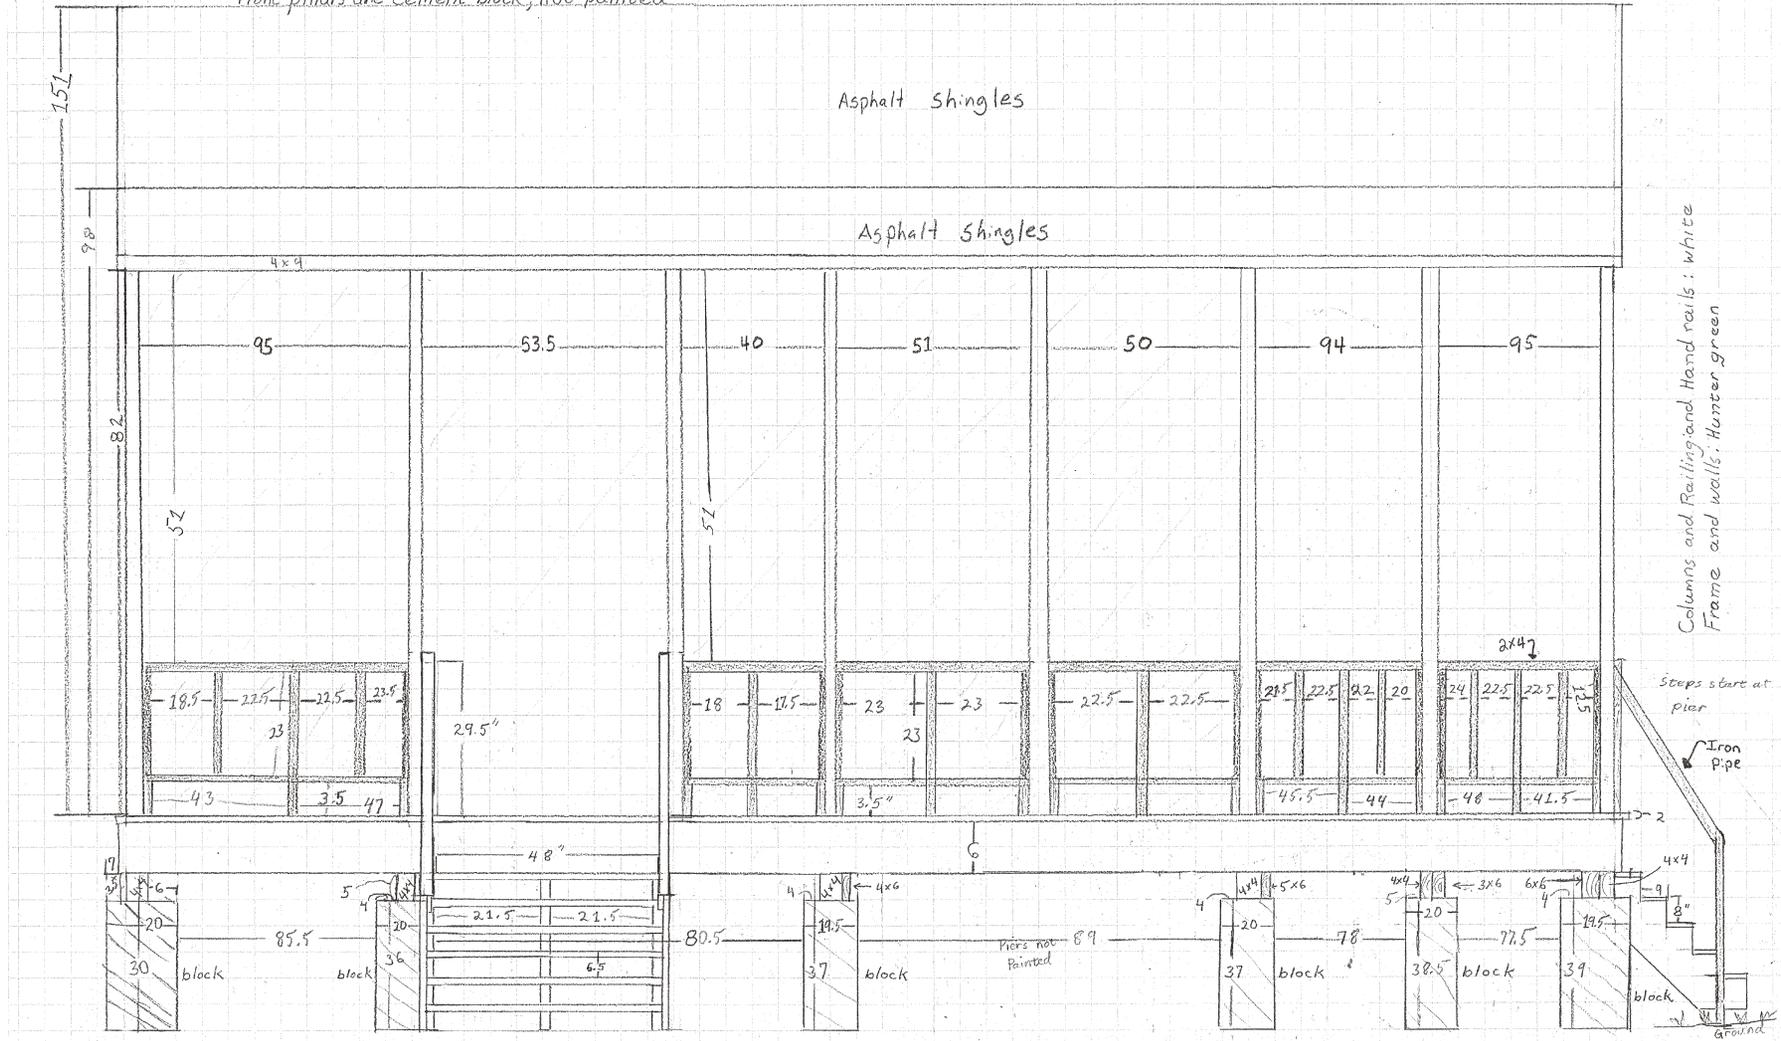


**Plate 32:** Detail of balustrade on north end of west porch.

### West Porch-Elevation

Notes: All columns are 4x4's. Columns extend through porch deck to piers  
Front pillars are cement block, not painted

Not to scale  
All measurements in inches



Not to Scale


Camp Wright (TP 08-025.00-011)  
3850 Mill Creek Road  
Mill Creek Hundred  
New Castle County, DE

Medical Building  
West Porch - Elevation  
(CRS# N-14422.09)

Facade West Elevation w/o porch or roof

Notes: Not to scale  
All measurements in inches

Hunter green  
Drop siding

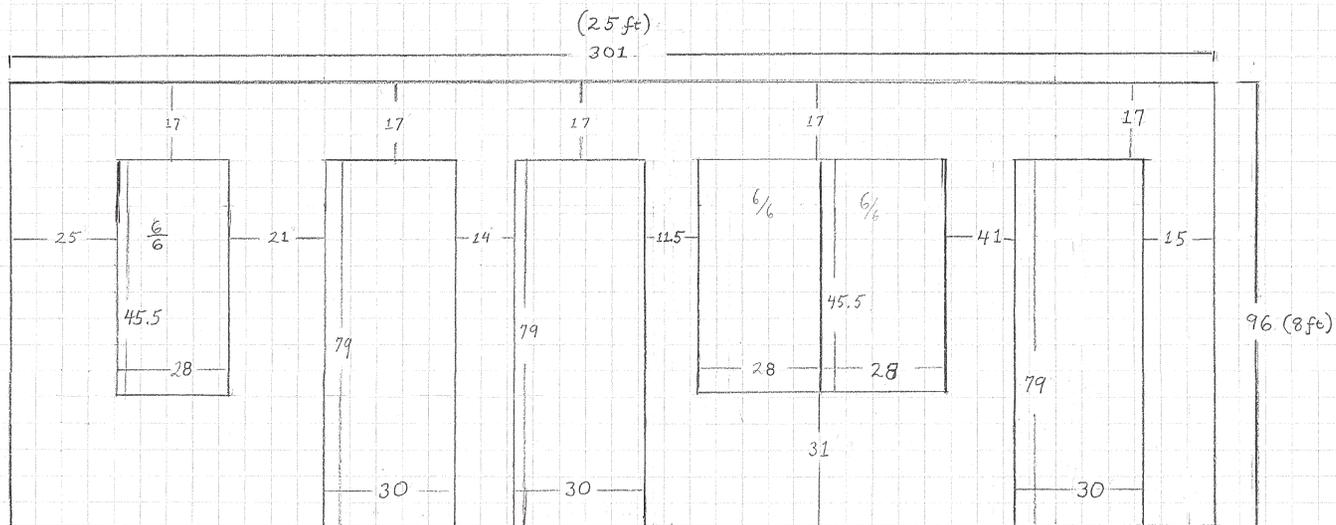


Not to Scale

Camp Wright (TP 08-025.00-011)  
3850 Mill Creek Road  
Mill Creek Hundred  
New Castle County, DE

Medical Building  
Facade (west) - Elevation  
(CRS# N-14422.09)

Camp Wright:  
Medical Building

North Elevation

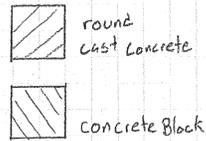


Notes: Hunter Green w/ white trim.  
Horizontal wood siding  
siding has a cove routed on upper edge.

simple drop siding




Steps: Front steps treads are 2 x 4's

Not to scale  
All measurements in inches

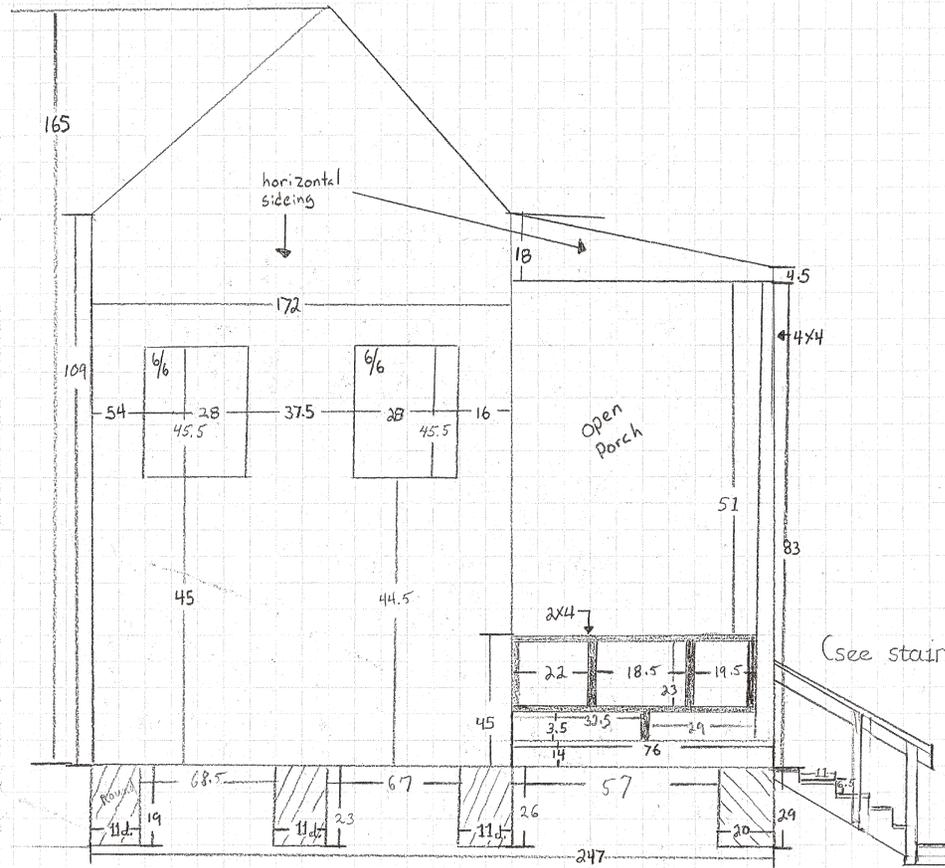

Detail of wood hand rail

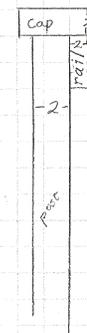


cap: 2x4  
rail: 2x4  
post: 2x4

Not to Scale

Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE
Medical Building Side (north) - Elevation (CRS# N-14422.09)

Notes: Balustrade made with 2x4s  
 Not to scale  
 All measurements in inches  
 Stoop is unpainted presure treated wood.  
 Piers under main block are cast concrete cylinders.

Medical Building  
 East Elevation (Rear)

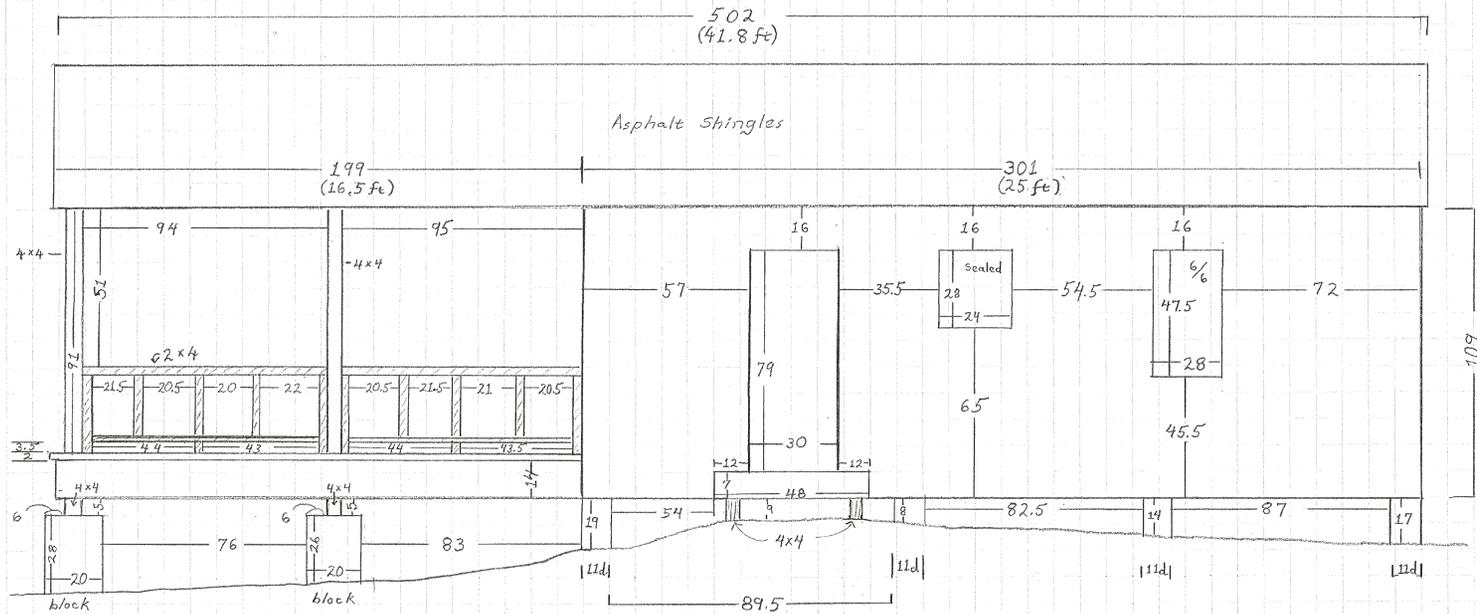



Not to Scale

Camp Wright (TP 08-025.00-011)  
 3850 Mill Creek Road  
 Mill Creek Hundred  
 New Castle County, DE

Medical Building  
 Rear (east) - Elevation  
 (CRS# N-14422.09)


Camp Wright:  
Medical Building  
South Porch Elevation

Notes: No apertures on south gable end.  
South hand rails are pipe, white  
Not to scale  
All measurements in inches  
See stair detail

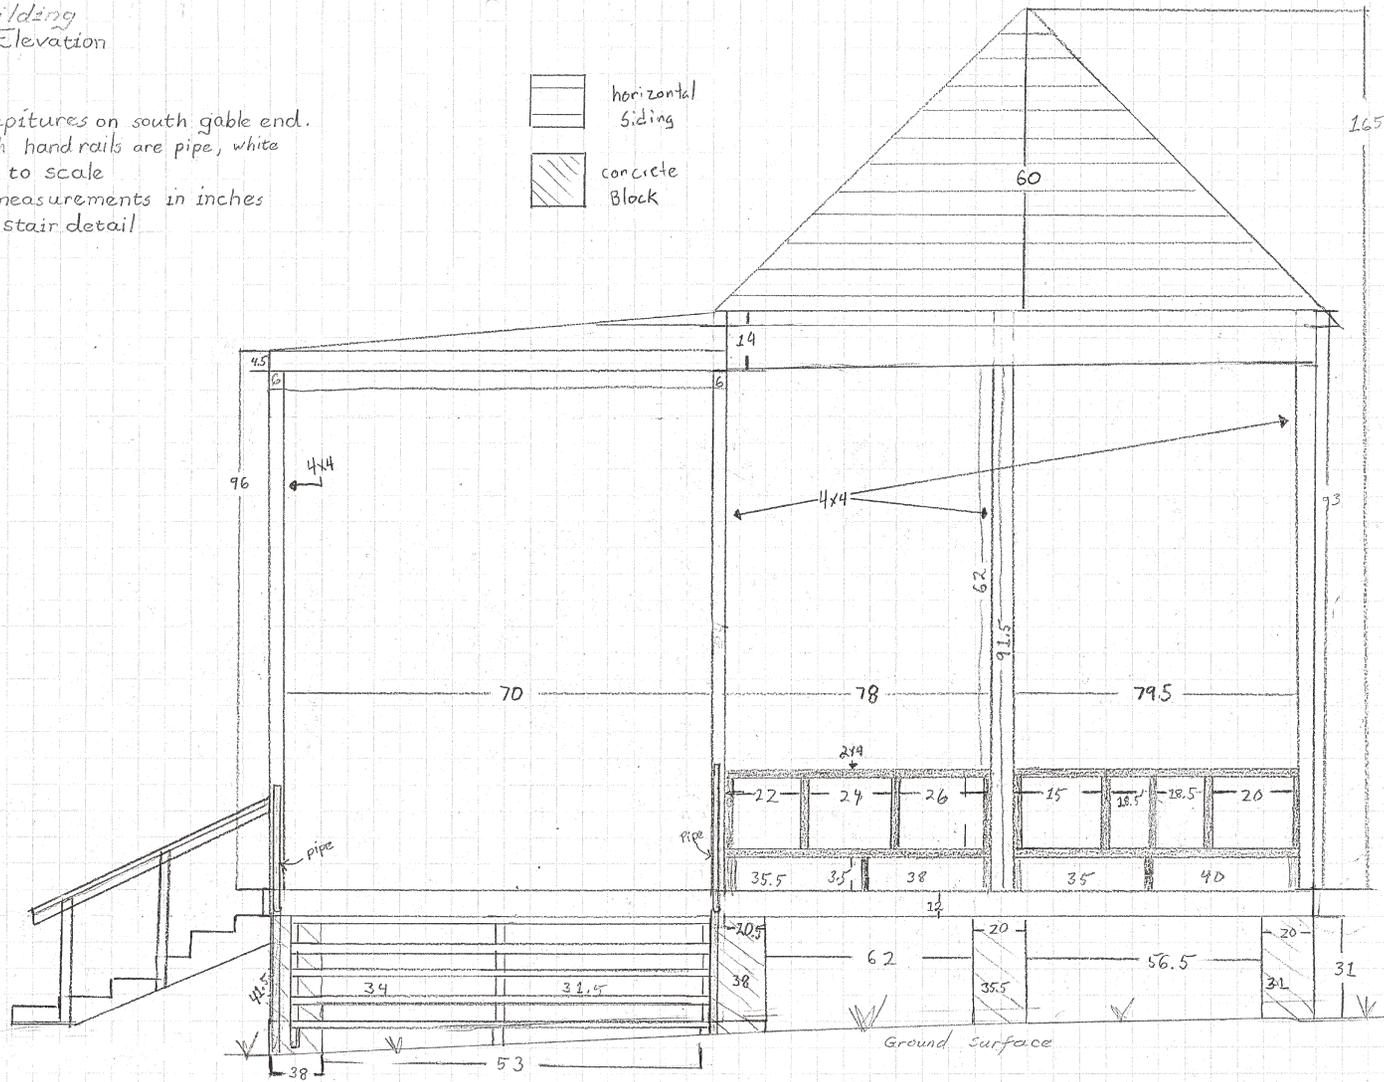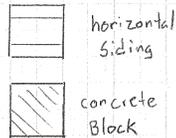


Not to Scale

Camp Wright (TP 08-025.00-011)  
3850 Mill Creek Road  
Mill Creek Hundred  
New Castle County, DE  
Medical Building  
South Porch - Elevation  
(CRS# N-14422.09)

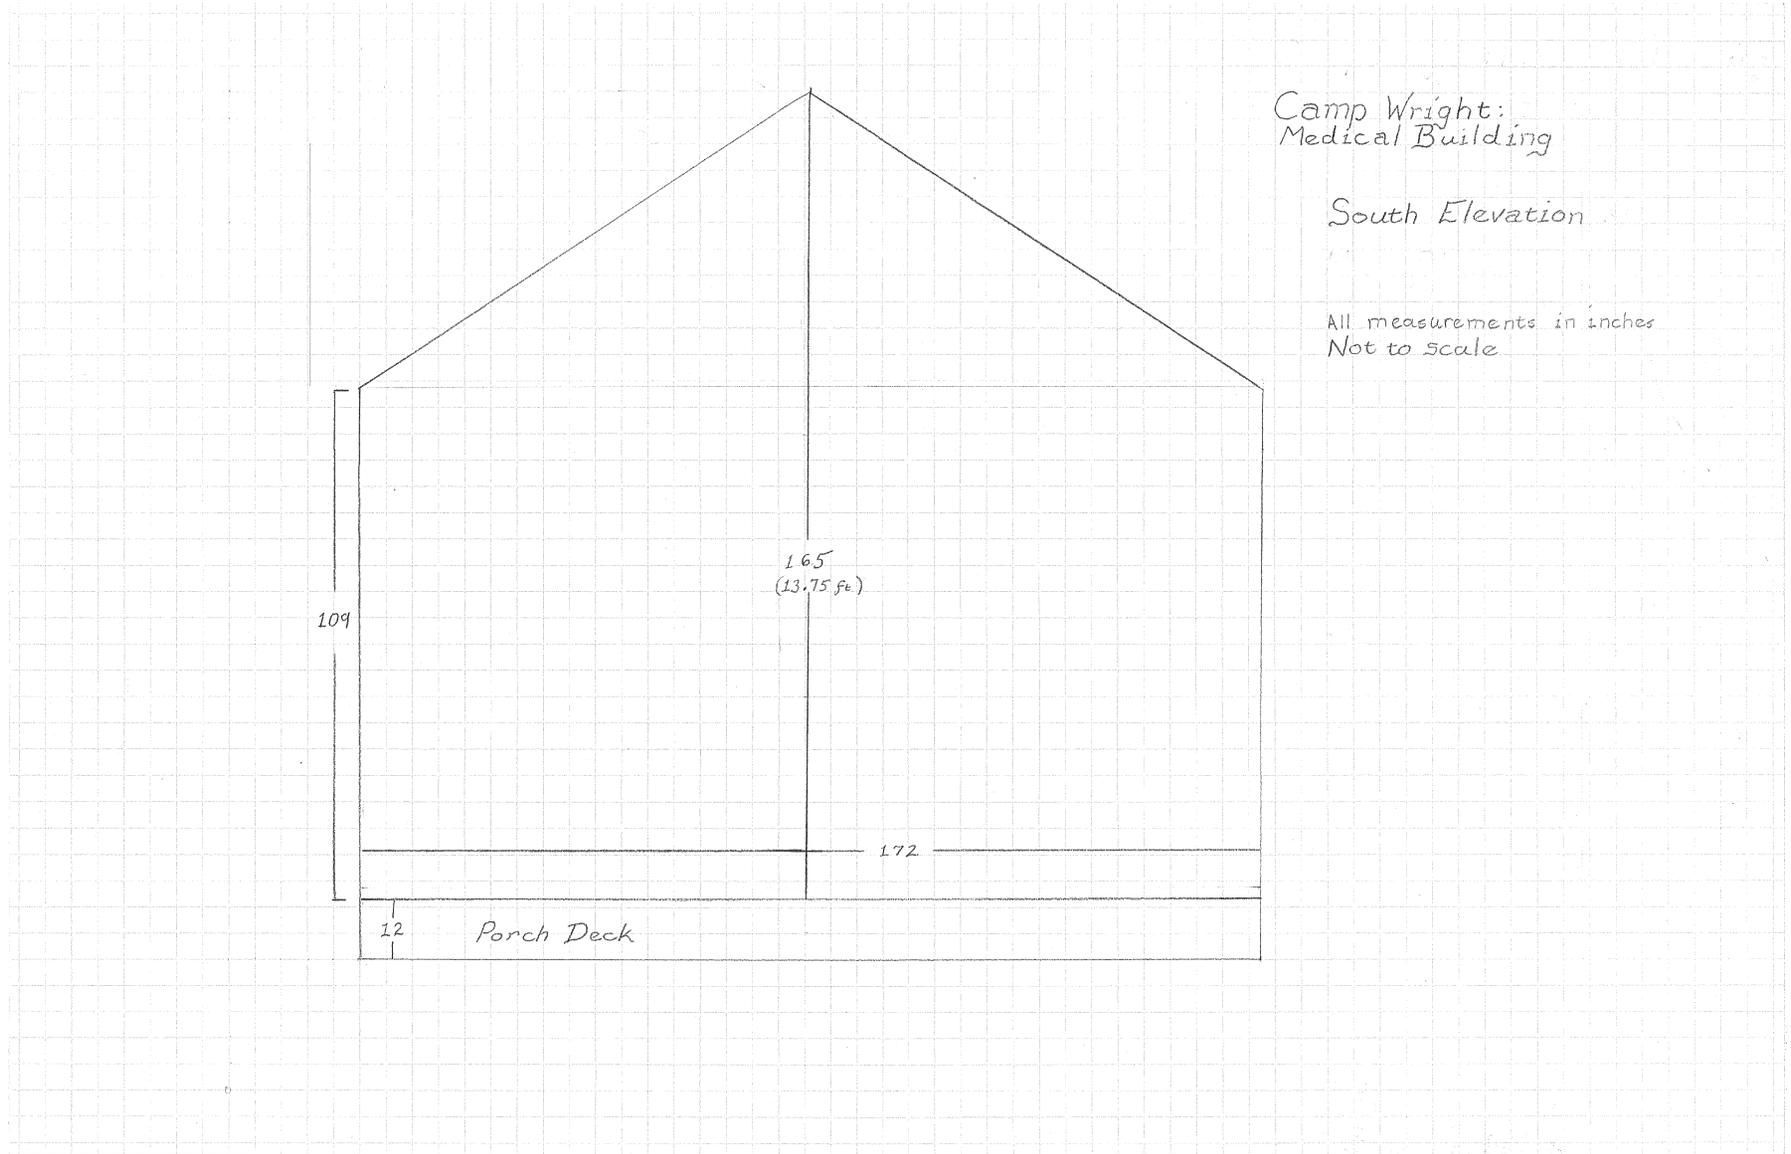

Not to Scale



Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE
Medical Building Side (south) - Elevation (CRS# N-14422.09)

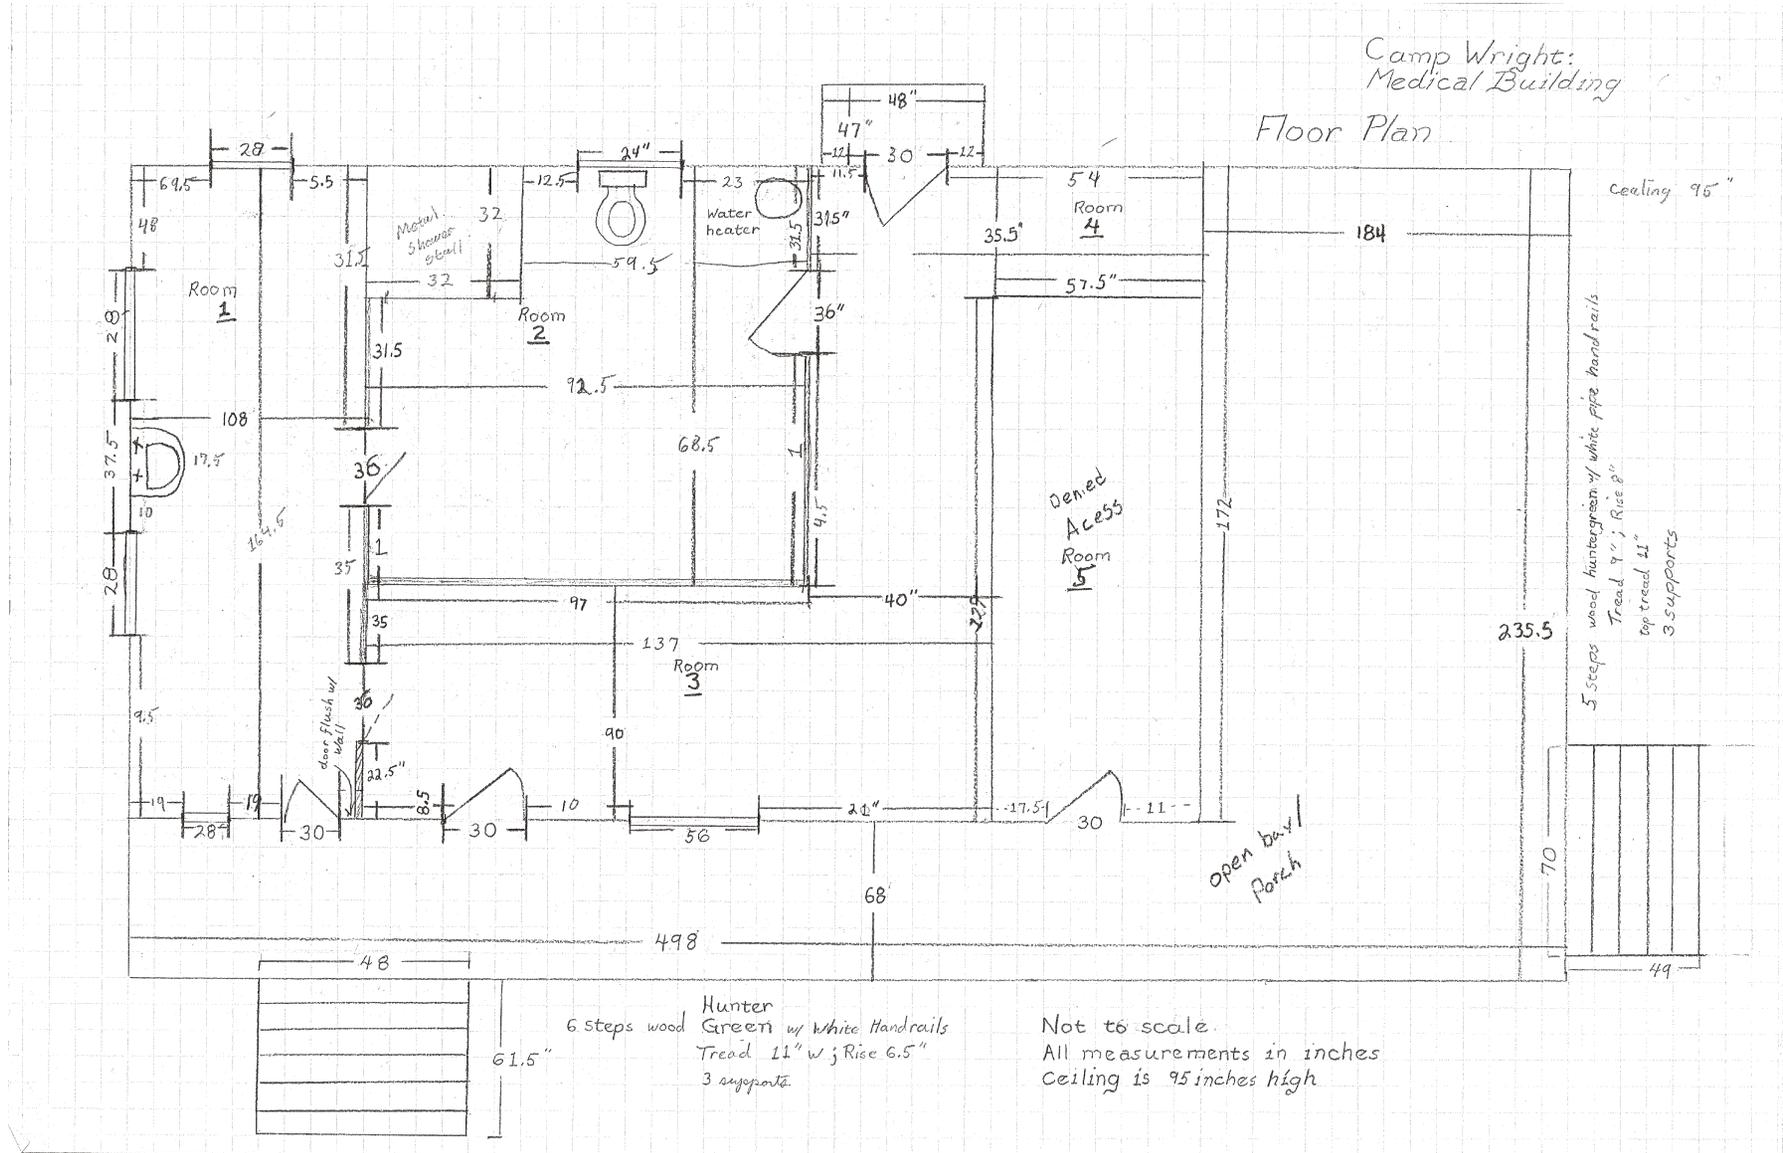

Not to Scale

Camp Wright (TP 08-025.00-011)  
 3850 Mill Creek Road  
 Mill Creek Hundred  
 New Castle County, DE

Medical Building  
 Floor Plan  
 (CRS# N-14422.09)

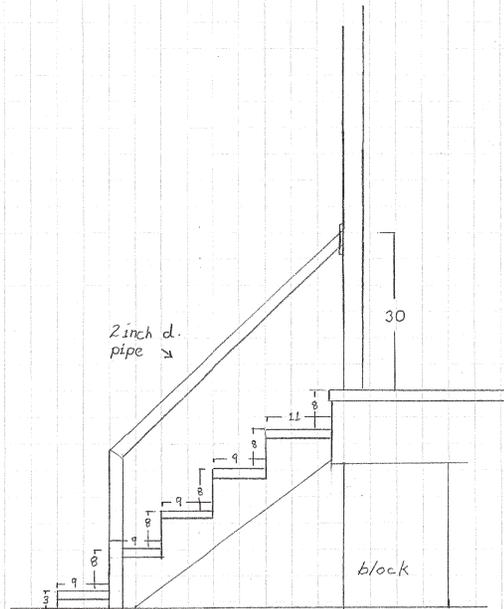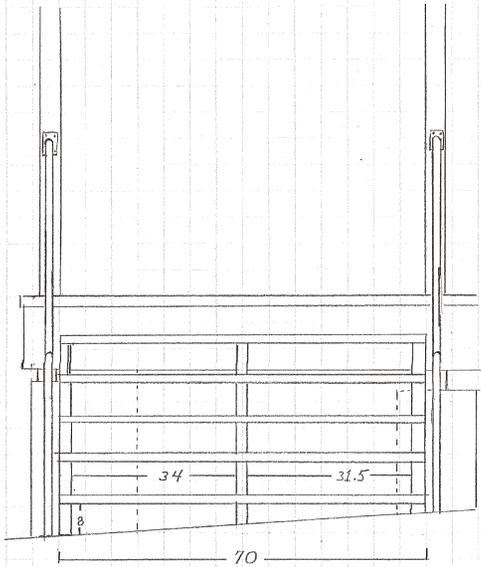


Camp Wright:  
Medical Building  
Detail - South Stair

- Notes:
- Not to scale
  - All measurements in inches
  - Handrails are white painted steel pipe set in poured concrete bases
  - 3 stair supports
  - Each step is one 2x10.

Not to Scale

Camp Wright (TP 08-025.00-011)  
3850 Mill Creek Road  
Mill Creek Hundred  
New Castle County, DE

Medical Building  
Detail - South Stair  
(CRS# N-14422.09)

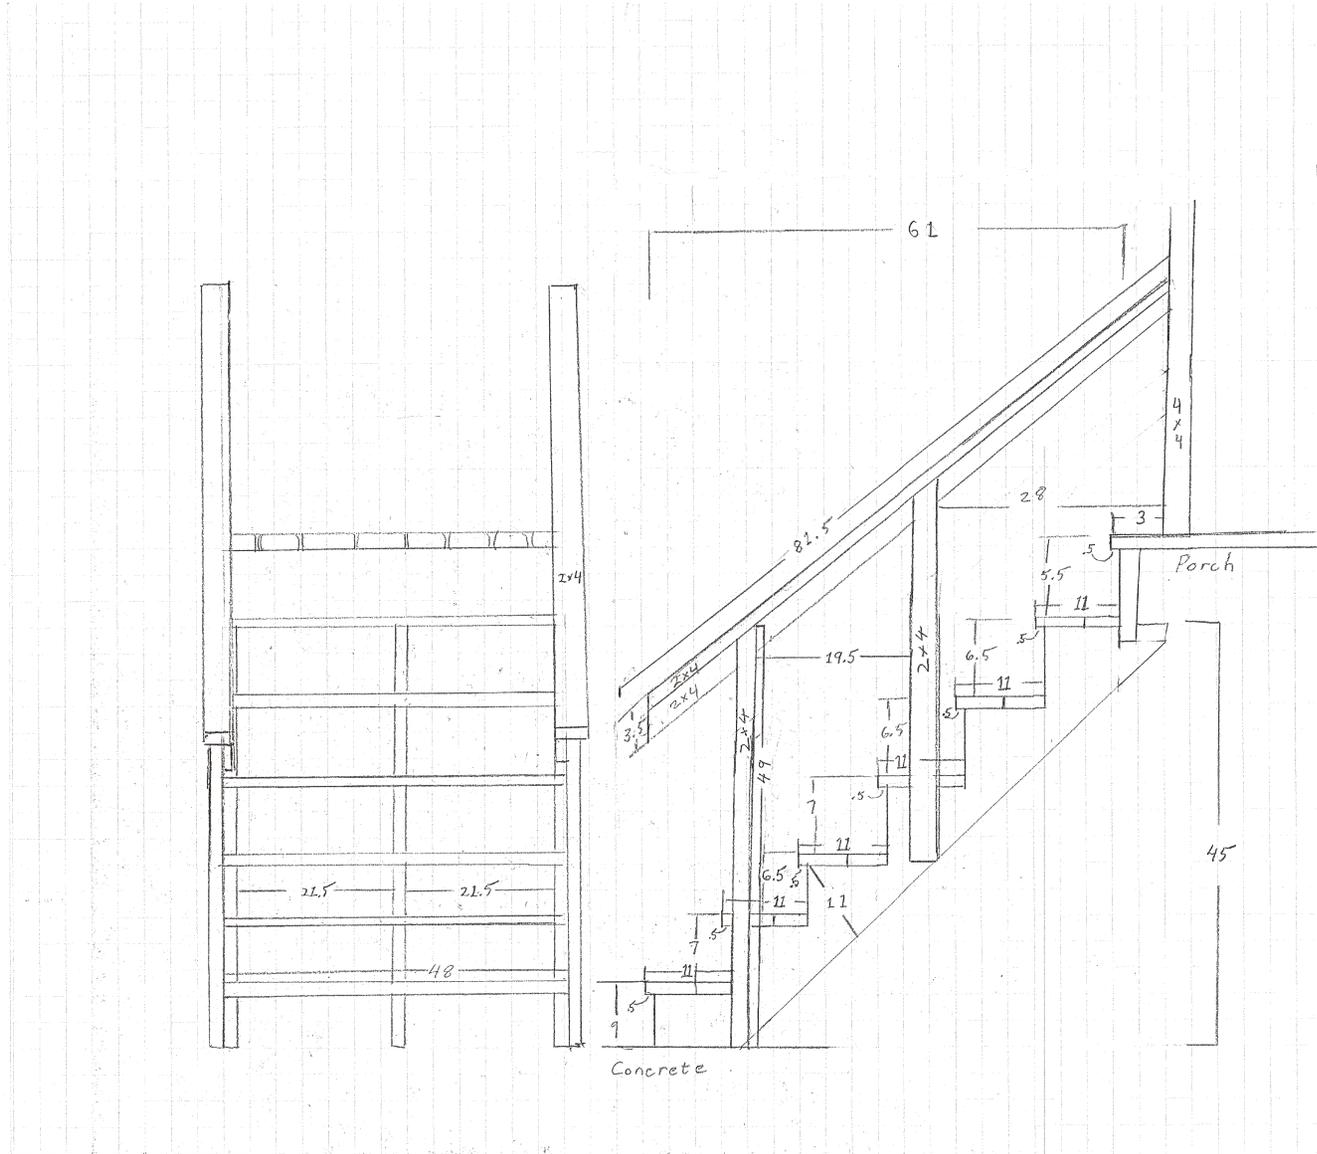

Camp Wright :  
Medical Building  
Detail: West Stair


All measurements in inches

Not to scale

Treads : paired 2x4s

Not to Scale

Camp Wright (TP 08-025.00-011) 3850 Mill Creek Road Mill Creek Hundred New Castle County, DE
Medical Building Detail - West Stair (CRS# N-14422.09)

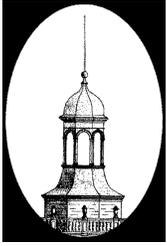

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # N-14422.09

1. ADDRESS/LOCATION: 3850 Mill Creek Road/S side of Mill Creek Road at intersection with Graves Road

2. FUNCTION(S): historic medical building current not in use

3. YEAR BUILT: 1925 CIRCA?:  ARCHITECT/BUILDER: unknown

4. STYLE/FLOOR PLAN: five-bay, two pile vernacular cabin

5. INTEGRITY: original site  moved

if moved, from where original location's CRS # year

list major alterations and additions with years (if known)

a. Raised on piers to prevent flood damage year 1993

b.

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

a. Structural system frame

b. Number of stories one

c. Wall coverings vertical wood board siding

d. Foundation concrete block piers

e. Roof

structural system frame

coverings asphalt shingles

openings N/A

8. DESCRIPTION OF ELEVATIONS:

a. Facade: direction: west

1) bays: five

2) windows: three (3) six-over-six double hung windows with wood sashes

3) door(s): two (2) wood paneled doors and one (1) enclosed door

4) other: one story wrap around porch with wood posts and asphalt shingle covered roof

**b. Side: direction:** south

- 1) **bays:** two
- 2) **windows:** two (2) enclosed window openings
- 3) **door(s):** N/A
- 4) **other:** N/A

**c. Side: direction:** north

- 1) **bays:** two
- 2) **windows:** two (2) six-over-six double hung windows with wood sashes and trim
- 3) **door(s):** N/A
- 4) **other:** N/A

**d. Rear: direction:** east

- 1) **bays:** not accessible
- 2) **windows:** not accessible
- 3) **door(s):** not accessible
- 4) **other:** N/A

**9. INTERIOR (if accessible):**

**a) Floor plan**            central parlor with three adjoining rooms

**b) Partition/walls**

**c) Finishes**            wood board flooring, artificial wood board interior walls

**d) Furnishings/machinery**            N/A