


**Appendix A**

**Cultural Resource Survey Forms**

N04337  
N01610

2 Nob Hill Road  
3600 Mill Creek Road

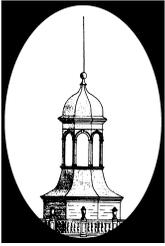

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
PROPERTY IDENTIFICATION FORM

CRS # N04337  
SPO Map 08-09-36  
Hundred Christiana  
Quad Wilmington-N  
Other \_\_\_\_\_

- HISTORIC NAME/FUNCTION: Dwelling
- ADDRESS/LOCATION: 2 Nob Hill Road
- TOWN/NEAREST TOWN: Wilmington vicinity?
- MAIN TYPE OF RESOURCE: building  structure  site  object   
landscape  district
- MAIN FUNCTION OF PROPERTY: Property Boundary
- PROJECT TITLE/ REASON FOR SURVEY (if applicable): National Register Eligibility Status and Evaluation for Properties at the Intersection of Mill Creek and Stoney Batter Roads

7. ADDITIONAL FORMS USED:

#:	Form:	List property types:
1	CRS 2 Main Building Form	Dwelling
1	CRS 3 Secondary Building Form	
	CRS 4 Archaeological Site Form	
	CRS 5 Structure (Building-Like) Form	
	CRS 6 Structure (Land Feature) Form	
1	CRS 7 Object Form	
	CRS 8 Landscape Elements Form	
1	CRS 9 Map Form	N/A
	CRS 14 Potential District Form	

8. SURVEYOR INFORMATION:

Surveyor name: Jon Schmidt

Principal Investigator name: Jon Schmidt

Principal Investigator signature: \_\_\_\_\_


Organization: DeIDOT Environmental Studies Date: 2/3/11

10. STATE HISTORIC CONTEXT FRAMEWORK (check all appropriate boxes; refer to state management plan(s)):

- a) Time period(s)
- Pre-European Contact
  - Paleo-Indian
  - Archaic
  - Woodland I
  - Woodland II
  - 1600-1750∇ Contact Period (Native American)
  - 1630-1730∇ Exploration and Frontier Settlement
  - 1730-1770∇ Intensified and Durable Occupation
  - 1770-1830∇ Early Industrialization
  - 1830-1880∇ Industrialization and Early Urbanization
  - 1880-1940∇ Urbanization and Early Suburbanization
  - 1940-1960∇ Suburbanization and Early Ex-urbanization

- b) Geographical zone
- Piedmont
  - Upper Peninsula
  - Lower Peninsula/Cypress Swamp
  - Coastal
  - Urban (City of Wilmington)

- c) Historic period theme(s)
- |  |   |
|--|---|
| <input type="checkbox"/> Agriculture           | <input type="checkbox"/> Transportation and Communication                         |
| <input type="checkbox"/> Forestry              | <input checked="" type="checkbox"/> Settlement Patterns and Demographic Changes   |
| <input type="checkbox"/> Trapping/Hunting      | <input checked="" type="checkbox"/> Architecture, Engineering and Decorative Arts |
| <input type="checkbox"/> Mining/Quarrying      | <input type="checkbox"/> Government   |
| <input type="checkbox"/> Fishing/Oystering     | <input type="checkbox"/> Religion   |
| <input type="checkbox"/> Manufacturing         | <input type="checkbox"/> Education  |
| <input type="checkbox"/> Retailing/Wholesaling | <input type="checkbox"/> Community Organizations                                  |
| <input type="checkbox"/> Finance               | <input type="checkbox"/> Occupational Organizations                               |
| <input type="checkbox"/> Professional Services | <input type="checkbox"/> Major Families, Individuals and Events                   |

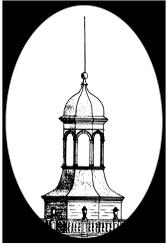

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
MAIN BUILDING FORM

CRS # N04337

1. ADDRESS/LOCATION: 2 Nob Hill Road

2. FUNCTION(S): historic Dwelling current Dwelling

3. YEAR BUILT: 1960 CIRCA?:  ARCHITECT/BUILDER: N/A

4. STYLE OR FLOOR PLAN: Split level

5. INTEGRITY: original site  moved   
if moved, from where other location's CRS # year

list major alterations and additions with years (if known) year

a. Window replacement a

b. Enclosed three season room

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION: (Describe the resource as completely as possible. Use N/A for not applicable; leave no blanks.)

a. Overall shape: Rectangular Stories: Two (2)  
Additions: Attached two-car garage; dormers at rear elevation

b Structural system (if known): Frame

c. Foundation: materials: Concrete block with exterior brick and permastone  
basement: full  partial  not visible  no basement

d. Exterior walls (original if visible& any subsequent coverings): brick and permastone at first story,  
aluminum siding at second story

e. Roof: shape: side gable  
materials: asphalt  
cornice: Broad overhanging eaves with plain box cornice  
dormers: three-bay shed roof dormer at rear elevation  
chimney: location(s): external brick chimney at south gable end and partially engaged brick chimney  
at north gable end

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: W

1) Bays Six (6)

2) Windows

fenestration Irregular and asymmetrical arranged in singles and pairs  
type one/one vinyl sash (some with grille inserts), fixed bay  
trim narrow vinyl surrounds; permastone sills  
shutters fixed, louvered, aluminum



**Facade (cont'd)**

- 3) **Door(s)** One (1)  
     **location** central  
     **type** Contemporary steel and leaded-glass  
     **trim** paired glass-over-wood-paneled sidelights
- 4) **Porch(es)** engaged, poured-concrete stoop under overhanging eave

**b. Side: Direction: N**

- 1) **Bays** Two (2)
- 2) **Windows** Central  
     **fenestration** Regular and Symmetrical  
     **type** one/one vinyl sash  
     **trim** narrow vinyl surround  
     **shutters** N/A
- 3) **Door(s)** Two (2)  
     **location** Central  
     **type** Contemporary, vinyl, roll-up garage doors  
     **trim** plain wood reveals
- 4) **Porch(es)** Concrete walkway under an engaged porch that runs along the eastern elevation

**c. Side: Direction: S**

- 1) **Bays** Two (2)
- 2) **Windows**  
     **fenestration** Regular and symmetrical  
     **type** one/one vinyl sash  
     **trim** narrow vinyl surround  
     **shutters** fixed, louvered, aluminum
- 3) **Door(s)** N/A  
     **location**  
     **type**  
     **trim**
- 4) **Porch(es)** N/A

**d. Rear: Direction: E**

- 1) **Bays** Six (6)
- 2) **Windows**  
     **fenestration** Irregular and asymmetrical  
     **type** one/one vinyl sash, fixed, bay  
     **trim** narrow vinyl surround, turned brick and permastone sills  
     **shutters** fixed, louvered, aluminum
- 3) **Door(s)** Three (3)  
     **location** south; center; north  
     **type** sliding glass; 9-light/2-panel, glass and wood; 9-light/2-panel, glass and wood  
     **trim** narrow wood surrounds
- 4) **Porch(es)** partially engaged concrete walkway w/ poured concrete retaining wall @ N


9. **INTERIOR:** N/A

10. **LANDSCAPING:** Typical suburban landscaping with mature plants and trees. Minor landscaping features are executed in permastone. There is a pool and poolhouse situated southeast of the residence.

11. **OTHER COMMENTS:**

USE BLACK INK ONLY

CRS-2

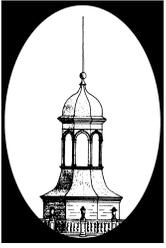

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # N04337

1. ADDRESS/LOCATION: 2 Nob Hill Road

2. FUNCTION(S): historic Garage and pool house current Garage and pool house

3. YEAR BUILT: 1960 CIRCA?:  ARCHITECT/BUILDER: \_\_\_\_\_

4. STYLE/FLOOR PLAN: Garage

5. INTEGRITY: original site  moved   
if moved, from where original location's CRS # year

list major alterations and additions with years (if known) year

a.

b.

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

a. Structural system **Frame**

b. Number of stories **One**

c. Wall coverings **Brick-clad exterior**

d. Foundation **poured concrete slab**

e. Roof

structural system **frame side gable roof**

coverings **asphalt shingles**

openings **central, brick chimney with corbelled cap**

8. DESCRIPTION OF ELEVATIONS:

a. Facade: direction: **S**

1) **bays:** Two interior bays, one partially enclosed and three open bays

2) **windows:** Partially enclosed bay features a ribbon of screened windows; stylized concrete block opening

3) **door(s):** Contemporary roll-up garage door

4) **other:** A rectangular in-ground pool is situated southwest of the resource enclosed by a wooden privacy fence



**b. Side: direction: E**

- 1) **bays:** One
- 2) **windows:** central glass siding window
- 3) **door(s):** N/A

4) **other:** The garage is partially built into the side of a hill and the northern end of the elevation is partially subterranean

**c. Side: direction: W**

- 1) **bays:** Two
- 2) **windows:** Screened in porch projects at northern end of elevation
- 3) **door(s):** Two-flat panel wood door at southern end.

4) **other:** broad overhanging eave at the garage/pool house. A three-open-bay, partially enclosed concrete pool deck extends westward from the northern end of the west elevation.

**d. Rear: direction: N**

- 1) **bays:** Five (5)
- 2) **windows:** fixed, glass
- 3) **door(s):** N/A

4) **other:** The full elevation is constructed of concrete block. The portion above ground at the north elevation is clad with brick

**9. INTERIOR (if accessible):**

a) Floor plan            **N/A**


b) Partition/walls        **N/A**

c) Finishes            **N/A**

d) Furnishings/machinery    **N/A**

USE BLACK INK ONLY

CRS-3

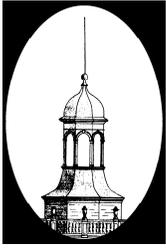

CULTURAL RESOURCE SURVEY

CRS # N04337


MAP FORM

1. ADDRESS/LOCATION: 2 Nob Hill Road Wilmington, DE
2. NOT FOR PUBLICATION  reason: \_\_\_\_\_
3. LOCATION MAP:


Indicate position of resource in relation to geographical landmarks such as streams and crossroads.

(attach section of USGS quad map with location marked or draw location map )

INDICATE NORTH ON SKETCH

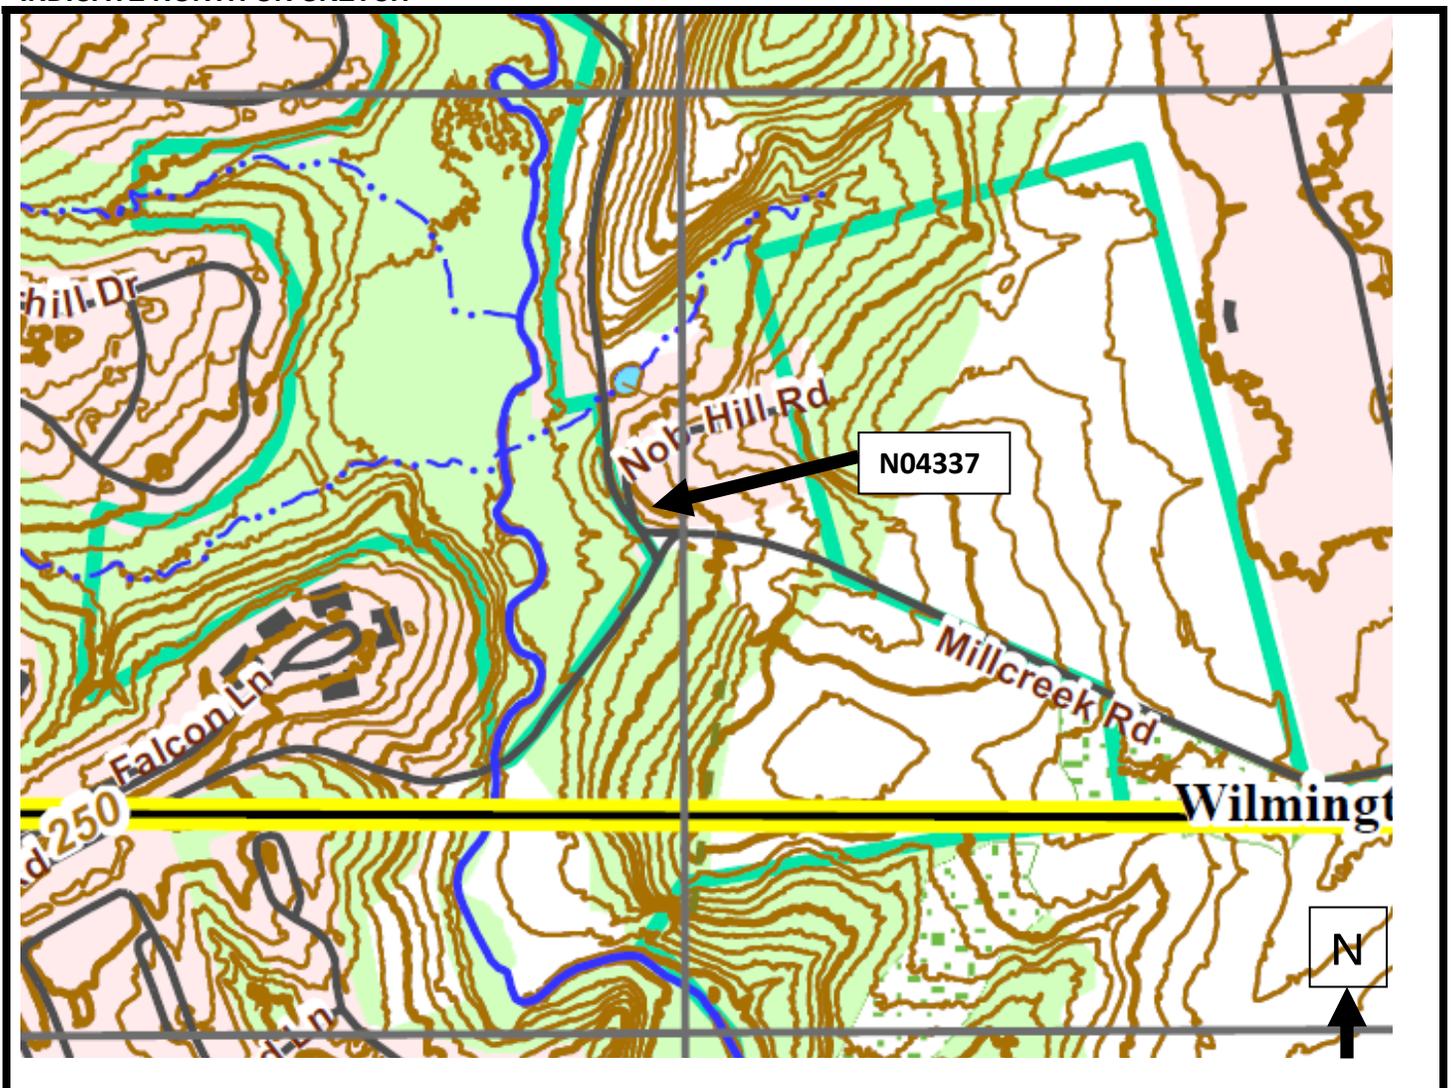

INDICATE NORTH ON PLAN

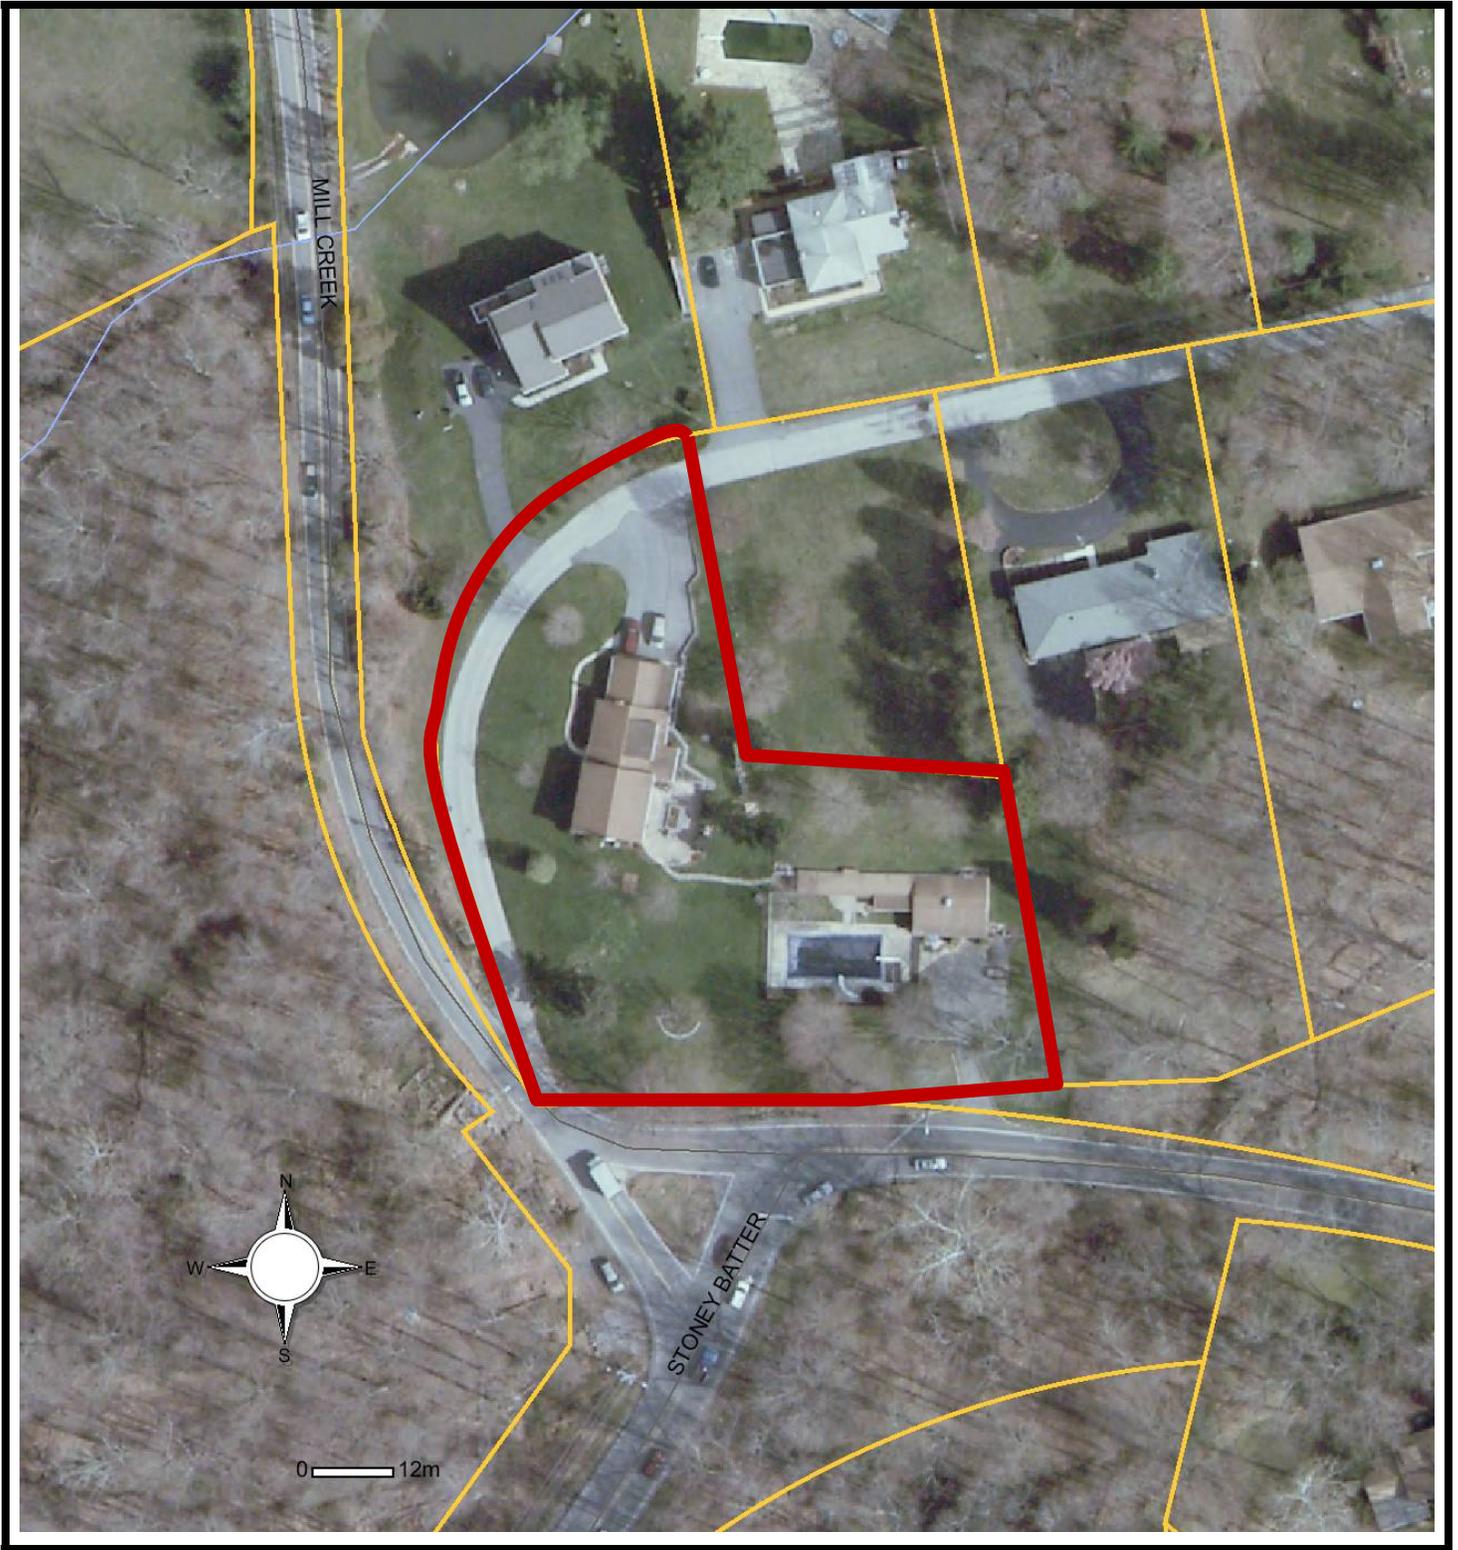



CULTURAL RESOURCE SURVEY  
DIGITAL PHOTOGRAPHS FORM

CRS #     N04337    

Date   2/3/11   Surveyor/Photographer   Jon Schmidt  

Insert photographs; note file name and brief description of view:  
(size photograph 3" on longest side; MAINTAIN ASPECT RATIO – DO NOT STRETCH PHOTO)



View of the façade of N04337.001  
looking southwest.



View of the façade of N04337.001  
looking northwest.



View of the north gable end of  
N04337.001 looking southwest.



View of the north gable end of  
N04337.001 looking south.



View of the east elevation of N04337.001  
looking south.



View of the east elevation of N04337.001 looking west.



View of the east elevation of N04337.001 looking southwest.



View of the south gable end of N04337.001 looking northwest.



View of the south and west elevation of N04337.002 looking northeast.




View of the south elevation of N04337.002 looking northwest.



View of the east elevation of N04337.002 looking northwest.



View of the north elevation of  
N04337.002 looking west.

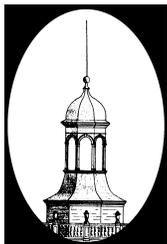

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SURVEY UPDATE FORM

CRS # N01610

1. HISTORIC NAME/FUNCTION: Dwelling

2. ADDRESS/LOCATION: 3600 Mill Creek Road

3. CURRENT CONDITION: excellent  good  fair  poor  demolished

4. INTEGRITY: None

5. SETTING INTEGRITY: Setting remains largely rural, but there is no context for the resource.

6. FORMS ADDED (give number of forms completed for each):

#:	Form:	List property types:
	CRS 2 Main Building Form	
	CRS 3 Secondary Building Form	
	CRS 4 Archaeological Site Form	
	CRS 5 Structure (Building-Like) Form	
	CRS 6 Structure (Land Feature) Form	
	CRS 7 Object Form	
	CRS 8 Landscape Elements Form	
1	CRS 9 Map Form	N/A
	CRS 14 Potential District Form	

7. SURVEYOR INFORMATION:

Surveyor name: Jon Schmidt

Principal Investigator name: Jon Schmidt

Principal Investigator signature: \_\_\_\_\_

Organization: Deldot Environmental Studies Date: 2/10/2011



8. OTHER NOTES OR OBSERVATIONS:

CRS# N01610

The resource was determined to have been demolished during a survey in association with the National Register Eligibility Status and Evaluation for Historic Resources affected by the HSIP at Mill Creek Road and Stoney Batter Road.

9. STATE HISTORIC CONTEXT FRAMEWORK (check all appropriate boxes; refer to state management plan(s)):

- a) Time period(s)
- Pre-European Contact
  - Paleo-Indian
  - Archaic
  - Woodland I
  - Woodland II
  - 1600-1750∇ Contact Period (Native American)
  - 1630-1730∇ Exploration and Frontier Settlement
  - 1730-1770∇ Intensified and Durable Occupation
  - 1770-1830∇ Early Industrialization
  - 1830-1880∇ Industrialization and Early Urbanization
  - 1880-1940∇ Urbanization and Early Suburbanization
  - 1940-1960∇ Suburbanization and Early Ex-urbanization


- b) Geographical zone
- Piedmont
  - Upper Peninsula
  - Lower Peninsula/Cypress Swamp
  - Coastal
  - Urban (City of Wilmington)

c) Historic period theme(s)

- |  |   |
|--|---|
| <input type="checkbox"/> Agriculture           | <input type="checkbox"/> Transportation and Communication                         |
| <input type="checkbox"/> Forestry              | <input checked="" type="checkbox"/> Settlement Patterns and Demographic Changes   |
| <input type="checkbox"/> Trapping/Hunting      | <input checked="" type="checkbox"/> Architecture, Engineering and Decorative Arts |
| <input type="checkbox"/> Mining/Quarrying      | <input type="checkbox"/> Government   |
| <input type="checkbox"/> Fishing/Oystering     | <input type="checkbox"/> Religion   |
| <input type="checkbox"/> Manufacturing         | <input type="checkbox"/> Education  |
| <input type="checkbox"/> Retailing/Wholesaling | <input type="checkbox"/> Community Organizations                                  |
| <input type="checkbox"/> Finance               | <input type="checkbox"/> Occupational Organizations                               |
| <input type="checkbox"/> Professional Services | <input type="checkbox"/> Major Families, Individuals and Events                   |

USE BLACK INK ONLY

CRS-10

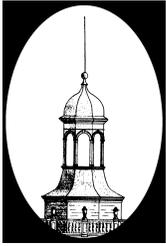

CULTURAL RESOURCE SURVEY

CRS # N01610


MAP FORM

1. ADDRESS/LOCATION: 3600 Mill Creek Road
2. NOT FOR PUBLICATION  reason: \_\_\_\_\_
3. LOCATION MAP:


Indicate position of resource in relation to geographical landmarks such as streams and crossroads.

(attach section of USGS quad map with location marked or draw location map )

INDICATE NORTH ON SKETCH

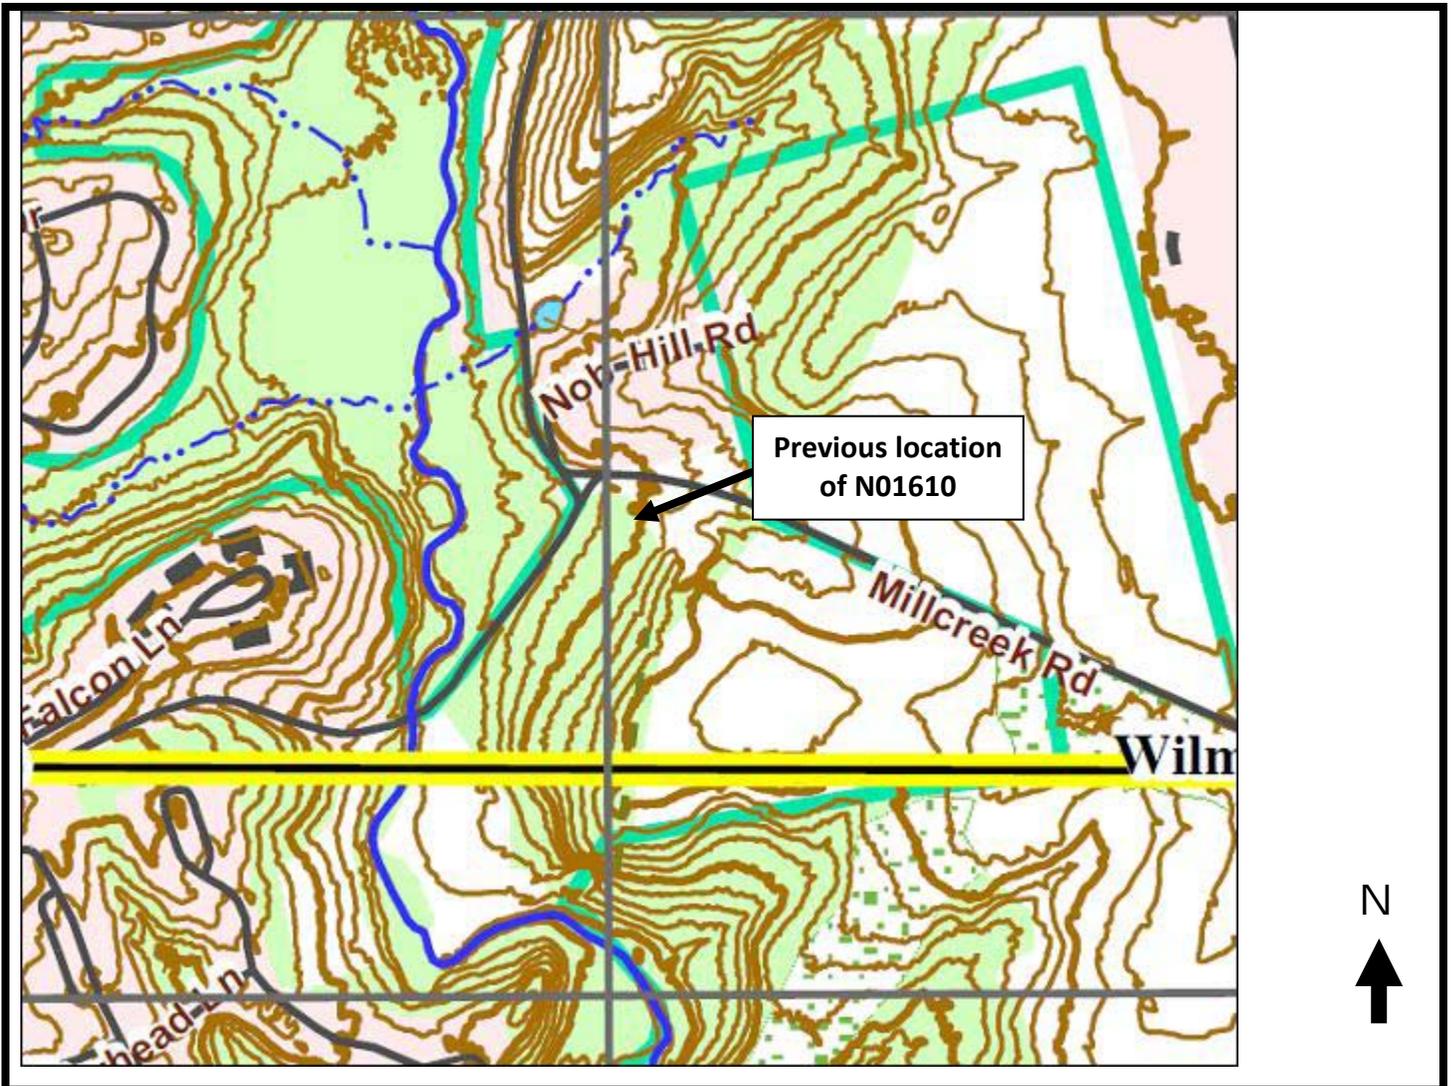

INDICATE NORTH ON PLAN

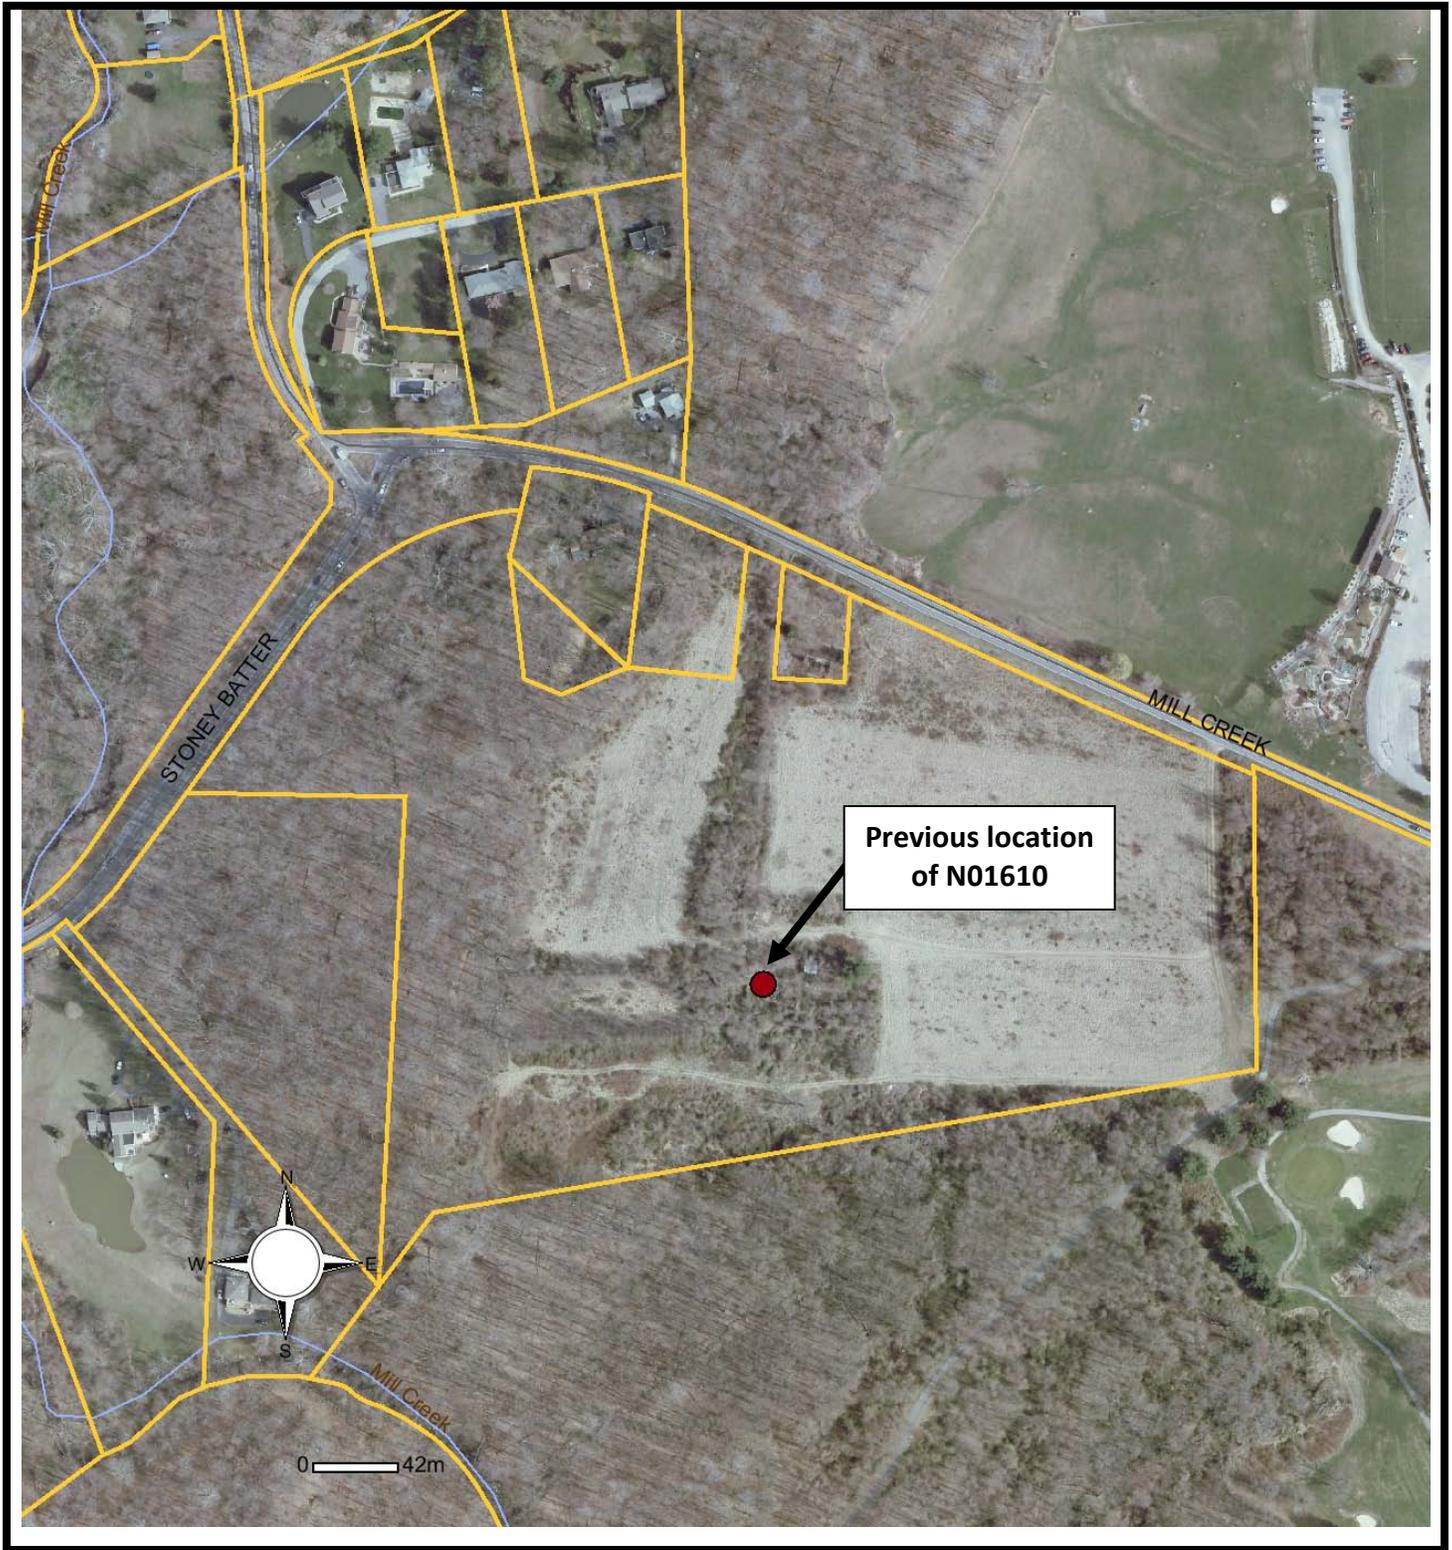



CULTURAL RESOURCE SURVEY  
DIGITAL PHOTOGRAPHS FORM

CRS #     N01610    

Date   2/10/11   Surveyor/Photographer   Jon Schmidt  

Insert photographs; note file name and brief description of view:  
(size photograph 3" on longest side; MAINTAIN ASPECT RATIO – DO NOT STRETCH PHOTO)



Section of the 1868 Beers Map showing the H. Stewart residence in the approximate location of N01610.



A 1937 aerial photograph from DE CHRIS showing N01610 (outlined in red).



A 1954 aerial photograph from DE CHRIS showing N01610 (outlined in red).



A 1961 aerial photograph from DE CHRIS showing N01610 (outlined in red).



A 1992 aerial photograph from DE CHRIS showing N01610 (outlined in red). Although the dwelling appears to have been demolished, outbuildings remain.



A 1992 aerial photograph from DE CHRIS showing N01610 (outlined in red). Although the dwelling appears to have been demolished, outbuildings remain.



A 1997 aerial photograph from DE CHRIS showing the previous location N01610 (outlined in red).



A 2007 aerial photograph from DE CHRIS showing the previous location of N01610 (outlined in red).