

APPENDIX B:
Delaware Cultural Resource Survey Forms

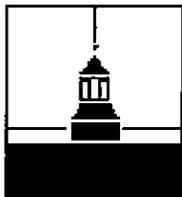

**CULTURAL RESOURCE SURVEY
PROPERTY IDENTIFICATION FORM**

CRS # N-14231
SPO Map 08-09-35
Hundred Christiana
Quad Wilmington South
Other Zone 11

1. NAME OF PROPERTY: _____

2. STREET ADDRESS: 7 Cedar Avenue

3. NEAREST TOWN Wilmington vicinity? X

4. TYPE OF RESOURCE: building X structure _____ site _____
object _____ district _____ landscape _____

5. FUNCTION: original Residential present Residential

6. PROJECT TITLE/REASON FOR SURVEY (if applicable):

S.R.141/Centre Road Improvement Project

7. ADDITIONAL FORMS USED:

#:	Form:	List property types:
X	CRS 2 Main Building form	
	CRS 3 Secondary Building Form	
	CRS 4 Archaeological Site Form	
	CRS 5 Structure (Building-Like) Form	
	CRS 6 Structure (Land Feature) Form	
	CRS 7 Object Form	
	CRS 8 Landscape Elements Form	
X	CRS 9 Map Form	N/A
	CRS 14 Potential District Form	

8. Surveyor name: Johnette Davies PHONE: 215-790-1050

Principal investigator name: Johnette Davies

Principal investigator signature: _____

Organization: Kise Straw & Kolodner DATE: April 26, 2005


9. OTHER NOTES OR OBSERVATIONS:

10. STATE HISTORIC CONTEXT FRAMEWORK (check all appropriate boxes;
refer to state management plan(s)):

a) Time period(s) 1940-1960 Suburbanization and Early Ex-urbanization

b) Geographical zone Piedmont

c) Historic period theme(s) · Settlement Patterns & Demographic Change

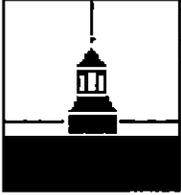

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N-14231

1. ADDRESS OF PROPERTY: 7 Cedar Avenue

2. FUNCTION(S): historic Residential current Residential

3. YEAR BUILT: 1940 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Cape Cod

5. INTEGRITY: original site X moved _____
if moved, when and from where

list major alterations and dates (if known)

Cladding, 1-story rear extension

6. CONDITION: excellent _____ good X fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape Square with extension
stories 1 1/2
bays 3
wings none

b) Structural system Frame

c) Foundation
basement Yes
materials Poured concrete

d) Exterior walls (modern over original)

materials Vinyl siding; false stone on enclosed porch
color(s) Brown

e) Roof

shape; materials Side gable; asphalt shingles
cornice None
dormers Gable
chimney location(s) Gable-end exterior (brick)

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: Southeast

1) Bays 2
2) Windows

fenestration Regular

type 8/8 and triple 6/1 vinyl double-hung sash

trim Flat

shutters None

Facade (cont'd)

3) Door(s)

location Centered on enclosed porch
 type Single leaf, modern, 10-light
 trim None

4) Porches Enclosed porch with cement steps

b. Side: Direction: Northwest

1) Bays 3

2) Windows

fenestration Irregular
 type Single and paired 6/1 vinyl double-hung sash; 1/1 double-hung sash
 trim Flat
 shutters None

3) Door(s)

location None
 type n/a
 trim n/a

4) Porches None

c. Side: Direction: Southeast

1) Bays 3

2) Windows

fenestration Irregular
 type Paired 6/1 vinyl double-hung sash; 6-light casements flanking chimney
 trim Flat
 shutters None

3) Door(s)

location None
 type n/a
 trim n/a

4) Porches None

d. Rear: Direction: Northeast; not visible

1) Bays n/a

2) Windows

fenestration n/a
 type n/a
 trim n/a
 shutters n/a

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches Wood deck

9. INTERIOR: Not accessible

10. LANDSCAPING: Concrete sidewalk and driveway

11. OTHER COMMENTS:

4. SITE PLAN:


CRS # N-14231

INDICATE NORTH ON PLAN

Sketch Plan

First-Floor Plan
(where available)

NOTE: Sketches are not to scale.

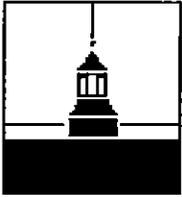

**CULTURAL RESOURCE SURVEY
PROPERTY IDENTIFICATION FORM**

CRS # N-14232
SPO Map 08-09-35
Hundred Christiana
Quad Wilmington South
Other Zone 11

1. NAME OF PROPERTY: _____

2. STREET ADDRESS: 8 Cedar Avenue

3. NEAREST TOWN Wilmington vicinity? X

4. TYPE OF RESOURCE: building X structure _____ site _____

object _____ district _____ landscape _____

5. FUNCTION: original Residential present Residential

6. PROJECT TITLE/REASON FOR SURVEY (if applicable):

S.R.141/Centre Road Improvement Project

7. ADDITIONAL FORMS USED:

#:	Form:	List property types:
X	CRS 2 Main Building form	
	CRS 3 Secondary Building Form	
	CRS 4 Archaeological Site Form	
	CRS 5 Structure (Building-Like) Form	
	CRS 6 Structure (Land Feature) Form	
	CRS 7 Object Form	
	CRS 8 Landscape Elements Form	
X	CRS 9 Map Form	N/A
	CRS 14 Potential District Form	

8. Surveyor name: Johnette Davies PHONE: 215-790-1050

Principal investigator name: Johnette Davies

Principal investigator signature: _____

Organization: Kise Straw & Kolodner DATE: April 26, 2005


9. OTHER NOTES OR OBSERVATIONS:

10. STATE HISTORIC CONTEXT FRAMEWORK (check all appropriate boxes;
refer to state management plan(s)):

a) Time period(s) 1940-1960 Suburbanization and Early Ex-urbanization

b) Geographical zone Piedmont

c) Historic period theme(s) Settlement Patterns & Demographic Change

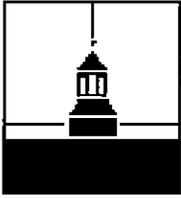

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N-14232

1. ADDRESS OF PROPERTY: 8 Cedar Avenue

2. FUNCTION(S): historic Residential current Residential

3. YEAR BUILT: 1950 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Cape Cod

5. INTEGRITY: original site X moved _____
if moved, when and from where

list major alterations and dates (if known)

Replacement windows; conversion of former garage to residential space

6. CONDITION: excellent _____ good X fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).

a) Overall shape Irregular
stories 1 1/2
bays 3
wings none

b) Structural system Frame

c) Foundation
basement Yes
materials Concrete

d) Exterior walls (modern over original)

materials Aluminum siding
color(s) White

e) Roof

shape; materials Side gable; asphalt shingles
cornice None
dormers Gable with 6/6 wood double hung sash
chimney location(s) Center (brick)

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: Northeast

1) Bays 3

2) Windows

fenestration Regular

type 6/6 vinyl double hung sash; canted bay with multi-light central window and 4/4 vinyl double hung sash; 6/6 double hung sash in dormers

trim Flat

shutters Louvered modern non-functional

Facade (cont'd)

- 3) Door(s)
 location Center
 type Single leaf panel wood door with one light; metal storm door.
 trim Transom
- 4) Porches Concrete sroop with metal railings

b. Side: Direction: Southeast

- 1) Bays 2
- 2) Windows
 fenestration Irregular
 type 6/6 vinyl double-hung sash; 6/6 double-hung sash in gable end; 3-light wood basement window
 trim Flat
 shutters Louvered modern non-functional
- 3) Door(s)
 location None
 type n/a
 trim n/a
- 4) Porches None

c. Side: Direction: Northwest

- 1) Bays 2
- 2) Windows
 fenestration Regular
 type 1/1 vinyl double-hung sash; 6/6 wood double-hung sash in gable end
 trim Flat
 shutters Louvered modern non-functional
- 3) Door(s)
 location None
 type n/a
 trim n/a
- 4) Porches None

d. Rear: Direction: Southwest

- 1) Bays 3
- 2) Windows
 fenestration Irregular; wall dormer with shed roof in center of rear facade
 type 6/6 wood double hung sash
 trim Flat
 shutters Louvered modern non-functional
- 3) Door(s)
 location Not visible
 type n/a
 trim n/a
- 4) Porches 1-story screened porch with metal shed roof

9. INTERIOR: Not accessible

10. LANDSCAPING: Concrete sidewalk and driveway, wood plank fence around rear yard

11. OTHER COMMENTS: one-story former garage at east end of building converted to residential space.

4. SITE PLAN:

CRS # N-14232

INDICATE NORTH ON PLAN

Sketch Plan

enclosed porch

First-Floor Plan
(where available)

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
PROPERTY IDENTIFICATION FORM**

CRS # N-14233
SPO Map 08-09-35
Hundred Christiana
Quad Wilmington South
Other Zone 11

1. NAME OF PROPERTY: _____

2. STREET ADDRESS: 1001 Centre Road

3. NEAREST TOWN Wilmington vicinity? X

4. TYPE OF RESOURCE: building X structure _____ site _____

object _____ district _____ landscape _____

5. FUNCTION: original Gas station present Gas station

6. PROJECT TITLE/REASON FOR SURVEY (if applicable):

S.R.141/Centre Road Improvement Project

7. ADDITIONAL FORMS USED:

#:	Form:	List property types:
X	CRS 2 Main Building form	
X	CRS 3 Secondary Building Form	
	CRS 4 Archaeological Site Form	
	CRS 5 Structure (Building-Like) Form	
	CRS 6 Structure (Land Feature) Form	
	CRS 7 Object Form	
	CRS 8 Landscape Elements Form	
X	CRS 9 Map Form	N/A
	CRS 14 Potential District Form	

8. Surveyor name: Johnette Davies PHONE: 215-790-1050

Principal investigator name: Johnette Davies

Principal investigator signature: _____

Organization: Kise Straw & Kolodner DATE: April 28, 2005

9. OTHER NOTES OR OBSERVATIONS:

10. STATE HISTORIC CONTEXT FRAMEWORK (check all appropriate boxes;
refer to state management plan(s)):

a) Time period(s) 1940-1960 Suburbanization and Early Ex-urbanization

b) Geographical zone Piedmont

c) Historic period theme(s) Settlement Patterns & Demographic Change



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N-14233 .001

1. ADDRESS OF PROPERTY: 1001 Centre Road

2. FUNCTION(S): historic Gas station current Gas station

3. YEAR BUILT: c. 1955 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Commercial

5. INTEGRITY: original site X moved _____

if moved, when and from where

list major alterations and dates (if known)

6. CONDITION: excellent _____ good X fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape Rectangular
 stories 1
 bays 4
 wings none

b) Structural system Unknown

c) Foundation
 basement none
 materials Concrete

d) Exterior walls (modern over original)

 materials Metal panels (steel?)
 color(s) Brown and tan

e) Roof

 shape; materials Flat; material unknown/not visible
 cornice None
 dormers None
 chimney location(s) Within roof surface (brick)

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: Northeast

 1) Bays 4

 2) Windows

 fenestration Irregular

 type Single light fixed pane anodized aluminum windows

 trim Flat

 shutters None

Facade (cont'd)

3) Door(s)

location Off-center
 type Single leaf full glass door; 3 folding overhead garage doors at service bays
 trim single-light transom

4) Porches

b. Side: Direction: Northwest

1) Bays 1

2) Windows

fenestration None
 type n/a
 trim n/a
 shutters n/a

3) Door(s)

location Off-center
 type Single leaf modern metal slab door
 trim

4) Porches None

c. Side: Direction: Southeast

1) Bays 1

2) Windows

fenestration Regular
 type 1-pane fixed cashier window with money repository
 trim Flat
 shutters None

3) Door(s)

location Off-center
 type Single leaf metal slab doors (for restrooms)
 trim none

4) Porches None

d. Rear: Direction: Southwest

1) Bays 4

2) Windows

fenestration None
 type n/a
 trim n/a
 shutters n/a

3) Door(s)


location None
 type n/a
 trim n/a

4) Porches None

9. INTERIOR: n/a

10. LANDSCAPING: Asphalt driveway; parking; concrete sidewalk and ADA ramps at south side; concrete pad at rear; guard rail and chain link fence along rear of property

11. OTHER COMMENTS:

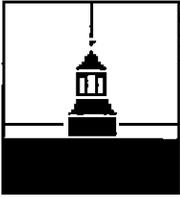

**CULTURAL RESOURCE SURVEY
SECONDARY BUILDING FORM**

CRS # N-14233 .002

1. ADDRESS OF PROPERTY: 1001 Centre Road
2. FUNCTION(S): Gasoline island
3. YEAR BUILT: 1980-90's (?) ARCHITECT/BUILDER: _____
4. STYLE/FLOOR PLAN: _____
5. INTEGRITY: original site X moved _____
6. CURRENT CONDITION: excellent _____ good X fair _____ poor _____

7. DESCRIPTION:

- a) Structural system
- b) Number of stories 1
- c) Wall Coverings None
- d) Foundation Concrete slab
- e) Roof
structural system Flat
coverings Not visible
openings

8. DESCRIPTION OF ELEVATIONS:

- a) Facade: direction:
- 1) bays:
- 2) windows:
- 3) door(s):
- 4) other:



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N-14233 .001


1. ADDRESS/LOCATION: 1001 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

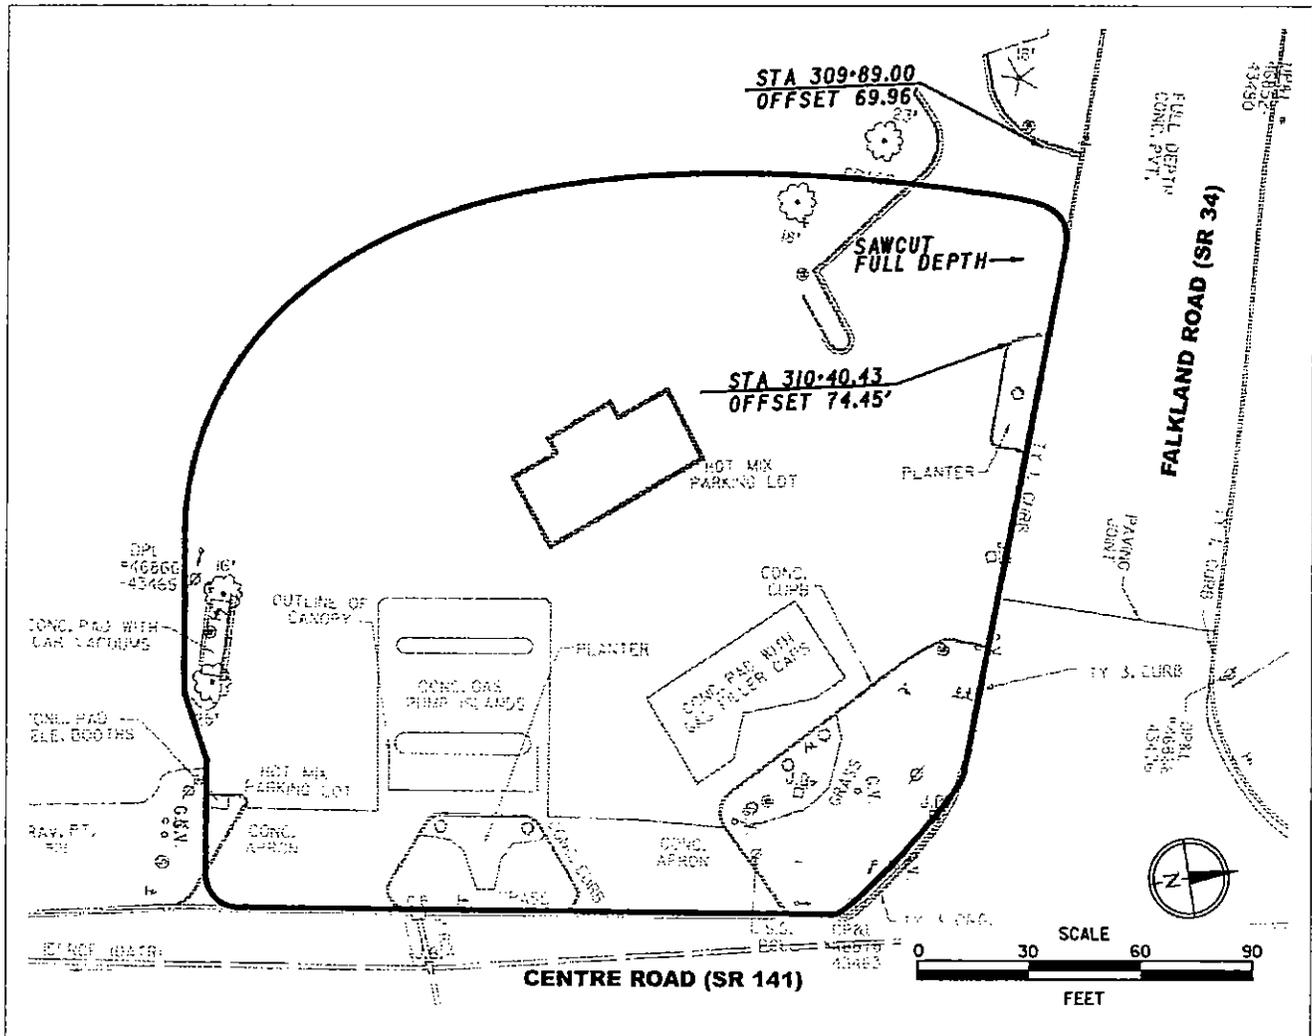


USE BLACK INK ONLY

4. SITE PLAN:

CRS # N-14233

INDICATE NORTH ON PLAN

Sketch Plan

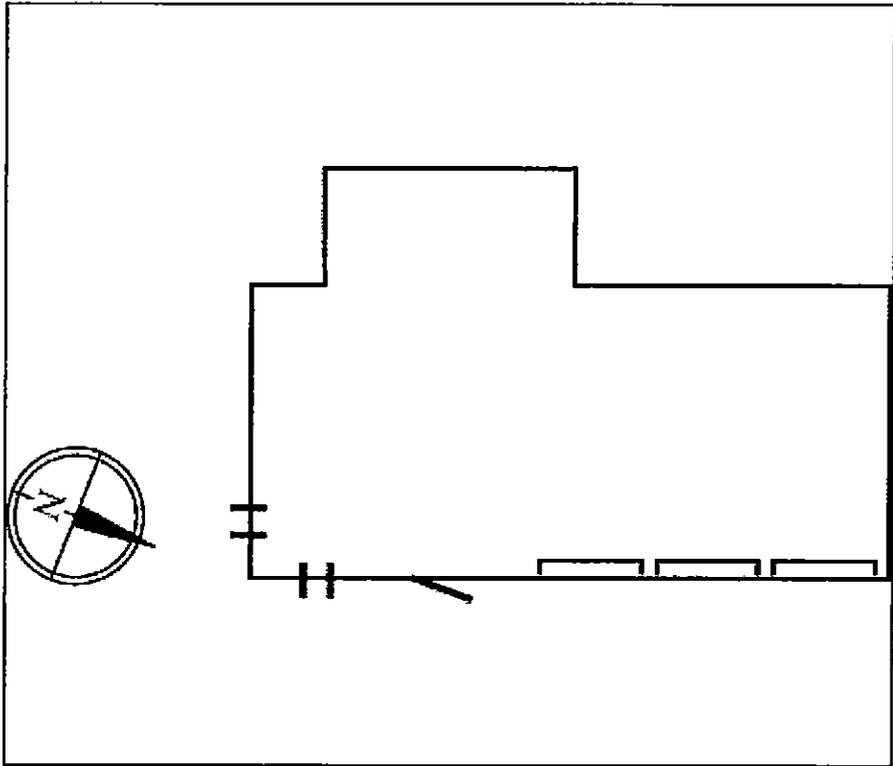

First-Floor Plan
(where available)

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
PROPERTY IDENTIFICATION FORM**

CRS # N-14235
SPO Map 08-09-35
Hundred Christiana
Quad Wilmington South
Other Zone 11

1. NAME OF PROPERTY: _____

2. STREET ADDRESS: 1108 Centre Road

3. NEAREST TOWN Wilmington vicinity? X

4. TYPE OF RESOURCE: building X structure _____ site _____

object _____ district _____ landscape _____

5. FUNCTION: original Residential present Vacant

6. PROJECT TITLE/REASON FOR SURVEY (if applicable):

Impending demolition associated with roadway improvements

7. ADDITIONAL FORMS USED:

#:	Form:	List property types:
X	CRS 2 Main Building form	
X	CRS 3 Secondary Building Form	
	CRS 4 Archaeological Site Form	
	CRS 5 Structure (Building-Like) Form	
	CRS 6 Structure (Land Feature) Form	
	CRS 7 Object Form	
	CRS 8 Landscape Elements Form	
X	CRS 9 Map Form	N/A
	CRS 14 Potential District Form	

8. Surveyor name: Johnette Davies PHONE: 215-790-1050

Principal investigator name: Johnette Davies

Principal investigator signature: _____

Organization: Kise Straw & Kolodner DATE: January 18, 2005


9. OTHER NOTES OR OBSERVATIONS:

10. STATE HISTORIC CONTEXT FRAMEWORK (check all appropriate boxes;
refer to state management plan(s)):

a) Time period(s) 1940-1960 Suburbanization and Early Ex-urbanization

b) Geographical zone Piedmont

c) Historic period theme(s) Settlement Patterns & Demographic Change

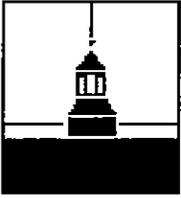

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N-14235 .001

1. ADDRESS OF PROPERTY: 1108 Centre Road

2. FUNCTION(S): historic Residential current Vacant

3. YEAR BUILT: 1951 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Minimal Traditional

5. INTEGRITY: original site X moved _____
if moved, when and from where

_____ list major alterations and dates (if known)

6. CONDITION: excellent _____ good _____ fair _____ poor X

7. DESCRIPTION: (Describe the resource as completely as possible.)

Use N/A for not applicable; leave no blanks).

a) Overall shape Rectangle
stories 1
bays 3
wings none

b) Structural system Frame

c) Foundation
basement no
materials Concrete

d) Exterior walls (modern over original)

materials Asbestos
color(s) White

e) Roof

shape; materials Front gable
cornice None
dormers None
chimney location(s) Brick off-center within roof surface

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: West

1) Bays 3

2) Windows

fenestration Regular

type Paired vinyl 1/1 double hung sash

trim Flat

shutters None, metal awnings over windows and door

Facade (cont'd)

- 3) Door(s)
 location Off-center
 type Single leaf (missing, only aluminum storm door present)
 trim None
- 4) Porches None

b. Side: Direction: South

- 1) Bays 3
- 2) Windows
 fenestration Irregular
 type Paired vinyl 1/1 double-hung sash
 trim Flat
 shutters None
- 3) Door(s)
 location None
 type None
 trim None
- 4) Porches None

c. Side: Direction: North

- 1) Bays 3
- 2) Windows
 fenestration Irregular
 type 1/1 vinyl double-hung sash and single-light vinyl sliding windows
 trim Flat
 shutters None
- 3) Door(s)
 location Center
 type Single leaf wood 4 pane and panel door inside porch
 trim None
- 4) Porches Enclosed frame porch with shed roof; door missing


d. Rear: Direction: East

- 1) Bays 3
- 2) Windows
 fenestration Irregular
 type Single-light vinyl sliding windows
 trim Flat
 shutters None
- 3) Door(s)
 location None
 type None
 trim None
- 4) Porches None

9. INTERIOR: n/a

10. LANDSCAPING: Concrete driveway and sidewalk, stockade and chainlink fence at rear yard.

11. OTHER COMMENTS:

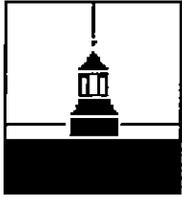

**CULTURAL RESOURCE SURVEY
SECONDARY BUILDING FORM**

CRS # N-14235 .002

1. ADDRESS OF PROPERTY: 1108 Centre Road
2. FUNCTION(S): Garage (1 car)
3. YEAR BUILT: c. 1950 ARCHITECT/BUILDER: _____
4. STYLE/FLOOR PLAN: Matches house
5. INTEGRITY: original site _____ X moved _____
6. CURRENT CONDITION: excellent _____ good _____ fair _____ poor X

7. DESCRIPTION:

- a) Structural system Frame
- b) Number of stories 1
- c) Wall Coverings Asbestos siding - matches house
- d) Foundation Not visible
- e) Roof
structural system Front gable
coverings Asphalt shingles
openings None

8. DESCRIPTION OF ELEVATIONS:

- a) Facade: direction: West
- 1) bays: 1
- 2) windows: none
- 3) door(s): Metal folding overhead garage door; single-leaf wood slab door
- 4) other: _____

- b) Side: direction: North
 - 1) bays: 1
 - 2) windows: Fixed single pane window

 - 3) door(s):

 - 4) other:

- c) Side: direction: South
 - 1) bays: 2
 - 2) windows: Fixed single pane window

 - 3) door(s): Wood pane and panel door

 - 4) other:

- d) Rear: direction: East
 - 1) bays: 1
 - 2) windows: Fixed single pane window

 - 3) door(s):

 - 4) other:


9. INTERIOR (if accessible):

- a) Floor plan

- b) Partition/walls

- c) Finishes

- d) Furnishings/machinery

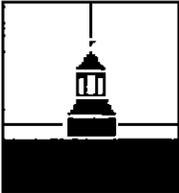

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N-14235 .001


1. ADDRESS/LOCATION: 1108 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

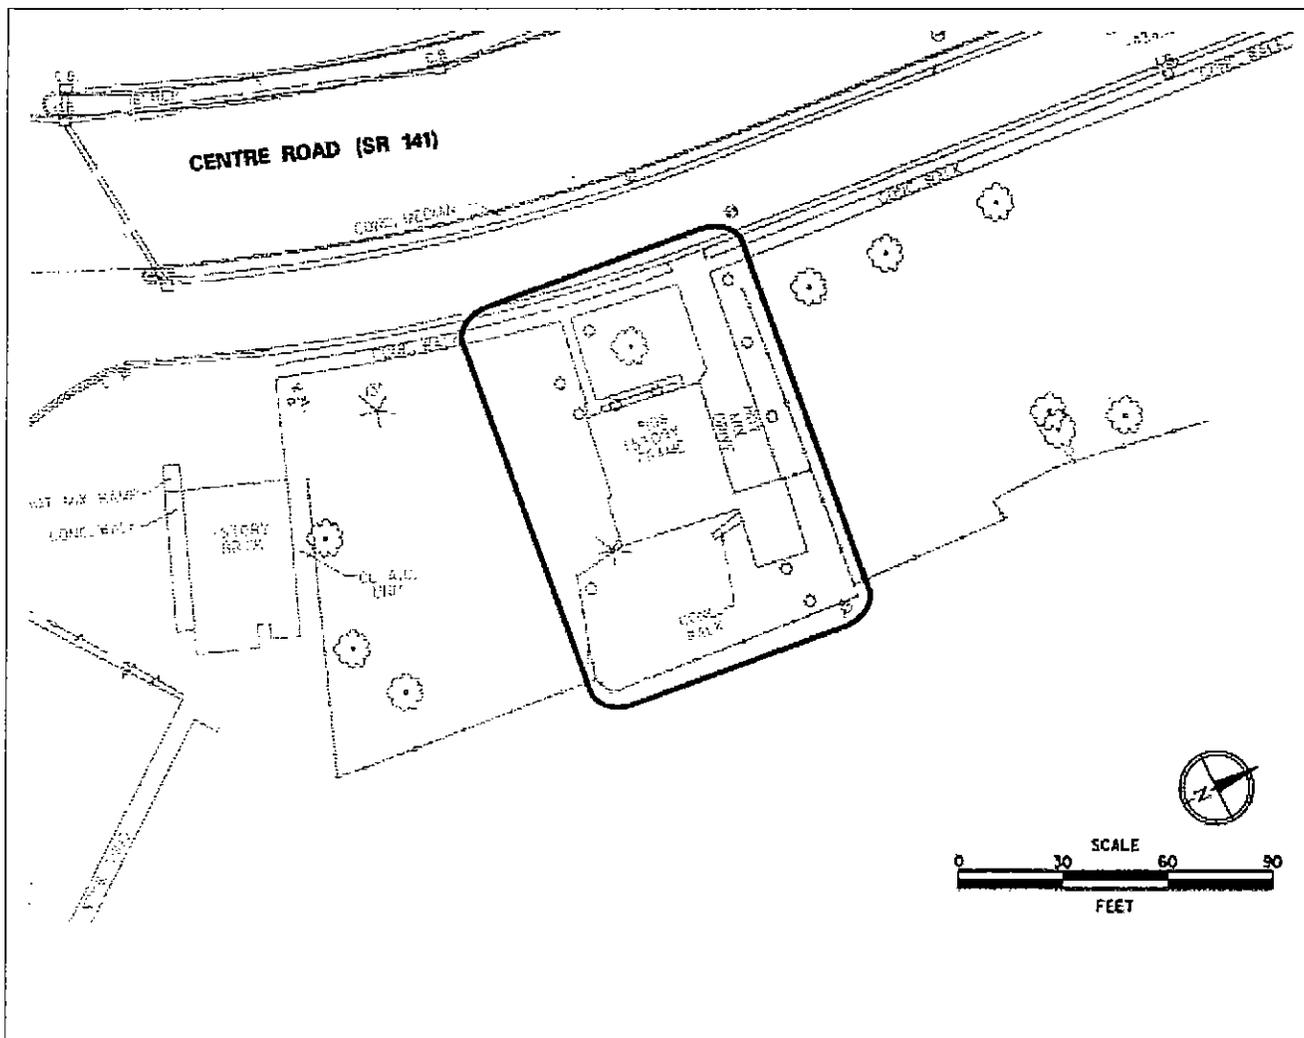


USE BLACK INK ONLY

4. SITE PLAN:

CRS # N-14235

INDICATE NORTH ON PLAN

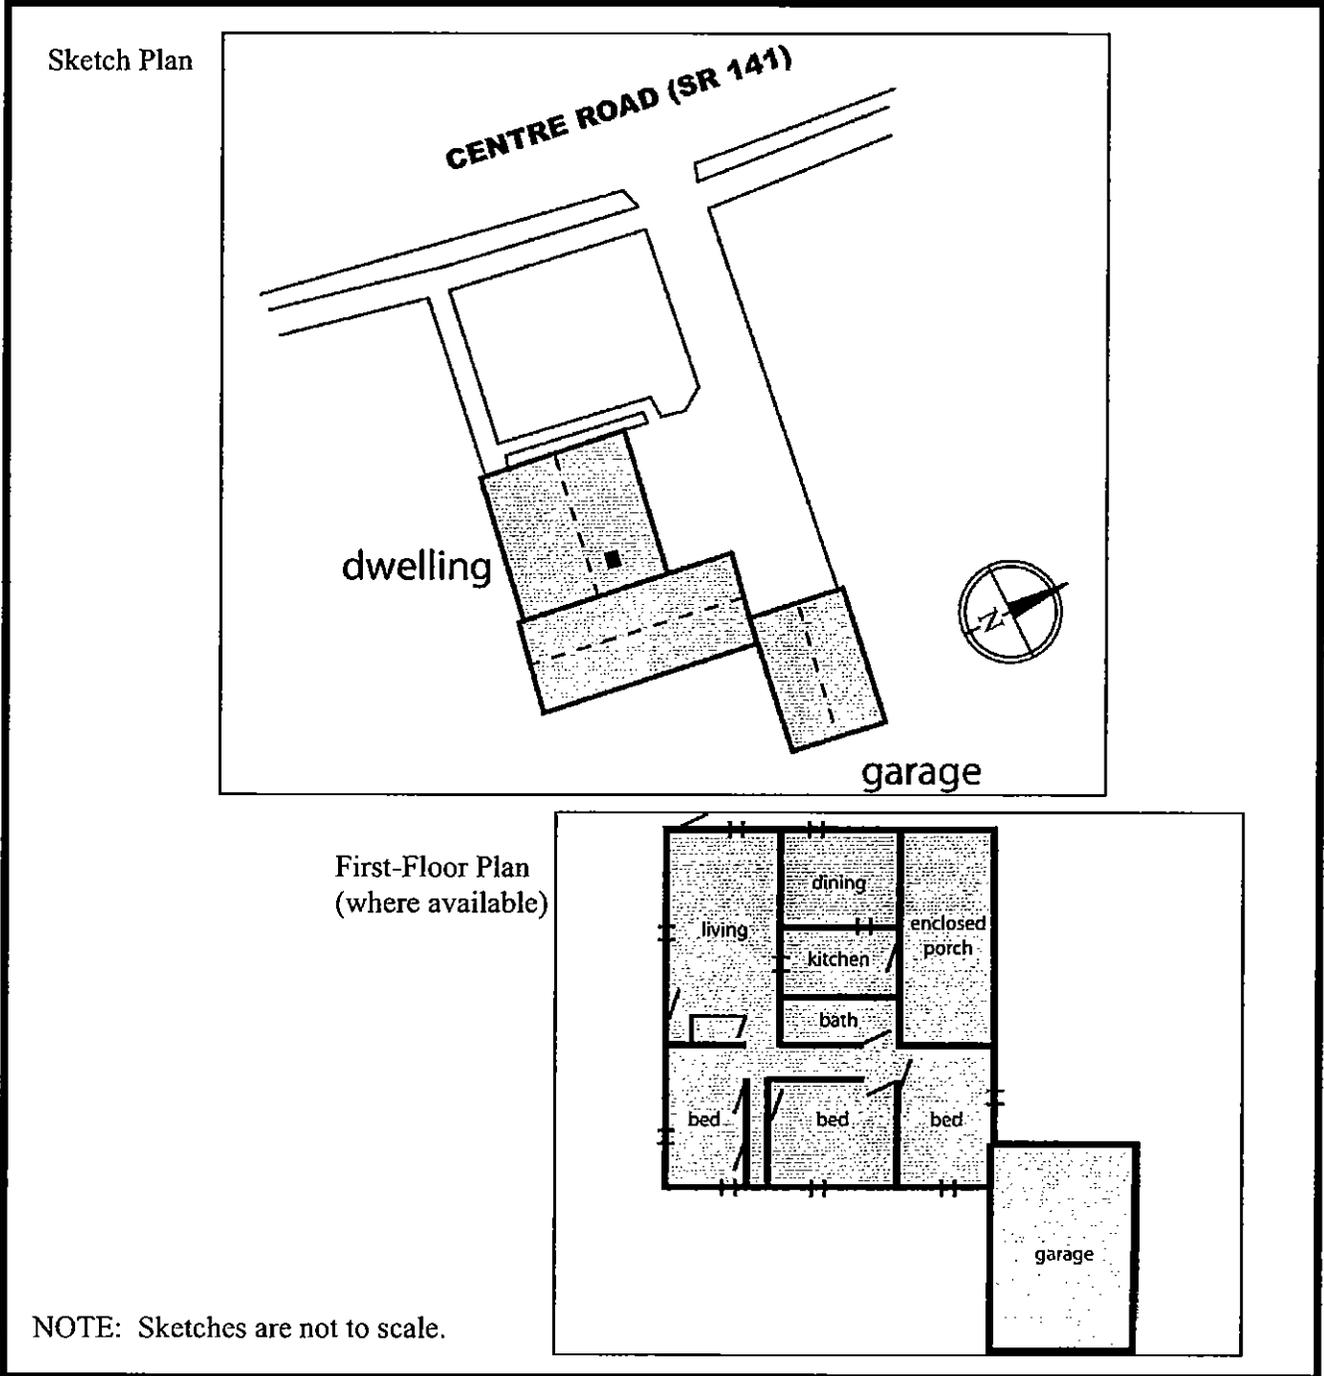

USE BLACK INK ONLY



**CULTURAL RESOURCE SURVEY
SURVEY UPDATE FORM**

CRS # N-14235

1. HISTORIC NAME/FUNCTION: Residential

2. ADDRESS/LOCATION: 1108 Centre Road

3. CURRENT CONDITION: excellent good fair poor demolished

4. INTEGRITY:

Buildings on this property were demolished in 2005 in preparation for a roadway improvement project.

5. SETTING INTEGRITY:

This property is in the Willow Run I subdivision. Neighboring properties have also been demolished.

6. FORMS ADDED (give number of forms completed for each):


#:	Form:	List property types:
	CRS 2 Main Building form	
	CRS 3 Secondary Building Form	
	CRS 4 Archaeological Site Form	
	CRS 5 Structure (Building-Like) Form	
	CRS 6 Structure (Land Feature) Form	
	CRS 7 Object Form	
	CRS 8 Landscape Elements Form	
	CRS 9 Map Form	N/A
	CRS 14 Potential District Form	

8. Surveyor name: Johnette Davies PHONE: 215-790-1050

Principal investigator name: Johnette Davies

Principal investigator signature: _____

Organization: Kise Straw & Kolodner DATE: July 29, 2005

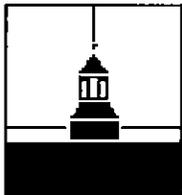

**CULTURAL RESOURCE SURVEY
PROPERTY IDENTIFICATION FORM**

CRS # N-14234
SPO Map 08-09-35
Hundred Christiana
Quad Wilmington South
Other Zone 11

1. NAME OF PROPERTY: _____

2. STREET ADDRESS: 1100 Centre Road

3. NEAREST TOWN Wilmington vicinity? X

4. TYPE OF RESOURCE: building X structure _____ site _____

object _____ district _____ landscape _____

5. FUNCTION: original Residential present Vacant

6. PROJECT TITLE/REASON FOR SURVEY (if applicable):

Impending demolition associated with roadway improvements

7. ADDITIONAL FORMS USED:

#:	Form:	List property types:
X	CRS 2 Main Building form	
X	CRS 3 Secondary Building Form	
	CRS 4 Archaeological Site Form	
	CRS 5 Structure (Building-Like) Form	
	CRS 6 Structure (Land Feature) Form	
	CRS 7 Object Form	
	CRS 8 Landscape Elements Form	
X	CRS 9 Map Form	N/A
	CRS 14 Potential District Form	

8. Surveyor name: Johnette Davies PHONE: 215-790-1050

Principal investigator name: Johnette Davies

Principal investigator signature: _____

Organization: Kise Straw & Kolodner DATE: January 18, 2005

9. OTHER NOTES OR OBSERVATIONS:

10. STATE HISTORIC CONTEXT FRAMEWORK (check all appropriate boxes;
refer to state management plan(s)):

a) Time period(s) 1940-1960 Suburbanization and Early Ex-urbanization

b) Geographical zone Piedmont

c) Historic period theme(s) Settlement Patterns & Demographic Change



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N-14234 .001

1. ADDRESS OF PROPERTY: 1100 Centre Road
2. FUNCTION(S): historic Residential current Vacant
3. YEAR BUILT: 1951 ARCHITECT/BUILDER: _____
4. STYLE/FLOOR PLAN: Minimal Traditional
5. INTEGRITY: original site X moved _____
if moved, when and from where

_____ list major alterations and dates (if known)

6. CONDITION: excellent _____ good _____ fair X poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.)

Use N/A for not applicable; leave no blanks).

- a) Overall shape L-shaped
 stories 1
 bays 3
 wings none
- b) Structural system Frame
- c) Foundation
 basement no
 materials Concrete
- d) Exterior walls (modern over original)
 materials Aluminum siding
 color(s) White
- e) Roof
 shape; materials Cross gable; asphalt shingles
 cornice None
 dormers None
 chimney location(s) 2 brick chimneys: 1 off-center at ridgeline, 1 off-center on east slope

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: Direction: West
- 1) Bays 3
 2) Windows
- fenestration Regular
 type 1/1 paired vinyl double-hung sash; terrarium window
- trim Flat
 shutters Modern non-functional louvered

Facade (cont'd)

3) Door(s)

location Center
 type Single leaf wood pane and panel door with aluminum storm door
 trim None

4) Porches None

b. Side: Direction: South

1) Bays 3

2) Windows

fenestration Regular
 type 6/6 and 8/8 vinyl double hung sash. Window opening size altered.
 trim Flat
 shutters None

3) Door(s)

location None
 type n/a
 trim n/a

4) Porches None

c. Side: Direction: North

1) Bays 2

2) Windows

fenestration Irregular
 type Paired 1/1 vinyl double-hung sash; paired 1-light casements
 trim Flat
 shutters None

3) Door(s)

location On enclosed porch
 type Pane and panel
 trim None

4) Porches None

d. Rear: Direction: East

1) Bays 4

2) Windows

fenestration Regular
 type 6/1 vinyl double-hung sash; paired 3-light casements; terrarium window
 trim None
 shutters None

3) Door(s)


location None
 type None
 trim None

4) Porches Open porch with enclosed section

9. INTERIOR: Wall extension separates living room from dining room; added fireplace.

10. LANDSCAPING: Concrete sidewalk and driveway

11. OTHER COMMENTS: Laundry facilities in enclosed porch section.

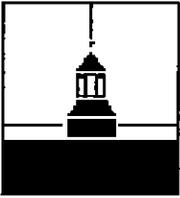

**CULTURAL RESOURCE SURVEY
SECONDARY BUILDING FORM**

CRS # N-14234 .002

1. ADDRESS OF PROPERTY: 1100 Centre Road
2. FUNCTION(S): garage (1-car)
3. YEAR BUILT: c. 1950 ARCHITECT/BUILDER: _____
4. STYLE/FLOOR PLAN: Matches house
5. INTEGRITY: original site X moved _____
6. CURRENT CONDITION: excellent _____ good _____ fair X poor _____

7. DESCRIPTION:

- a) Structural system frame
- b) Number of stories 1
- c) Wall Coverings aluminum siding
- d) Foundation Not visible
- e) Roof
structural system front gable
coverings asphalt shingles
openings None

8. DESCRIPTION OF ELEVATIONS:

- a) Facade: direction: north
- 1) bays: 1
- 2) windows: none
- 3) door(s): overhead garage door
- 4) other:

b) Side: direction:

1) bays:

2) windows:

3) door(s):

4) other:

c) Side: direction:

1) bays:

2) windows:

3) door(s):

4) other:

d) Rear: direction: south

1) bays: 1

2) windows: covered window opening

3) door(s):

4) other:


9. INTERIOR (if accessible):

a) Floor plan

b) Partition/walls

c) Finishes

d) Furnishings/machinery

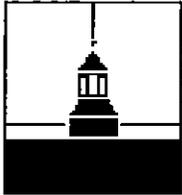

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N-14234 .001


1. ADDRESS/LOCATION: 1100 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

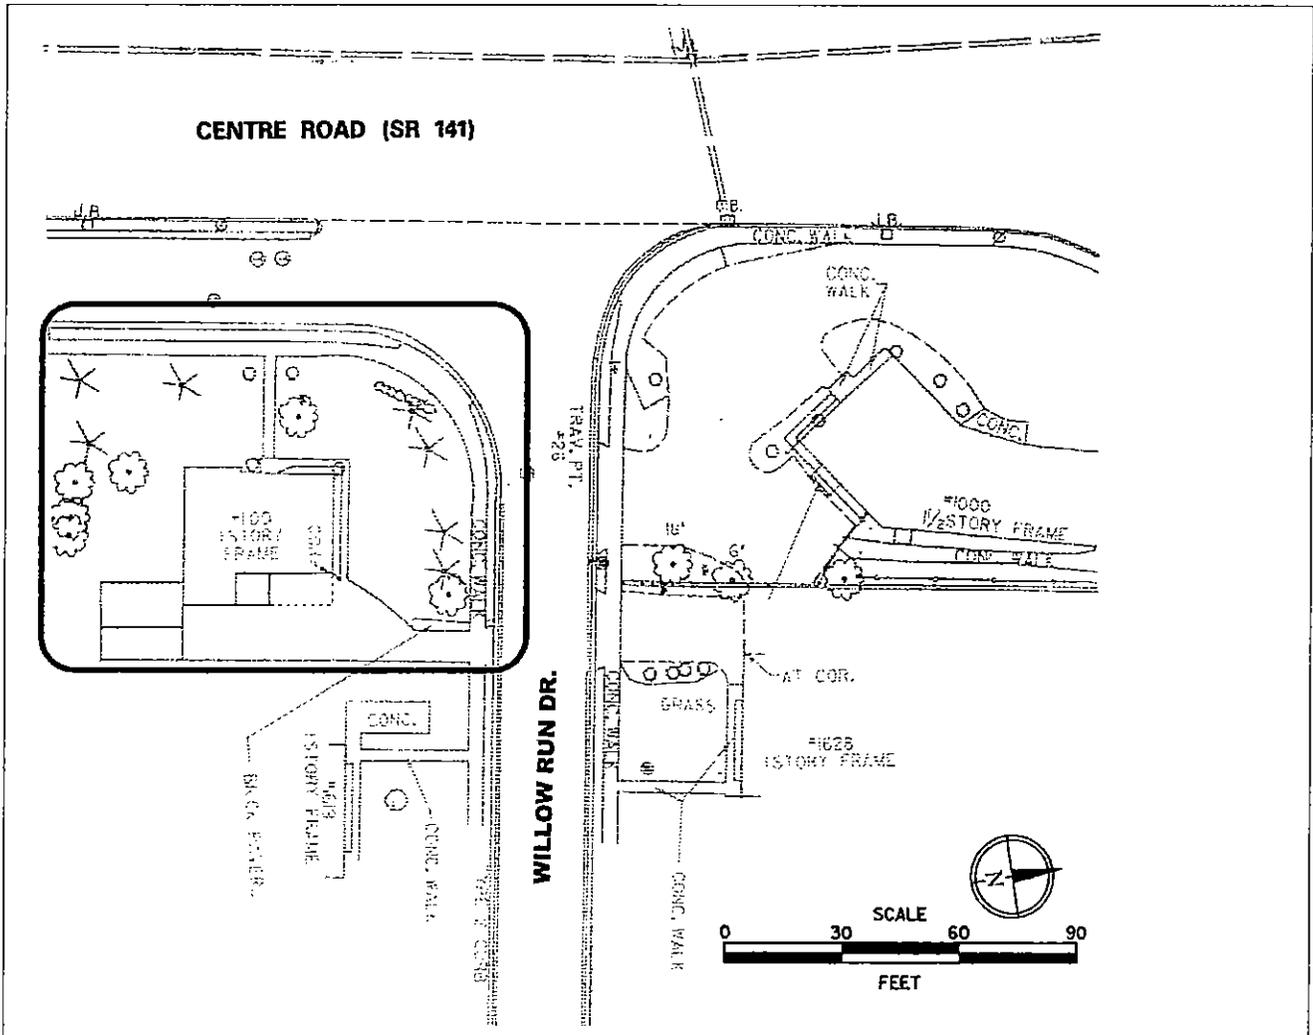



**CULTURAL RESOURCE SURVEY
SURVEY UPDATE FORM**

CRS # N-14234

1. HISTORIC NAME/FUNCTION: Residential

2. ADDRESS/LOCATION: 1100 Centre Road

3. CURRENT CONDITION: excellent good fair poor demolished

4. INTEGRITY:
Buildings on this property were demolished in 2005 in preparation for a roadway improvement project.

5. SETTING INTEGRITY:
This property is in the Willow Run I subdivision. Neighboring properties have also been demolished.

6. FORMS ADDED (give number of forms completed for each):


#:	Form:	List property types:
	CRS 2 Main Building form	
	CRS 3 Secondary Building Form	
	CRS 4 Archaeological Site Form	
	CRS 5 Structure (Building-Like) Form	
	CRS 6 Structure (Land Feature) Form	
	CRS 7 Object Form	
	CRS 8 Landscape Elements Form	
	CRS 9 Map Form	N/A
	CRS 14 Potential District Form	

8. Surveyor name: Johnette Davies PHONE: 215-790-1050

Principal investigator name: Johnette Davies

Principal investigator signature: _____

Organization: Kise Straw & Kolodner DATE: July 29, 2005

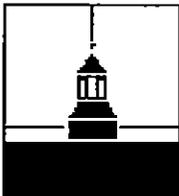

**CULTURAL RESOURCE SURVEY
PROPERTY IDENTIFICATION FORM**

CRS # N14270
SPO Map 08-09-35
Hundred Christiana
Quad Wilmington South
Other _____

1. NAME OF PROPERTY: Woodland Apartments

2. STREET ADDRESS: 1201 Centre Road

3. NEAREST TOWN Wilmington vicinity? x

4. TYPE OF RESOURCE: building _____ structure _____ site _____
object _____ district x landscape _____

5. FUNCTION: original Multi-family dwelling present Multi-family dwelling

6. PROJECT TITLE/REASON FOR SURVEY (if applicable):

S.R.141/Centre Road Improvement Project

7. ADDITIONAL FORMS USED:

#:	Form:	List property types:
48	CRS 2 Main Building form	
10	CRS 3 Secondary Building Form	
	CRS 4 Archaeological Site Form	
	CRS 5 Structure (Building-Like) Form	
	CRS 6 Structure (Land Feature) Form	
	CRS 7 Object Form	
1	CRS 8 Landscape Elements Form	
1	CRS 9 Map Form	N/A
1	CRS 14 Potential District Form	

8. Surveyor name: J. Davies; E. Burling; J. Kennedy; V. Zeoli PHONE: 215-790-1050

Principal investigator name: Johnette Davies, Director of Historical Services

Principal investigator signature: _____

Organization: Kise Straw & Kolodner DATE: _____

9. OTHER NOTES OR OBSERVATIONS:

10. STATE HISTORIC CONTEXT FRAMEWORK (check all appropriate boxes;
refer to state management plan(s)):

a) Time period(s) 1940-1960 Suburbanization and Early Ex-urbanization

b) Geographical zone Piedmont

c) Historic period theme(s) Architecture, Engineering, and Decorative Arts; Government



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .001

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good _____ fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey with blue shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North

1) Bays 5 units facing north, into courtyard

2) Windows

fenestration Irregular

type Vinyl 1/1 with 6/6 snap-in dividers; 1 large six-light fixed window

trim wood and vinyl

shutters inoperable louvered (blue)

Facade (cont'd)

- 3) Door(s)
 location One per residential until fronting on this facade (5 units)
 type pane and panel wood, with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop for each entryway

b. Side: Direction: East

- 1) Bays 2 units facing east
- 2) Windows
 fenestration irregular
 type 1/1 vinyl with 6/6 snap-in dividers; large bay window
 trim wood and vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: West

- 1) Bays 2 units facing west
- 2) Windows
 fenestration irregular
 type 1/1 vinyl with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood and vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: South

- 1) Bays 2 units fronting south
- 2) Windows
 fenestration irregular
 type 1/1 vinyl with 6/6 snap-in dividers; Large bay windows
 trim vinyl and wood
 shutters inoperable louvered
- 3) Door(s)
 location One per residential unit fronting on this facade (2 units)
 type pane and panel wood, with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop for each entryway, with wrought iron railings

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1225, 1227, 1229, 1231, 1233, 1235
 Centre Road



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .002

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey with blue shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: South

1) Bays 5 residential units fronting south

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers

trim wood and vinyl

shutters inoperable louvered

Facade (cont'd)

3) Door(s)

location 1 for each residential unit
 type paneled, with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window

4) Porches concrete stoop for each residential until in front of main entrance

b. Side: Direction: East

1) Bays 2 residential units

2) Windows

fenestration irregular
 type 1/1 vinyl dhs with 6/6 snap-in dividers; large bay window
 trim wood and vinyl; bay window has wood shingle hood
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

c. Side: Direction: West

1) Bays 2 residential units

2) Windows

fenestration irregular
 type 1/1 vinyl dhs with 6/6 snap-in dividers; large bay window
 trim wood and vinyl; bay window has wood shingle hood
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

d. Rear: Direction: North

1) Bays 5 residential units; 2 front to the north

2) Windows

fenestration irregular
 type 1/1 vinyl dhs with 6/6 snap-in dividers
 trim wood and vinyl
 shutters inoperable louvered

3) Door(s)


location 1 for each residential unit fronting this facade
 type paneled, with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window

4) Porches concrete stoop for each entrance, with wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1205 -1217 Centre Road

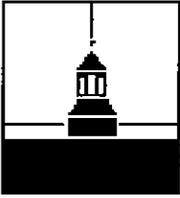

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .003

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).

a) Overall shape L-shaped
stories 1 story with 2-story end units
bays 6 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s)

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: South

1) Bays 5 residential units; 1 fronts on this side
2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; large bay window

trim wood and vinyl; bay window has wood shingled roof
shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location 1 for each residential unit fronting on this side
 type paneled wood door, with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop for each entryway

b. Side: Direction: East

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs with 6/6 snap-in dividers; Large bay window
 trim wood and vinyl
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit which fronts this direction (1 unit) - Main Office for complex is here
 type paneled wood door, with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop for each entryway, with wrought iron railing

c. Side: Direction: West

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap-in dividers
 trim wood and vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: North

- 1) Bays 5 residential units, 4 fronting north
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap-in dividers
 trim wood and vinyl
 shutters inoperable louvered
- 3) Door(s)
 location 1 for each residential unit fronting on this side
 type paneled wood door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop for each residential unit, with wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1201 and 1203 Centre Road, and #1,3,5,7 Lowry Drive



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .004

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape L-shaped
stories 1 story with 2-story end units
bays 5 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) white with black shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North

1) Bays 4 units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large bay window with asphalt shingled hood

trim wood and vinyl; stucco covering brick for replacement bay window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location 1 per residential unit fronting on this facade (1 unit)
 type paneled wood door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing

b. Side: Direction: West

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs with 6/6 snap in dividers
 trim wood and vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: East

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large bay window with wood shingled hood
 trim wood and vinyl; wood shingled hood; stucco covering brick where bay replaced larger window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: South

- 1) Bays 4 residential units front on this facade
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large bay window with wood shingled hood
 trim wood, vinyl; stucco covers brick where bay replaced larger window; wood shingled hood over bay
 shutters inoperable louvered
- 3) Door(s)
 location 1 per residential unit on this facade (4 units)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railings

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1160 Centre Road, #2,4,6,8 Lowry Drive

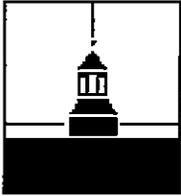

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .005

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) white with black shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North

1) Bays 5 residential units, 4 fronting to the north

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl

shutters inoperable louvered

Facade (cont'd)

3) Door(s)

location 1 per residential unit, 4 fronting this side

type paneled wood doors, with aluminum storm doors

trim wood; concrete trim above door and adjacent window

4) Porches concrete stoop for each entrance, with wrought iron railing

b. Side: Direction: East

1) Bays 2 residential units

2) Windows

fenestration irregular

type 1/1 dhs vinyl windows with 6/6 snap-in dividers

trim wood and vinyl

shutters inoperable louvered

3) Door(s)

location one per residential unit which fronts this direction (1 unit)

type wood paneled door with aluminum storm door

trim wood; concrete trim above door and adjacent 1/1 window

4) Porches concrete stoop for each entrance, with wrought iron railing

c. Side: Direction: West

1) Bays 2 residential units

2) Windows

fenestration irregular

type 1/1 dhs vinyl windows with 6/6 snap in dividers; 1 large bay window

trim wood and vinyl; bay window has wood shingled hood and cement trim behind; stucco

shutters inoperable louvered

3) Door(s)

location n/a

type n/a

trim n/a

4) Porches n/a

d. Rear: Direction: South

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 dhs vinyl windows w/ 6/6 snap-in dividers; 2 large six-light fixed windows

trim wood

shutters inoperable louvered

3) Door(s)

location one per residential unit fronting in this direction (2 units)

type wood paneled door with aluminum storm door

trim wood; concrete trim above door and adjacent 1/1 window

4) Porches concrete stoop for each entrance, with wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1155, 1157, 1159, 1161, 1163, 1165, and 1167 Centre Road



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .006

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) white with black shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: South

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 3 side by side 1/1 windows with snap in dividers

trim wood and vinyl

shutters inoperable louvered (no shutters on #1141)

Facade (cont'd)

- 3) Door(s)
 location one per residential unit which fronts on this side (5)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: East

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: West

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim vinyl; wood; concrete trim above window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: North

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 2 large six-light fixed windows
 trim wood; vinyl; concrete trim above large windows
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1135, 1137, 1139, 1141, 1143, 1145, 1147 Centre Road



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .007

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) white with black shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North

1) Bays 5 residential units
2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl; concrete trim above door and adjacent window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit which fronts this direction (5)
 type wood panel with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: East

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snapin dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: West

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above large window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: South

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1121, 1123, 1125, 1127, 1129, 1131, and 1133 Centre Road

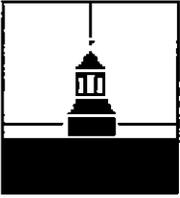

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .008

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where _____

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) white with black shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: South

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl; concrete trim above large window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location 1 per residential unit which fronts this direction (5 units)
 type wood panel with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: East

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: West

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above large window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: North

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above large window
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1101, 1103, 1105, 1107, 1109, 1111, 1113 Centre Road

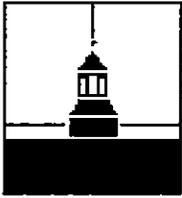

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .009

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.)

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) white with black shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: South

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large fixed window

trim wood and vinyl; concrete trim above large window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit which front this direction (5 units)
 type wood panel with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: East

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: West

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; large replacement bay window
 trim wood, vinyl; concrete trim from original window still visible behind bay; wood shingled hood
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: North

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 2 large six-light fixed window
 trim wood, vinyl; concrete trim above large windows
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #38,40, 42, 44, 46, 48, 50 Devlin Terrace

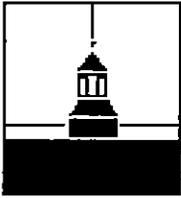

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .010

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) white with black shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl; concrete trim above large fixed window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit facing this direction (5 units)
 type paneled wood with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: East

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: West

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: South

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above large fixed window
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #18, 20, 22, 24, 26, 28, and 30 Delvin Terrace.



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .011

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) white with black shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl; concrete trim above large window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit facing this direction (5)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: East

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; one large bay window
 trim wood, vinyl; concrete trim above bay window; wood shingled hood
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: West

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; large bay replacement window
 trim wood, vinyl; bay window has wood shingled hood and concrete transom behind
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: South

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 2 large six-light fixed windows
 trim wood, vinyl; concrete trim above fixed windows
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #4, 6, 8, 10, 12, 14, and 16 Devin Terrace

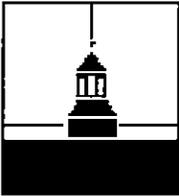

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .012

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) white with black shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: East

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl; concrete trim above window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit facing this direction (5)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: South

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above large window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: West

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows; 1 large six-light fixed window; one set of 3 1/1 vinyl windows
 trim wood, vinyl; concrete trim above large windows
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #2 Delvin Terrace, and 10, 12, 14, 16, 18, and 20 Lowry Drive



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .013

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey with blue shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: West

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl; concrete trim above fixed window

shutters inoperable louvered

Facade (cont'd)

3) Door(s)

location one per residential unit facing this direction (5 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window

4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

1) Bays 2 residential units

2) Windows

fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

c. Side: Direction: South

1) Bays 2 residential units

2) Windows

fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

d. Rear: Direction: East

1) Bays 5 residential units

2) Windows

fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered

3) Door(s)


location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window

4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #15, 17, 19, 21, 23, 25, 27 Lowry Drive

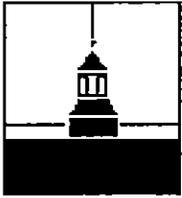

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .014

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).

a) Overall shape L-shaped
stories 1 story with 2-story end units
bays 6 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey with blue shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: East

1) Bays 5 residential units
2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; large bay window

trim wood and vinyl; concrete trim above bay window; asphalt shingled hood

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (4 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: South

- 1) Bays 1 residential unit
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: North

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this direction (2)
 type wood paneled; with aluminum screen door
 trim wood; concrete transom above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

d. Rear: Direction: West

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1,3 Morton Avenue and #35, 37, 39, and 41 Lowry Drive



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .015

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).

a) Overall shape L-shaped
stories 1 story with 2-story end units
bays 6 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey with blue shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: West

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 2 large six-light fixed windows

trim wood and vinyl; concrete trim above fixed windows

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (4 units)
 type wood paneled, with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; large bay window
 trim wood, vinyl; stucco over base of bay window; asphalt shingled hood over bay window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: South

- 1) Bays 1 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/q
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: East

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #2,4 Morton Ave, and #43, 45, 47, and 49 Lowry Drive



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .016

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site moved _____
if moved, when and from where _____

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey with blue shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: East

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl; concrete trim above fixed window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (5 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: South

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: West

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above large window
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #57, 59, 61, 63, 65, 67, and 69 Lowry Drive



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .017

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site moved _____
if moved, when and from where _____

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) cream with blue shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: East

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl; concrete trim above fixed window

shutters inoperable louvered

Facade (cont'd)

3) Door(s)

location one per residential unit fronting this direction (5 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window

4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

1) Bays 2 residential units

2) Windows

fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters finoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

c. Side: Direction: South

1) Bays 2 residential units

2) Windows

fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; large bay window
 trim wood, vinyl; stucco over base of bay window; asphalt shingled hood
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

d. Rear: Direction: West

1) Bays 5 residential units

2) Windows

fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)


location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window

4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #74, 76, 78, 80, 82, 84, 86 Lowry Drive

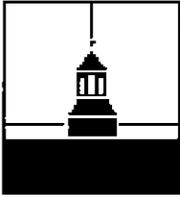

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .018

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site moved _____
if moved, when and from where _____

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) cream with blue shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: West

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl; concrete trim above fixed window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (5 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: South

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; large bay window
 trim wood, vinyl; asphalt shingled hood over bay window; concrete transom visible behind bay
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: East

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways; wooden ADA ramp leading to unit #62

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #54, 56, 58, 60, 62, 64, 66 Lowry Drive



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .019

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site _____ x moved _____
if moved, when and from where _____

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) cream with blue shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: East

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 3 1/1 vinyl dhs windows, with cement transom above

trim wood and vinyl

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (5)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: South

- 1) Bays 3 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: North

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; large bay window
 trim wood, vinyl; asphalt shingled hood over bay window; stucco covering base of bay
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: West

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 2 large six-light fixed windows
 trim wood, vinyl
 shutters inoperable louvered; concrete transom above fixed windows
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #23, 25, 27, 29, 31, 33, and 35 Delvin Terrace

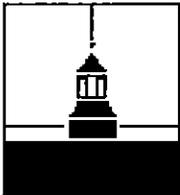

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .020

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) cream with blue shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: West

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (5 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; large bay window
 trim wood, vinyl; asphalt shingled hood; stucco covering base of bay window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: South

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim over fixed window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: East

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #3, 5, 7, 9, 11, 13, 15 Delvin Terrace



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .021

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) cream with blue shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: West

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 2 large six-light fixed windows

trim wood and vinyl; concrete trim above fixed window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (5 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: South

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: East

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 1 large six-light fixed window; 3 1/1 replacement
 trim wood, vinyl; concrete trim above fixed window and triple 1/1 windows
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #40, 42, 44, 46, 48, 50, 52 Lowry Drive



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .022

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) cream with blue shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: West

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl; concrete trim above large fixed window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (5 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: South

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: East

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1 Delvin Terrace; 22, 24, 68, 28, 30, 32 Lowry Drive

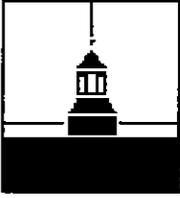

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .023

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site moved _____
if moved, when and from where _____

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) cream with blue shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: East

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; triple 1/1 windows

trim wood and vinyl; concrete trim above triple window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (2 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: South

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: West

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #37, 39, 41, 43, 45, 47, 49 Delvin Terrace



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .024

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) cream with blue shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: East

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl; concrete trim above fixed window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (5 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; large bay window
 trim wood, vinyl; wood shingles covering bay window hood; stucco covering base of bay
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: South

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: West

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #57, 59, 61, 63, 65, 67, 69 Delvin Terrace

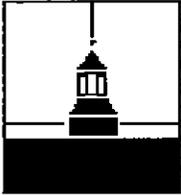

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .025

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey with red shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: East

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl

shutters inoperable louvered

Facade (cont'd)

3) Door(s)

location one per residential unit fronting this direction (5 units)

type wood paneled with aluminum storm door

trim wood; concrete trim above door and adjacent window

4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

1) Bays 2 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs windows with 6/6 snap in dividers; large fixed window

trim wood, vinyl

shutters inoperable louvered

3) Door(s)

location n/a

type n/a

trim n/a

4) Porches n/a

c. Side: Direction: South

1) Bays 2 residential units

2) Windows

fenestration irregular

type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window

trim wood, vinyl; concrete trim above

shutters inoperable louvered

3) Door(s)

location n/a

type n/a

trim n/a

4) Porches n/a

d. Rear: Direction: West

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 dhs vinyl windows with 6/6 snap in dividers

trim wood, vinyl

shutters inoperable louvered

3) Door(s)

location one per residential unit fronting this side (2)

type wood paneled door with aluminum storm door

trim wood; concrete trim above door and adjacent 1/1 window

4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #72, 74, 76, 78, 80, 82, 84 Delvin Terrace



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .026

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape L-shaped
stories 1 story with 2-story end units
bays 6 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey with red shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: West

1) Bays 5 residential units
2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window; triple 1/1 dhs windows

trim wood and vinyl; concrete trim above fixed window and 1/1 replacements

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (5 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

- 1) Bays 1 residential unit
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: South

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: East

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #58, 60, 62, 64 Delvin Terrace, and 5 and 7 Caleb Terrace



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .027

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape L-shaped
stories 1 story with 2-story end units
bays 6 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey with red shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: South

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 3 1/1 windows

trim wood and vinyl; concrete trim above 3 1/1 windows

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (3 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: West

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; large bay window
 trim wood, vinyl; wood shingled hood over bay window
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this direction (1 unit)
 type wood paneled with aluminum storm door
 trim wood
- 4) Porches concrete stoop with wrought iron railing, one per residential unit

c. Side: Direction: East

- 1) Bays 1 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: North

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 2 large six-light fixed windows
 trim wood, vinyl; concrete trim above fixed windows
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #42,44, 46, Caleb Terrace and #52, 54, 56 Delvin Terrace



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .028

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey with red shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl

shutters inoperable louvered

Facade (cont'd)

3) Door(s)

location one per residential unit fronting this direction (5 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window

4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: West

1) Bays 2 residential units

2) Windows

fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; large bay window
 trim wood, vinyl; wood shingled hood covering bay window
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

c. Side: Direction: East

1) Bays 2 residential units

2) Windows

fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

d. Rear: Direction: South

1) Bays 5 residential units

2) Windows

fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 2 large six-light fixed windows
 trim wood, vinyl; concrete trim above fixed windows
 shutters inoperable louvered

3) Door(s)


location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window

4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #28, 30, 32, 34, 36, 38, 40 Caleb Terrace

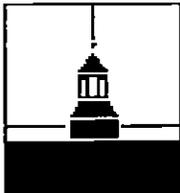

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .029

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
stories 1 story with 2-story end units
bays 7 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey with red shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: South

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; large bay window

trim wood and vinyl; asphalt shingled hood over bay window
shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (5 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: West

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: East

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; large bay window
 trim wood, vinyl; wood shingled hood over bay window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: North

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 2 large six-light fixed windows
 trim wood, vinyl; concrete trim above fixed windows
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes # 8, 10, 12, 14, 16, 18, 20 Caleb Terrace

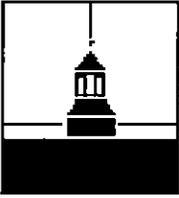

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .030

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site x moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).

a) Overall shape L-shaped
stories 1 story with 2-story end units
bays 6 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)
materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey with red shutters

e) Roof
shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North
1) Bays 5 residential units
2) Windows
fenestration irregular
type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large bay window
trim wood and vinyl; asphalt shingled hood over bay window
shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (3 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: West

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; 1 large bay window
 trim wood, vinyl; asphalt shingled hood over bay window
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this direction (1 unit)
 type wood paneled with aluminum storm door
 trim wood; concrete trim over bay window
- 4) Porches concrete stoop with wrought iron railing

c. Side: Direction: East

- 1) Bays 1 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: South

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 1 large six-light fixed window; 3 1/1 dhs windows as
 trim wood, vinyl; concrete trim over fixed window and over 3 1/1 dhs windows
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (3)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways; South side of building faces parking lot with tall bushes as divider between lot and yard

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #2, 4, 6 Caleb Terrace, 1752, 1754, 1756 Faulkland Road

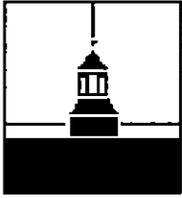

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .031

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival / International

5. INTEGRITY: original site moved _____
if moved, when and from where

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape L-shaped
stories 1 story with 2-story end units
bays 6 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey with red shutters

e) Roof

shape; materials asphalt shingle
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: West

1) Bays 5 residential units

2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl; concrete trim above fixed window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (4 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; large bay window
 trim wood, vinyl; wood shingled hood over bay window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: South

- 1) Bays 1 residential unit
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: East

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1 and 3 Caleb Terrace, and 1800, 1802, 1804, 1806 Faulkland Road

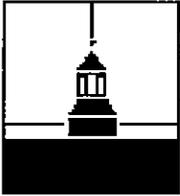

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .032

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type A
2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling
3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____
4. STYLE/FLOOR PLAN: Colonial Revival / International
5. INTEGRITY: original site _____ x moved _____
if moved, when and from where _____

list major alterations and dates (if known)

full height windows filled in with smaller bay windows; brick covered with stucco;
roof improvements, c. 2000

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).

a) Overall shape S-shaped
 stories 1 story with 2-story end units
 bays 7 residential units
 wings n/a

b) Structural system brick

c) Foundation
 basement brick
 materials brick

- d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
 color(s) grey with red shutters

- e) Roof

shape; materials asphalt shingle
 cornice none
 dormers n/a
 chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: East

1) Bays 5 residential units
 2) Windows

fenestration irregular

type 1/1 vinyl dhs with 6/6 snap in dividers; 1 large six-light fixed window

trim wood and vinyl

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (5 units)
 type wood paneled with aluminum storm door
 trim wood; concrete trim above door and adjacent window
- 4) Porches concrete stoop with wrought iron railing (one per entrance)

b. Side: Direction: North

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; large bay window
 trim wood, vinyl; wood shingled hood over bay window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: South

- 1) Bays 2 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above large fixed window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: West

- 1) Bays 5 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers; 1 large six-light fixed window; 3 1/1 dhs replacements
 trim wood, vinyl; concrete trim above windows
 shutters inoperable louvered
- 3) Door(s)
 location one per residential unit fronting this side (2)
 type wood paneled door with aluminum storm door
 trim wood; concrete trim above door and adjacent 1/1 window
- 4) Porches concrete stoop with wrought iron railing, one per residential unit entrance

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1814, 1816, 1818, 1820, 1822, 1824, 1826 Faulkland Terrace

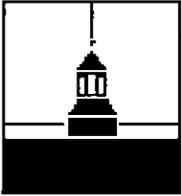

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .033

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type B

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival

5. INTEGRITY: original site x moved _____

if moved, when and from where

_____ list major alterations and dates (if known)

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape U-shape
stories 2 story residential unit with flanking one story residential units
bays 3 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials brick; vertical aluminum siding at upper portion of second story
color(s) grey shutters, red aluminum siding on second floor

e) Roof

shape; materials side gable, with hipped roof on central block
cornice none
dormers n/a
chimney location(s) one on South facade (exterior); brick

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North

1) Bays 3 residential units

2) Windows

fenestration symmetrical

type 1/1 dhs vinyl windows, with 1 large fixed window to right of door to centrally located unit

trim vinyl; wood; concrete transom above fixed window

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit (3 units) fronting this direction
 type wood paneled with aluminum storm door
 trim wood
- 4) Porches concrete stoop with wrought iron railing (one per entrance); 6 full height metal columns supporting roof overhang on central block.

b. Side: Direction: East

- 1) Bays 1 residential unit
- 2) Windows
 fenestration asymmetrical
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: West

- 1) Bays 1 residential unit
- 2) Windows
 fenestration asymmetrical
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: South

- 1) Bays 3 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl dhs windows with 6/6 snap-in dividers
 trim vinyl
 shutters inoperable louvered
- 3) Door(s)
 location one, at basement level.
 type Metal slab door
 trim metal
- 4) Porches concrete steps down to basement entrance, wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1812, 1810, 1808 Faulkland Road



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .034

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type B

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival

5. INTEGRITY: original site x moved _____
if moved, when and from where

_____ list major alterations and dates (if known)

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape U-shape
stories 2 story residential unit with flanking one story residential units
bays 3 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials brick; vertical aluminum siding at upper portion of second story
color(s) red brick, with cream shutters and red aluminum siding at second floor

e) Roof

shape; materials side gabled, with hipped roof on central block
cornice none
dormers n/a
chimney location(s) one exterior, on north facade; brick

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: South

1) Bays 3 residential units

2) Windows

fenestration symmetrical

type 1/1 dhs vinyl windows, with 1 large six-light fixed window to right of door to centrally located unit

trim vinyl, wood

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit (3 units)
 type wood paneled, with aluminum storm door
 trim wood; wood transom and door surround
- 4) Porches concrete stoop with wrought iron railing (one per entrance); 6 full height metal columns supporting roof overhang on central block.

b. Side: Direction: East

- 1) Bays 1 residential unit
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: West

- 1) Bays 1 residential unit
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters finoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: North

- 1) Bays 3 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location one, at basement level of central block
 type metal slab door
 trim wood, metal
- 4) Porches concrete steps down to basement entrance, wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #66, 68, 70 Delvin Terrace

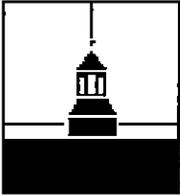

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .035

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type B

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival

5. INTEGRITY: original site _____ x moved _____

if moved, when and from where

_____ list major alterations and dates (if known)

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape U-shape
stories 2 story residential unit with flanking one story residential units
bays 3 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials brick; vertical aluminum siding at upper portion of second story
color(s) red brick with grey shutters and red aluminum siding at second story

e) Roof

shape; materials side gabled, with hipped roof on central block
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: West

1) Bays 3 residential units

2) Windows

fenestration symmetrical

type 1/1 dhs vinyl windows, with 1 large six-light fixed window to right of door to centrally located unit

trim vinyl, wood

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit (3 units)
 type wood paneled, with aluminum storm door
 trim wood; wood transom and door surround
- 4) Porches concrete stoop with wrought iron railing (one per entrance); 6 full height metal columns supporting roof overhang on central block.

b. Side: Direction: North

- 1) Bays 1 residential unit

2) Windows

- fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; large bay window
 trim wood, vinyl; wood shingled hood over bay window; base of bay window patched with red stucco
 shutters inoperable louvered

3) Door(s)

- location n/a
 type n/a
 trim n/a

4) Porches n/a

c. Side: Direction: South

- 1) Bays 1 residential unit

2) Windows

- fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; large bay window
 trim wood, vinyl; wood shingled hood over bay window; base of bay window patched with red stucco
 shutters inoperable louvered

3) Door(s)

- location n/a
 type n/a
 trim n/a

4) Porches n/a

d. Rear: Direction: East

- 1) Bays 3 residential units

2) Windows

- fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)


- location one, at basement level of central block
 type metal slab door
 trim wood, metal

4) Porches concrete steps down to basement entrance, wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #22, 24, 26 Caleb Terrace

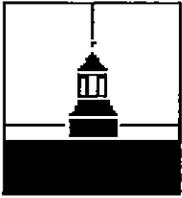

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .036

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type B

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival

5. INTEGRITY: original site _____ x moved _____

if moved, when and from where

_____ list major alterations and dates (if known)

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape U-shape
stories 2 story residential unit with flanking one story residential units
bays 3 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) cream with blue shutters, cream colored aluminum siding

e) Roof

shape; materials side gabled, with hipped roof on central block
cornice none
dormers n/a
chimney location(s) one exterior, on south facade; brick

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North

1) Bays 3 residential units

2) Windows

fenestration symmetrical

type 1/1 dhs vinyl windows, with 1 large six-light fixed window to right of door to centrally located unit

trim vinyl, wood

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit (3 units)
 type wood paneled, with aluminum storm door
 trim wood; wood transom and door surround
- 4) Porches concrete stoop with wrought iron railing (one per entrance); 6 full height metal columns supporting roof overhang on central block.

b. Side: Direction: East

- 1) Bays 1 residential unit
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: West

- 1) Bays 1 residential unit
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; large bay window
 trim wood, vinyl; wood shingled hood over bay window; base of bay window patched with red stucco
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: South

- 1) Bays 3 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location one, at basement level of central block
 type metal slab door
 trim wood; metal
- 4) Porches concrete steps down to basement entrance, wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #51, 53, 55 Delvin Terrace

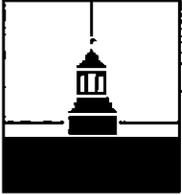

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .037

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type B

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival

5. INTEGRITY: original site x moved _____
if moved, when and from where

_____ list major alterations and dates (if known)

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape U-shape
stories 2 story residential unit with flanking one story residential units
bays 3 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey stucco, cream shutters

e) Roof

shape; materials side gabled, with hipped roof on central block
cornice none
dormers n/a
chimney location(s) one exterior, on north facade

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: South

1) Bays 3 residential units

2) Windows

fenestration symmetrical

type 1/1 dhs vinyl windows, with 1 large six-light fixed window to right of door to centrally located unit

trim vinyl, wood

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit (3 units)
 type wood paneled, with aluminum storm door
 trim wood; wood transom and door surround
- 4) Porches concrete stoop with wrought iron railing (one per entrance); 6 full height metal columns supporting roof overhang on central block.

b. Side: Direction: East

- 1) Bays 1 residential unit
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: West

- 1) Bays 1 residential unit
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: North

- 1) Bays 3 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location one, at basement level of central block (17 steps down to basement entrance)
 type metal slab door
 trim wood; metal
- 4) Porches concrete steps down to basement entrance, wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #68, 70, 72 Lowry Drive



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .038

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type B

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival

5. INTEGRITY: original site _____ x moved _____

if moved, when and from where

list major alterations and dates (if known)

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape U-shape
stories 2 story residential unit with flanking one story residential units
bays 3 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials brick; vertical aluminum siding at upper portion of second story
color(s) red brick with cream shutters, and red aluminum siding

e) Roof

shape; materials side gabled, with hipped roof on central block
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: South

1) Bays 3 residential units

2) Windows

fenestration symmetrical

type 1/1 dhs vinyl windows, with 1 large six-light fixed window to right of door to centrally located unit

trim vinyl, wood

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit (3 units)
 type wood paneled, with aluminum storm door
 trim wood; wood transom and door surround
- 4) Porches concrete stoop with wrought iron railing (one per entrance); 6 full height metal columns supporting roof overhang on central block.

b. Side: Direction: East

- 1) Bays 1 residential unit
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: West

- 1) Bays 1 residential unit
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: North

- 1) Bays 3 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location one, at basement level of central block
 type metal slab door
 trim wood; metal
- 4) Porches concrete steps down to basement entrance, wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways; large asphalt pad behind buildings 38 and 39, with permanent clothes line supports

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #34,36, 38 Delvin Terrace



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .039

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type B

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival

5. INTEGRITY: original site x moved _____
if moved, when and from where

_____ list major alterations and dates (if known)

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape U-shape
stories 2 story residential unit with flanking one story residential units
bays 3 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials brick; vertical aluminum siding at upper portion of second story
color(s) red brick with cream shutters, and red aluminum siding

e) Roof

shape; materials side gabled, with hipped roof on central block
cornice none
dormers n/a
chimney location(s) one exterior, on north facade; brick

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North

1) Bays 3 residential units

2) Windows

fenestration symmetrical

type 1/1 dhs vinyl windows, with 1 large six-light fixed window to right of door to centrally located unit

trim vinyl, wood

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit (3 units)
 type wood paneled, with aluminum storm door
 trim wood; wood transom and door surround
- 4) Porches concrete stoop with wrought iron railing (one per entrance); 6 full height metal columns supporting roof overhang on central block.

b. Side: Direction: East

- 1) Bays 1 residential unit

2) Windows

- fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete transom above fixed window
 shutters inoperable louvered

3) Door(s)

- location n/a
 type n/a
 trim n/a

4) Porches n/a

c. Side: Direction: West

- 1) Bays 1 residential unit

2) Windows

- fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)

- location n/a
 type n/a
 trim n/a

4) Porches n/a

d. Rear: Direction: South

- 1) Bays 3 residential units

2) Windows

- fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)

- location one, at basement level of central block
 type metal slab door
 trim wood; metal

4) Porches concrete steps down to basement entrance, wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways; large asphalt pad behind buildings 38 and 39, with permanent clothes line supports

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes # 17, 19, 21 Delvin Terrace



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .040

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type B

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival

5. INTEGRITY: original site moved _____
if moved, when and from where

_____ list major alterations and dates (if known)

6. CONDITION: excellent _____ good fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape U-shape
stories 2 story residential unit with flanking one story residential units
bays 3 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials brick; vertical aluminum siding at upper portion of second story
color(s) red brick with blue shutters

e) Roof

shape; materials side gabled, with hipped roof on central block
cornice none
dormers n/a
chimney location(s) one exterior, on south facade; brick

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North

1) Bays 3 residential units

2) Windows

fenestration symmetrical

type 1/1 dhs vinyl windows, with 1 large six-light fixed window to right of door to centrally located unit

trim vinyl, wood

shutters inoperable louvered

Facade (cont'd)

3) Door(s)

location one per residential unit (3 units)
 type wood paneled, with aluminum storm door
 trim wood; wood transom and door surround

4) Porches concrete stoop with wrought iron railing (one per entrance); 6 full height metal columns supporting roof overhang on central block.

b. Side: Direction: East

1) Bays 1 residential unit

2) Windows

fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; large bay window
 trim wood, vinyl; stucco patching around bay window; wood shingled hood over window
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

c. Side: Direction: West

1) Bays 1 residential unit

2) Windows

fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

d. Rear: Direction: South

1) Bays 3 residential units

2) Windows

fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)

location one, at basement level of central block
 type metal slab door
 trim wood; metal

4) Porches concrete steps down to basement entrance, wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Patching on rear of building where windows may have been filled in. Building includes # 31, 33, 35 Lowry Drive.



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .041

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type B
2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling
3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival

5. INTEGRITY: original site x moved _____
if moved, when and from where

_____ list major alterations and dates (if known)

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.)

Use N/A for not applicable; leave no blanks).

a) Overall shape U-shape
stories 2 story residential unit with flanking one story residential units
bays 3 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey stucco with blue shutters, grey aluminum siding

e) Roof

shape; materials side gabled, with hipped roof on central block
cornice none
dormers n/a
chimney location(s) one, exterior, on south facade; brick

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North

1) Bays 3 residential units

2) Windows

fenestration symmetrical

type 1/1 dhs vinyl windows, with 1 large six-light fixed window to right of door to centrally located unit

trim vinyl, wood

shutters inoperable louvered

Facade (cont'd)

3) Door(s)

location one per residential unit (3 units)
 type wood paneled, with aluminum storm door
 trim wood; wood transom and door surround

4) Porches concrete stoop with wrought iron railing (one per entrance); 6 full height metal columns supporting roof overhang on central block.

b. Side: Direction: East

1) Bays 1 residential unit

2) Windows

fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

c. Side: Direction: West

1) Bays 1 residential unit

2) Windows

fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; one large bay window
 trim wood, vinyl; wood shingled hood over bay window
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

d. Rear: Direction: South

1) Bays 3 residential units

2) Windows

fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)

location one, at basement level of central block
 type metal slab door
 trim wood; metal

4) Porches concrete steps down to basement entrance, wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes # 29, 31, 33 Lowry Drive



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .042

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type B
2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling
3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____
4. STYLE/FLOOR PLAN: Colonial Revival
5. INTEGRITY: original site moved _____
if moved, when and from where _____
list major alterations and dates (if known)

6. CONDITION: excellent _____ good fair _____ poor _____
7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).
- a) Overall shape U-shape
stories 2 story residential unit with flanking one story residential units
bays 3 residential units
wings n/a
- b) Structural system brick
- c) Foundation
basement brick
materials brick
- d) Exterior walls (modern over original)
materials brick; vertical aluminum siding at upper portion of second story
color(s) red brick with red aluminum siding at second story, with blue shutters
- e) Roof
shape; materials side gabled, with hipped roof on central block
cornice none
dormers n/a
chimney location(s) one exterior, on west facade; brick
8. DESCRIPTION OF ELEVATIONS:
- a. Facade: Direction: East
- 1) Bays 3 residential units
2) Windows
fenestration symmetrical
type 1/1 dhs vinyl windows, with 1 large six-light fixed window to right of door to centrally located unit
trim vinyl, wood
shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit (3 units)
 type wood paneled, with aluminum storm door
 trim wood; wood transom and door surround
- 4) Porches concrete stoop with wrought iron railing (one per entrance); 6 full height metal columns supporting roof overhang on central block.

b. Side: Direction: North

- 1) Bays 1 residential unit
- 2) Windows
 fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: South

- 1) Bays 1 residential unit
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

d. Rear: Direction: West

- 1) Bays 3 residential units
- 2) Windows
 fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered
- 3) Door(s)
 location one, at basement level of central block
 type metal slab door
 trim wood; metal
- 4) Porches concrete steps down to basement entrance, wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1219, 1221, 1223 Centre Road



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .043

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type B

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival

5. INTEGRITY: original site x moved _____
if moved, when and from where

_____ list major alterations and dates (if known)

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape U-shape
stories 2 story residential unit with flanking one story residential units
bays 3 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials brick; vertical aluminum siding at upper portion of second story
color(s)

e) Roof

shape; materials side gabled, with hipped roof on central block
cornice none
dormers n/a
chimney location(s) one exterior, on north facade; brick

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North

1) Bays 3 residential units

2) Windows

fenestration symmetrical

type 1/1 dhs vinyl windows, with 1 large six-light fixed window to right of door to centrally located unit

trim vinyl, wood

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit (3 units)
 type wood paneled, with aluminum storm door
 trim wood; wood transom and door surround
- 4) Porches concrete stoop with wrought iron railing (one per entrance); 6 full height metal columns supporting roof overhang on central block.

b. Side: Direction: West

- 1) Bays 1 residential unit

2) Windows

- fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; large bay window
 trim wood, vinyl; wood shingles on bay window hood; stucco over bay window base
 shutters inoperable louvered

3) Door(s)

- location n/a
 type n/a
 trim n/a

4) Porches n/a

c. Side: Direction: East

- 1) Bays 1 residential unit

2) Windows

- fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)

- location n/a
 type n/a
 trim n/a

4) Porches n/a

d. Rear: Direction: South

- 1) Bays 3 residential units

2) Windows

- fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)

- location one, at basement level of central block
 type metal slab door
 trim wood; metal

4) Porches concrete steps down to basement entrance, wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #9, 11, 13 Lowry Drive



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .044

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type B

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival

5. INTEGRITY: original site x moved _____

if moved, when and from where

_____ list major alterations and dates (if known)

6. CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape U-shape
stories 2 story residential unit with flanking one story residential units
bays 3 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials brick; vertical aluminum siding at upper portion of second story
color(s) red brick with red aluminum siding

e) Roof

shape; materials side gabled, with hipped roof on central block
cornice none
dormers n/a
chimney location(s) one exterior, on north facade; brick

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: East

1) Bays 3 residential units

2) Windows

fenestration symmetrical

type 1/1 dhs vinyl windows, with 1 large six-light fixed window to right of door to centrally located unit

trim vinyl, wood

shutters inoperable louvered

Facade (cont'd)

3) Door(s)

location one per residential unit (3 units)
 type wood paneled, with aluminum storm door
 trim wood; wood transom and door surround

4) Porches concrete stoop with wrought iron railing (one per entrance); 6 full height metal columns supporting roof overhang on central block.

b. Side: Direction: North

1) Bays 1 residential unit

2) Windows

fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

c. Side: Direction: South

1) Bays 1 residential unit

2) Windows

fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; large bay window
 trim wood, vinyl; bay window has red painted stucco surround
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

d. Rear: Direction: West

1) Bays 3 residential units

2) Windows

fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)

location one, at basement level of central block
 type metal slab door
 trim wood; metal

4) Porches concrete steps down to basement entrance, wrought iron railing; 13 steps to basement

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1149, 1151, 1153 Centre Road



**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .045

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type B

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival

5. INTEGRITY: original site moved _____
if moved, when and from where _____

list major alterations and dates (if known)

6. CONDITION: excellent _____ good fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape U-shape
stories 2 story residential unit with flanking one story residential units
bays 3 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials brick; vertical aluminum siding at upper portion of second story
color(s) red brick, wth red aluminum siding

e) Roof

shape; materials side gabled, with hipped roof on central block
cornice none
dormers n/a
chimney location(s) one exterior, on east facade; brick

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: West

1) Bays 3 residential units

2) Windows

fenestration symmetrical

type 1/1 dhs vinyl windows, with 1 large six-light fixed window to right of door to centrally located unit

trim vinyl, wood

shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit (3 units)
 type wood paneled, with aluminum storm door
 trim wood; wood transom and door surround
- 4) Porches concrete stoop with wrought iron railing (one per entrance); 6 full height metal columns supporting roof overhang on central block.

b. Side: Direction: South

- 1) Bays 1 residential unit

2) Windows

- fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; large bay window
 trim wood, vinyl; wood shingled hood over bay window
 shutters inoperable louvered

3) Door(s)

- location n/a
 type n/a
 trim n/a

4) Porches n/a

c. Side: Direction: North

- 1) Bays 1 residential unit

2) Windows

- fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered

3) Door(s)

- location n/a
 type n/a
 trim n/a

4) Porches n/a

d. Rear: Direction: East

- 1) Bays 3 residential units

2) Windows

- fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)


- location one, at basement level of central block
 type metal slab door
 trim wood; metal

4) Porches concrete steps down to basement entrance, wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #32, 34, 36 Delvin Terrace

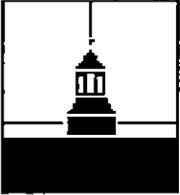

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .046

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type B
2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling
3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____
4. STYLE/FLOOR PLAN: Colonial Revival
5. INTEGRITY: original site x moved _____
if moved, when and from where _____
list major alterations and dates (if known)

6. CONDITION: excellent _____ good x fair _____ poor _____
7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).
 - a) Overall shape U-shape
stories 2 story residential unit with flanking one story residential units
bays 3 residential units
wings n/a
 - b) Structural system brick
 - c) Foundation
basement brick
materials brick
 - d) Exterior walls (modern over original)
materials brick; vertical aluminum siding at upper portion of second story
color(s) red brick, with red aluminum siding
 - e) Roof
shape; materials side gabled, with hipped roof on central block
cornice none
dormers n/a
chimney location(s) double chimney, exterior, on west facade; brick and stucco
8. DESCRIPTION OF ELEVATIONS:
 - a. Facade: Direction: East
 - 1) Bays 3 residential units
 - 2) Windows
fenestration symmetrical
type 1/1 dhs vinyl windows, with 1 large six-light fixed window to right of door to centrally located unit
trim vinyl, wood
shutters inoperable louvered

Facade (cont'd)

3) Door(s)

location one per residential unit (3 units)
 type wood paneled, with aluminum storm door
 trim wood; wood transom and door surround

4) Porches concrete stoop with wrought iron railing (one per entrance); 6 full height metal columns supporting roof overhang on central block.

b. Side: Direction: North

1) Bays 1 residential unit

2) Windows

fenestration irregular
 type 1/1 vinyl dhs windows with 6/6 snap in dividers; large bay window
 trim wood, vinyl; asphalt shingled hood above bay window; stucco surround
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

c. Side: Direction: South

1) Bays 1 residential unit

2) Windows

fenestration irregular
 type 1/1 dhs vinyl windows and 6/6 snap in dividers; 1 large six-light fixed window
 trim wood, vinyl; concrete trim above fixed window
 shutters inoperable louvered

3) Door(s)

location n/a
 type n/a
 trim n/a

4) Porches n/a

d. Rear: Direction: West

1) Bays 3 residential units

2) Windows

fenestration irregular
 type 1/1 dhs vinyl windows with 6/6 snap in dividers
 trim wood, vinyl
 shutters inoperable louvered

3) Door(s)


location one, at basement level of central block
 type metal slab door
 trim wood; metal

4) Porches concrete steps down to basement entrance, wrought iron railing

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1115, 1117, 1119 Centre Road

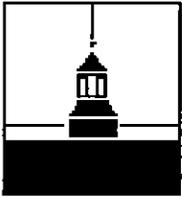

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .047

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type C
2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling
3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival

5. INTEGRITY: original site moved _____
if moved, when and from where _____

_____ list major alterations and dates (if known)

6. CONDITION: excellent _____ good fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.
Use N/A for not applicable; leave no blanks).

a) Overall shape Rectangular
stories 1 story
bays 2 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) grey with blue shutters

e) Roof

shape; materials side gable
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: North

1) Bays 2 residential units
2) Windows

fenestration asymmetrical
type 1/1 dhs vinyl windows

trim vinyl, wood
shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (2 units)
 type wood paneled with aluminum storm door
 trim wood
- 4) Porches concrete stoop for each entrance

b. Side: Direction: East

- 1) Bays 1
- 2) Windows
 fenestration one window
 type 1/1 dhs vinyl replacement
 trim vinyl, wood
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: West

- 1) Bays 1
- 2) Windows
 fenestration one window
 type 1/1 dhs vinyl replacement
 trim vinyl, wood
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: South

- 1) Bays 2 residential units
- 2) Windows
 fenestration asymmetrical
 type 1/1 dhs vinyl, large and small
 trim vinyl, wood
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #5 & 7 Lowry Drive

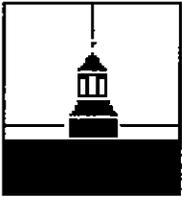

**CULTURAL RESOURCE SURVEY
MAIN BUILDING FORM**

CRS # N14270 .048

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type C

2. FUNCTION(S): historic Multi-family dwelling current Multi-family dwelling

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Colonial Revival

5. INTEGRITY: original site moved _____
if moved, when and from where _____

_____ list major alterations and dates (if known)

6. CONDITION: excellent _____ good fair _____ poor _____

7. DESCRIPTION: (Describe the resource as completely as possible.

Use N/A for not applicable; leave no blanks).

a) Overall shape Rectangular
stories 1 story
bays 2 residential units
wings n/a

b) Structural system brick

c) Foundation
basement brick
materials brick

d) Exterior walls (modern over original)

materials stucco; vertical aluminum siding at upper portion of second story
color(s) white with black shutters

e) Roof

shape; materials side gable
cornice none
dormers n/a
chimney location(s) n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: Direction: South

1) Bays 2 residential units

2) Windows

fenestration asymmetrical
type 1/1 dhs vinyl windows

trim vinyl, wood
shutters inoperable louvered

Facade (cont'd)

- 3) Door(s)
 location one per residential unit fronting this direction (2 units)
 type wood paneled with aluminum storm door
 trim wood
- 4) Porches concrete stoop for each entrance

b. Side: Direction: East

- 1) Bays 1
- 2) Windows
 fenestration one window
 type 1/1 dhs vinyl replacement
 trim vinyl, wood
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

c. Side: Direction: West

- 1) Bays 1
- 2) Windows
 fenestration one window
 type 1/1 dhs vinyl replacement
 trim vinyl/ wood
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a


d. Rear: Direction: North

- 1) Bays 2 residential units
- 2) Windows
 fenestration asymmetrical
 type 1/1 dhs vinyl, large and small
 trim vinyl, wood
 shutters inoperable louvered
- 3) Door(s)
 location n/a
 type n/a
 trim n/a
- 4) Porches n/a

9. INTERIOR: Not accessible at time of survey, but floor plans are available for each unit type.

10. LANDSCAPING: small bushes and shrubs, courtyard features large trees and circular pathways

11. OTHER COMMENTS: Brick soldier course at ground level; Building includes #1 and 2 Terrace Place

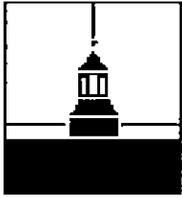

**CULTURAL RESOURCE SURVEY
SECONDARY BUILDING FORM**

CRS # N14270 .049

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type D

2. FUNCTION(S): Garage - 4 Car

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Vernacular / Rectangular plan

5. INTEGRITY: original site _____ X moved _____

6. CURRENT CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION:

a) Structural system brick

b) Number of stories 1

c) Wall Coverings stucco

d) Foundation brick, with brick soldier course at ground level

e) Roof
structural system Halifax
coverings asphalt shingles
openings n/a

8. DESCRIPTION OF ELEVATIONS:

a) Facade: direction: North

1) bays: 4

2) windows: n/a

3) door(s): metal (aluminum) overhead garage doors

4) other: western-most bay is completely filled in with concrete, creating a 3-car garage

b) Side: direction: East

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

c) Side: direction: West

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

d) Rear: direction: South

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

9. INTERIOR (if accessible):

a) Floor plan

Not accessible at time of survey.

b) Partition/walls


n/a

c) Finishes

n/a

d) Furnishings/machinery

n/a

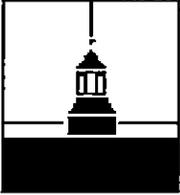

**CULTURAL RESOURCE SURVEY
SECONDARY BUILDING FORM**

CRS # N14270 .050

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type D

2. FUNCTION(S): Garage - 4 Car

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Vernacular / Rectangular plan

5. INTEGRITY: original site _____ X moved _____

6. CURRENT CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION:

a) Structural system brick

b) Number of stories 1

c) Wall Coverings stucco

d) Foundation brick, with brick soldier course at ground level

e) Roof
structural system Halifax
coverings asphalt shingles
openings n/a

8. DESCRIPTION OF ELEVATIONS:

a) Facade: direction: South

1) bays: 4

2) windows: n/a

3) door(s): metal (aluminum) overhead garage doors

4) other:

b) Side: direction: East

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

c) Side: direction: West

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

d) Rear: direction: North

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

9. INTERIOR (if accessible):

a) Floor plan

Not accessible at time of survey.

b) Partition/walls


n/a

c) Finishes

n/a

d) Furnishings/machinery

n/a

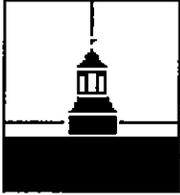

**CULTURAL RESOURCE SURVEY
SECONDARY BUILDING FORM**

CRS # N14270 .051

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type D
2. FUNCTION(S): Garage - 4 Car
3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____
4. STYLE/FLOOR PLAN: Vernacular / Rectangular plan
5. INTEGRITY: original site X moved _____
6. CURRENT CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION:

- a) Structural system brick
- b) Number of stories 1
- c) Wall Coverings stucco
- d) Foundation brick, with brick soldier course at ground level
- e) Roof
structural system Halifax
coverings asphalt shingles
openings n/a

8. DESCRIPTION OF ELEVATIONS:

- a) Facade: direction: North
- 1) bays: 4
- 2) windows: n/a
- 3) door(s): metal (aluminum) overhead garage doors
- 4) other:

b) Side: direction: East

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

c) Side: direction: West

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

d) Rear: direction: South

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

9. INTERIOR (if accessible):

a) Floor plan

Not accessible at time of survey.

b) Partition/walls

n/a

c) Finishes

n/a

d) Furnishings/machinery

n/a



**CULTURAL RESOURCE SURVEY
SECONDARY BUILDING FORM**

CRS # N14270 .052

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type D
2. FUNCTION(S): Garage - 4 Car
3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____
4. STYLE/FLOOR PLAN: Vernacular / Rectangular plan
5. INTEGRITY: original site moved _____
6. CURRENT CONDITION: excellent _____ good fair _____ poor _____

7. DESCRIPTION:

- a) Structural system brick
- b) Number of stories 1
- c) Wall Coverings stucco
- d) Foundation brick, with brick soldier course at ground level
- e) Roof
structural system Halifax
coverings asphalt shingles
openings n/a

8. DESCRIPTION OF ELEVATIONS:

- a) Facade: direction: South
- 1) bays: 4
- 2) windows: n/a
- 3) door(s): metal (aluminum) overhead garage doors
- 4) other:

b) Side: direction: East

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

c) Side: direction: West

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

d) Rear: direction: North

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

9. INTERIOR (if accessible):

a) Floor plan

Not accessible at time of survey.

b) Partition/walls


n/a

c) Finishes

n/a

d) Furnishings/machinery

n/a

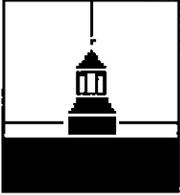

**CULTURAL RESOURCE SURVEY
SECONDARY BUILDING FORM**

CRS # N14270 .053

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type D
2. FUNCTION(S): Garage - 4 Car
3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____
4. STYLE/FLOOR PLAN: Vernacular / Rectangular plan
5. INTEGRITY: original site X moved _____
6. CURRENT CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION:

- a) Structural system brick
- b) Number of stories 1
- c) Wall Coverings stucco
- d) Foundation brick, with brick soldier course at ground level
- e) Roof
structural system Halifax
coverings asphalt shingles
openings n/a

8. DESCRIPTION OF ELEVATIONS:

- a) Facade: direction: North
- 1) bays: 4
- 2) windows: n/a
- 3) door(s): metal (aluminum) overhead garage doors
- 4) other:

b) Side: direction: East

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

c) Side: direction: West

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

d) Rear: direction: South

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

9. INTERIOR (if accessible):

a) Floor plan

Not accessible at time of survey.

b) Partition/walls


n/a

c) Finishes

n/a

d) Furnishings/machinery

n/a

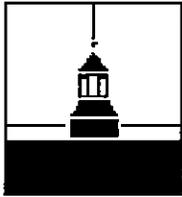

**CULTURAL RESOURCE SURVEY
SECONDARY BUILDING FORM**

CRS # NI4270 .054

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type D
2. FUNCTION(S): Garage - 4 Car
3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____
4. STYLE/FLOOR PLAN: Vernacular / Rectangular plan
5. INTEGRITY: original site X moved _____
6. CURRENT CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION:

- a) Structural system brick
- b) Number of stories 1
- c) Wall Coverings stucco
- d) Foundation brick, with brick soldier course at ground level
- e) Roof
structural system Halifax
coverings asphalt shingles
openings n/a

8. DESCRIPTION OF ELEVATIONS:

- a) Facade: direction: South
- 1) bays: 4
- 2) windows: n/a
- 3) door(s): metal (aluminum) overhead garage doors
- 4) other:

b) Side: direction: East

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

c) Side: direction: West

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

d) Rear: direction: North

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

9. INTERIOR (if accessible):

a) Floor plan

Not accessible at time of survey.

b) Partition/walls

n/a

c) Finishes

n/a

d) Furnishings/machinery

n/a



**CULTURAL RESOURCE SURVEY
SECONDARY BUILDING FORM**

CRS # N14270 .055

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type D
2. FUNCTION(S): Garage - 4 Car
3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____
4. STYLE/FLOOR PLAN: Vernacular / Rectangular plan
5. INTEGRITY: original site moved _____
6. CURRENT CONDITION: excellent _____ good fair _____ poor _____

7. DESCRIPTION:

- a) Structural system brick
- b) Number of stories 1
- c) Wall Coverings stucco
- d) Foundation brick, with brick soldier course at ground level
- e) Roof
structural system Halifax
coverings asphalt shingles
openings n/a

8. DESCRIPTION OF ELEVATIONS:

- a) Facade: direction: North
- 1) bays: 4
- 2) windows: n/a
- 3) door(s): metal (aluminum) overhead garage doors
- 4) other:

b) Side: direction: East

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

c) Side: direction: West

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

d) Rear: direction: South

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

9. INTERIOR (if accessible):

a) Floor plan

Not accessible at time of survey.

b) Partition/walls


n/a

c) Finishes

n/a

d) Furnishings/machinery

n/a

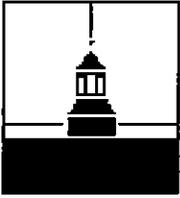

**CULTURAL RESOURCE SURVEY
SECONDARY BUILDING FORM**

CRS # N14270 .056

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type D

2. FUNCTION(S): Garage - 4 Car

3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____

4. STYLE/FLOOR PLAN: Vernacular / Rectangular plan

5. INTEGRITY: original site _____ X moved _____

6. CURRENT CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION:

a) Structural system brick

b) Number of stories 1

c) Wall Coverings stucco

d) Foundation brick, with brick soldier course at ground level

e) Roof
structural system Halifax
coverings asphalt shingles
openings n/a

8. DESCRIPTION OF ELEVATIONS:

a) Facade: direction: South

1) bays: 4

2) windows: n/a

3) door(s): metal (aluminum) overhead garage doors

4) other:

b) Side: direction: East

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

c) Side: direction: West

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

d) Rear: direction: North

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

9. INTERIOR (if accessible):

a) Floor plan

Not accessible at time of survey.

b) Partition/walls


n/a

c) Finishes

n/a

d) Furnishings/machinery

n/a

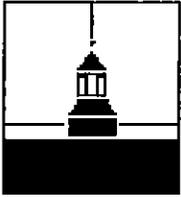

**CULTURAL RESOURCE SURVEY
SECONDARY BUILDING FORM**

CRS # N14270 .057

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type D
2. FUNCTION(S): Garage - 8 Car
3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____
4. STYLE/FLOOR PLAN: Vernacular / Rectangular plan
5. INTEGRITY: original site X moved _____
6. CURRENT CONDITION: excellent _____ good x fair _____ poor _____

7. DESCRIPTION:

- a) Structural system brick
- b) Number of stories 1
- c) Wall Coverings stucco
- d) Foundation brick, with brick soldier course at ground level
- e) Roof
structural system Halifax
coverings asphalt shingles
openings n/a

8. DESCRIPTION OF ELEVATIONS:

- a) Facade: direction: North
- 1) bays: 8
- 2) windows: n/a
- 3) door(s): metal (aluminum) overhead garage doors
- 4) other:

b) Side: direction: East

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

c) Side: direction: West

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

d) Rear: direction: South

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

9. INTERIOR (if accessible):

a) Floor plan

Not accessible at time of survey.

b) Partition/walls


n/a

c) Finishes

n/a

d) Furnishings/machinery

n/a

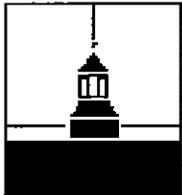

**CULTURAL RESOURCE SURVEY
SECONDARY BUILDING FORM**

CRS # N14270 .058

1. ADDRESS OF PROPERTY: 1201 Centre Road Woodland Apartments - Building Type D
2. FUNCTION(S): Garage - 8 Car
3. YEAR BUILT: 1952 ARCHITECT/BUILDER: _____
4. STYLE/FLOOR PLAN: Vernacular / Rectangular plan
5. INTEGRITY: original site moved _____
6. CURRENT CONDITION: excellent _____ good fair _____ poor _____

7. DESCRIPTION:

- a) Structural system brick
- b) Number of stories 1
- c) Wall Coverings stucco
- d) Foundation brick, with brick soldier course at ground level
- e) Roof
structural system Halifax
coverings asphalt shingles
openings n/a

8. DESCRIPTION OF ELEVATIONS:

- a) Facade: direction: South
- 1) bays: 8
- 2) windows: n/a
- 3) door(s): metal (aluminum) overhead garage doors
- 4) other:

b) Side: direction: East

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

c) Side: direction: West

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

d) Rear: direction: North

1) bays: 1

2) windows: n/a

3) door(s): n/a

4) other: n/a

9. INTERIOR (if accessible):

a) Floor plan

Not accessible at time of survey.

b) Partition/walls

n/a

c) Finishes

n/a

d) Furnishings/machinery


n/a

4. SITE PLAN:

CRS # N14270 .001

INDICATE NORTH ON PLAN

Sketch Plan

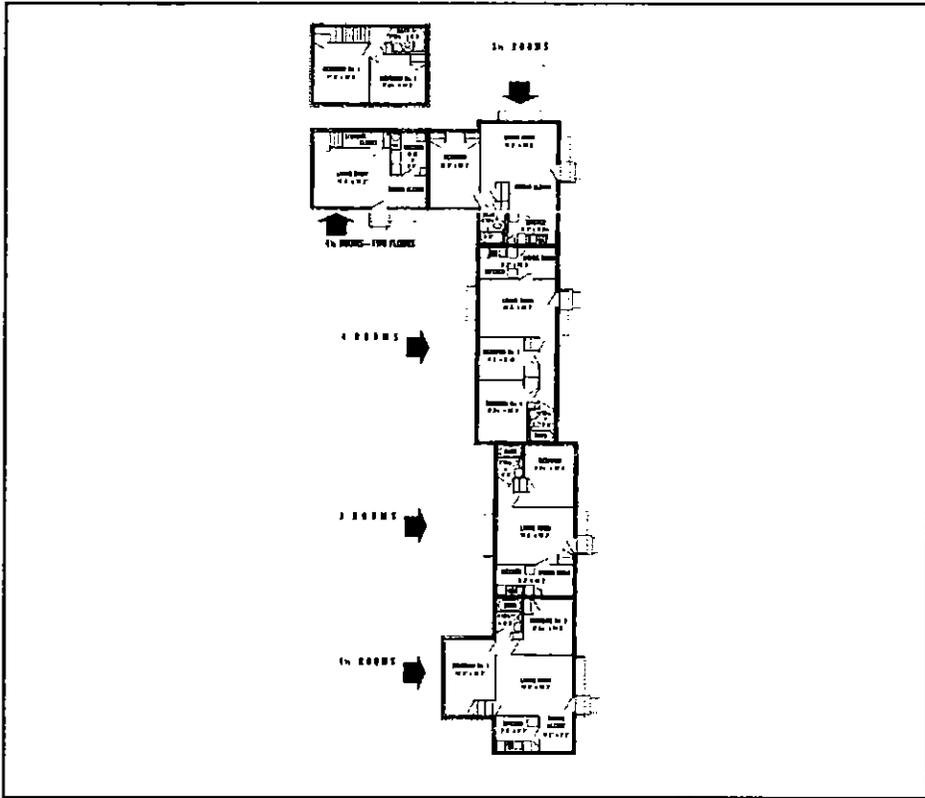

First-Floor Plan
(where available)


NOTE: Sketches are not to scale.

4. SITE PLAN:


CRS # N14270 .002

INDICATE NORTH ON PLAN

Sketch Plan

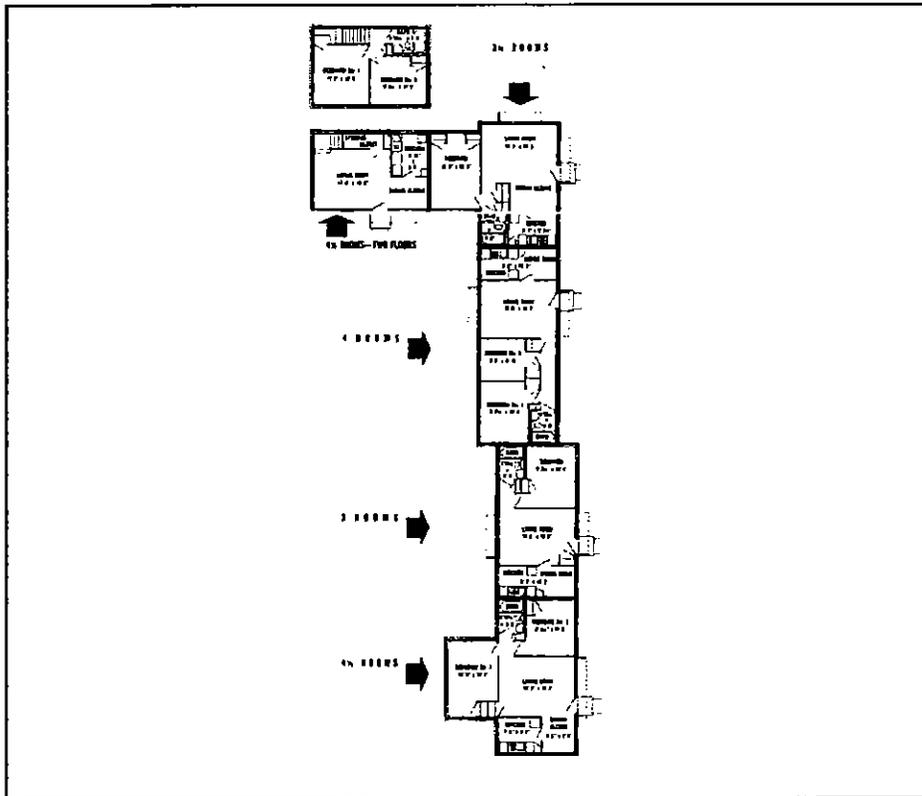

First-Floor Plan
(where available)

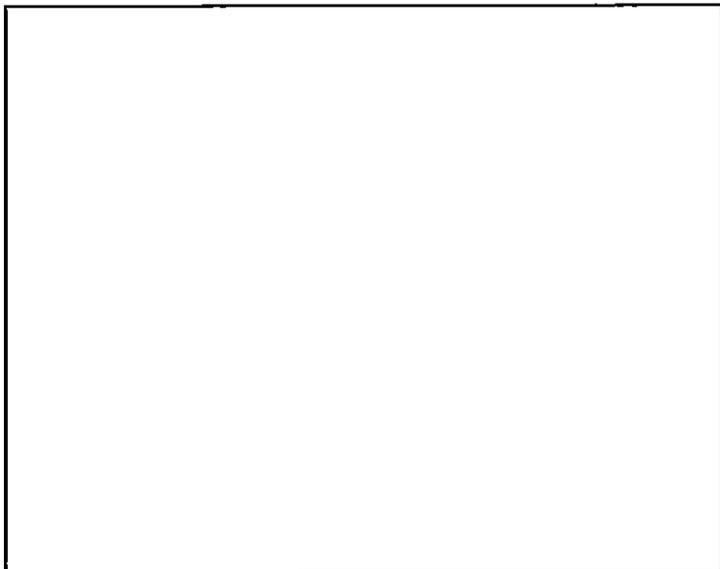


NOTE: Sketches are not to scale.

4. SITE PLAN:

CRS # N14270 .003

INDICATE NORTH ON PLAN


Sketch Plan

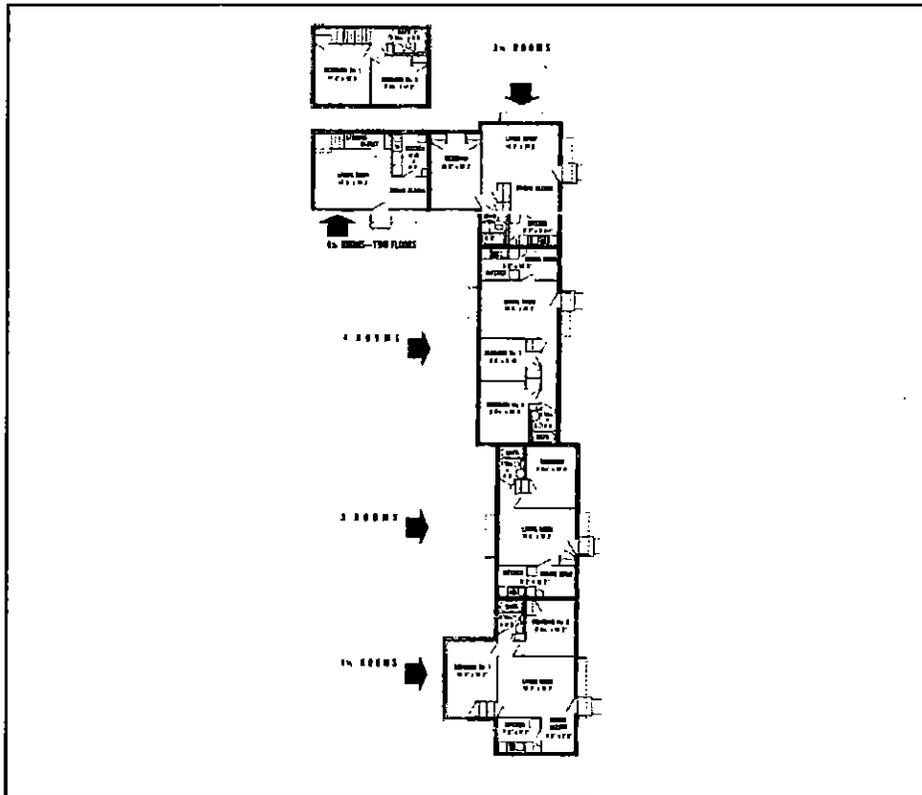

First-Floor Plan
(where available)



NOTE: Sketches are not to scale.

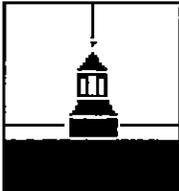

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .004


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason:

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

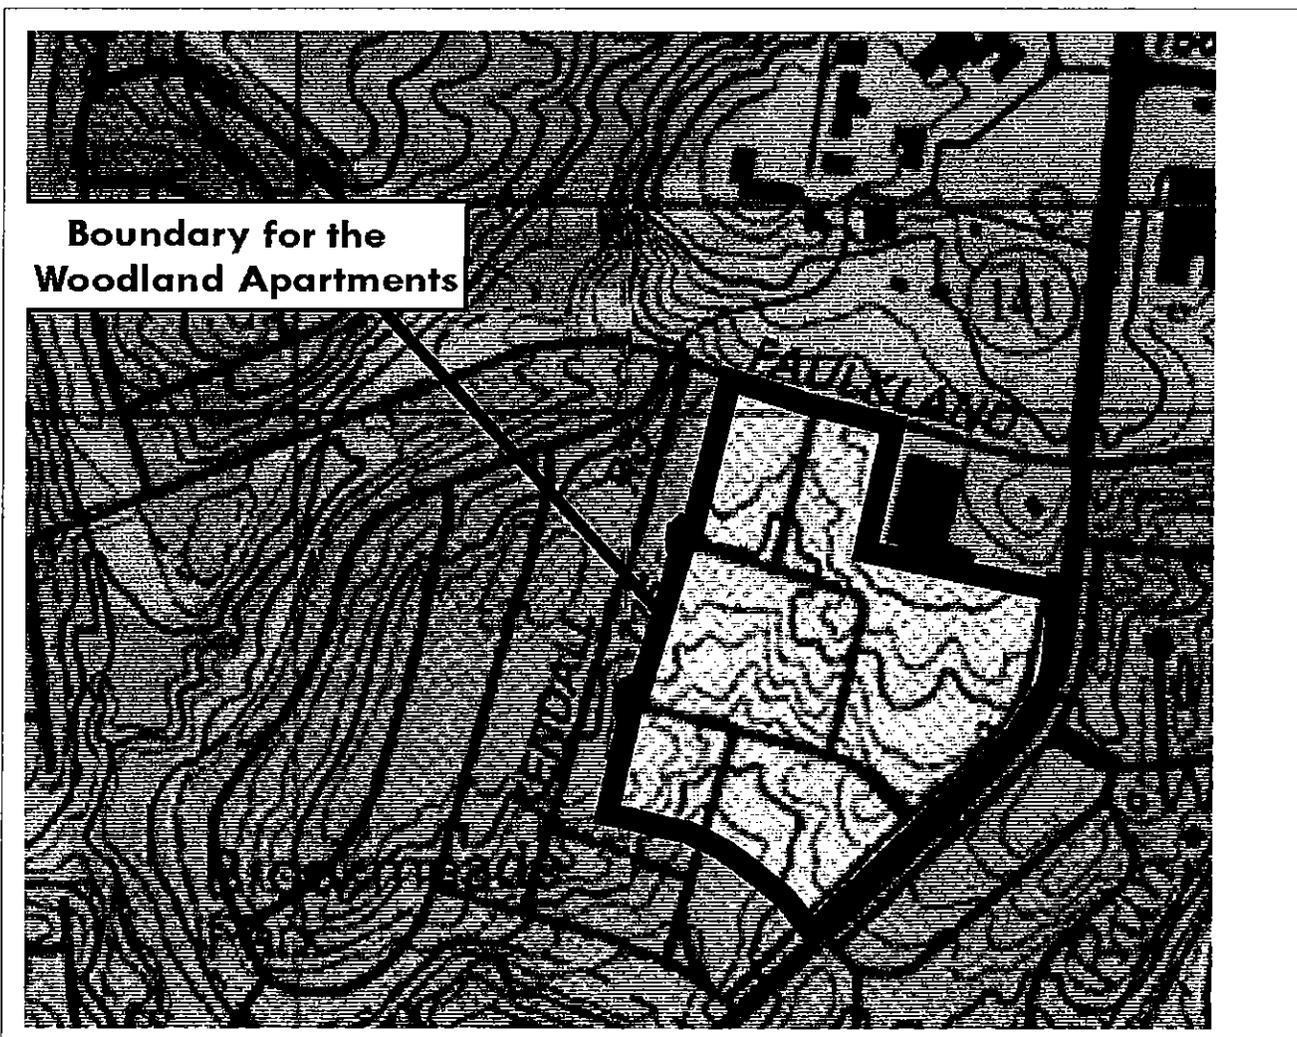


4. SITE PLAN:


CRS # N14270 .004

INDICATE NORTH ON PLAN

Sketch Plan

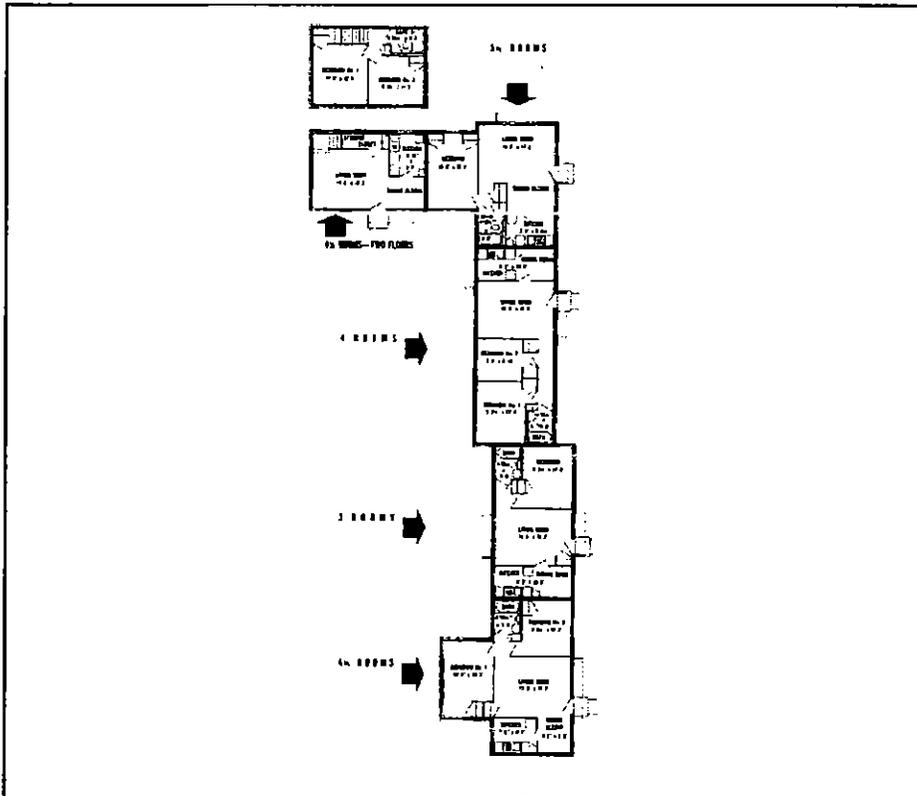

First-Floor Plan
(where available)

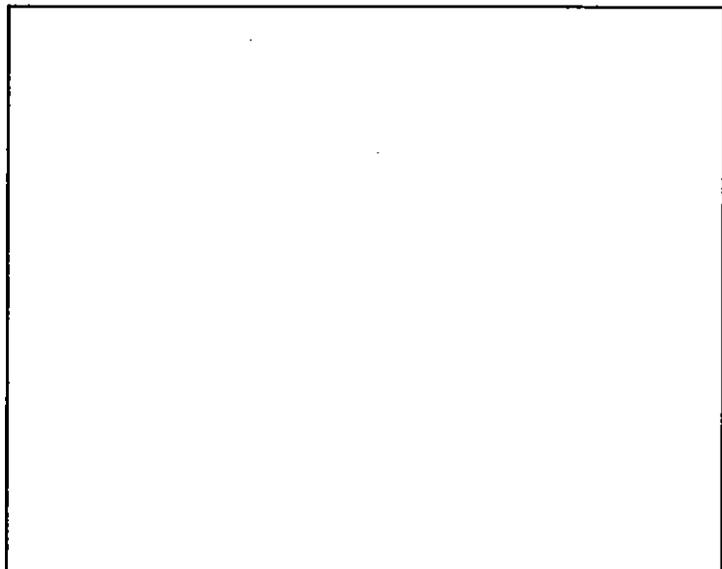

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .005


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

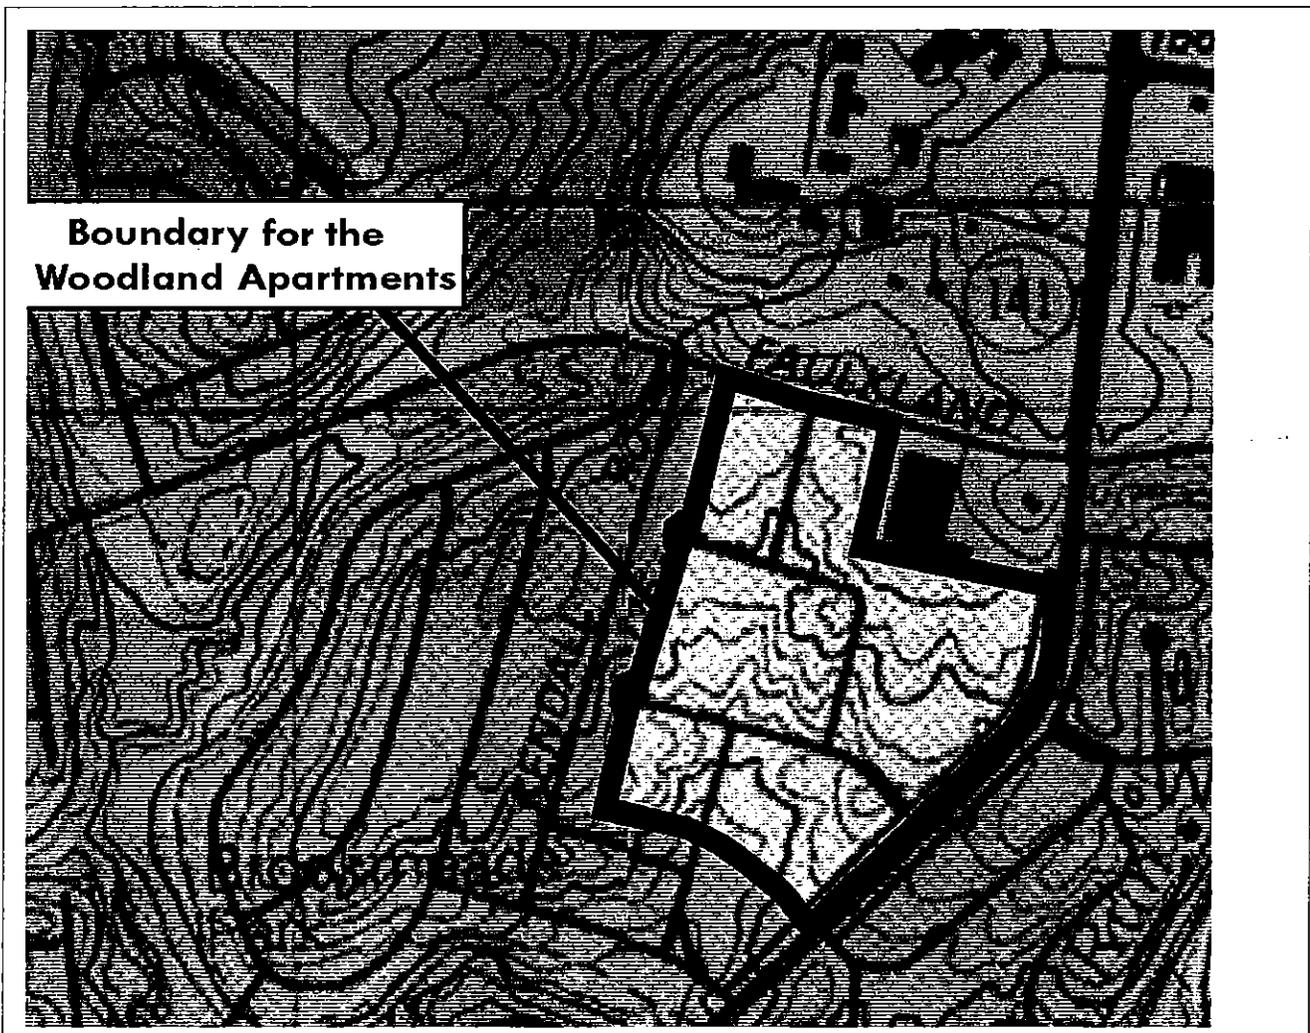


4. SITE PLAN:

CRS # N14270 .005

INDICATE NORTH ON PLAN


Sketch Plan

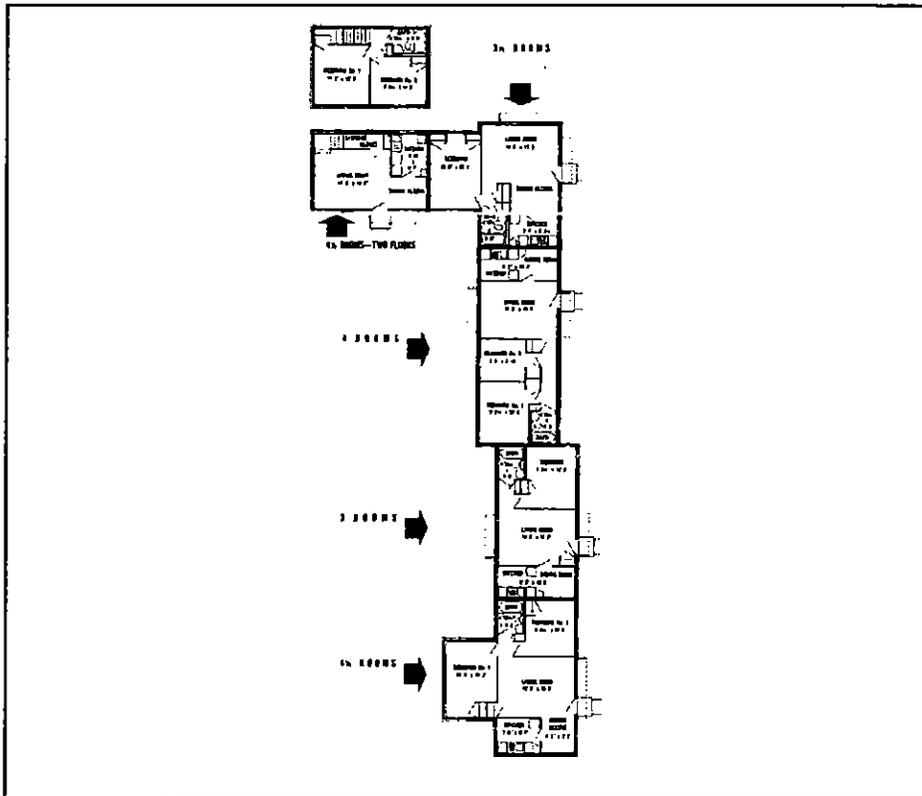

First-Floor Plan
(where available)



NOTE: Sketches are not to scale.

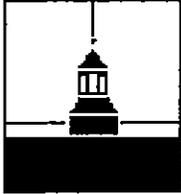

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .006


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

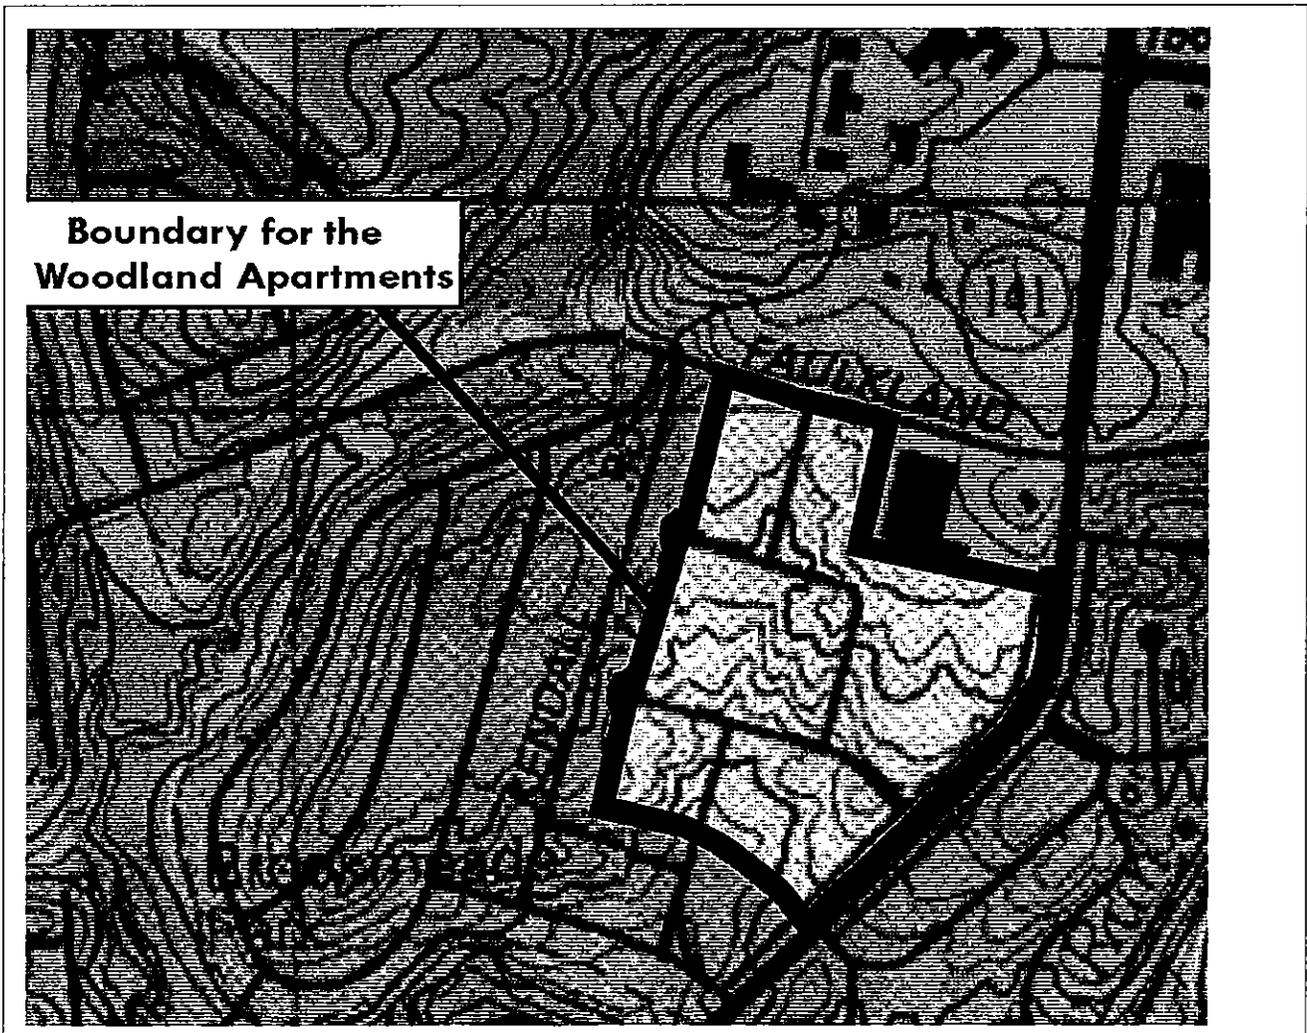


4. SITE PLAN:


CRS # N14270 .006

INDICATE NORTH ON PLAN

Sketch Plan

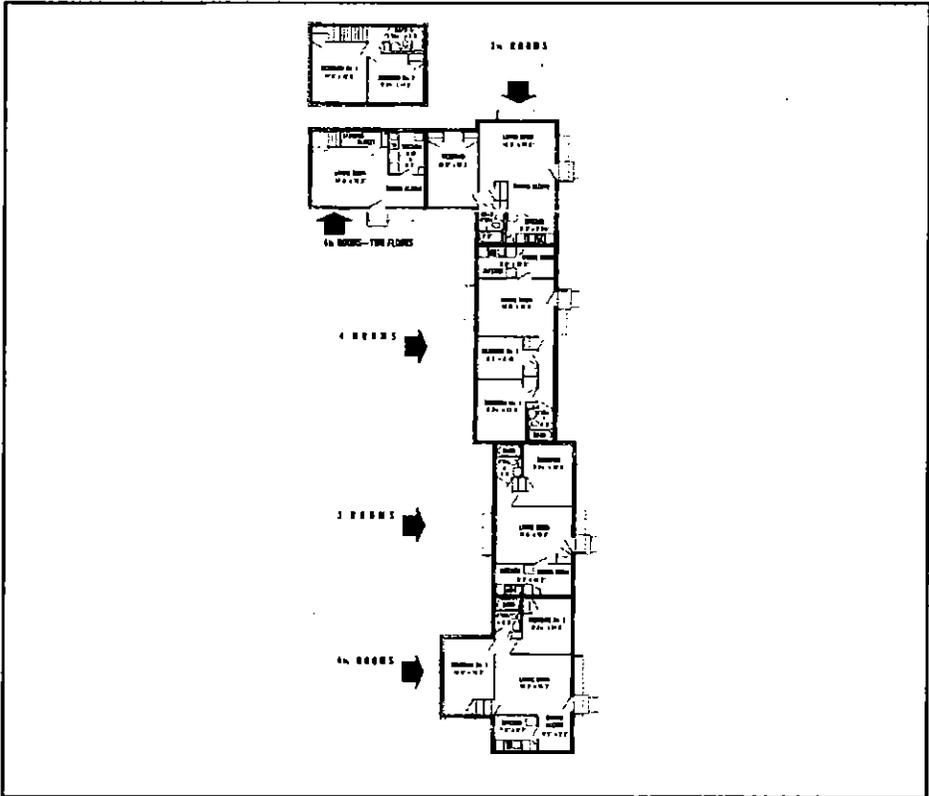

First-Floor Plan
(where available)

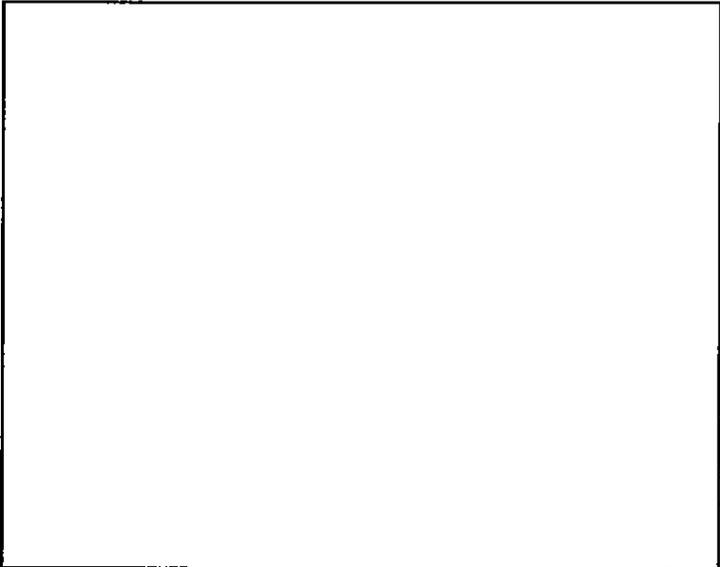


NOTE: Sketches are not to scale.

4. SITE PLAN:


CRS # N14270 .007

INDICATE NORTH ON PLAN

Sketch Plan

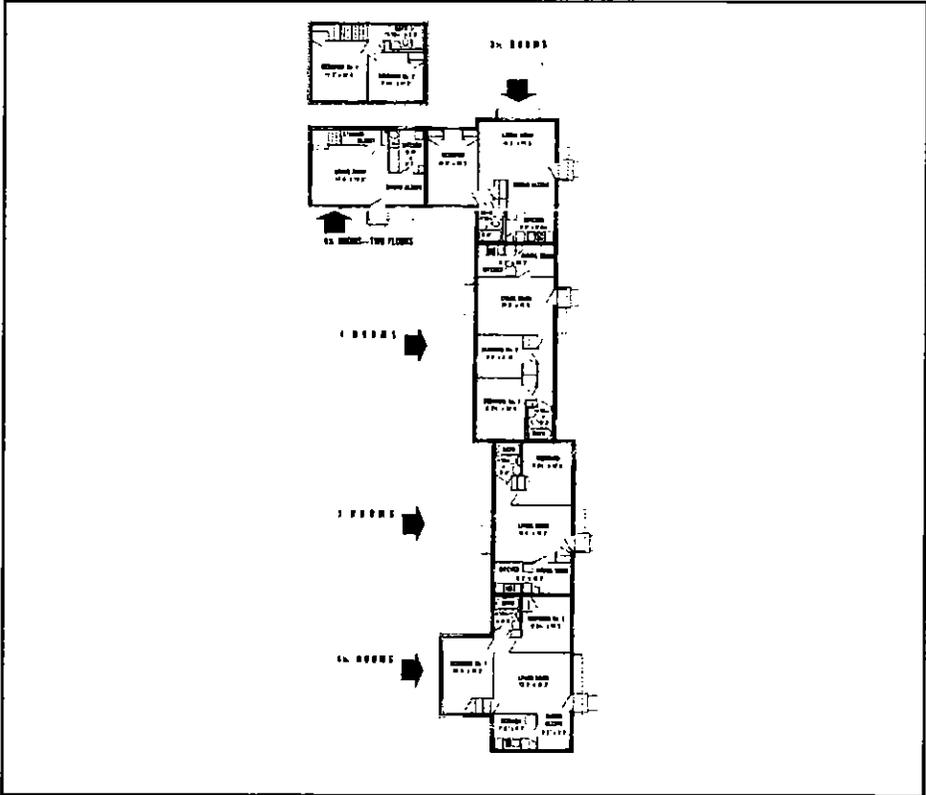

First-Floor Plan
(where available)

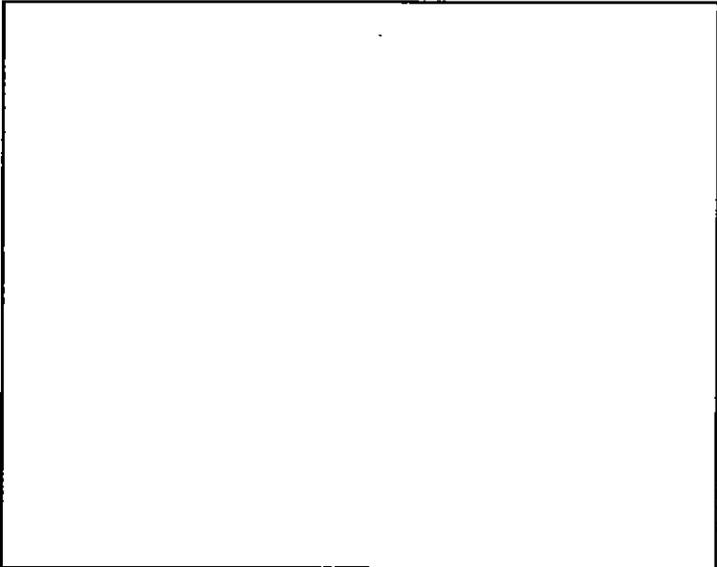


NOTE: Sketches are not to scale.

4. SITE PLAN:


CRS # N14270 .008

INDICATE NORTH ON PLAN


Sketch Plan

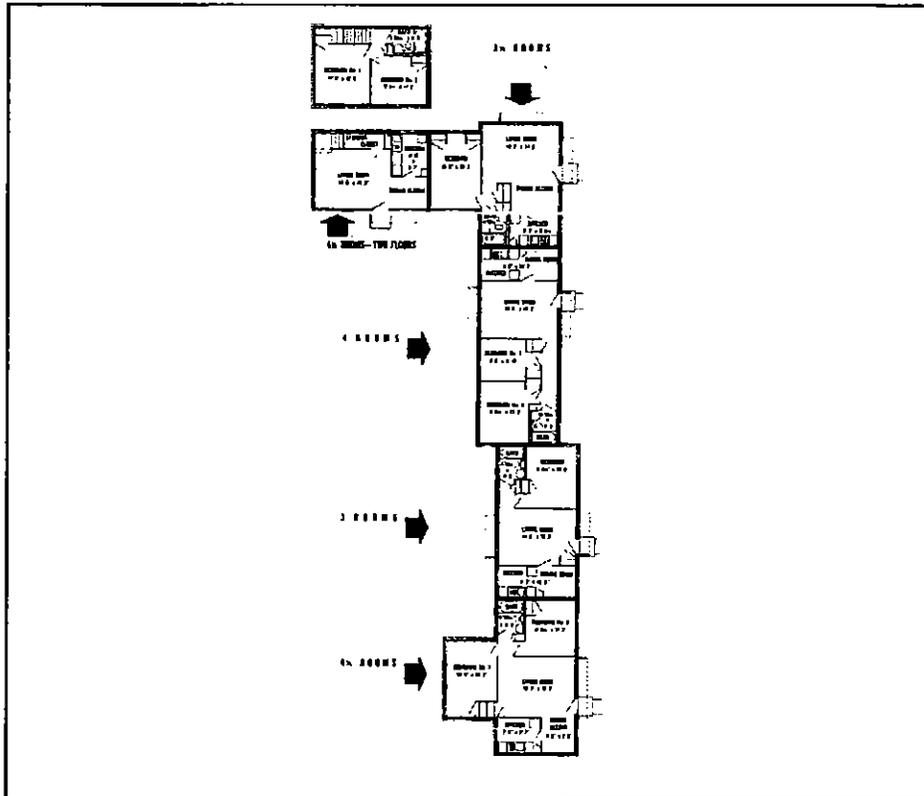

First-Floor Plan
(where available)

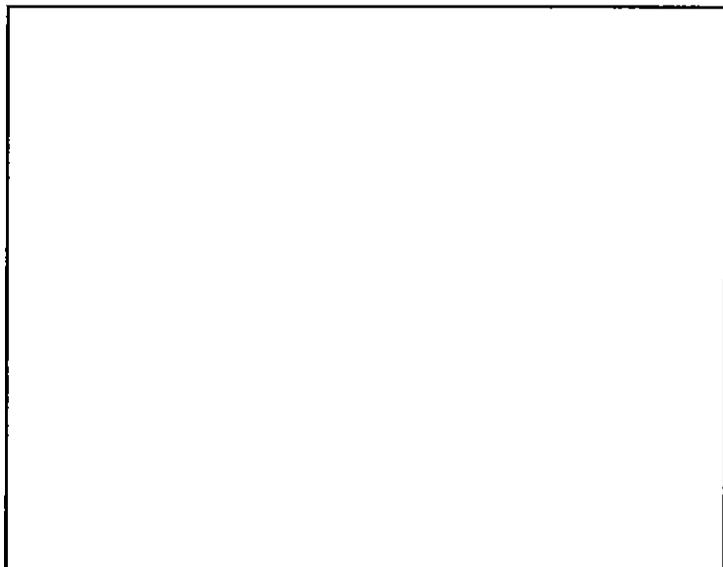

NOTE: Sketches are not to scale.

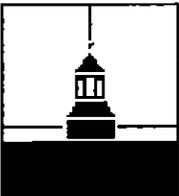

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .009


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

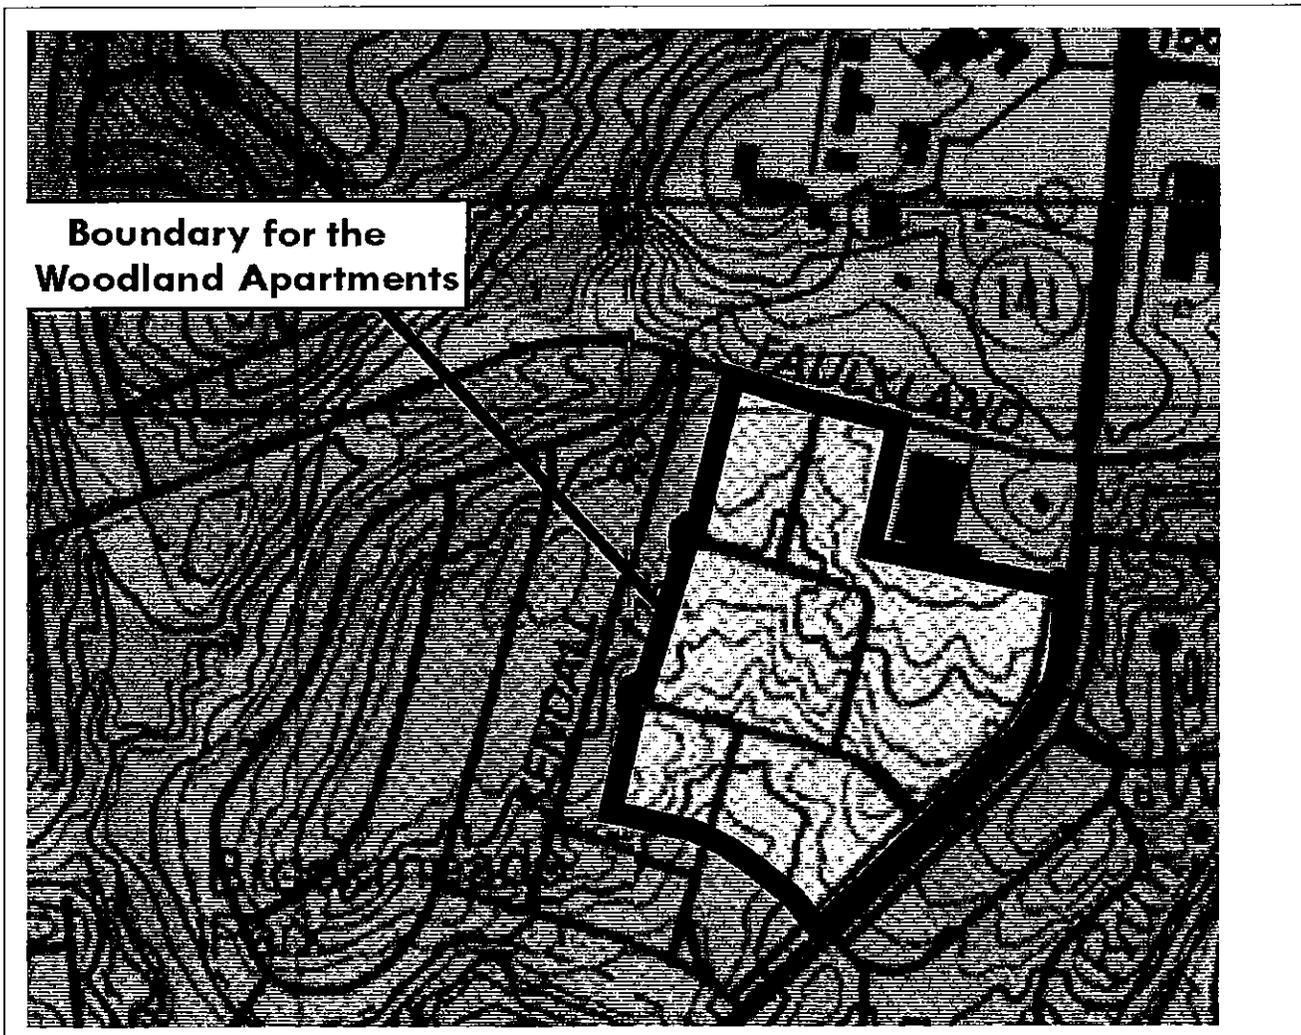


4. SITE PLAN:


CRS # N14270 .009

INDICATE NORTH ON PLAN

Sketch Plan

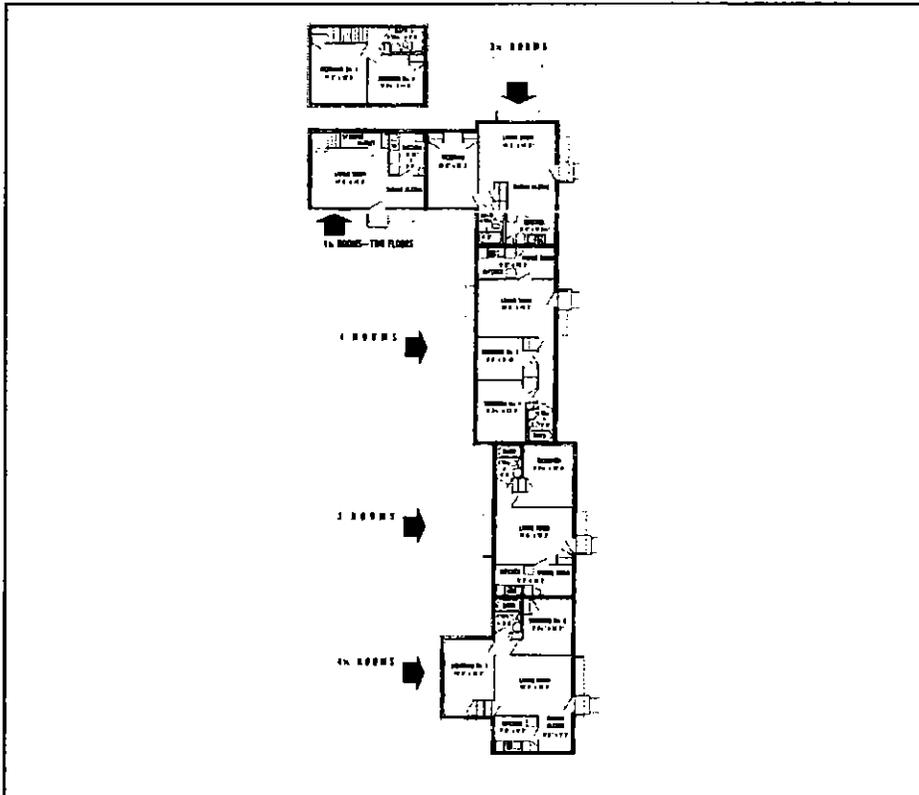

First-Floor Plan
(where available)

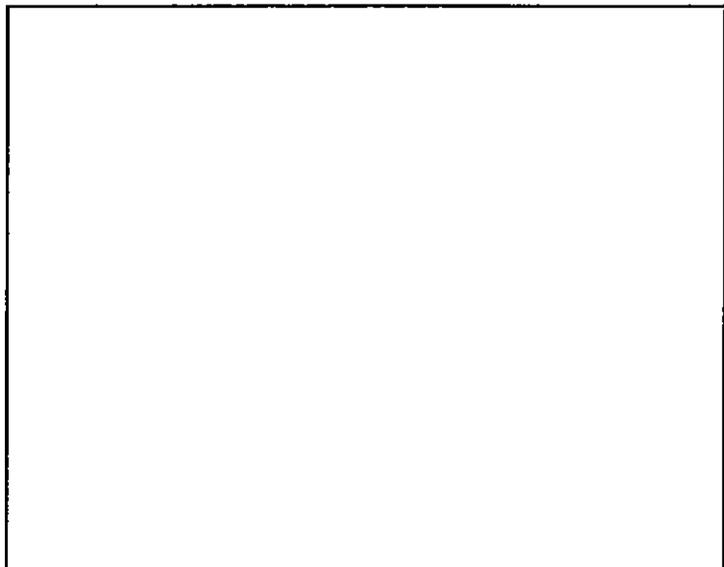

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .010


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

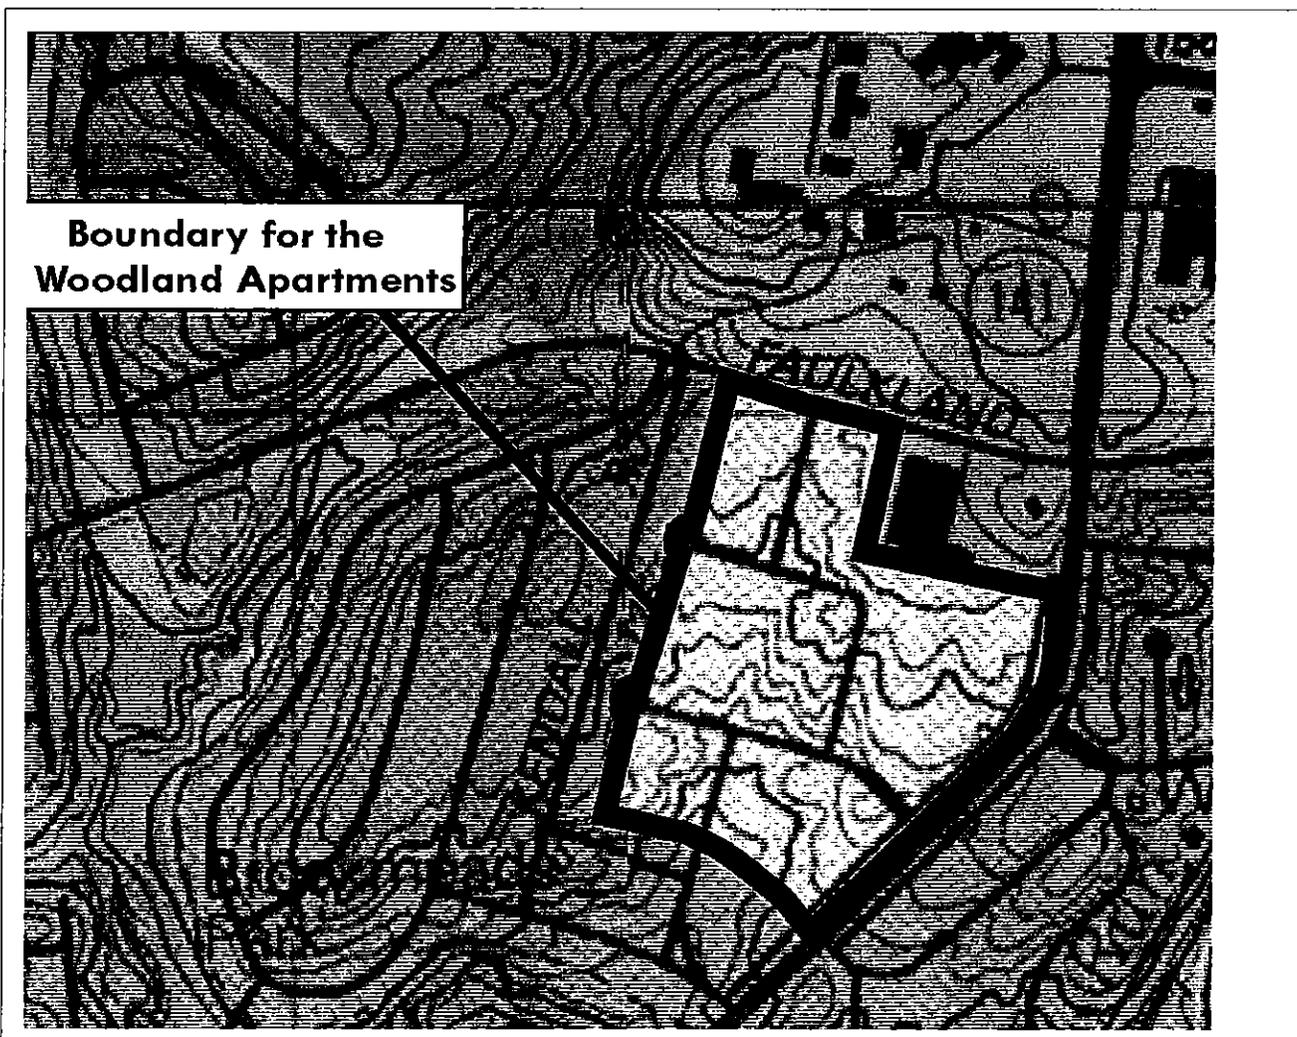


4. SITE PLAN:


CRS # N14270 .010

INDICATE NORTH ON PLAN

Sketch Plan

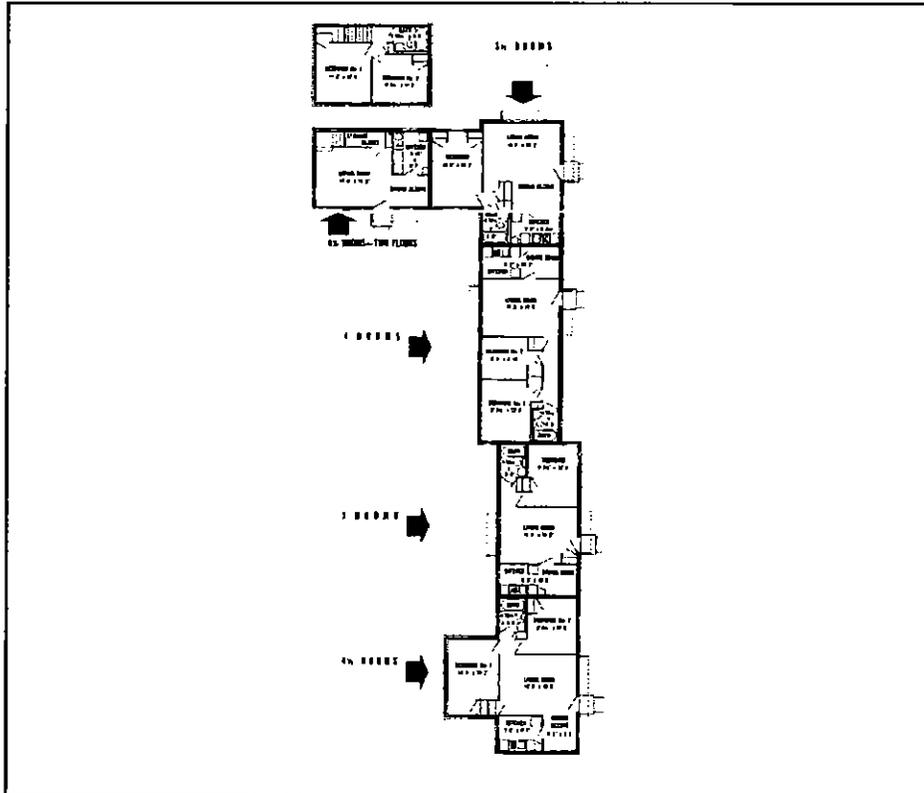

First-Floor Plan
(where available)

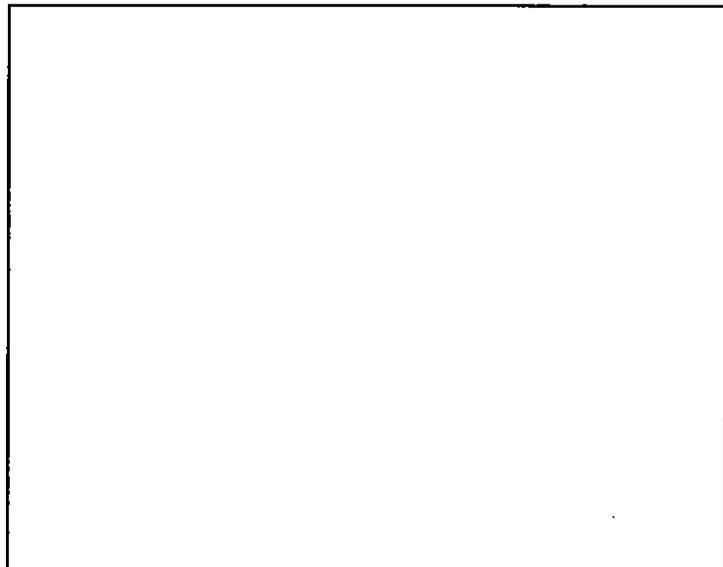


NOTE: Sketches are not to scale.

4. SITE PLAN:

CRS # N14270 .011

INDICATE NORTH ON PLAN

Sketch Plan

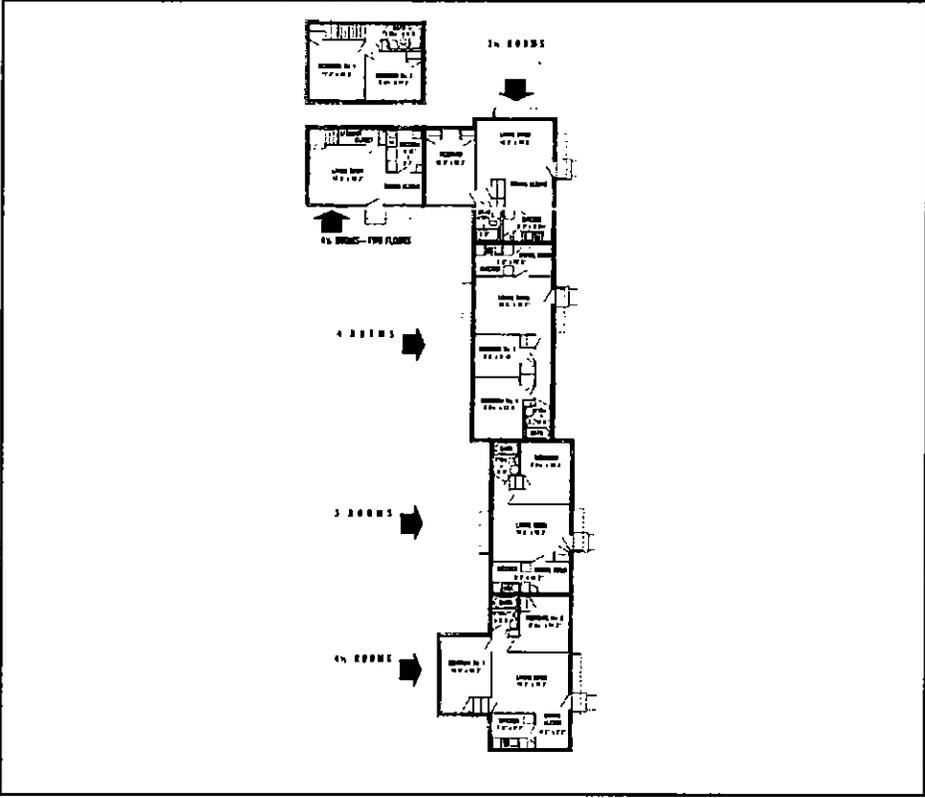

First-Floor Plan
(where available)

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .012


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

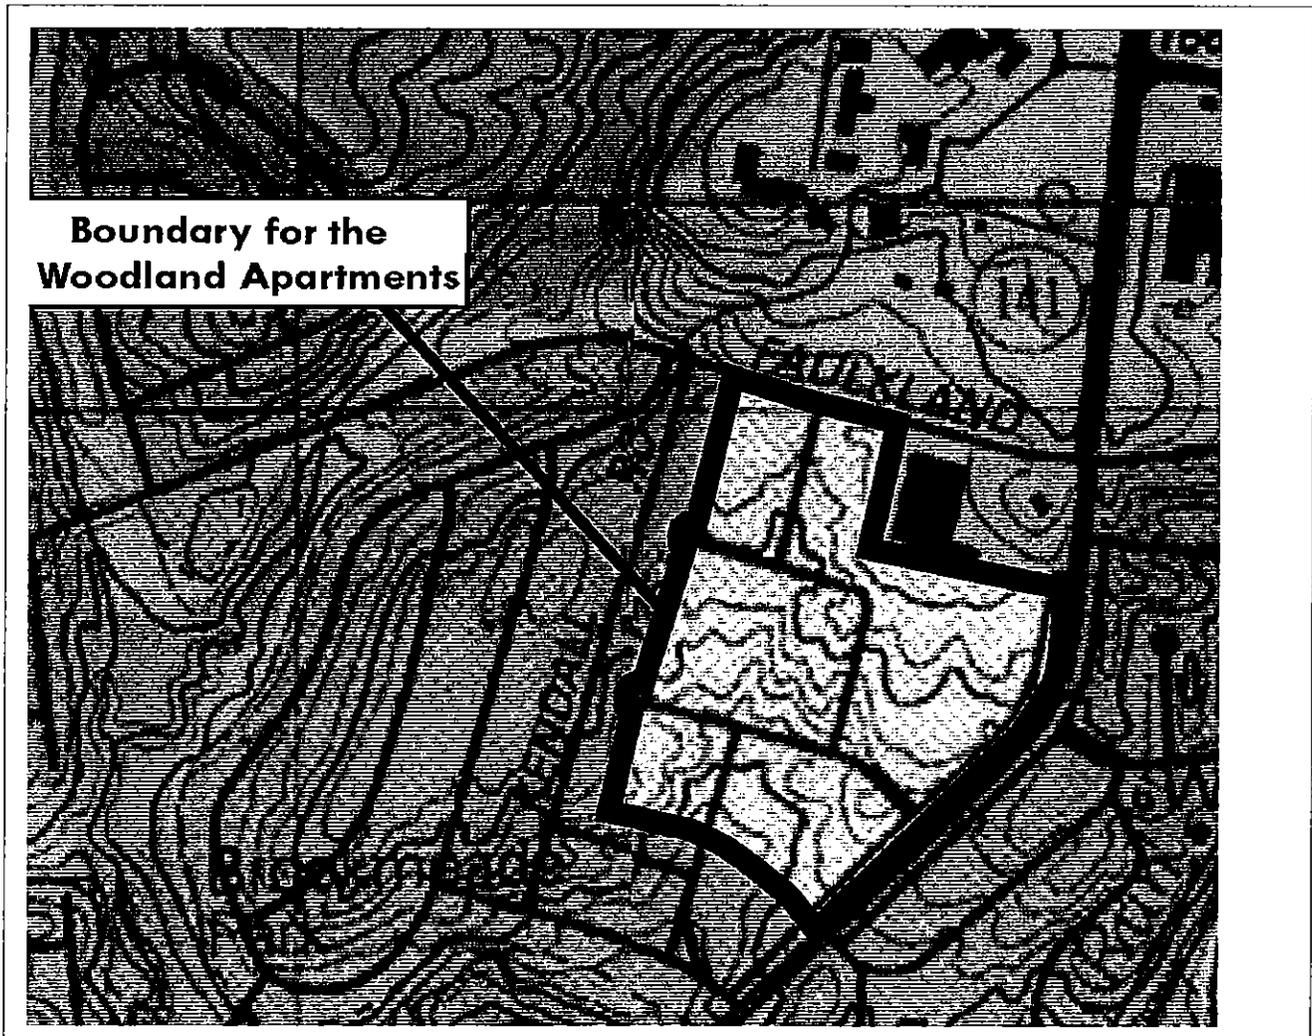


4. SITE PLAN:


CRS # N14270 .012

INDICATE NORTH ON PLAN

Sketch Plan

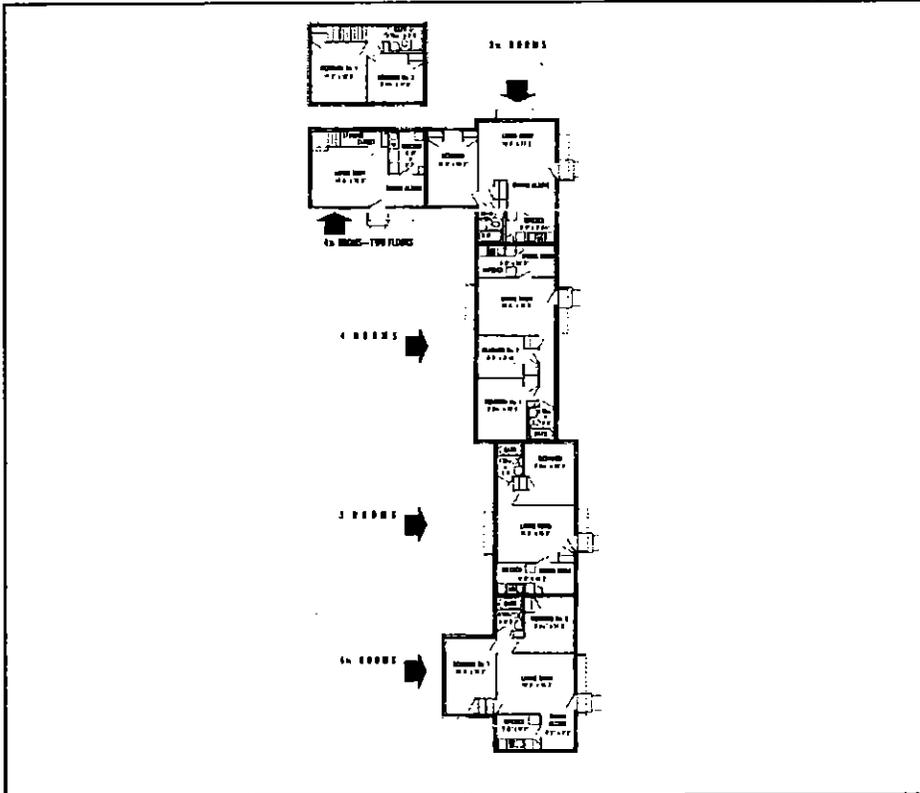

First-Floor Plan
(where available)

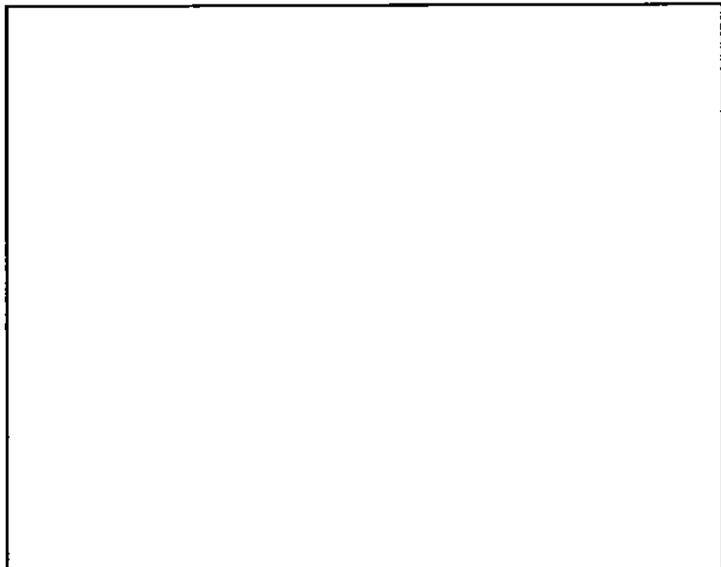

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .013


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

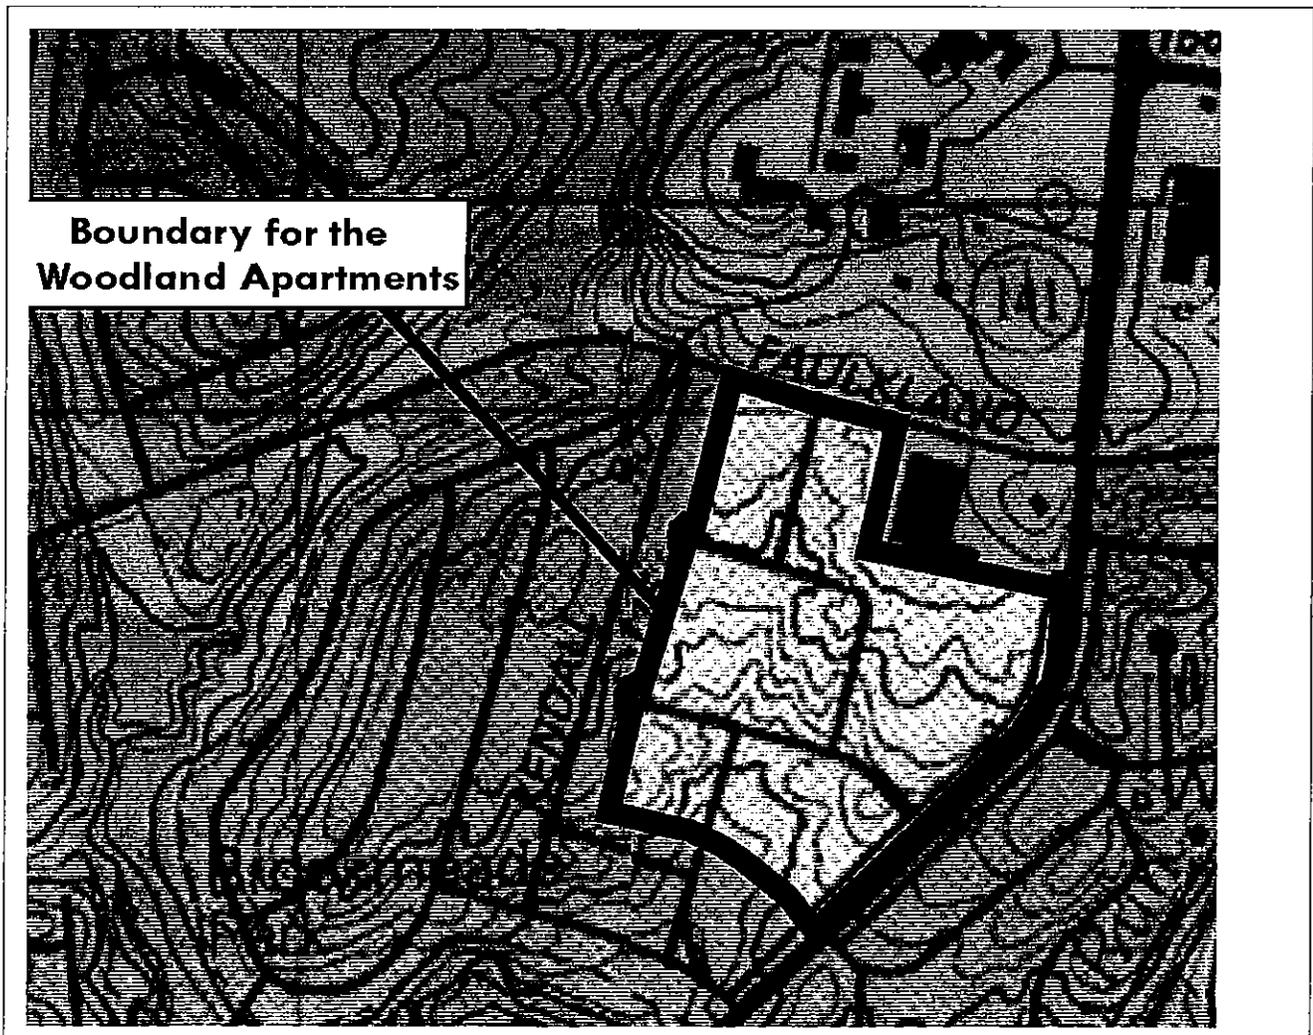


4. SITE PLAN:

CRS # N14270 .013


INDICATE NORTH ON PLAN

Sketch Plan

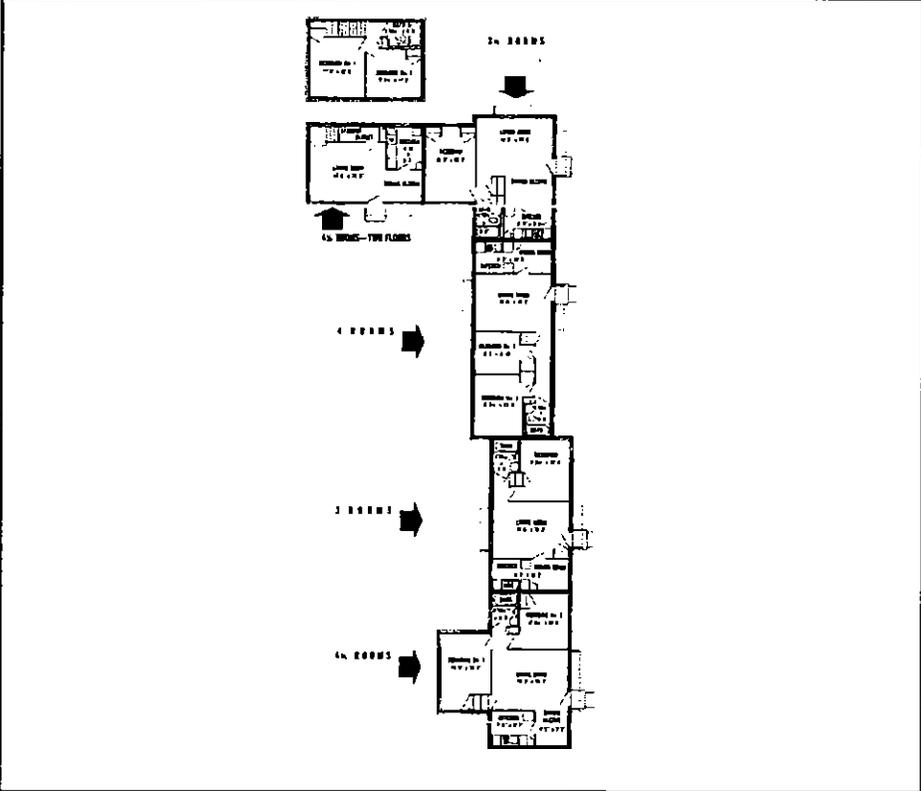

First-Floor Plan
(where available)

NOTE: Sketches are not to scale.

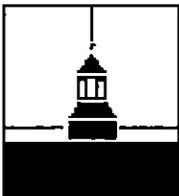

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .014

1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH




4. SITE PLAN:


CRS # N14270 .015

INDICATE NORTH ON PLAN


Sketch Plan

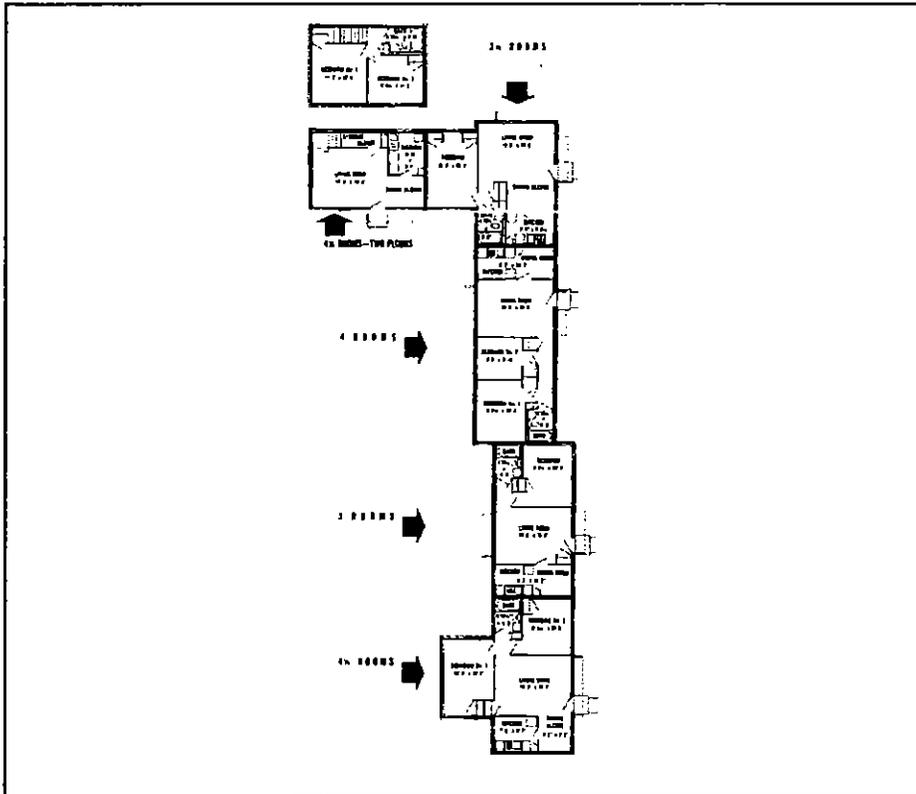

First-Floor Plan
(where available)

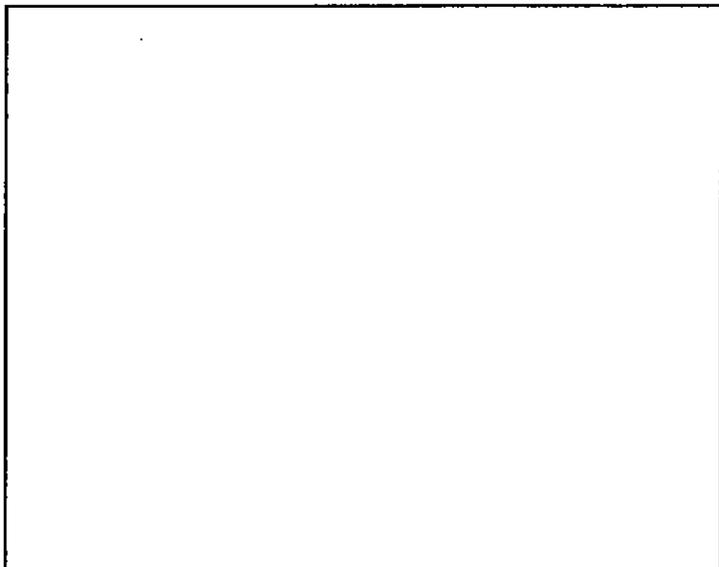

NOTE: Sketches are not to scale.

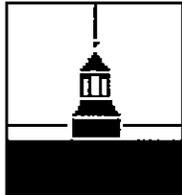

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .016


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

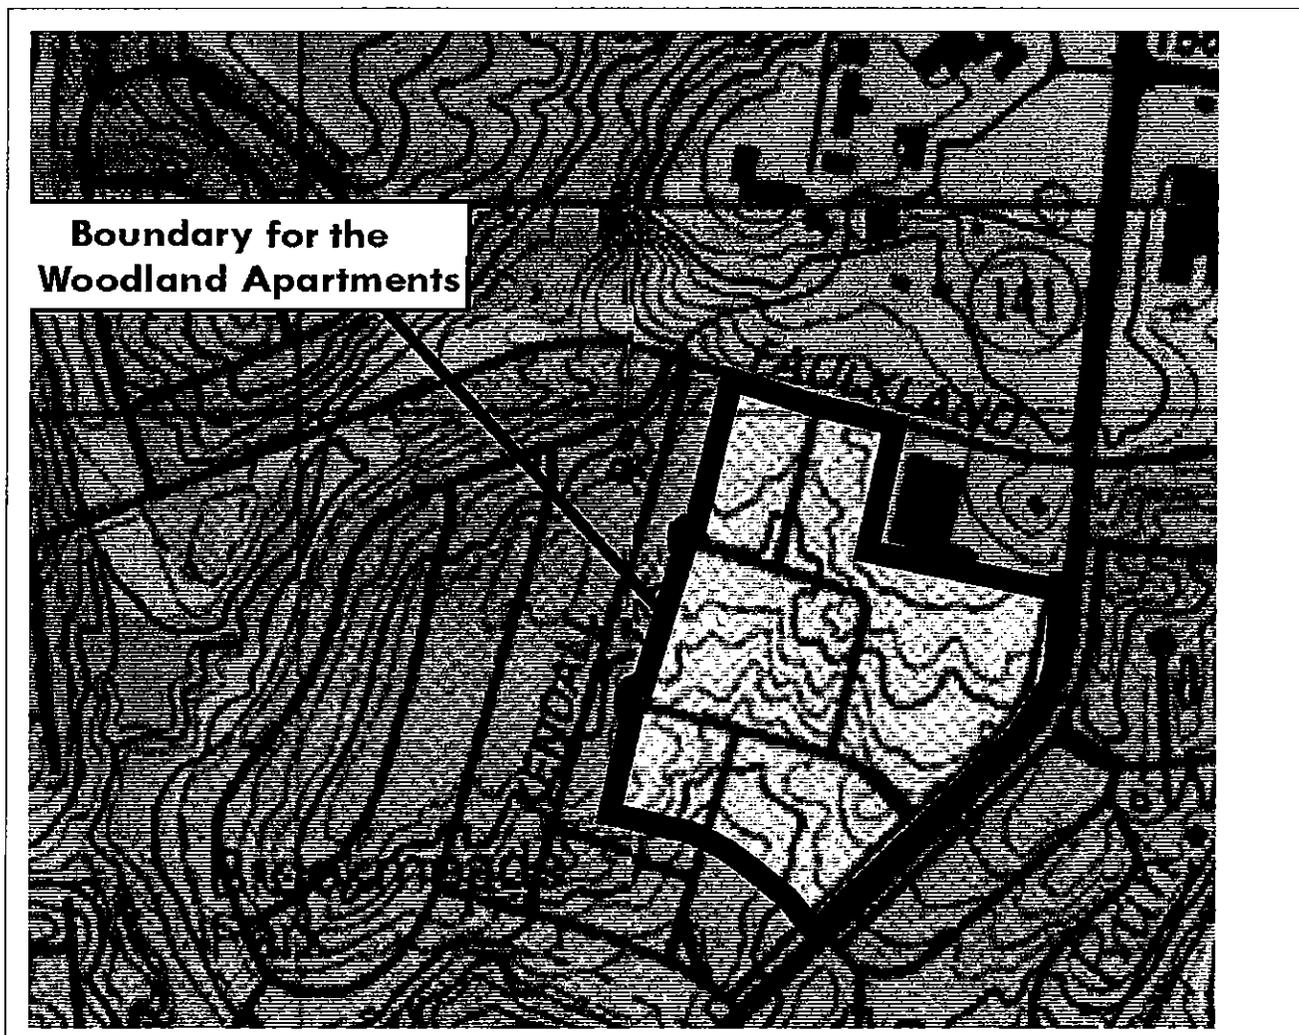


4. SITE PLAN:


CRS # N14270 .016

INDICATE NORTH ON PLAN

Sketch Plan

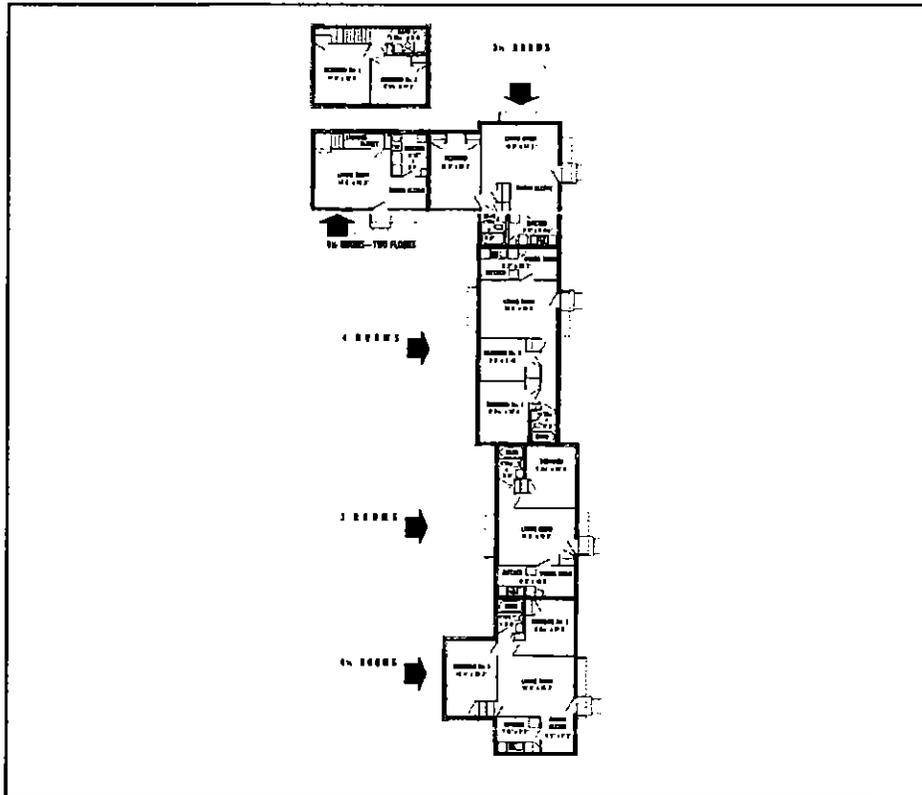

First-Floor Plan
(where available)

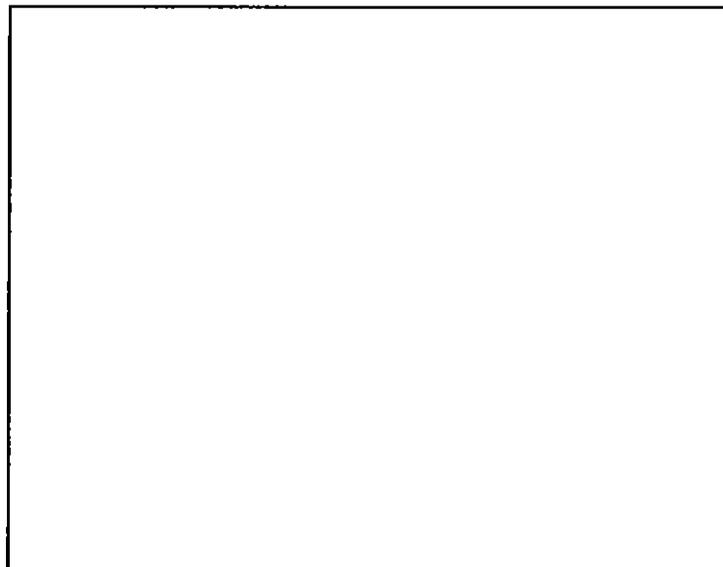

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .017


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

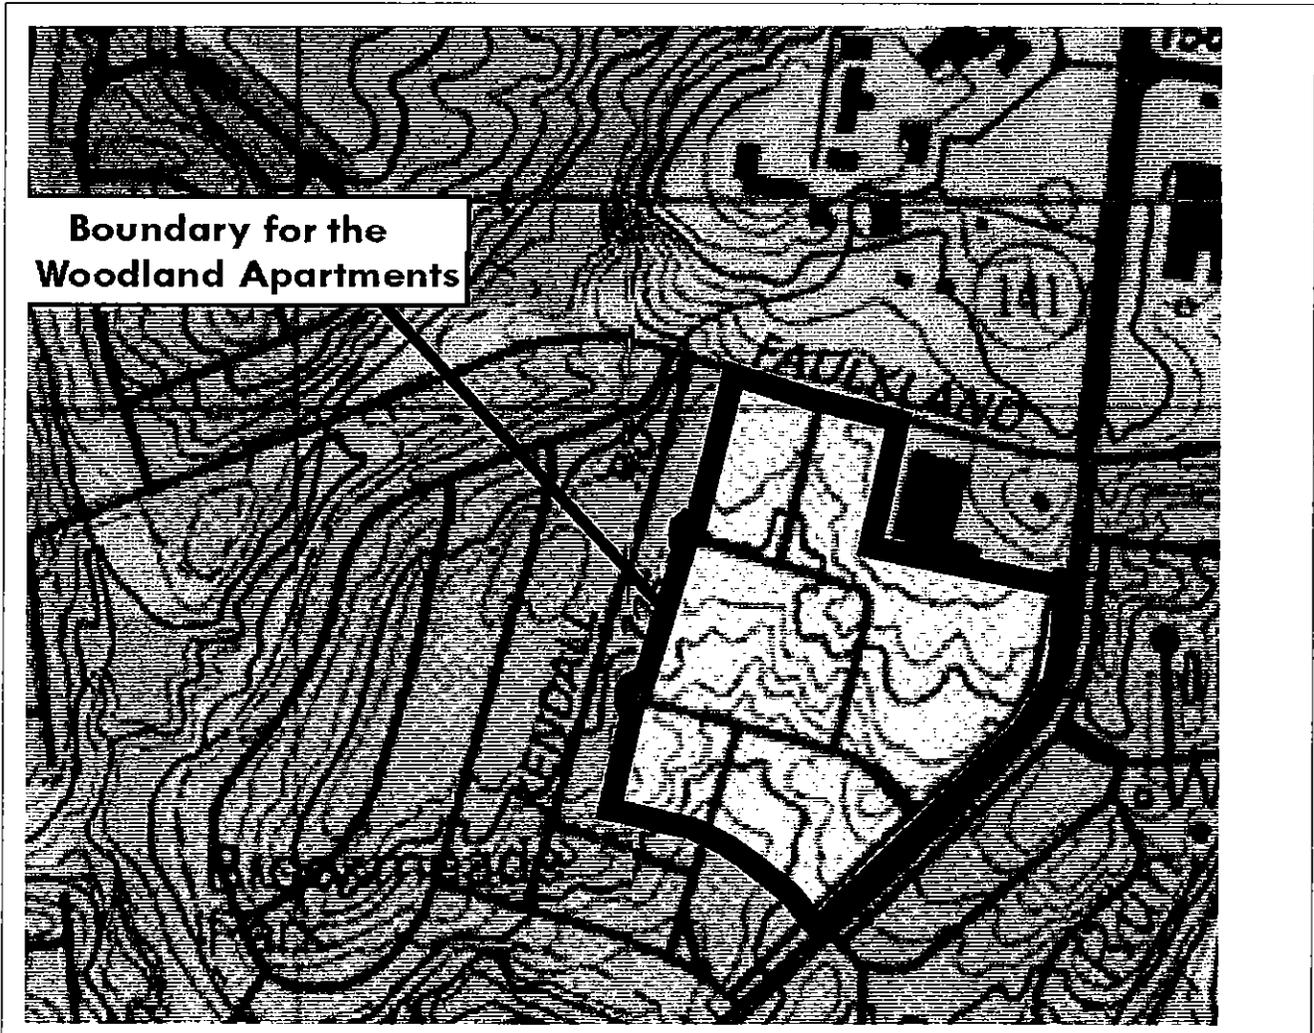


4. SITE PLAN:


CRS # N14270 .017

INDICATE NORTH ON PLAN


Sketch Plan

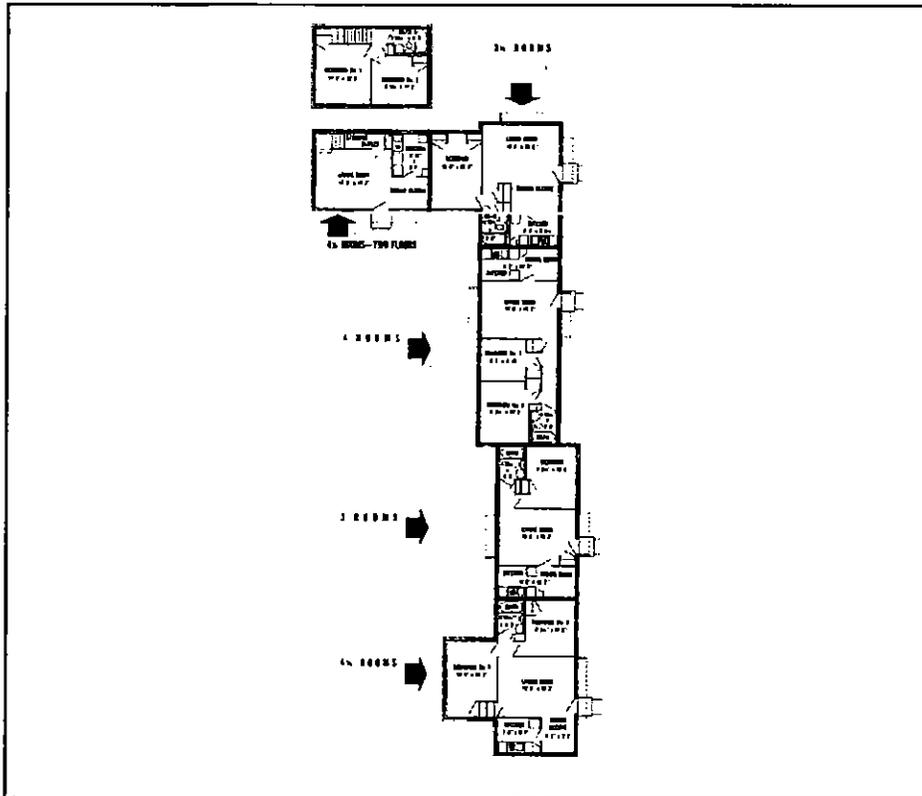

First-Floor Plan
(where available)

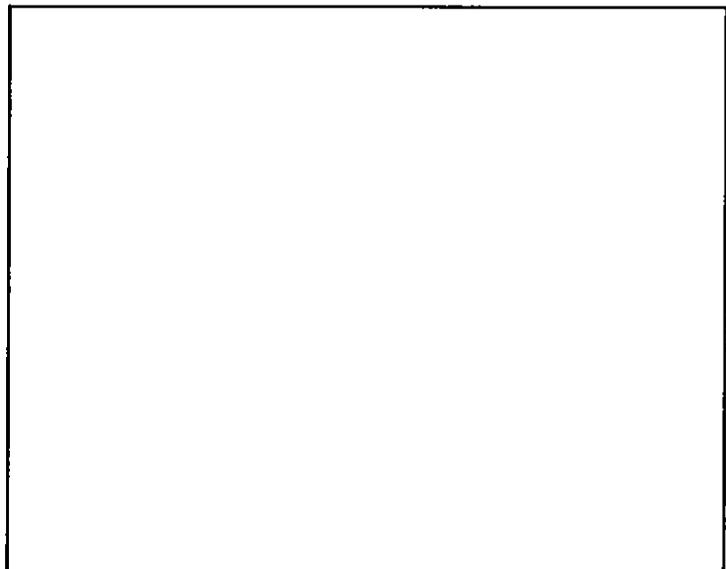

NOTE: Sketches are not to scale.

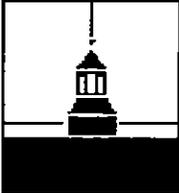

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .018


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

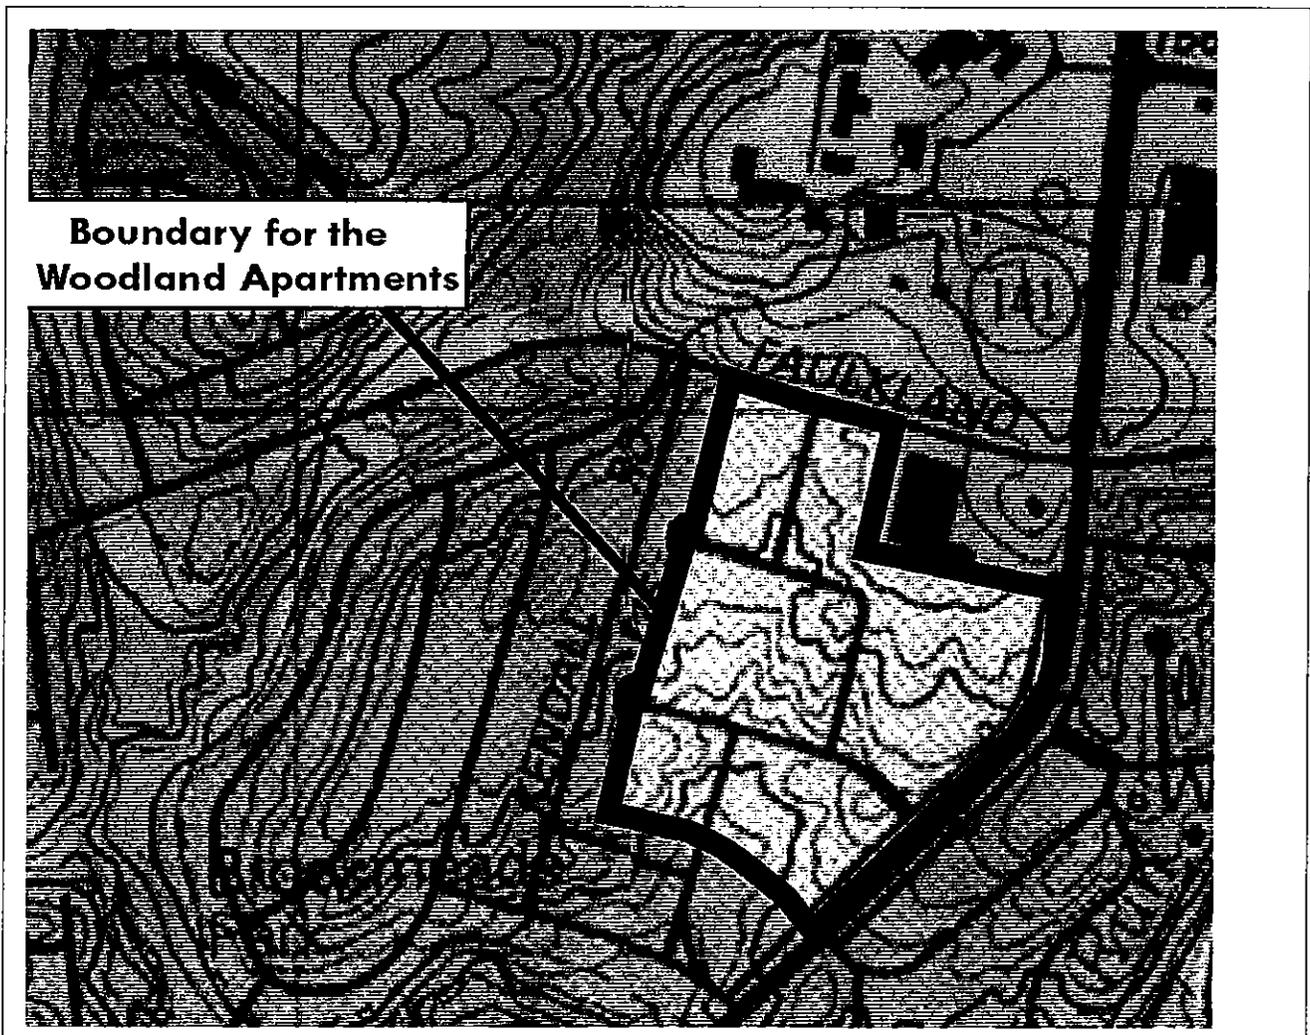


4. SITE PLAN:


CRS # N14270 .018

INDICATE NORTH ON PLAN


Sketch Plan

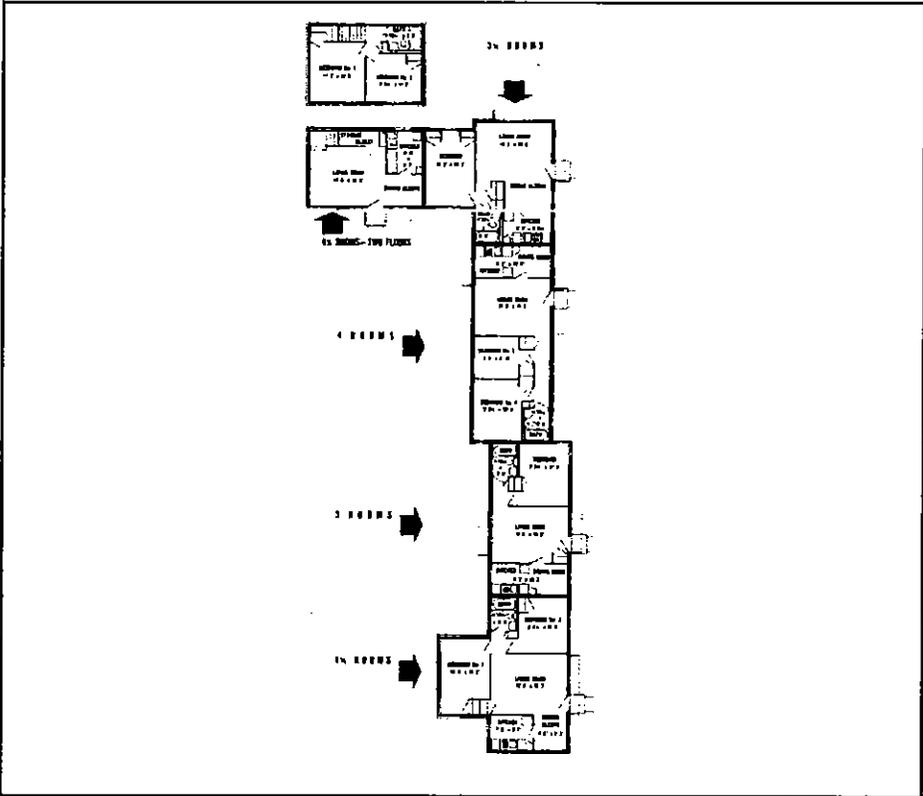

First-Floor Plan
(where available)

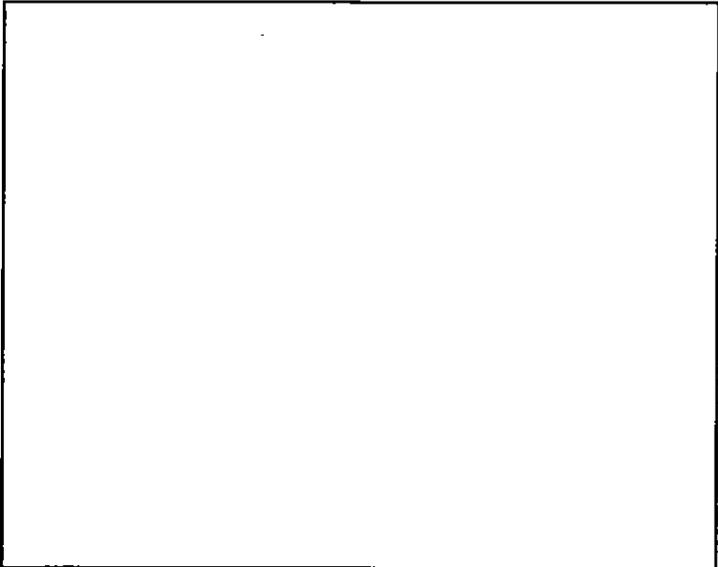

NOTE: Sketches are not to scale.

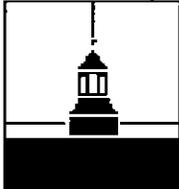

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .019


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

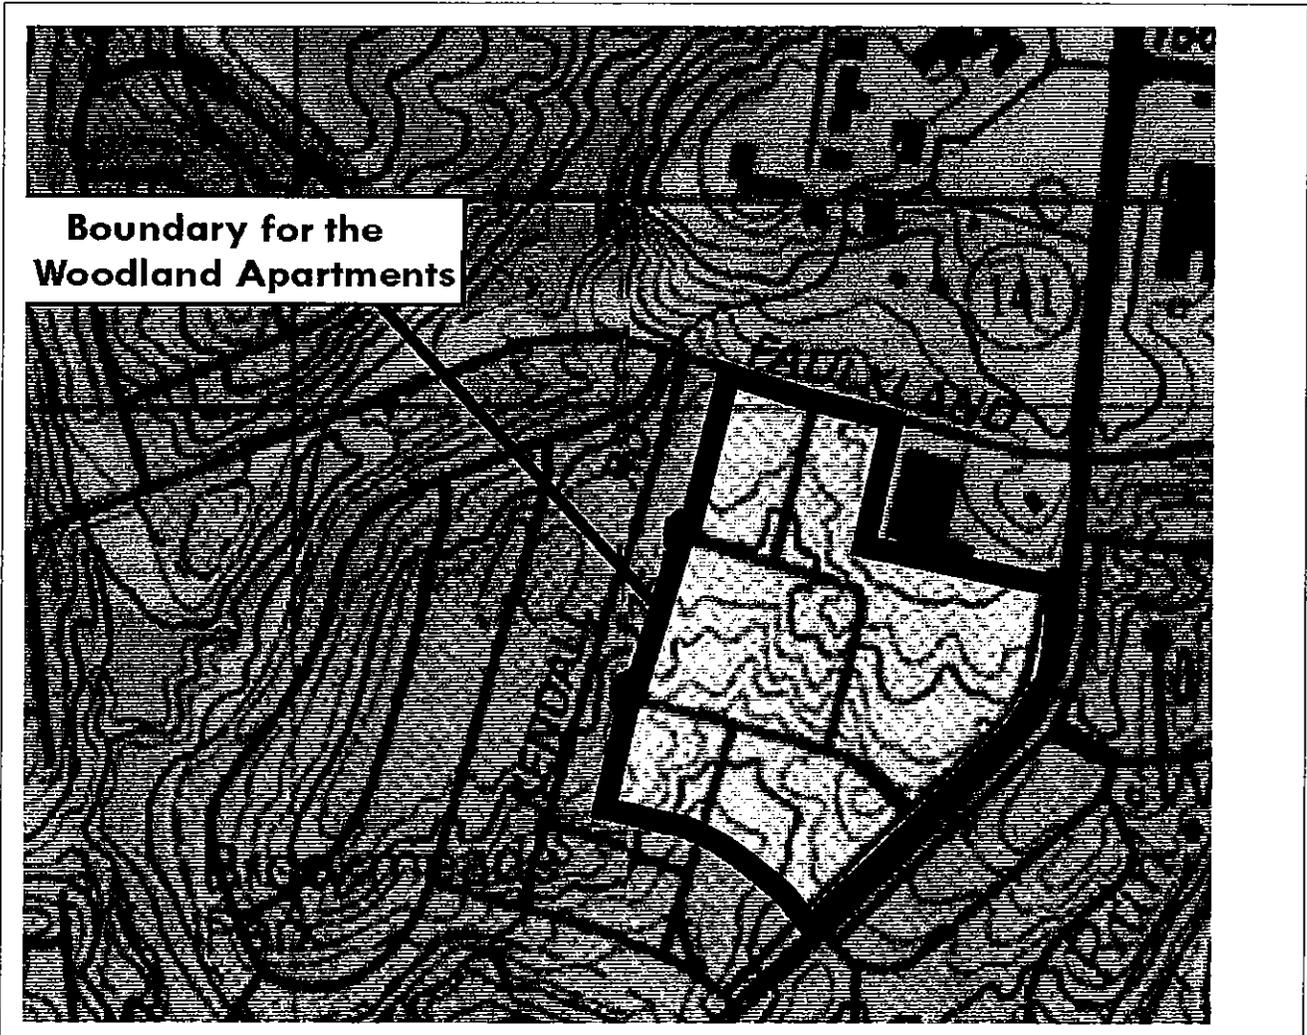


4. SITE PLAN:


CRS # N14270 .019

INDICATE NORTH ON PLAN

Sketch Plan

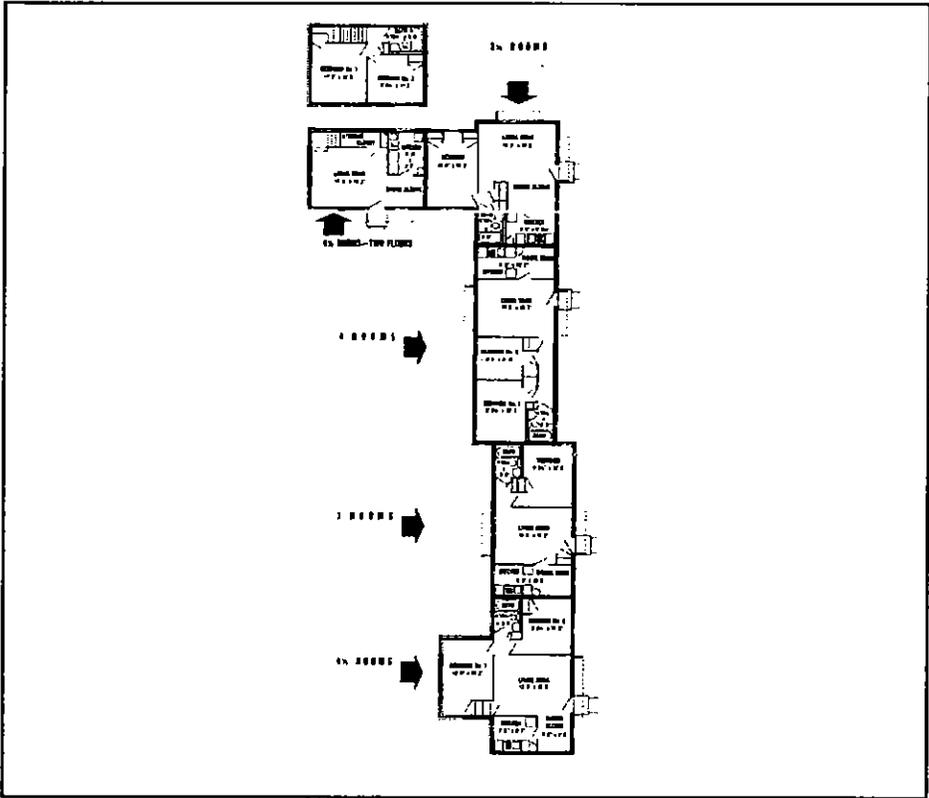

First-Floor Plan
(where available)

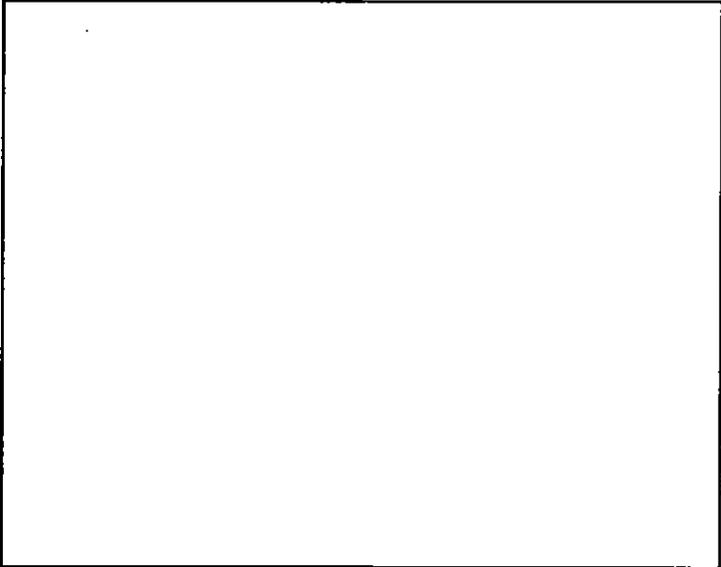


NOTE: Sketches are not to scale.

4. SITE PLAN:


CRS # N14270 .020

INDICATE NORTH ON PLAN

Sketch Plan

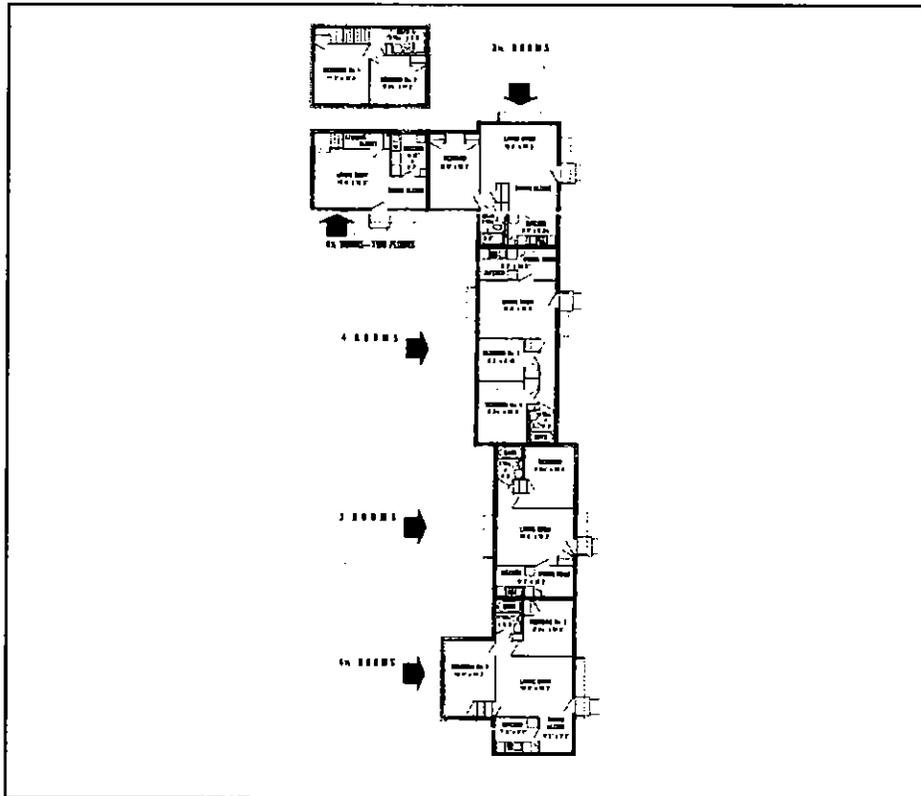

First-Floor Plan
(where available)

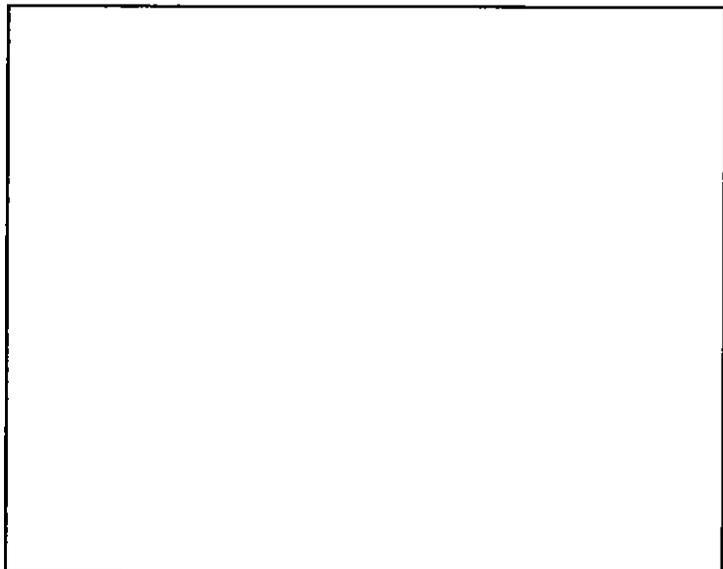

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .021


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

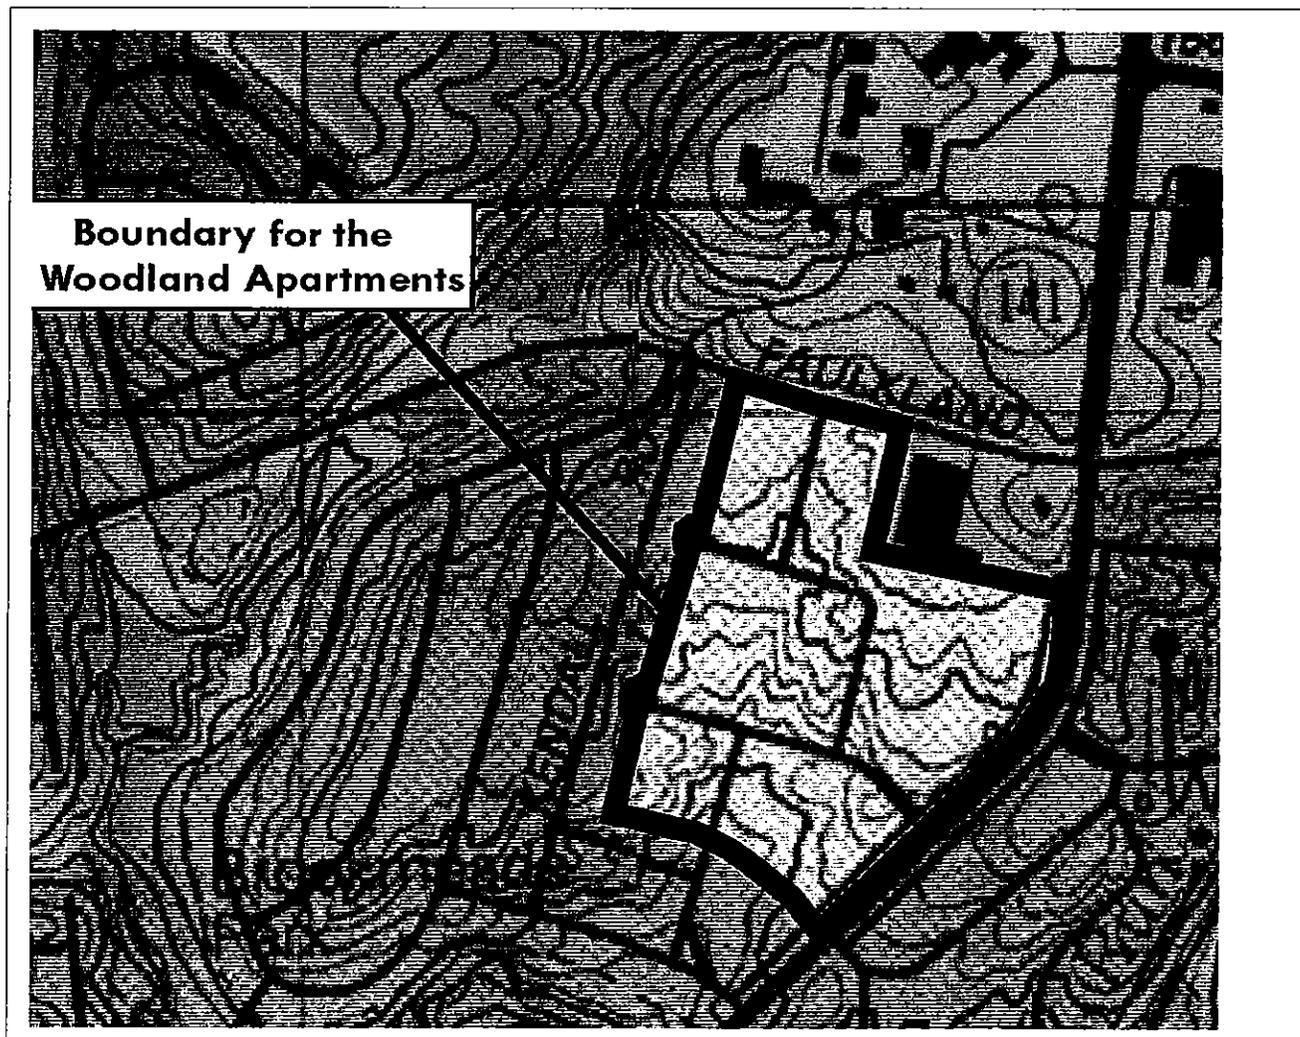


4. SITE PLAN:


CRS # N14270 .021

INDICATE NORTH ON PLAN


Sketch Plan

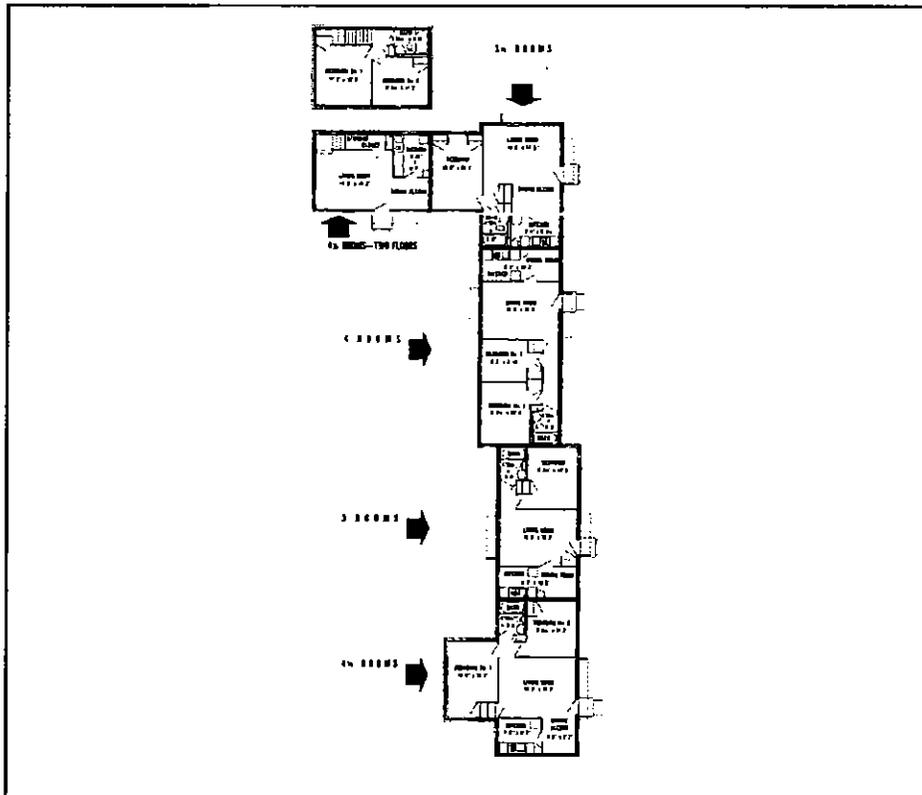

First-Floor Plan
(where available)

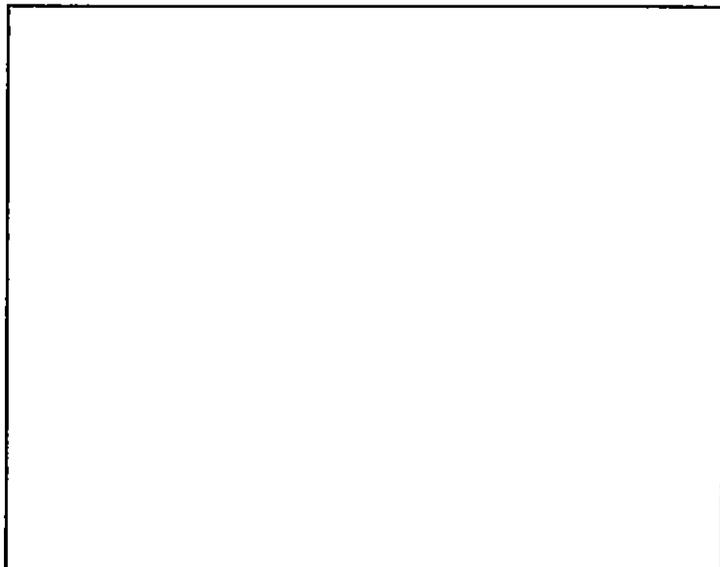

NOTE: Sketches are not to scale.

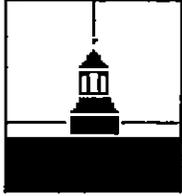

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .022


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

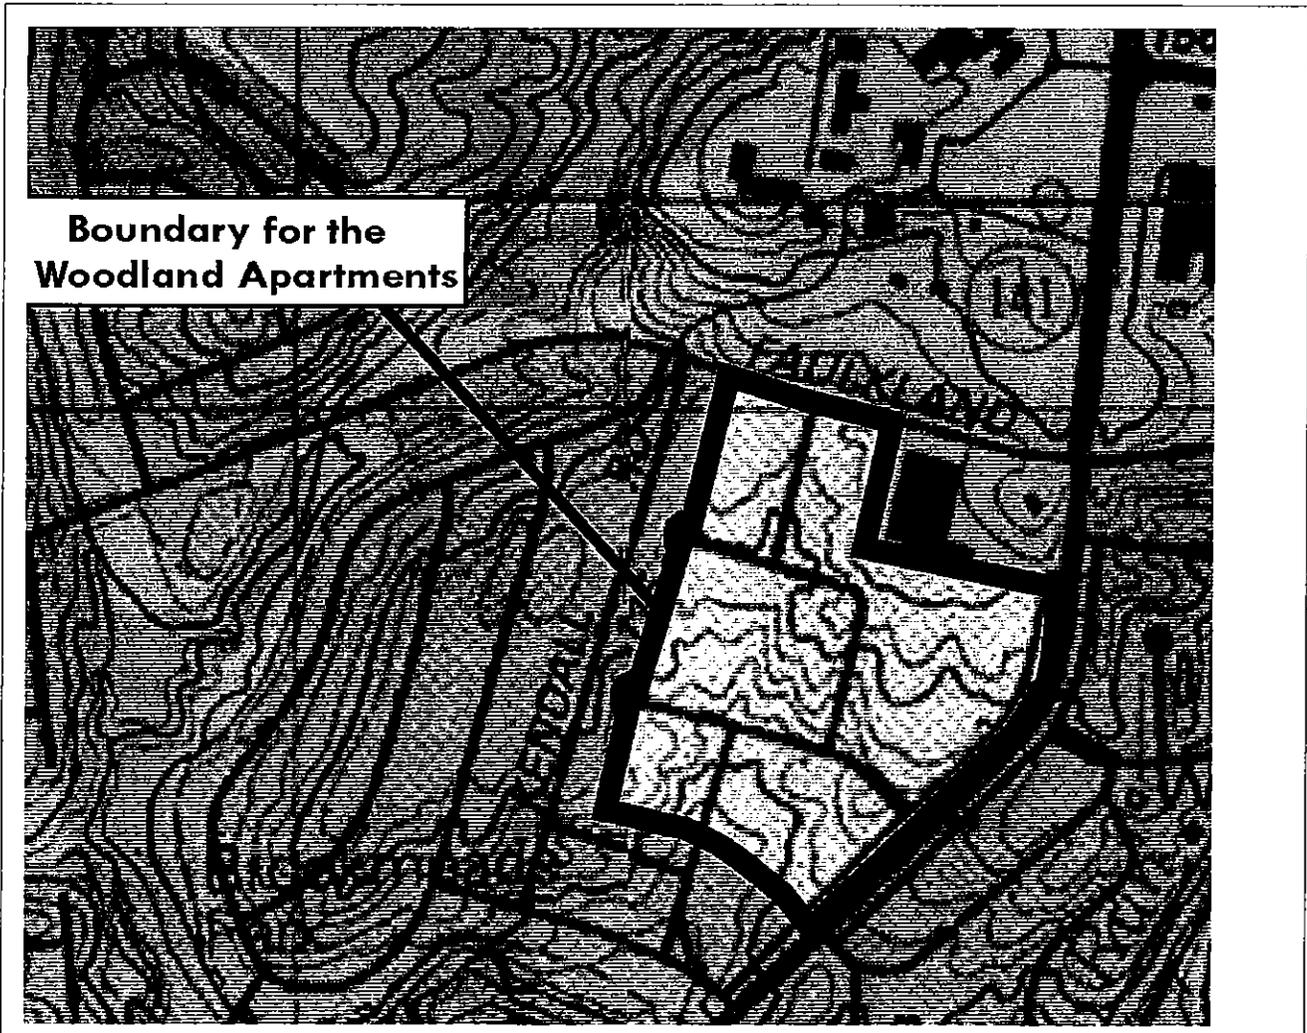


4. SITE PLAN:


CRS # N14270.022

INDICATE NORTH ON PLAN


Sketch Plan

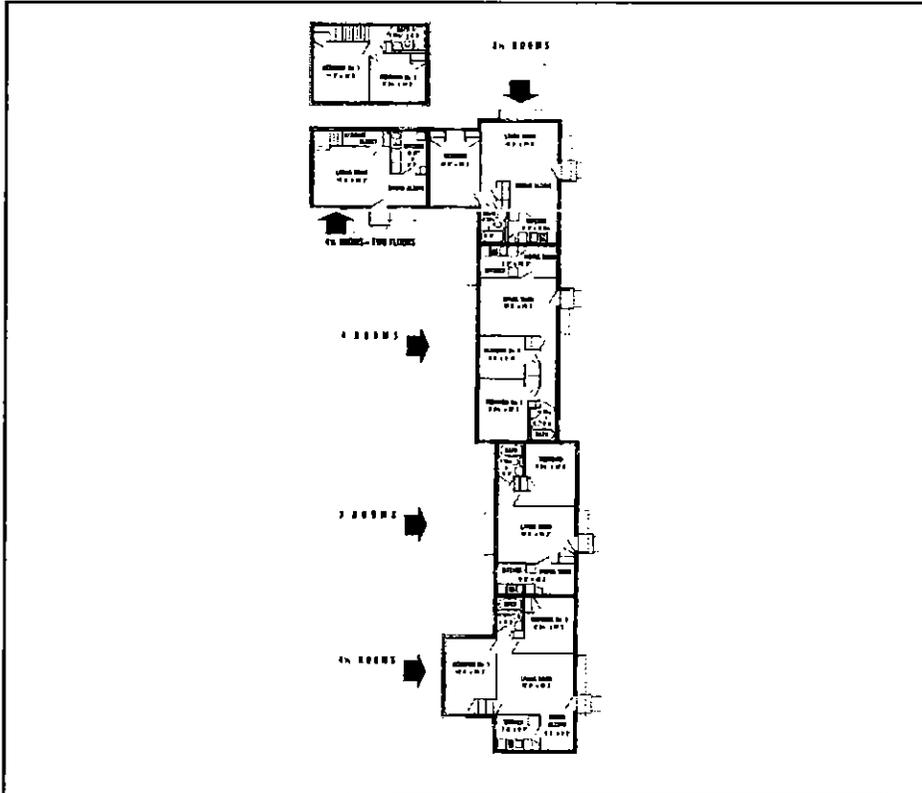

First-Floor Plan
(where available)

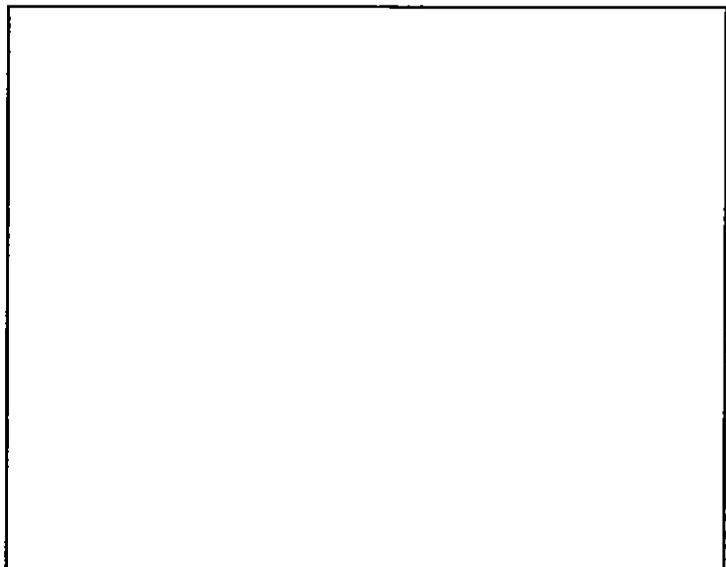

NOTE: Sketches are not to scale.

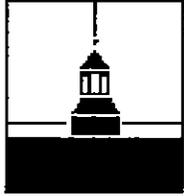

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .023


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

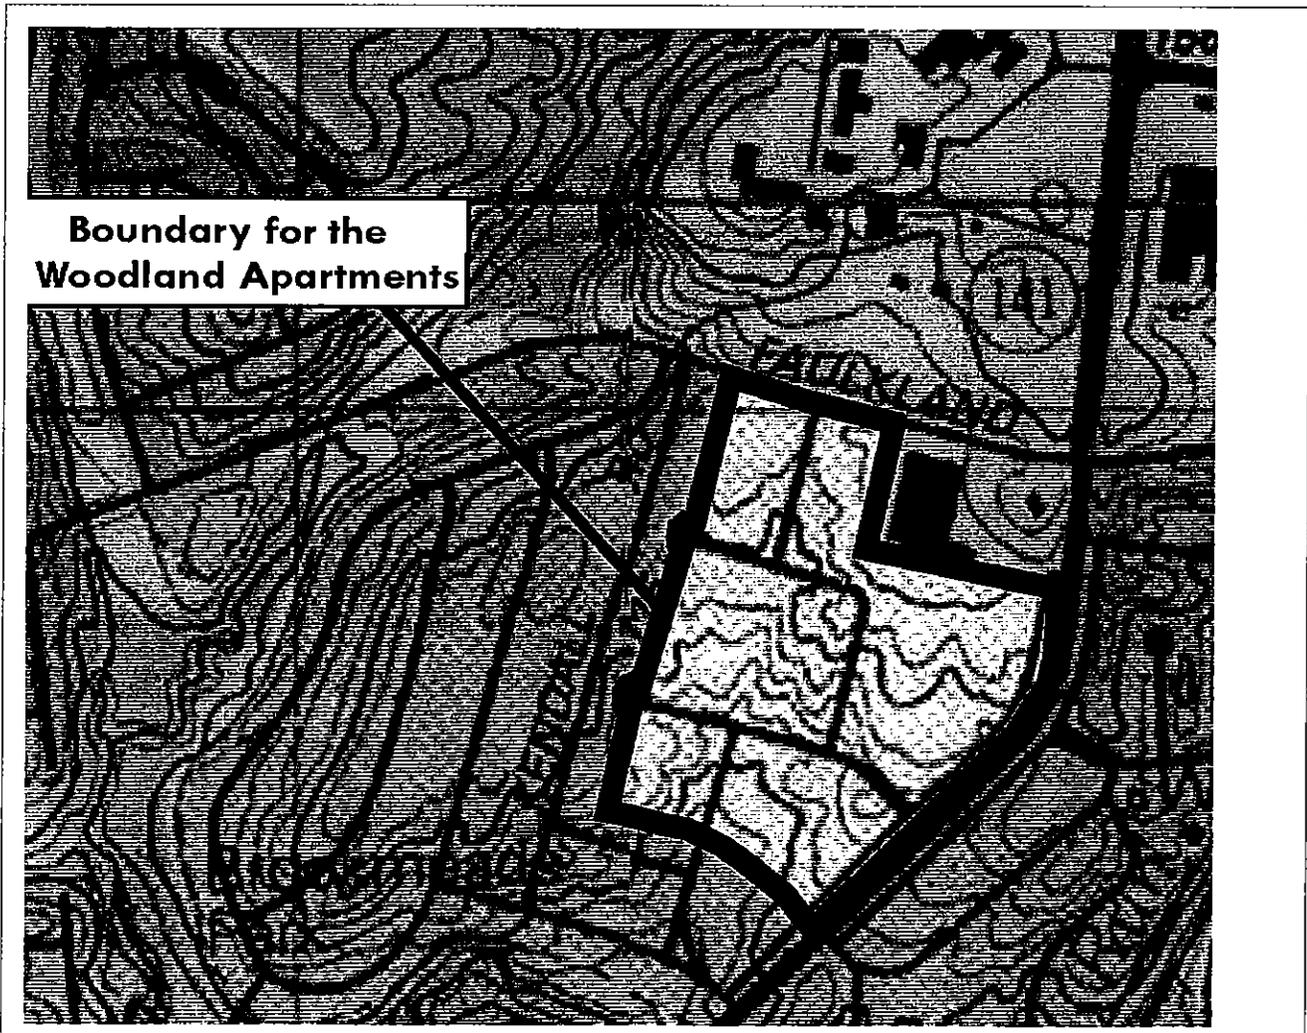


4. SITE PLAN:


CRS # N14270 .023

INDICATE NORTH ON PLAN

Sketch Plan

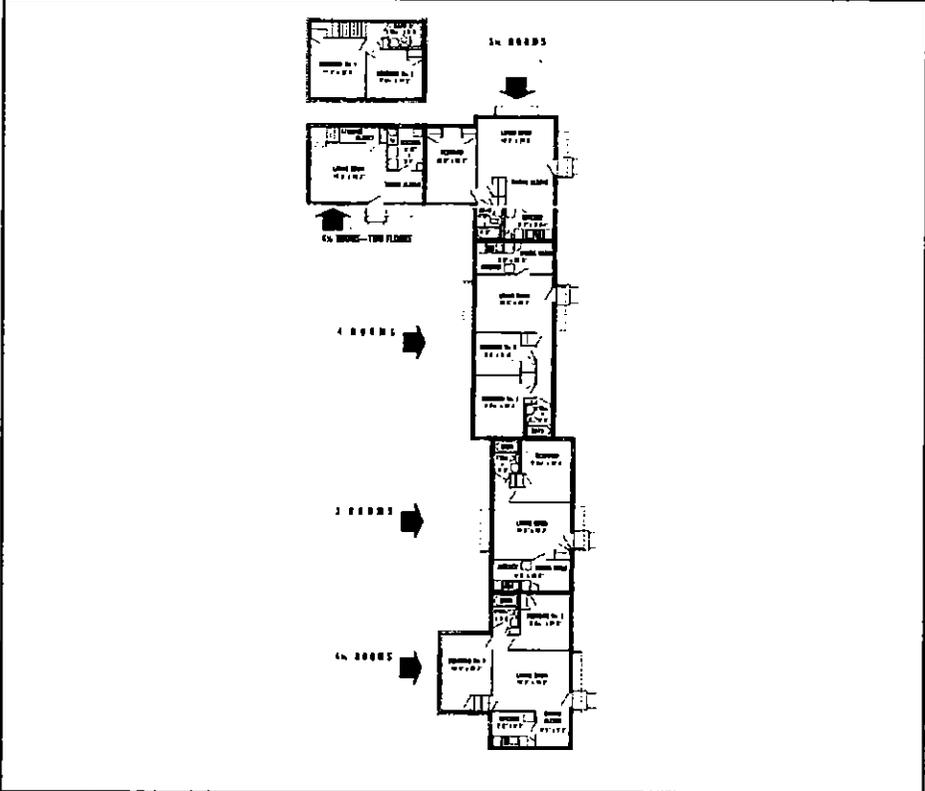

First-Floor Plan
(where available)

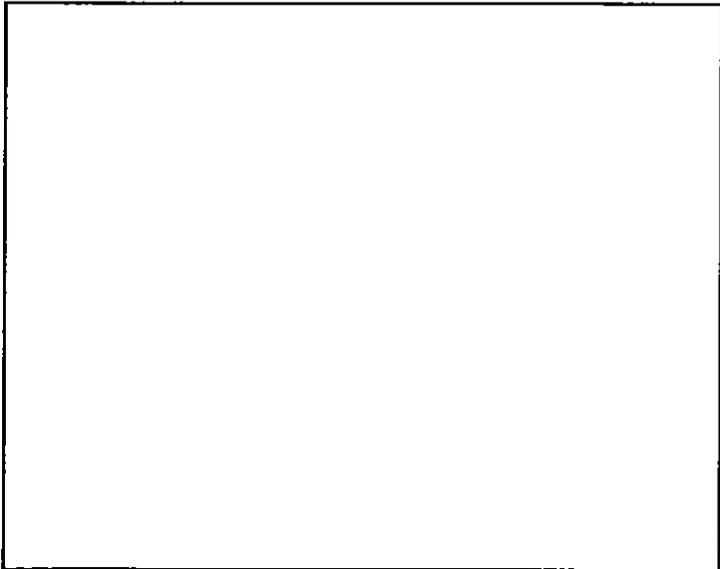

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .024


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

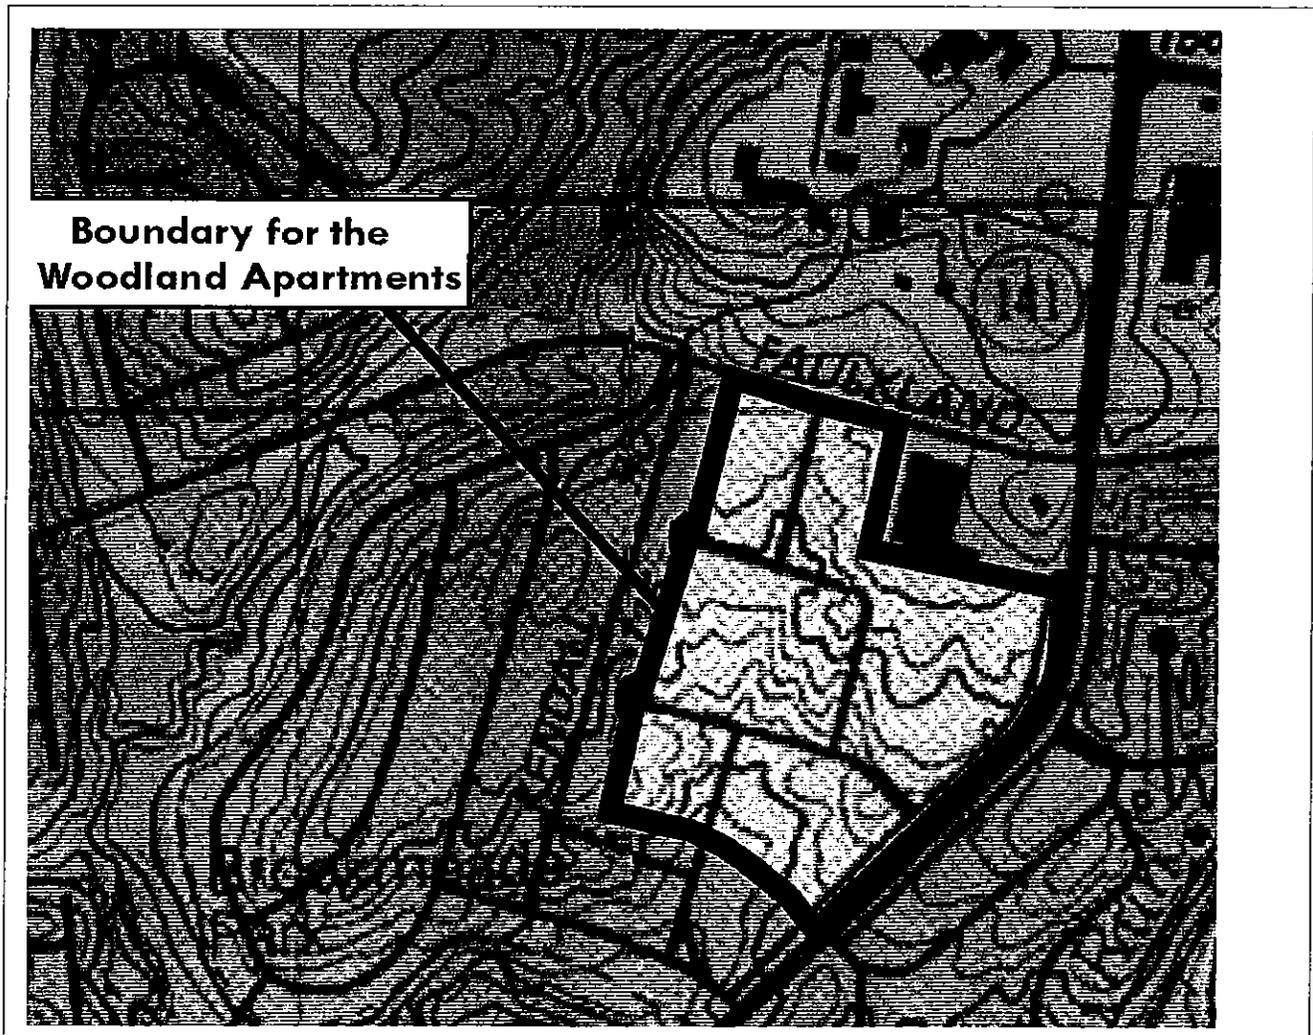


4. SITE PLAN:


CRS # N14270 .024

INDICATE NORTH ON PLAN


Sketch Plan

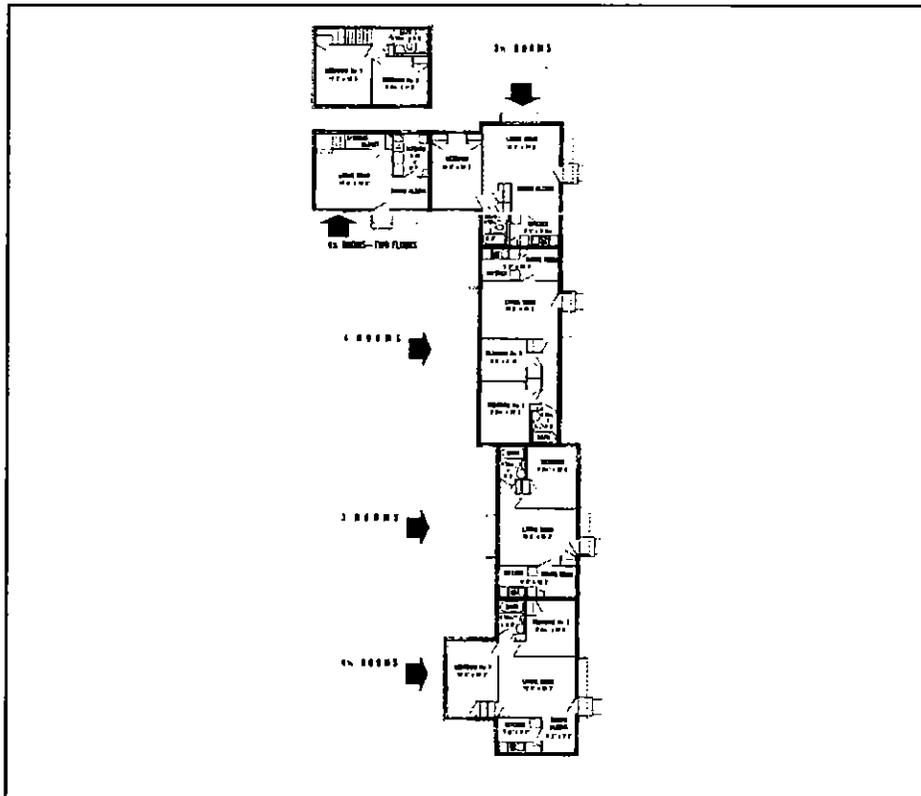

First-Floor Plan
(where available)

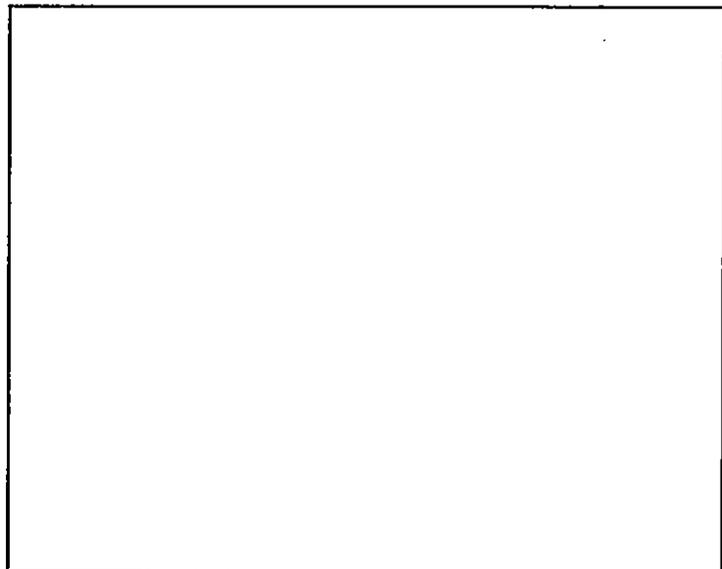

NOTE: Sketches are not to scale.

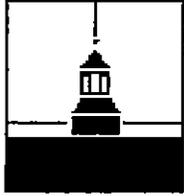

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .025


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

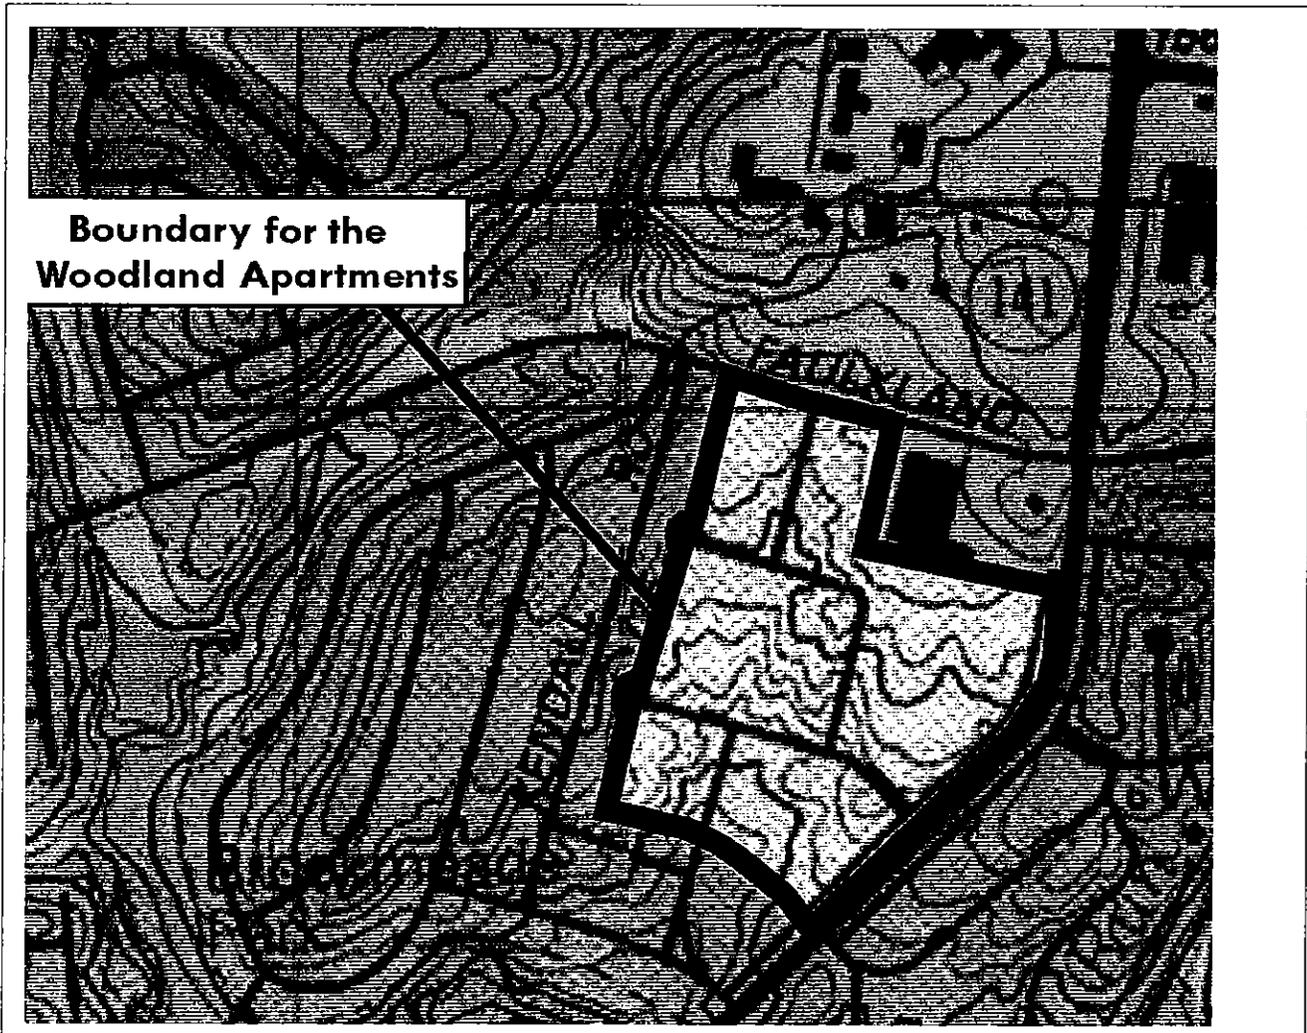


4. SITE PLAN:


CRS # N14270 .025

INDICATE NORTH ON PLAN

Sketch Plan

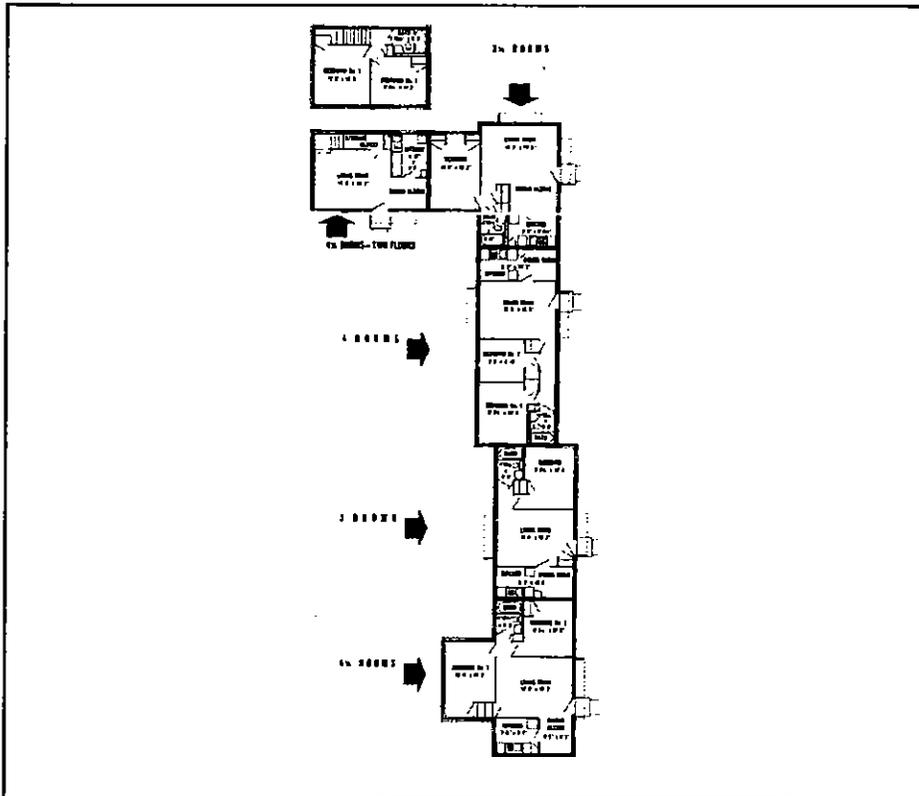

First-Floor Plan
(where available)

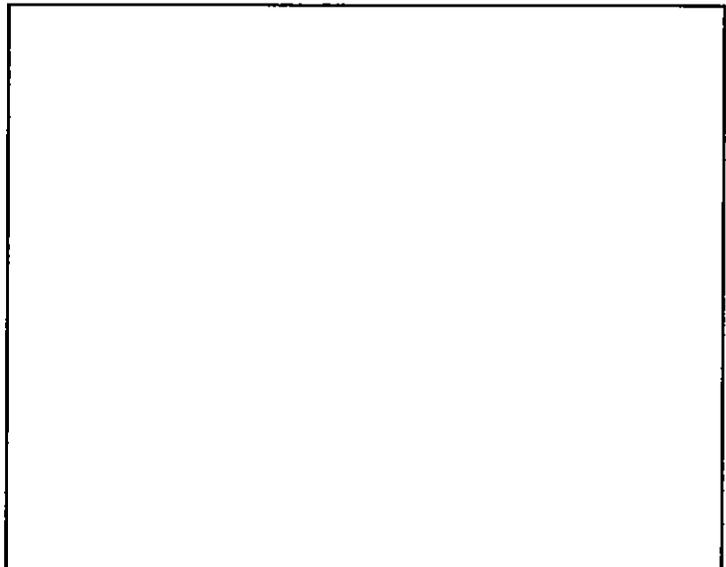

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .026


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

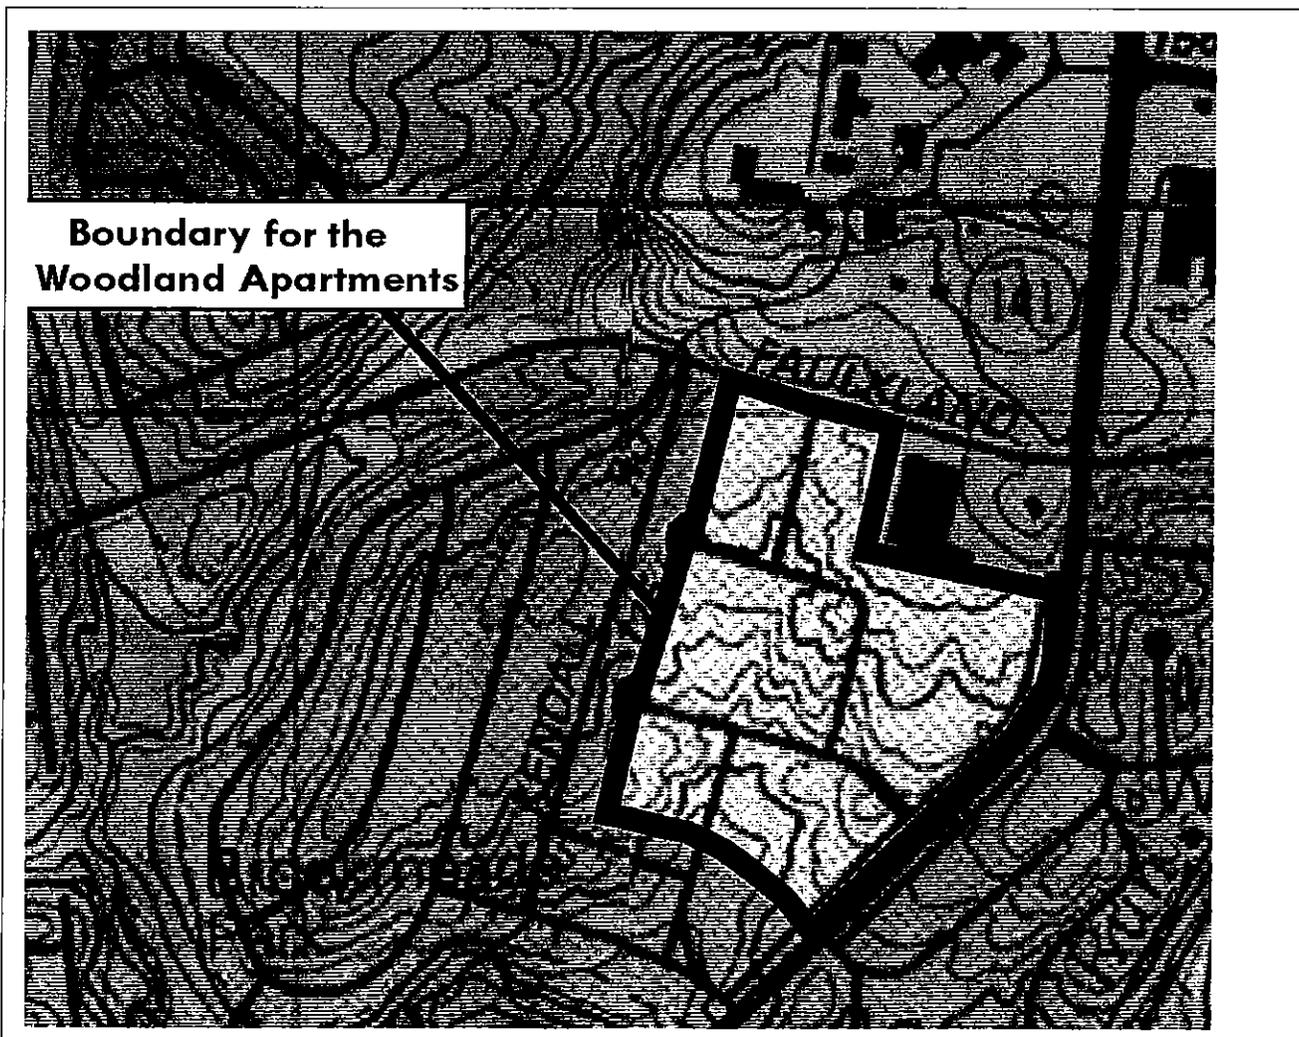


4. SITE PLAN:


CRS # N14270 .026

INDICATE NORTH ON PLAN


Sketch Plan

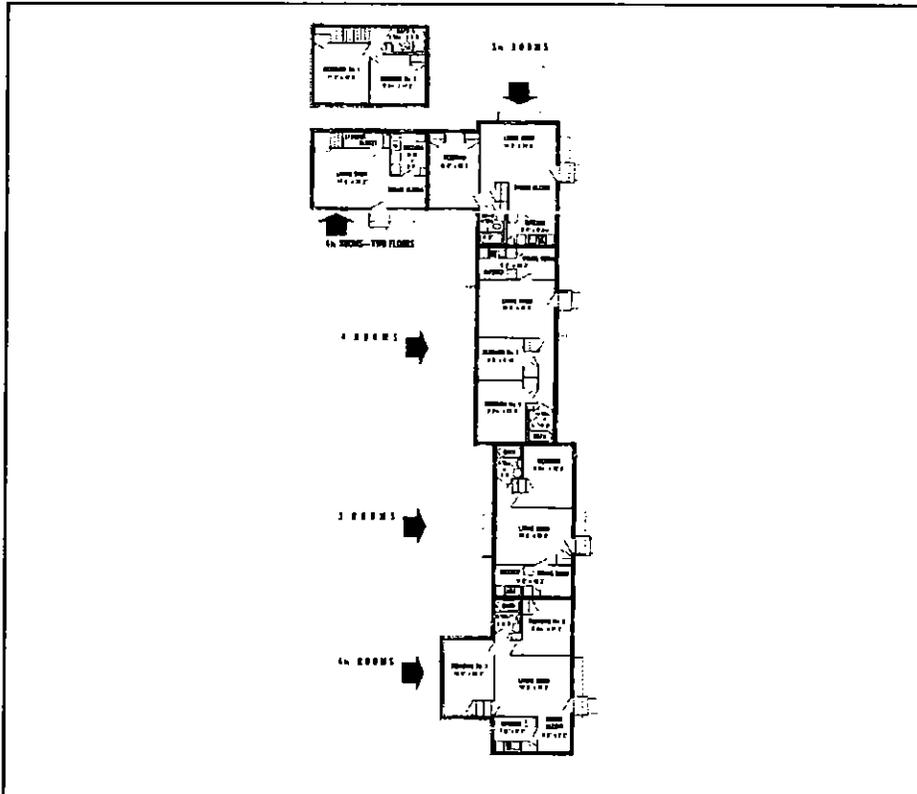

First-Floor Plan
(where available)

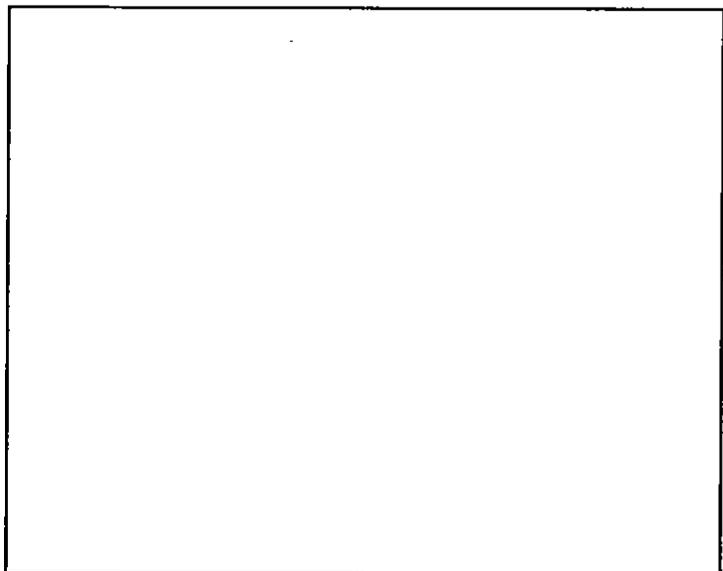

NOTE: Sketches are not to scale.

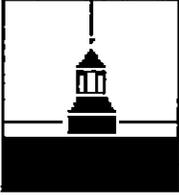

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .027


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

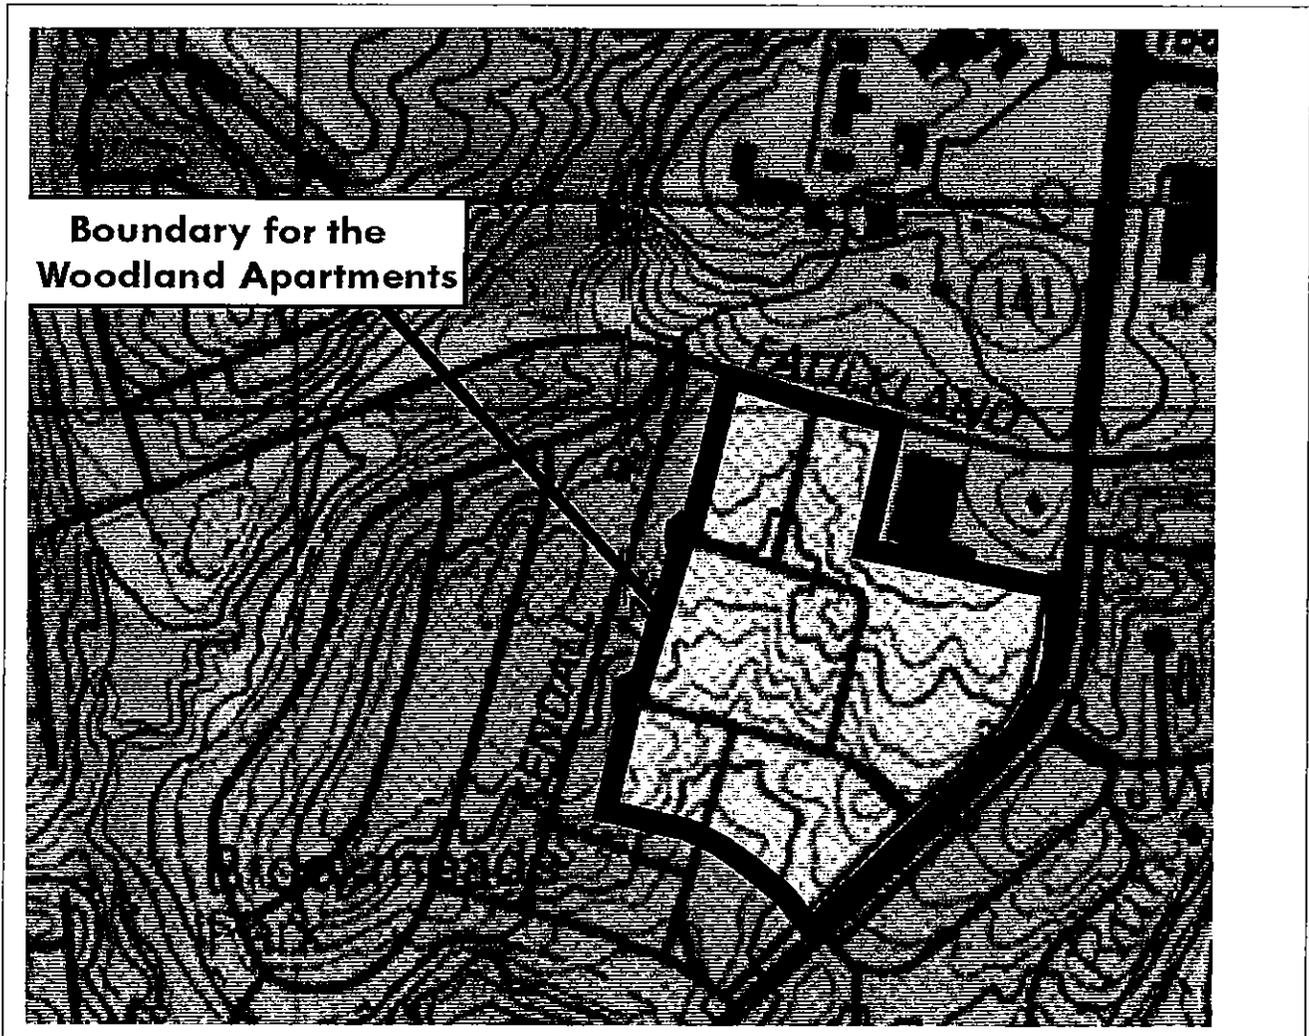


4. SITE PLAN:


CRS # N14270 .027

INDICATE NORTH ON PLAN


Sketch Plan

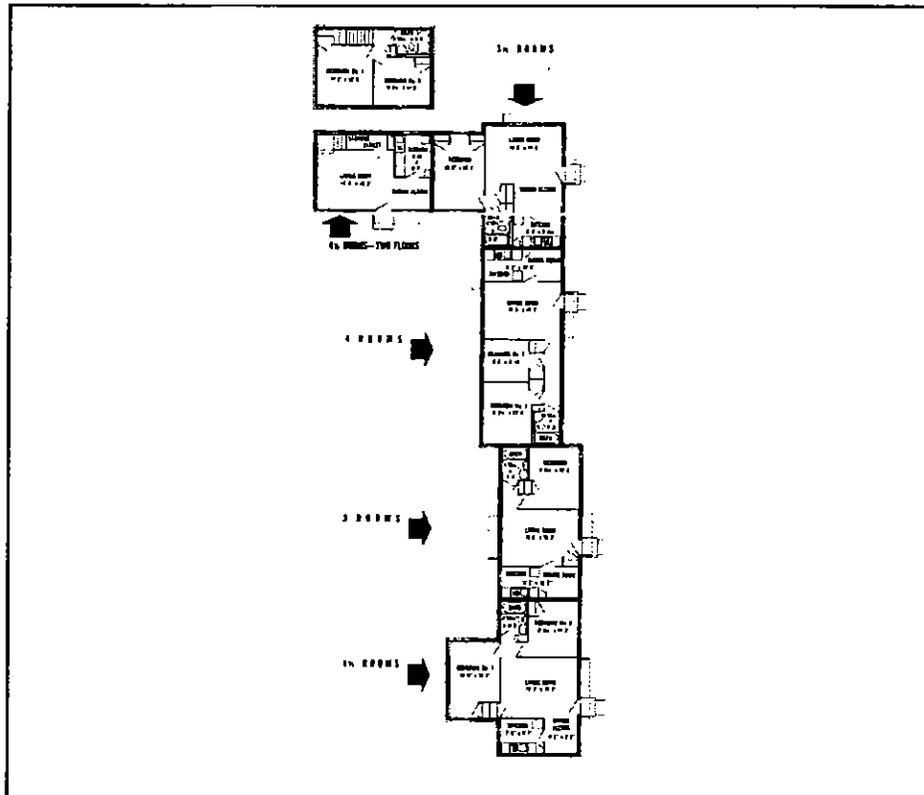

First-Floor Plan
(where available)

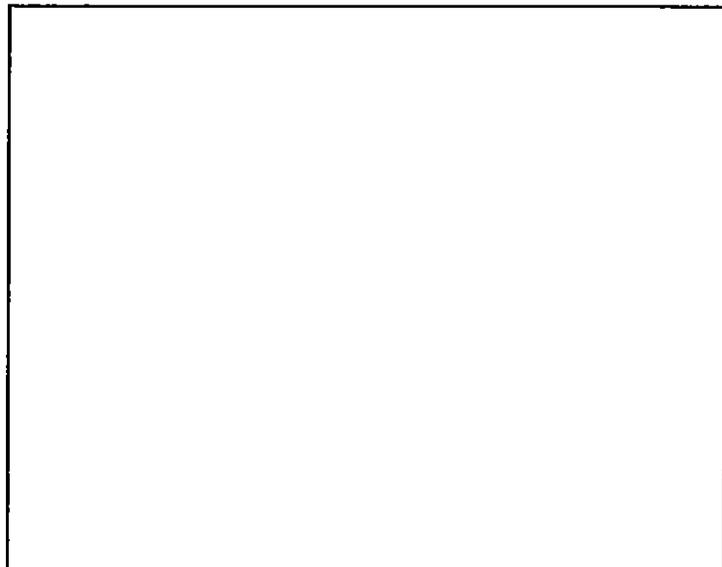

NOTE: Sketches are not to scale.

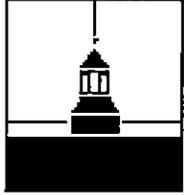

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .028


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

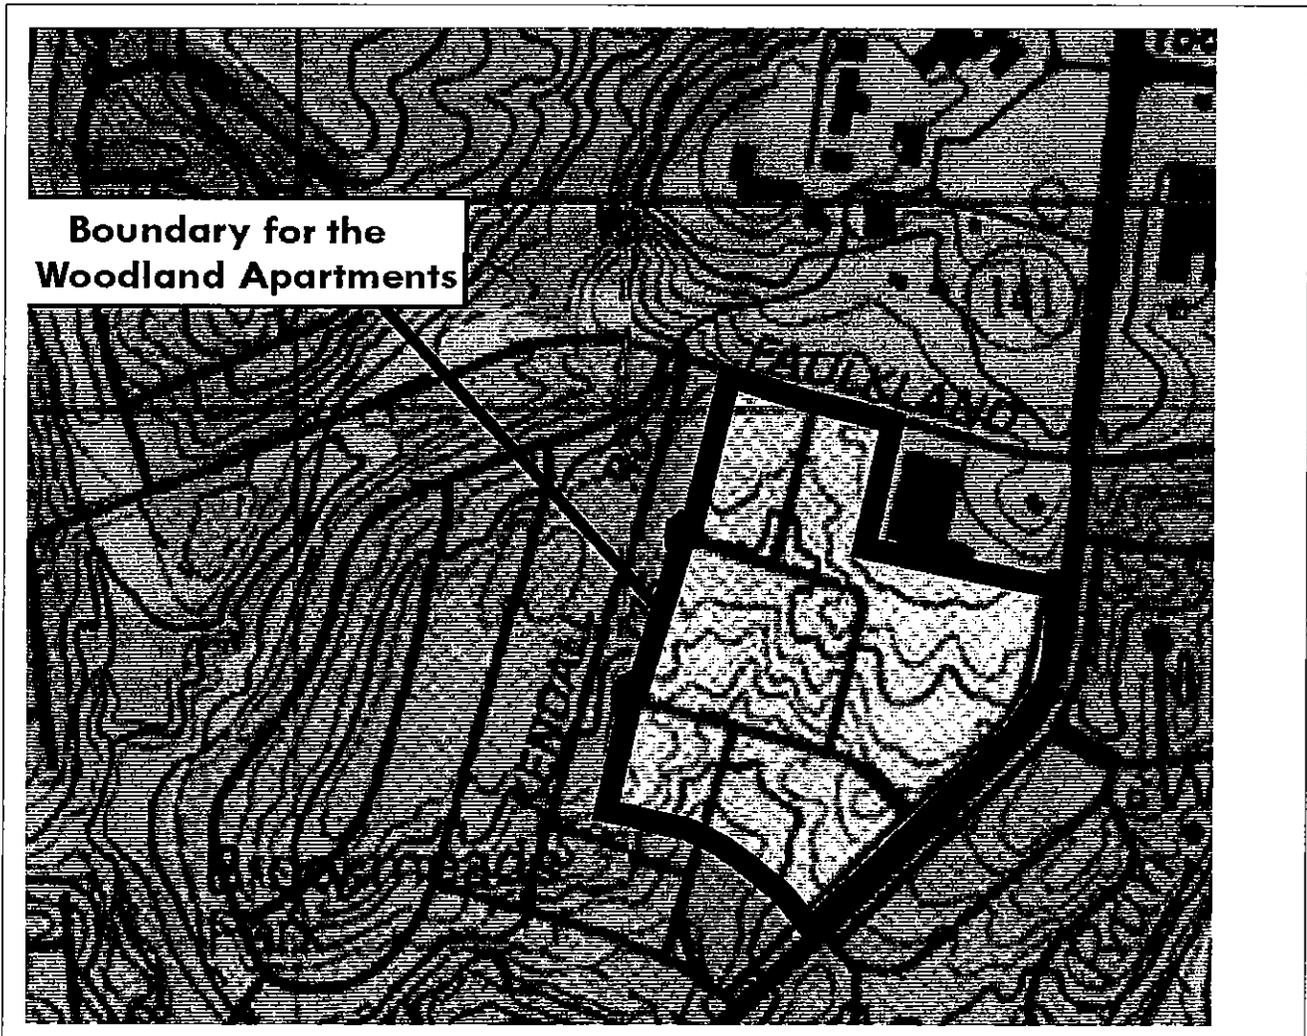


4. SITE PLAN:

CRS # N14270 .028

INDICATE NORTH ON PLAN


Sketch Plan

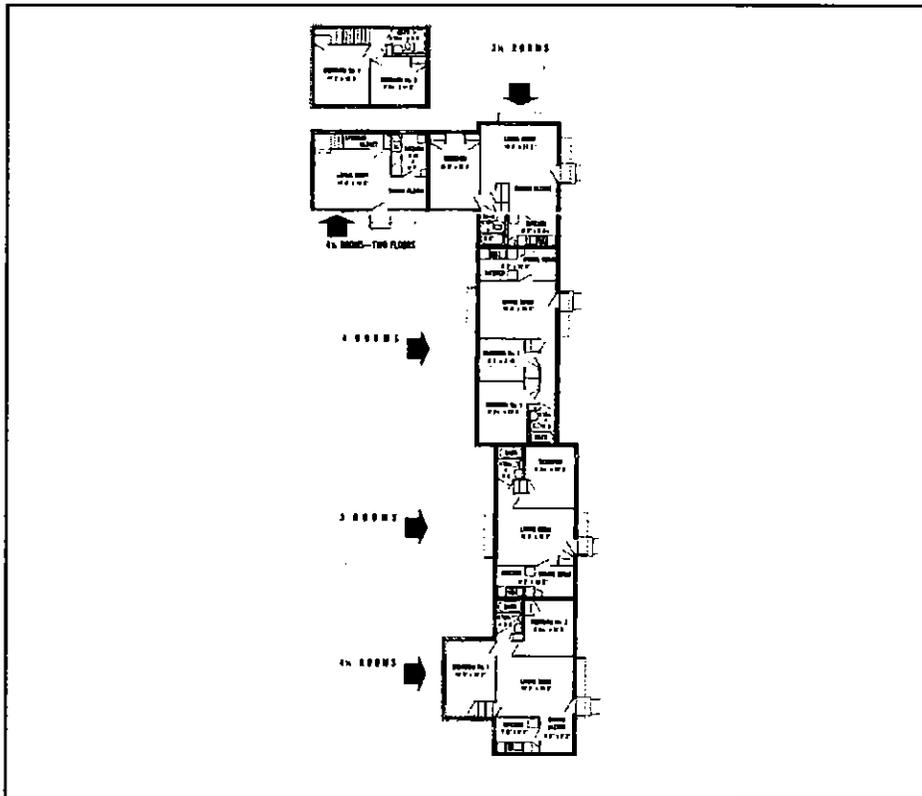

First-Floor Plan
(where available)



NOTE: Sketches are not to scale.

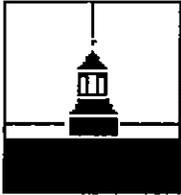

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .029


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

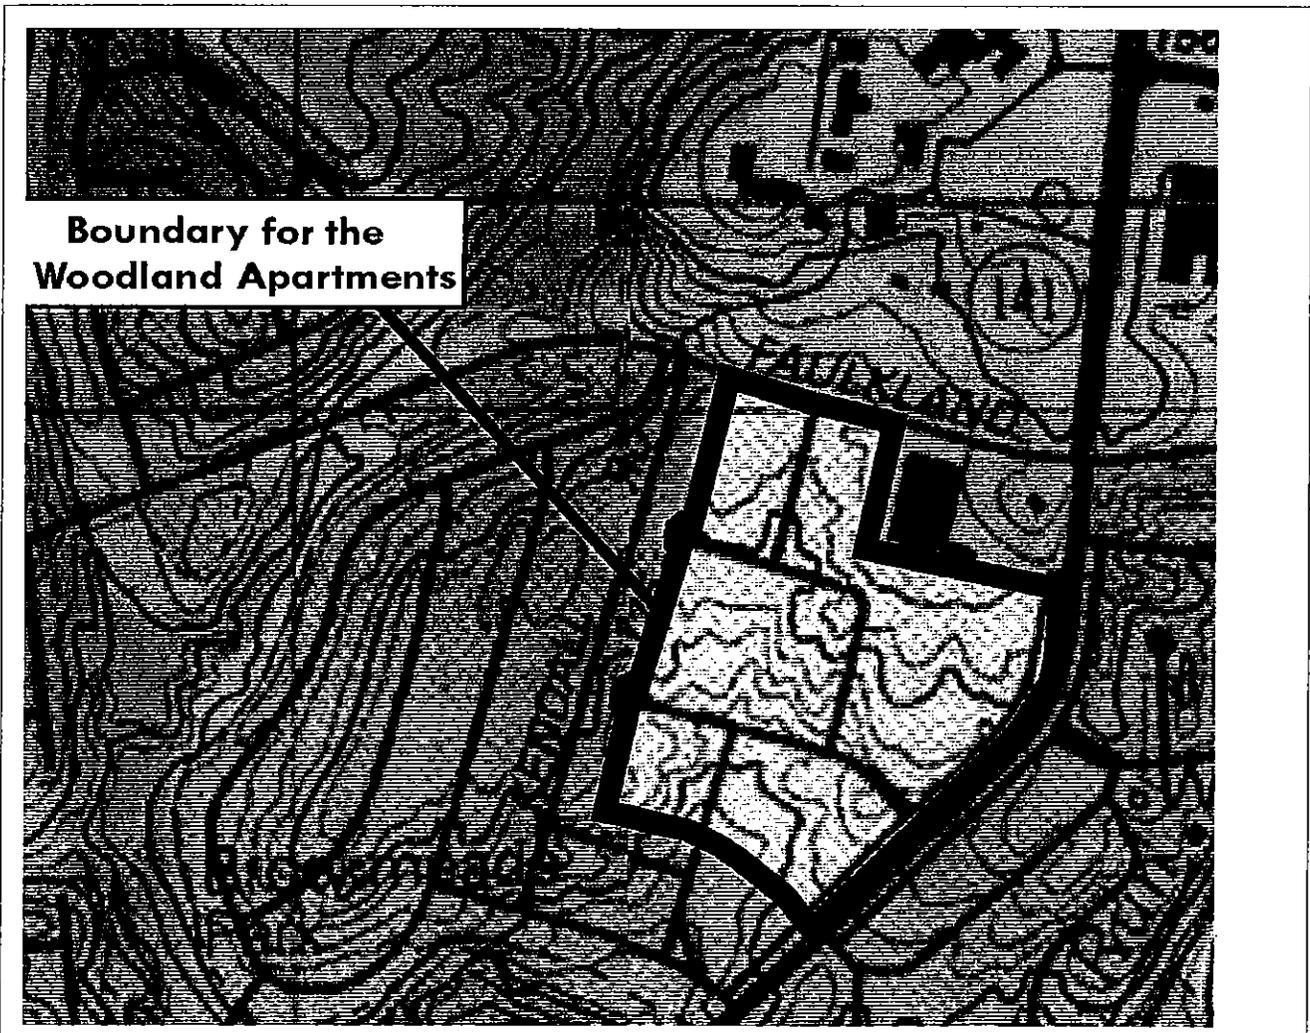


4. SITE PLAN:


CRS # N14270 .029

INDICATE NORTH ON PLAN

Sketch Plan

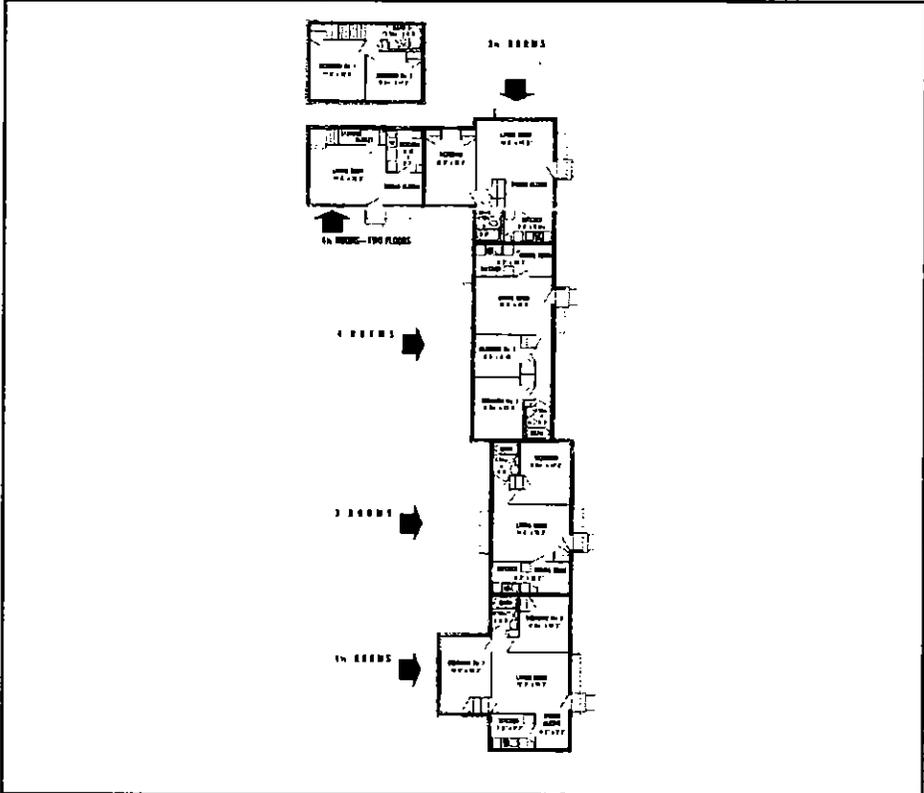

First-Floor Plan
(where available)

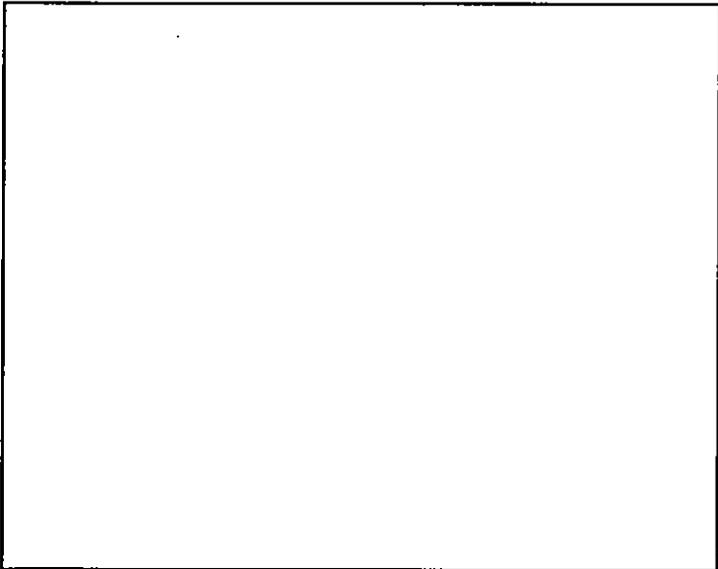

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .030


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

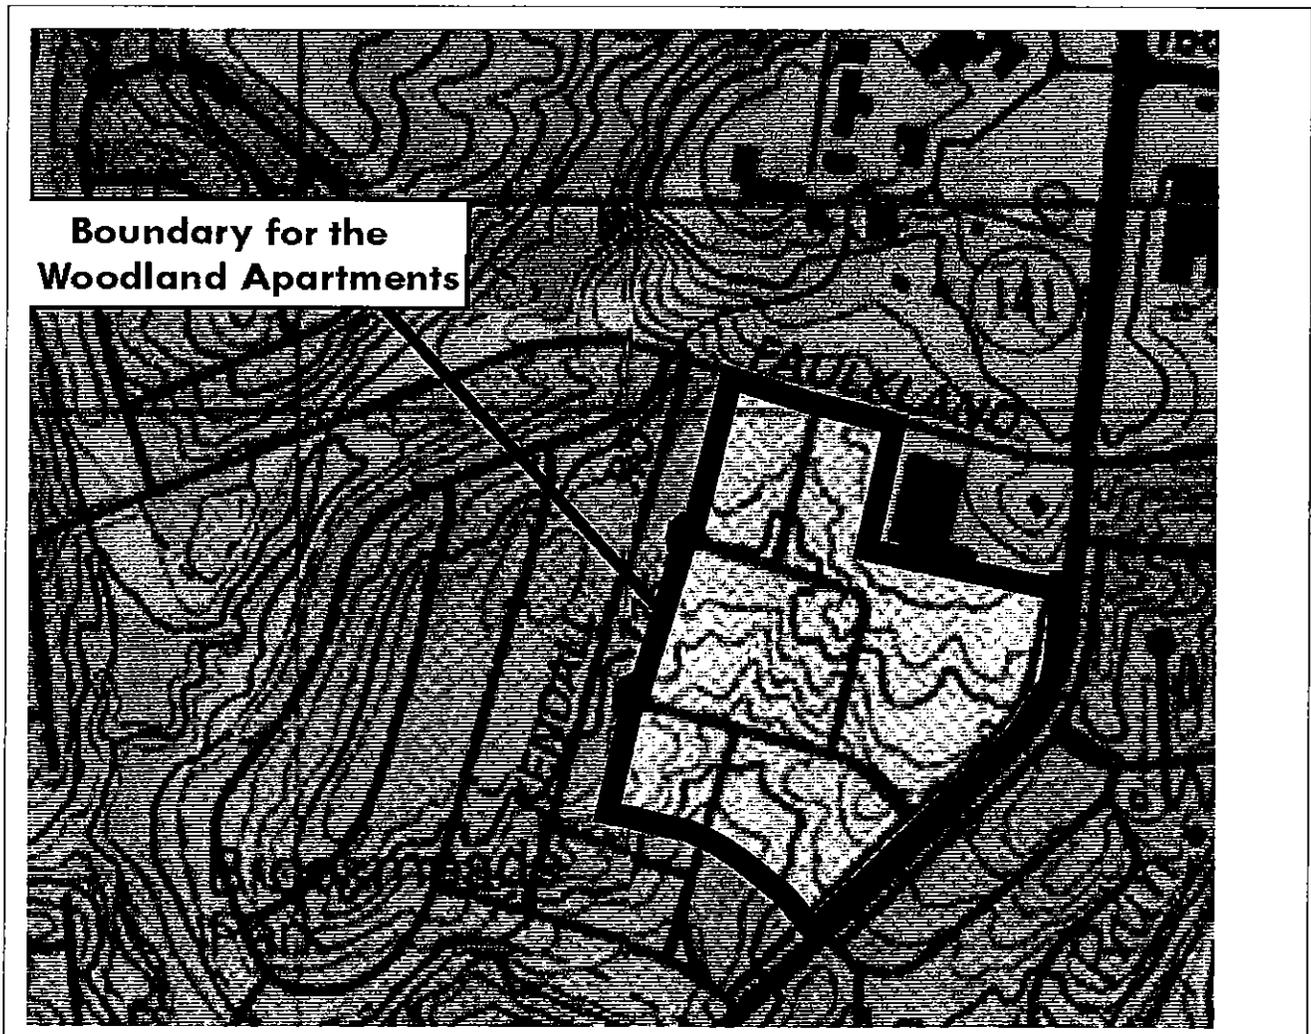


4. SITE PLAN:


CRS # N14270 .030

INDICATE NORTH ON PLAN

Sketch Plan

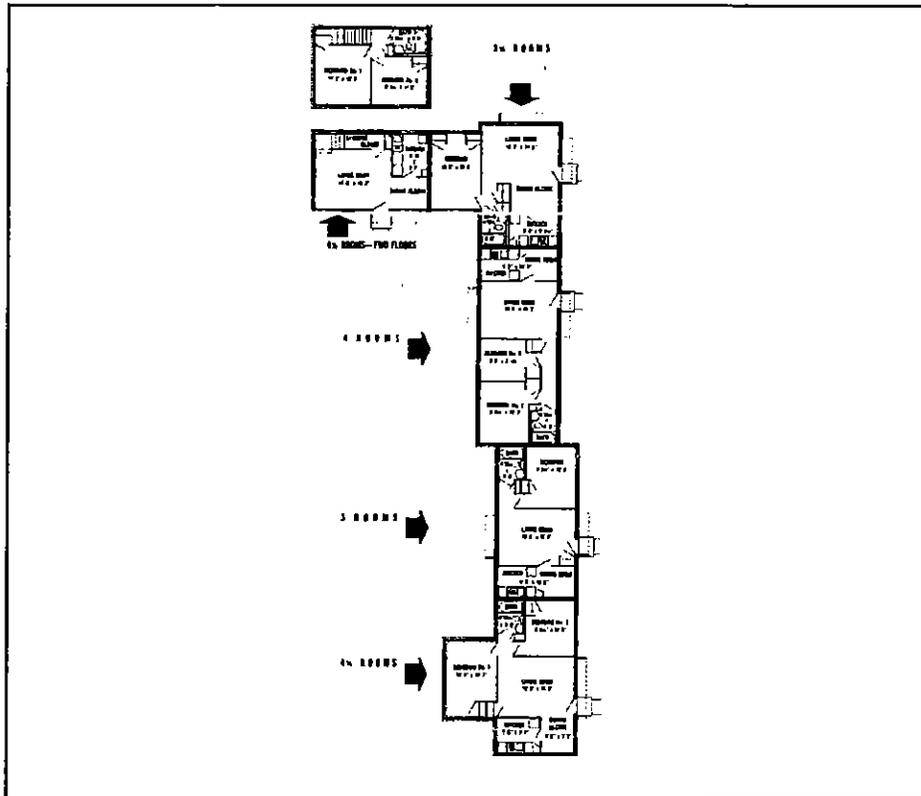

First-Floor Plan
(where available)

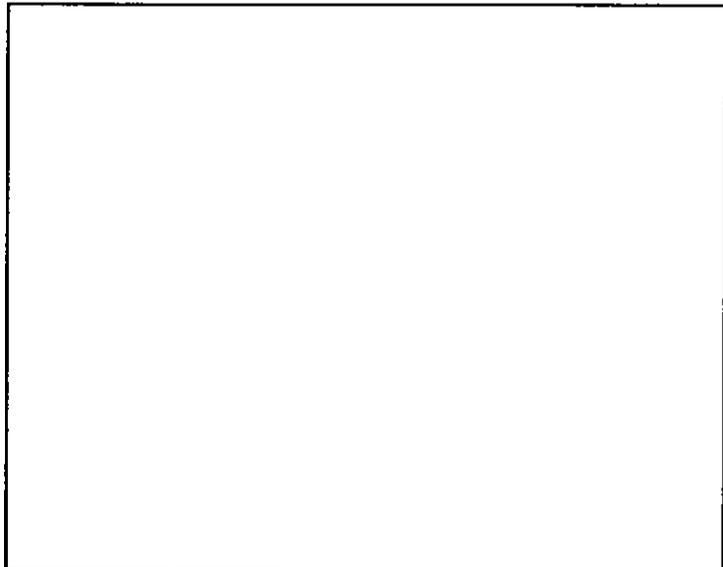


NOTE: Sketches are not to scale.

4. SITE PLAN:


CRS # N14270 .031

INDICATE NORTH ON PLAN


Sketch Plan

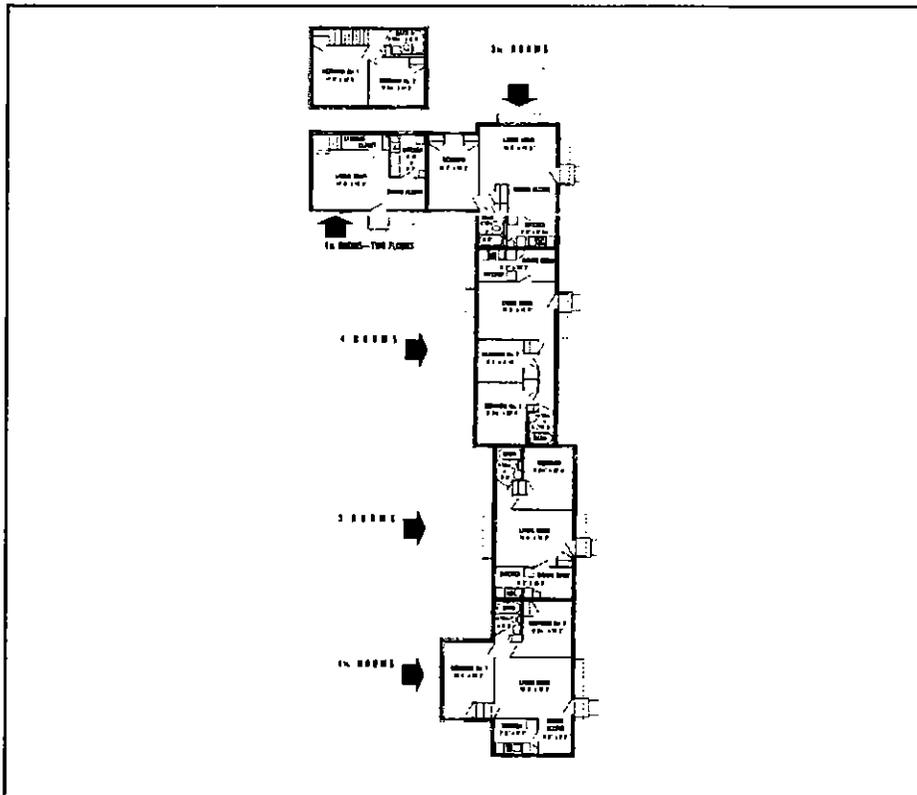

First-Floor Plan
(where available)

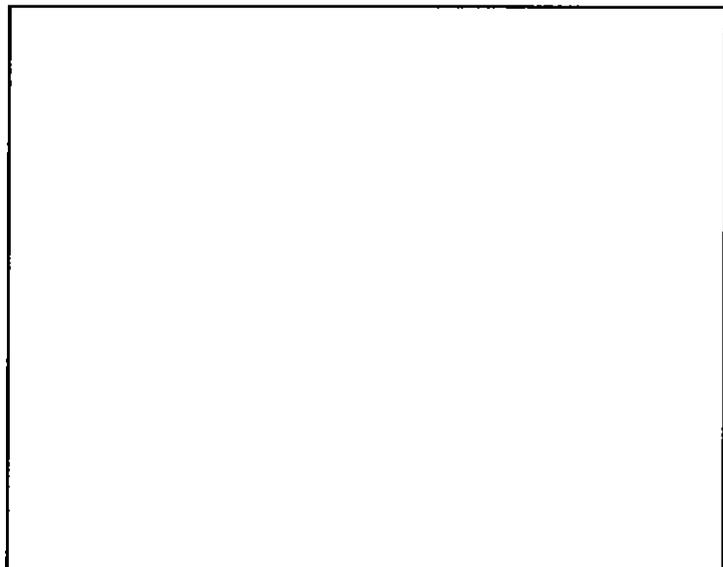

NOTE: Sketches are not to scale.

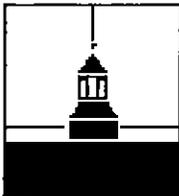

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .032

1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH




4. SITE PLAN:


CRS # NI4270 .032

INDICATE NORTH ON PLAN

Sketch Plan

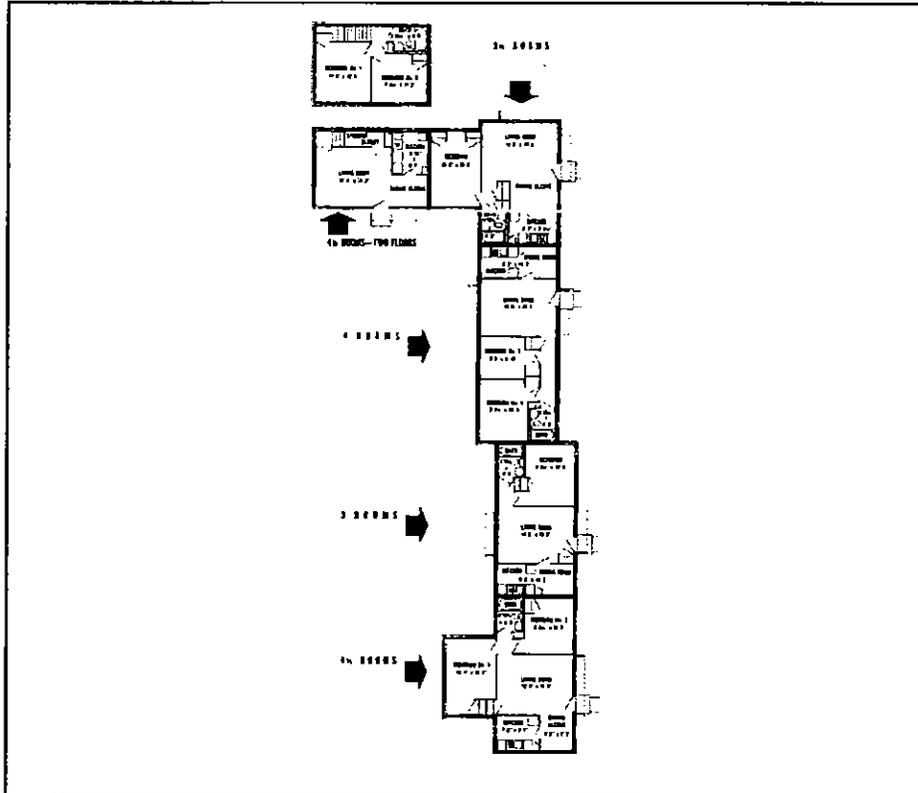

First-Floor Plan
(where available)

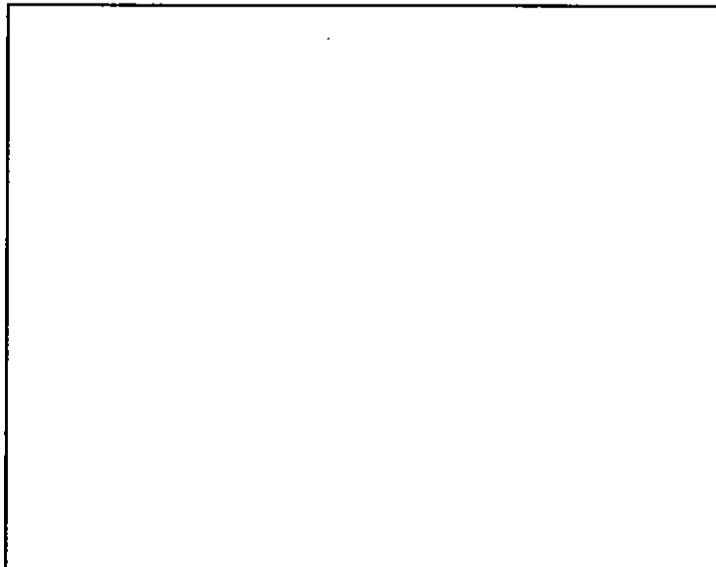

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .033


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)


INDICATE NORTH ON SKETCH

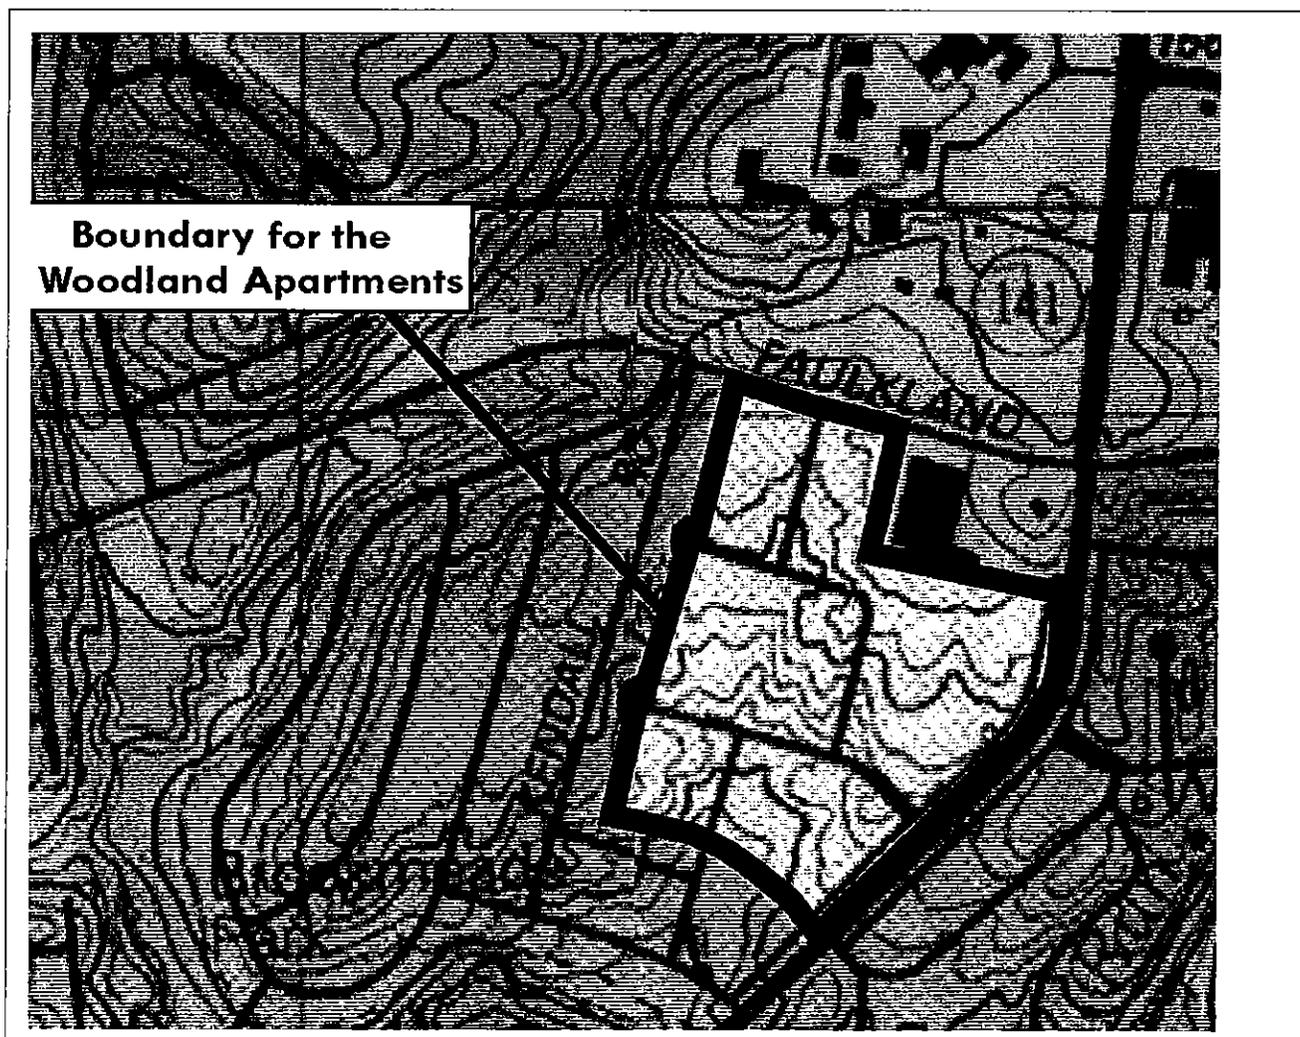


4. SITE PLAN:

CRS # N14270 .033

INDICATE NORTH ON PLAN

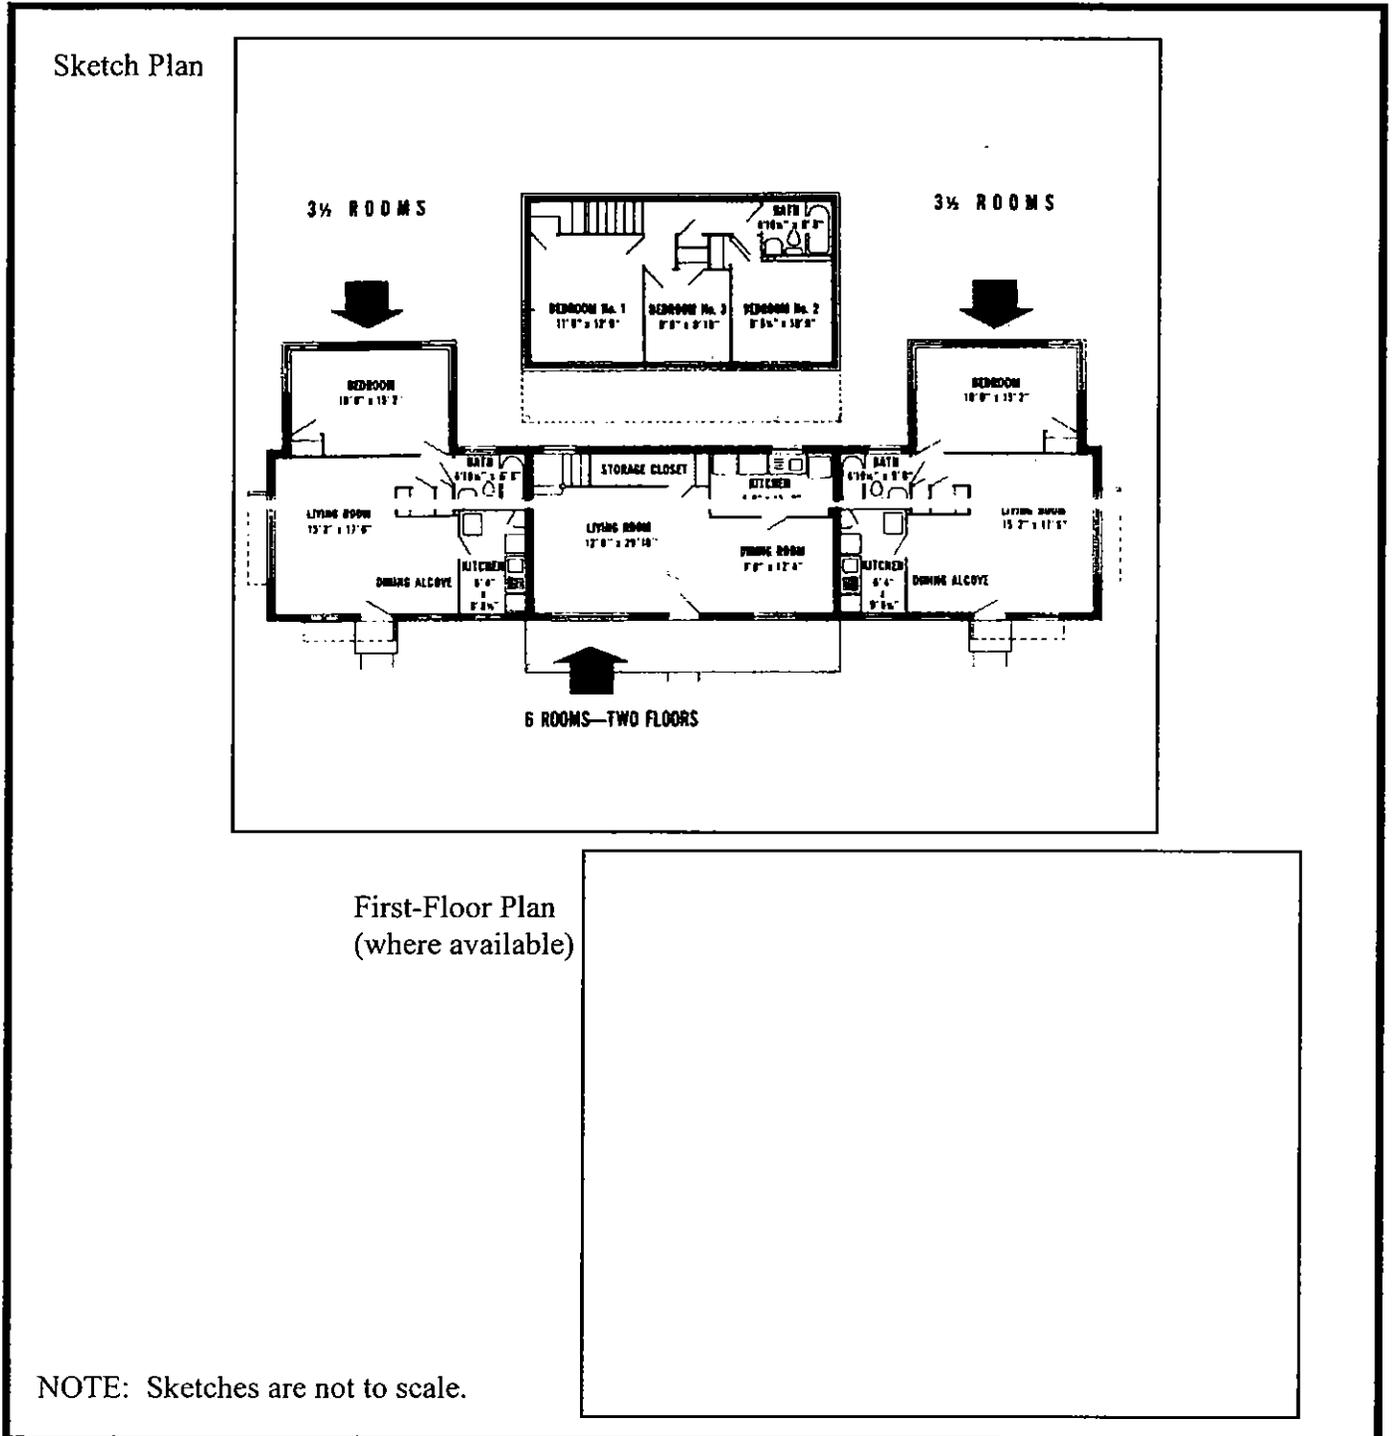

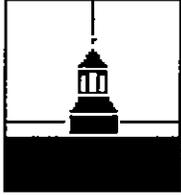

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .034


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

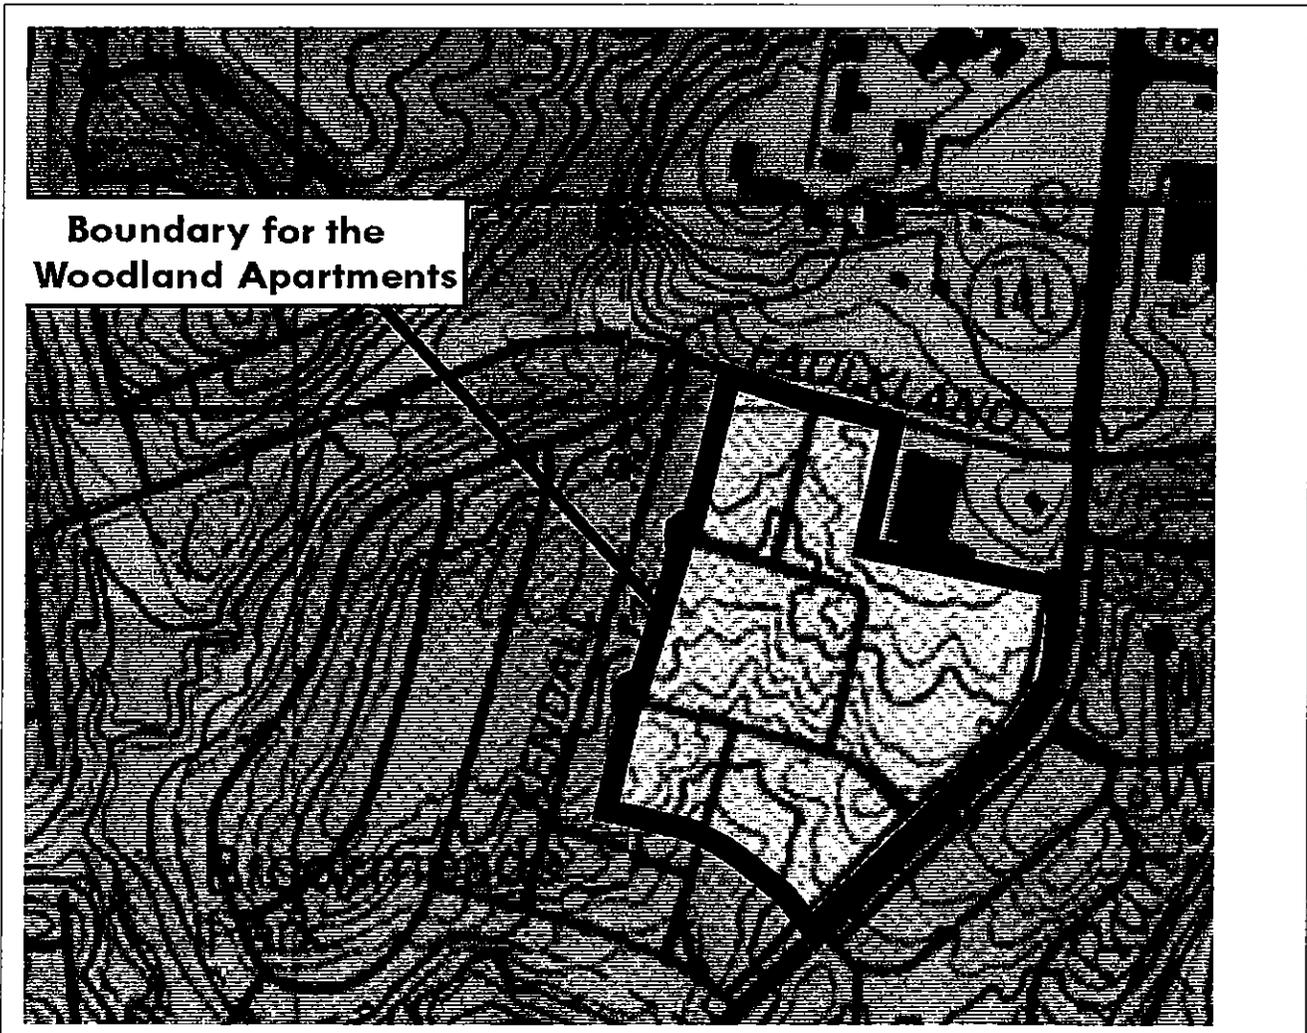


4. SITE PLAN:


CRS # N14270 .034

INDICATE NORTH ON PLAN

Sketch Plan

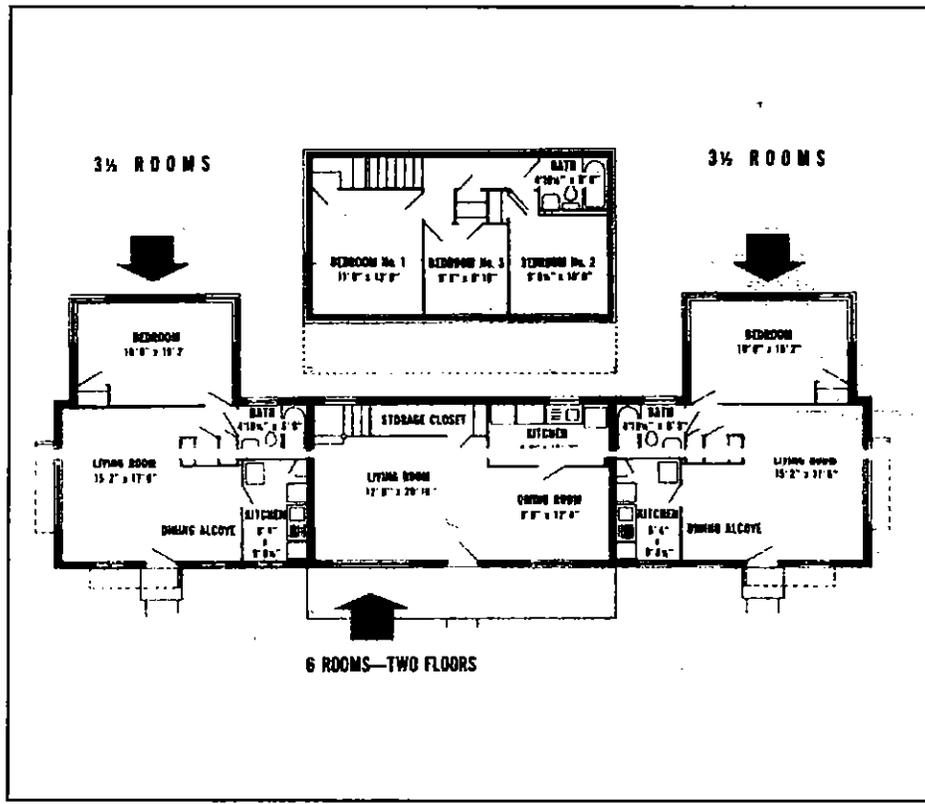

First-Floor Plan
(where available)

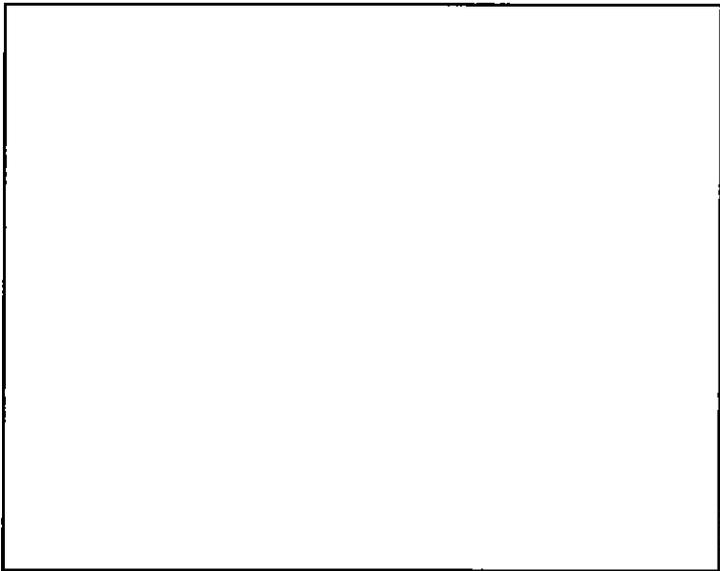

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .035


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)


INDICATE NORTH ON SKETCH

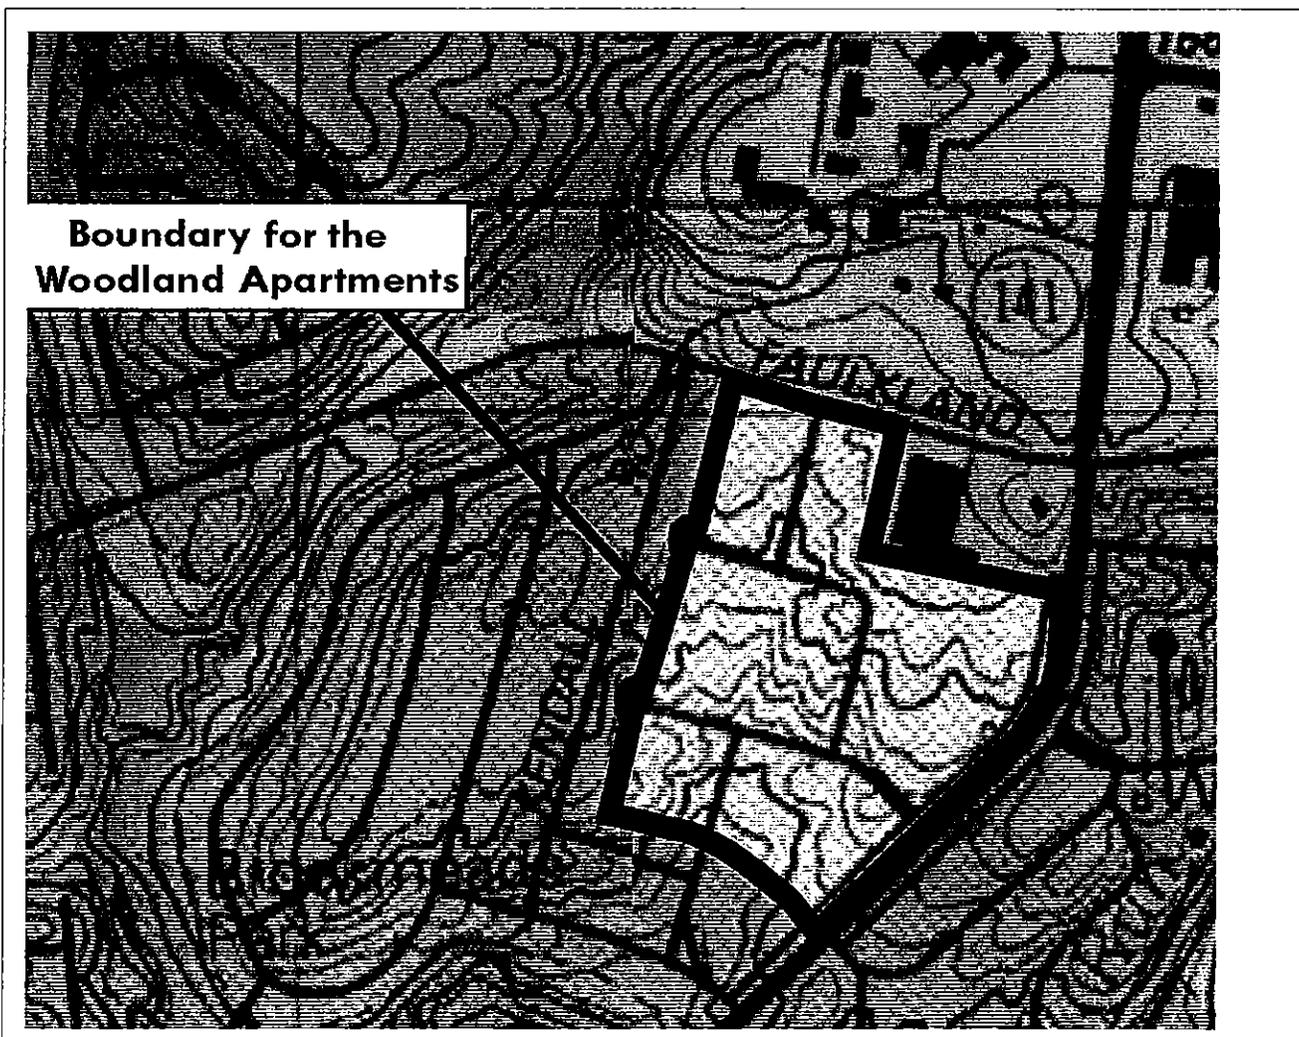

4. SITE PLAN:

CRS # N14270 .035


INDICATE NORTH ON PLAN

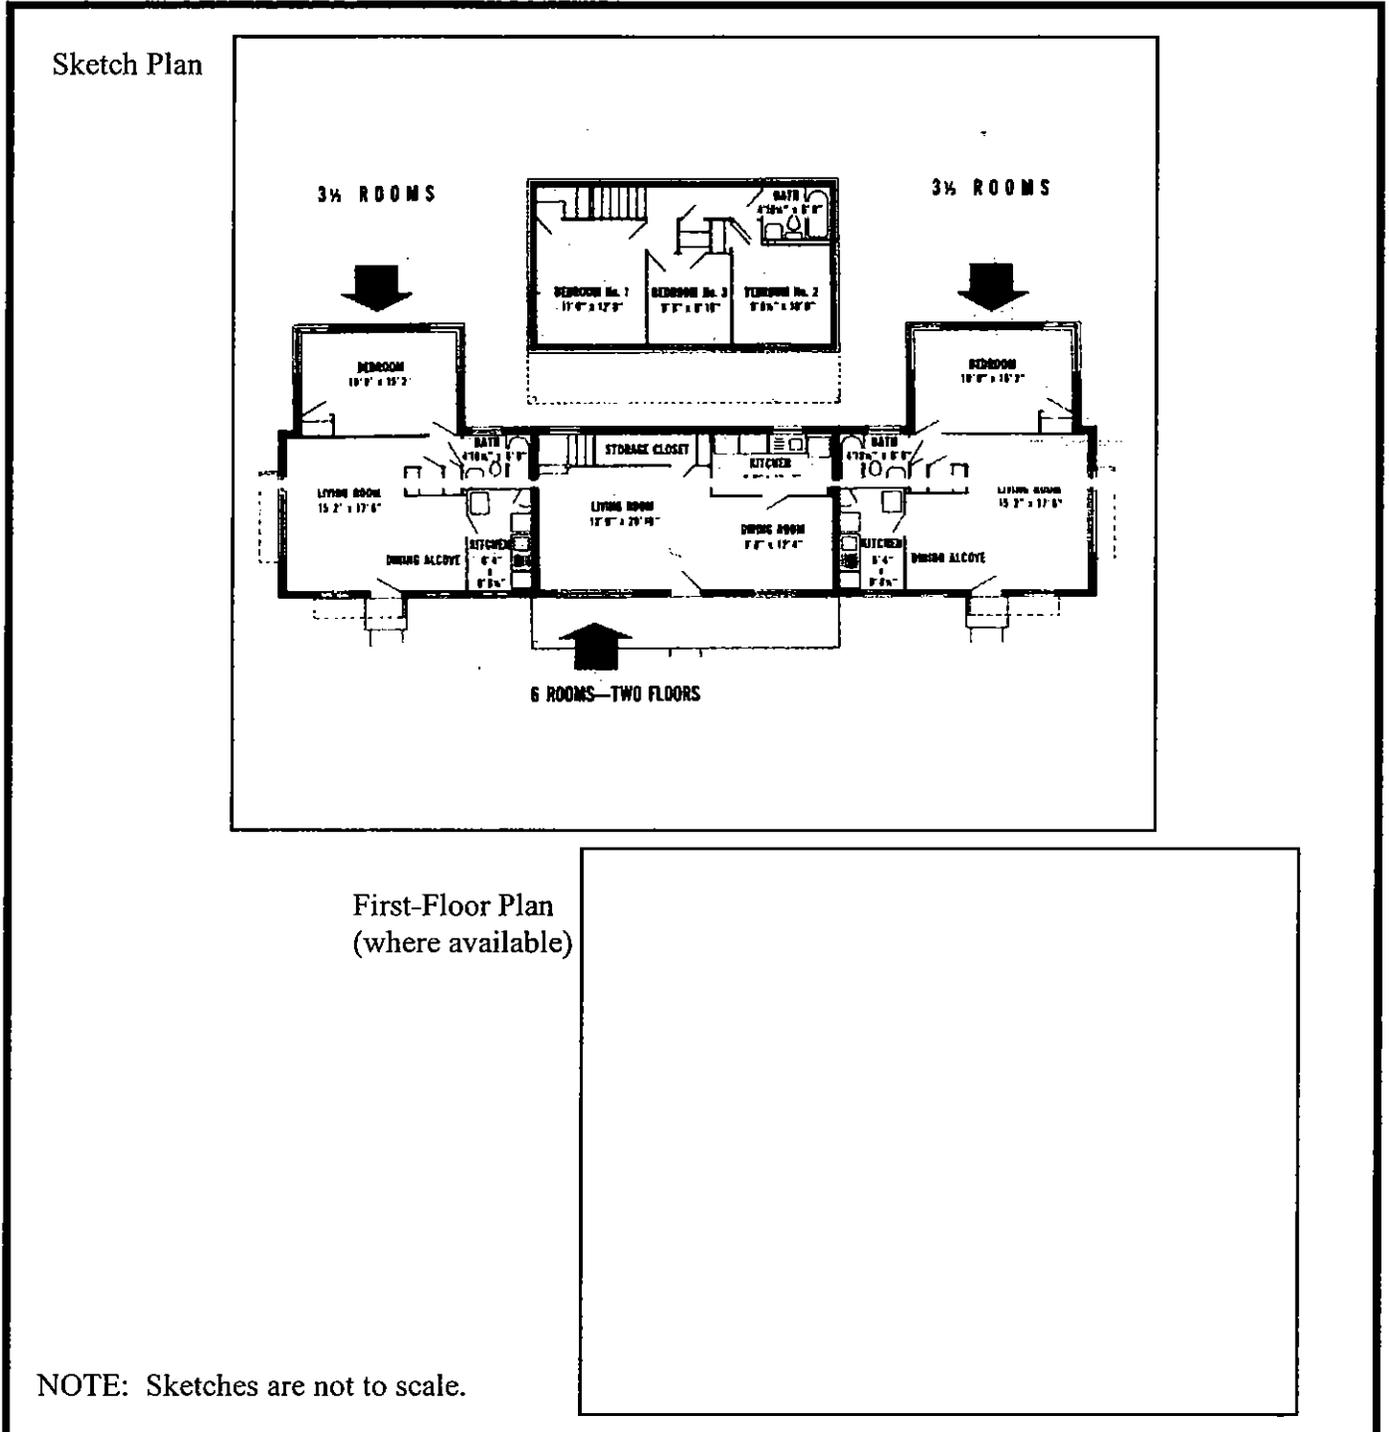

4. SITE PLAN:

CRS # N14270 .036


INDICATE NORTH ON PLAN

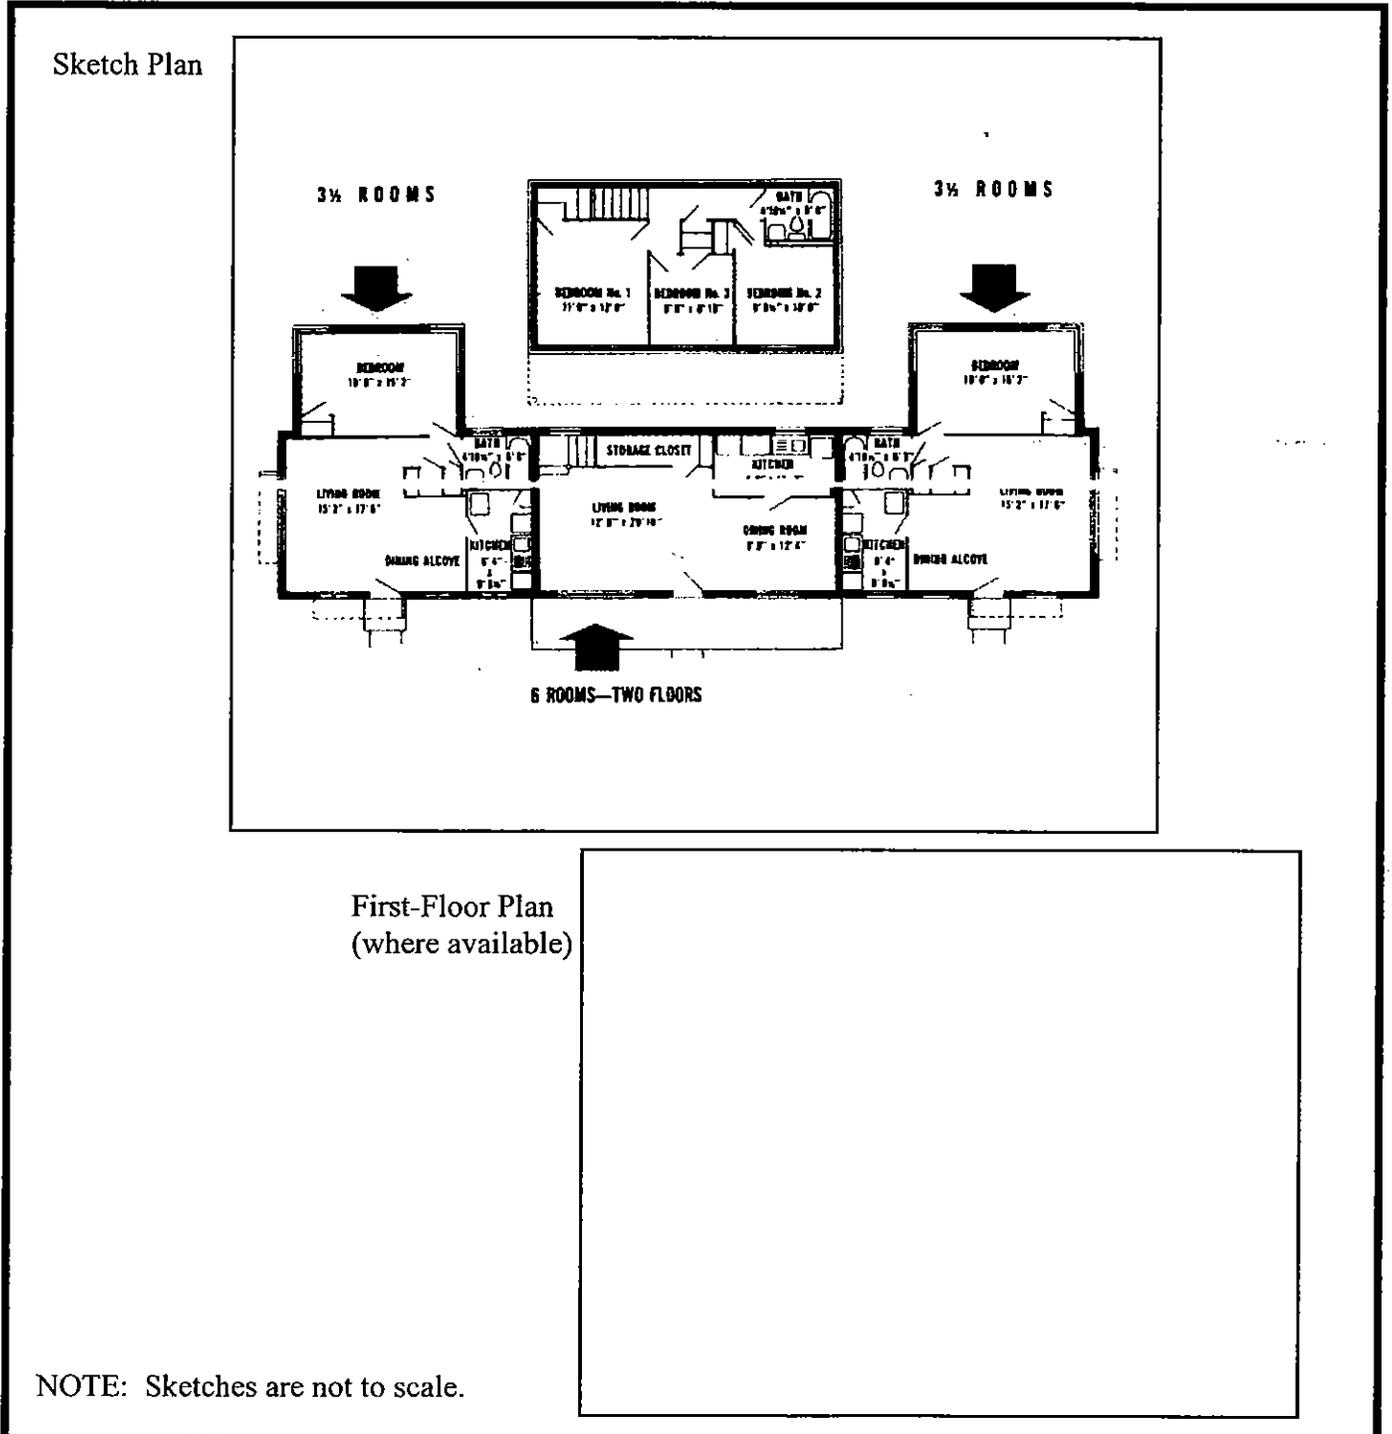

4. SITE PLAN:

CRS # N14270 .037

INDICATE NORTH ON PLAN

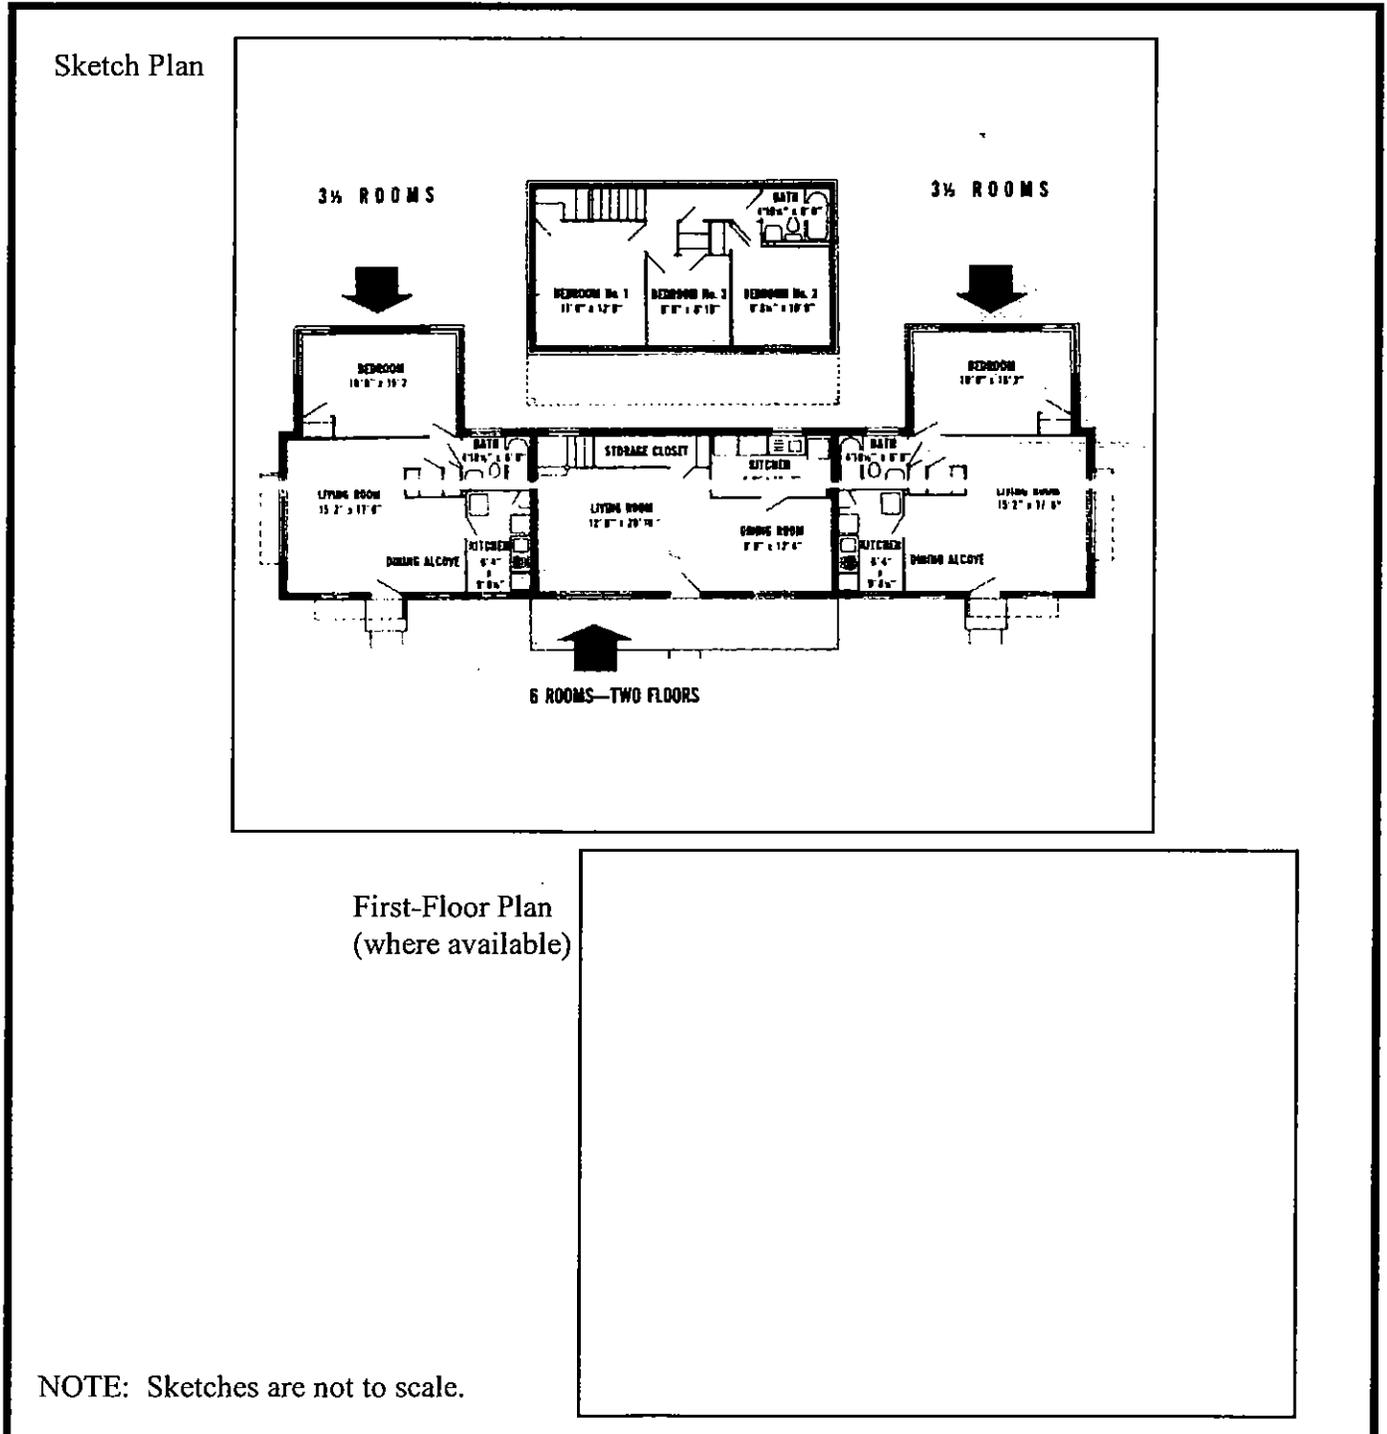



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .038


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)


INDICATE NORTH ON SKETCH

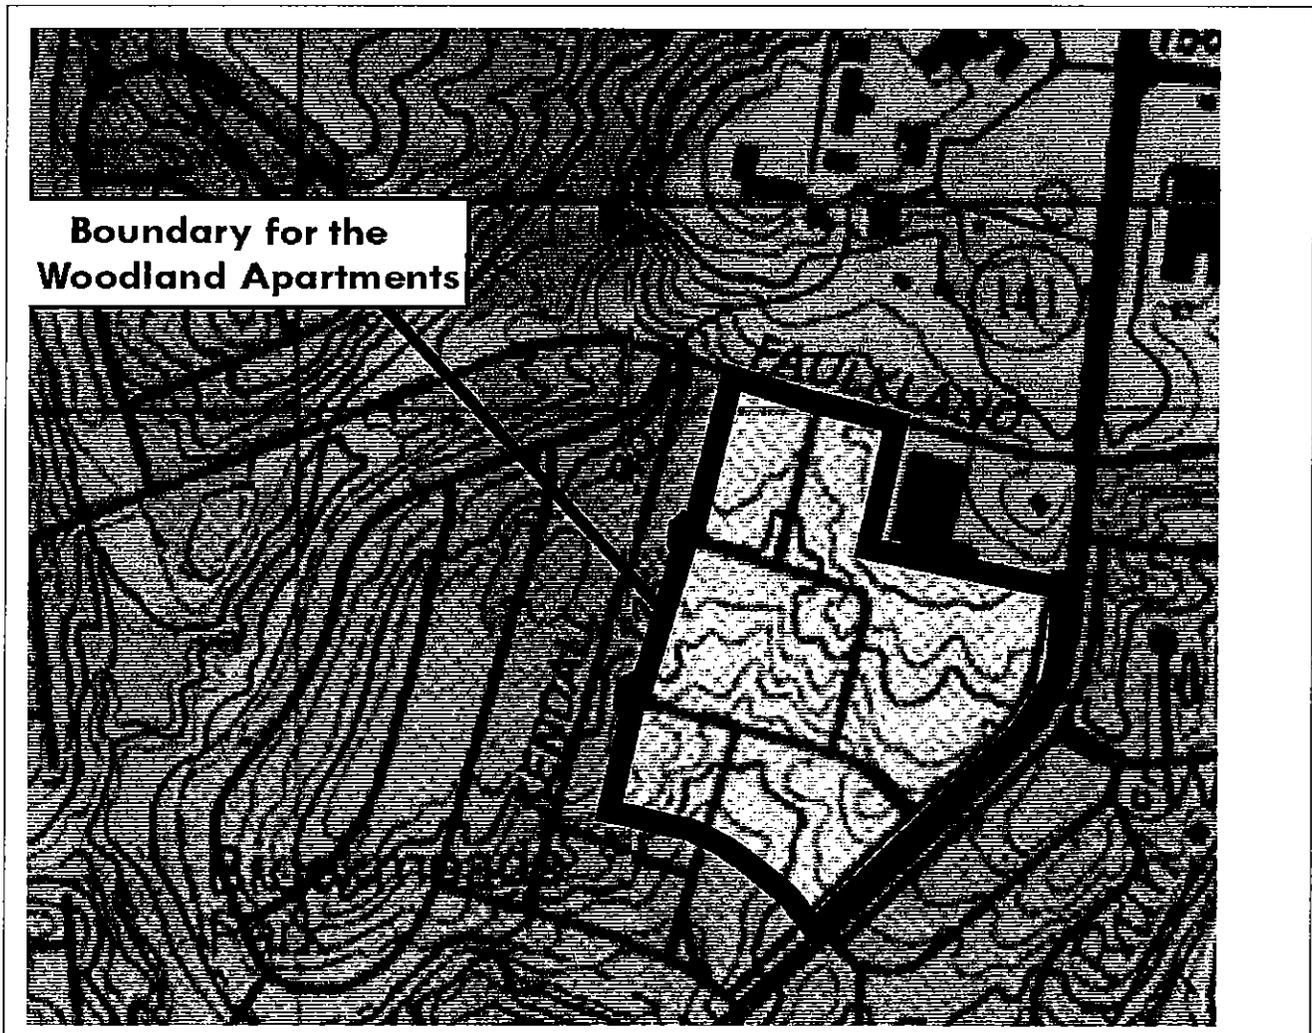

4. SITE PLAN:

CRS # N14270 .038


INDICATE NORTH ON PLAN

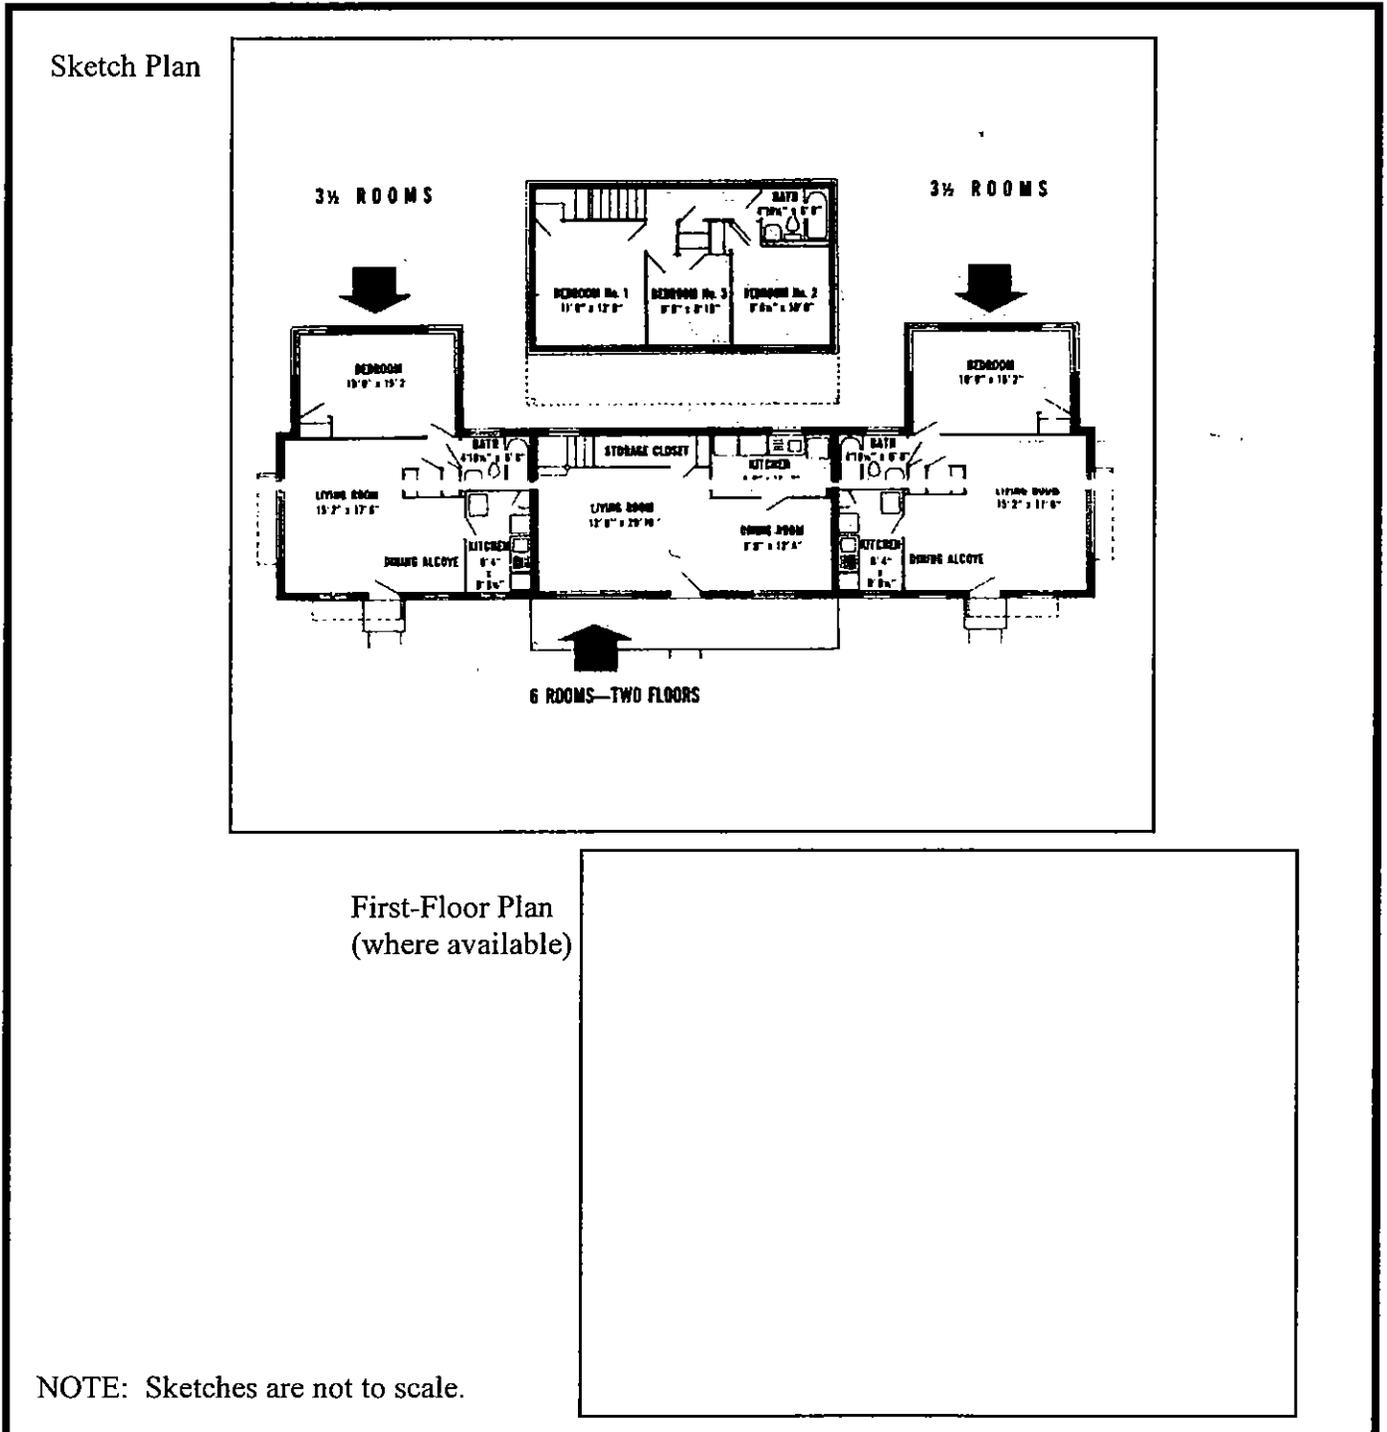

4. SITE PLAN:

CRS # N14270 .039


INDICATE NORTH ON PLAN

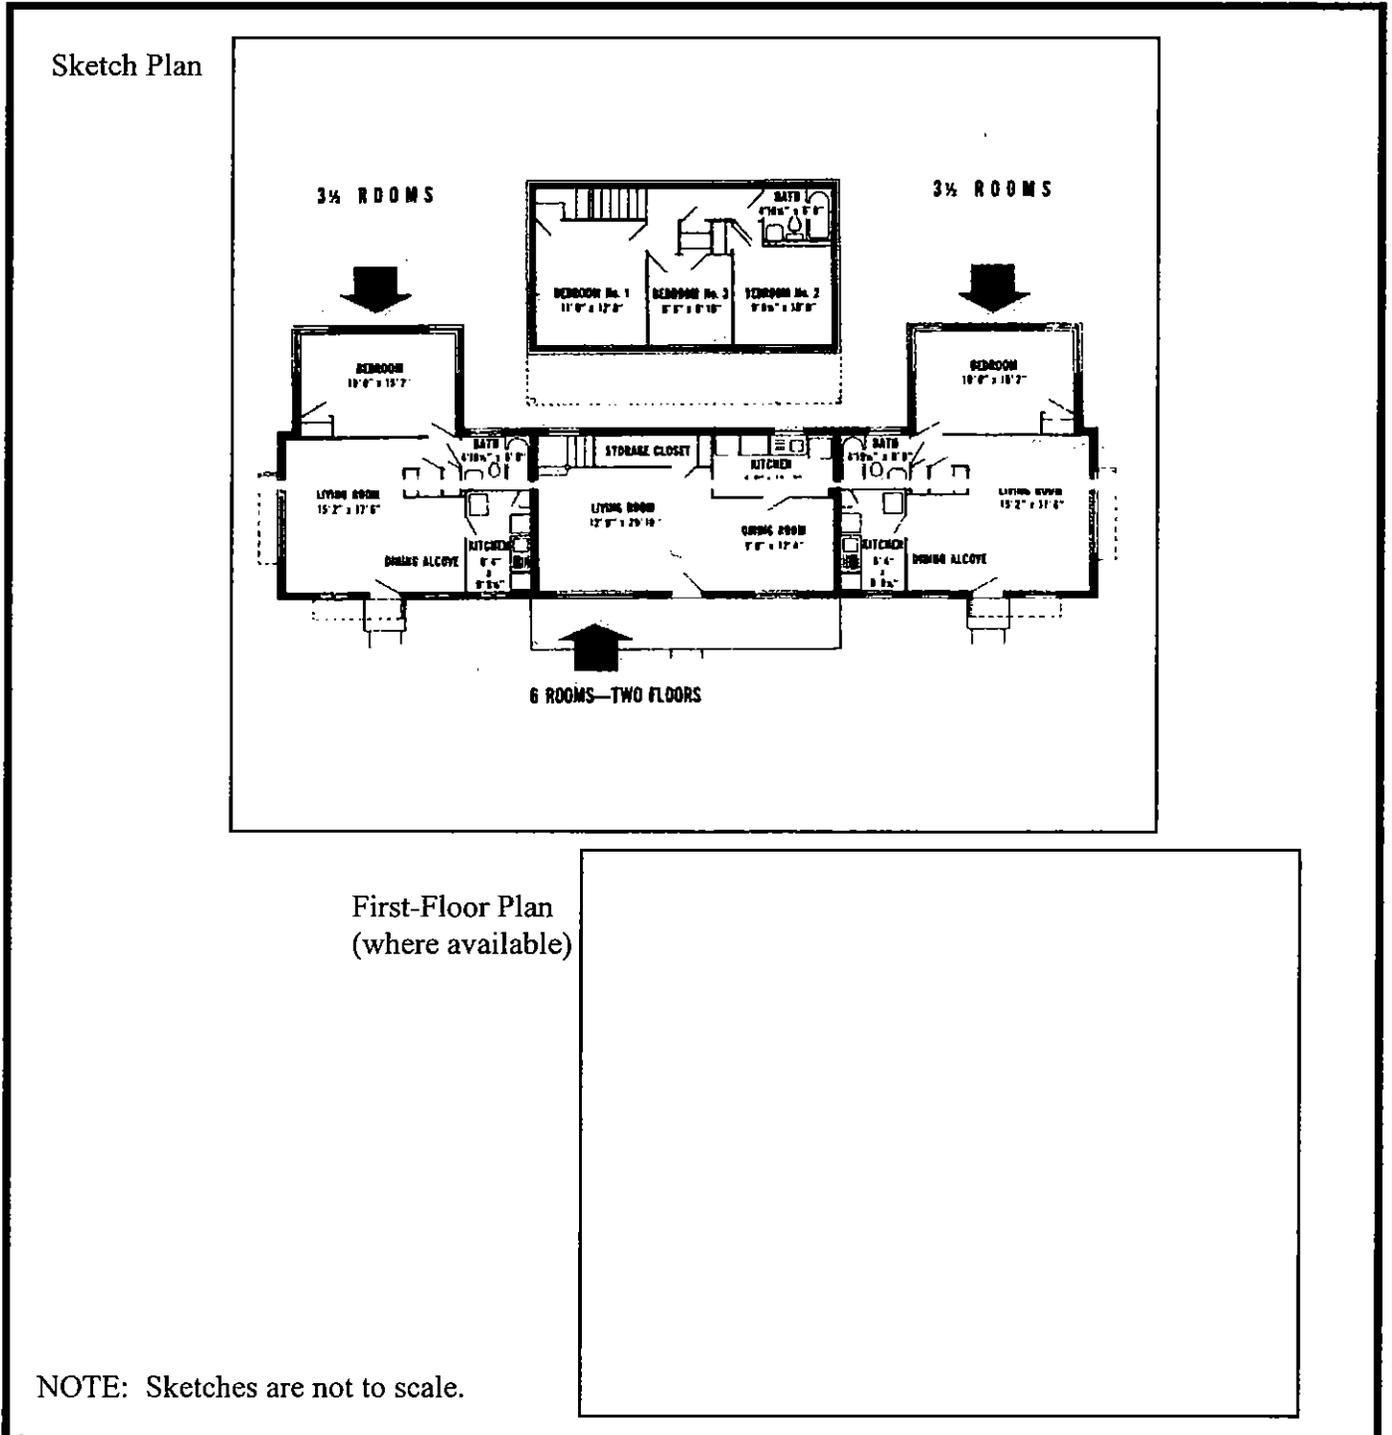

4. SITE PLAN:

CRS # N14270 .040


INDICATE NORTH ON PLAN

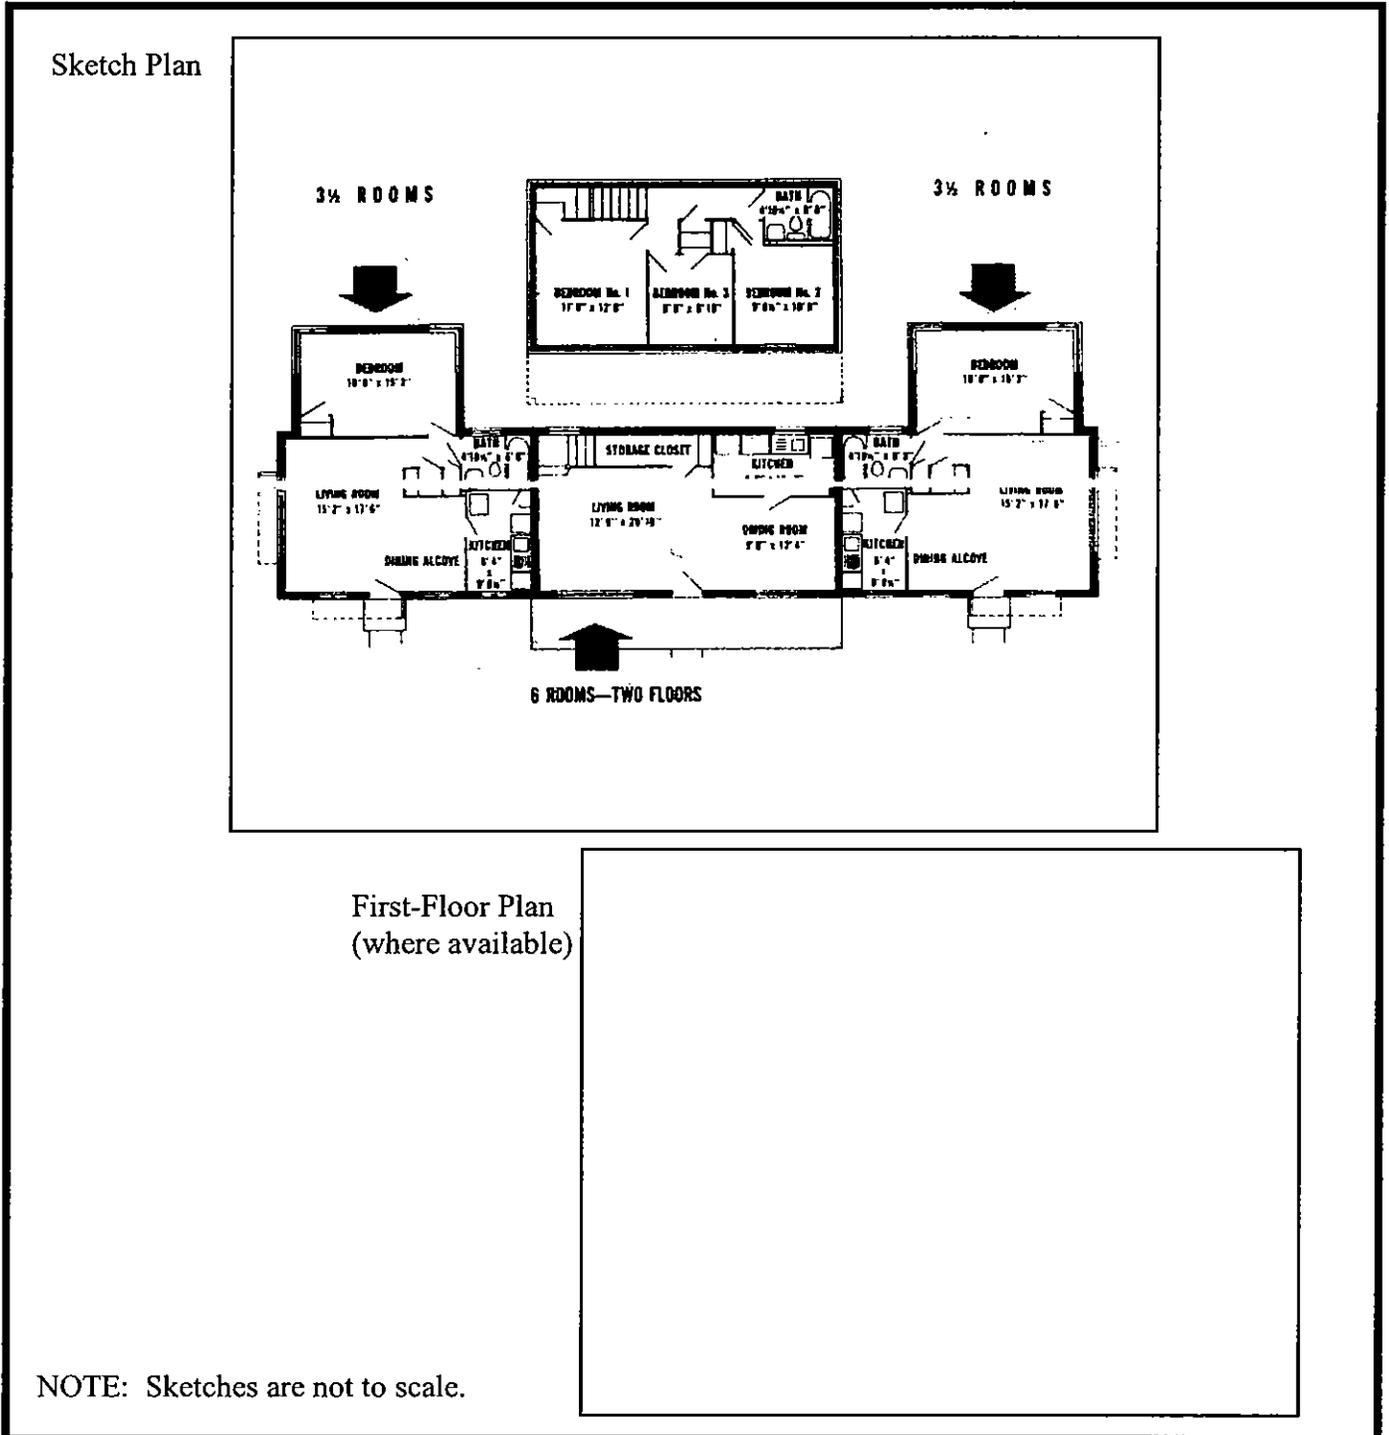

4. SITE PLAN:

CRS # N14270 .041


INDICATE NORTH ON PLAN

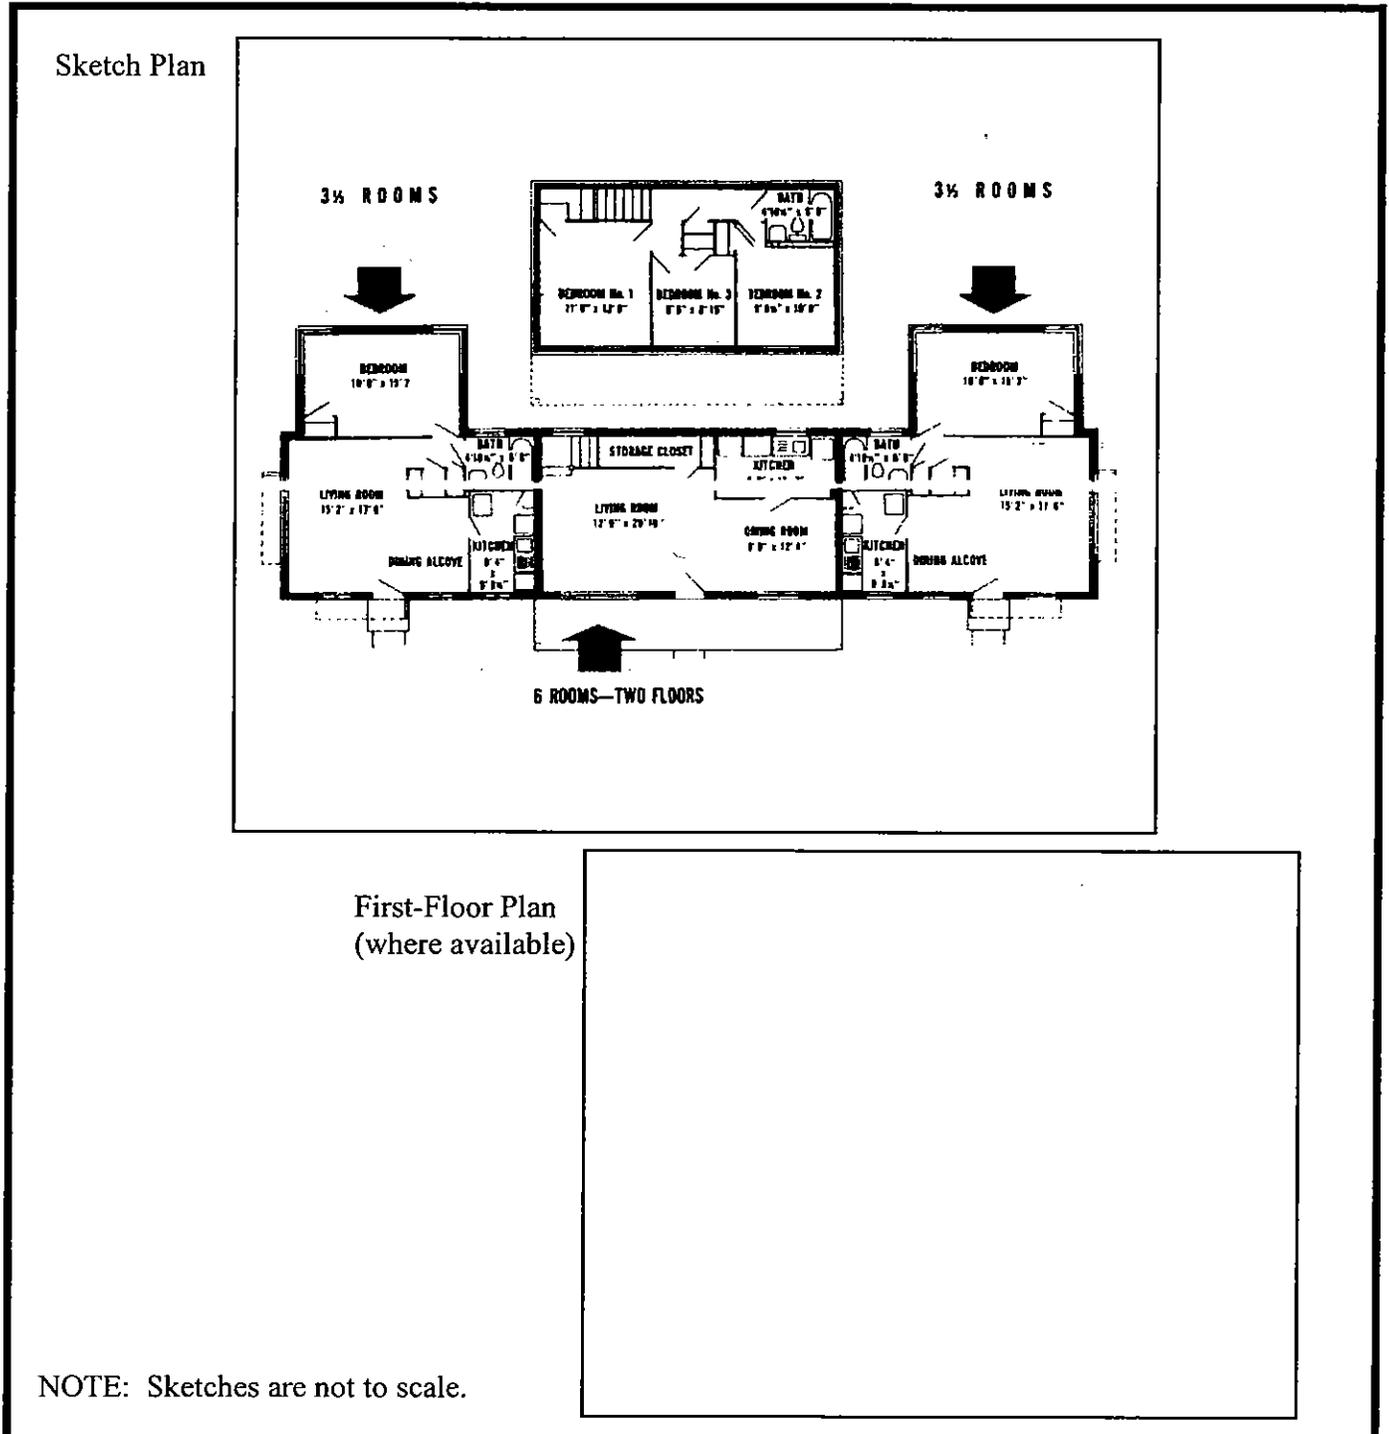

4. SITE PLAN:

CRS # N14270 .042

INDICATE NORTH ON PLAN

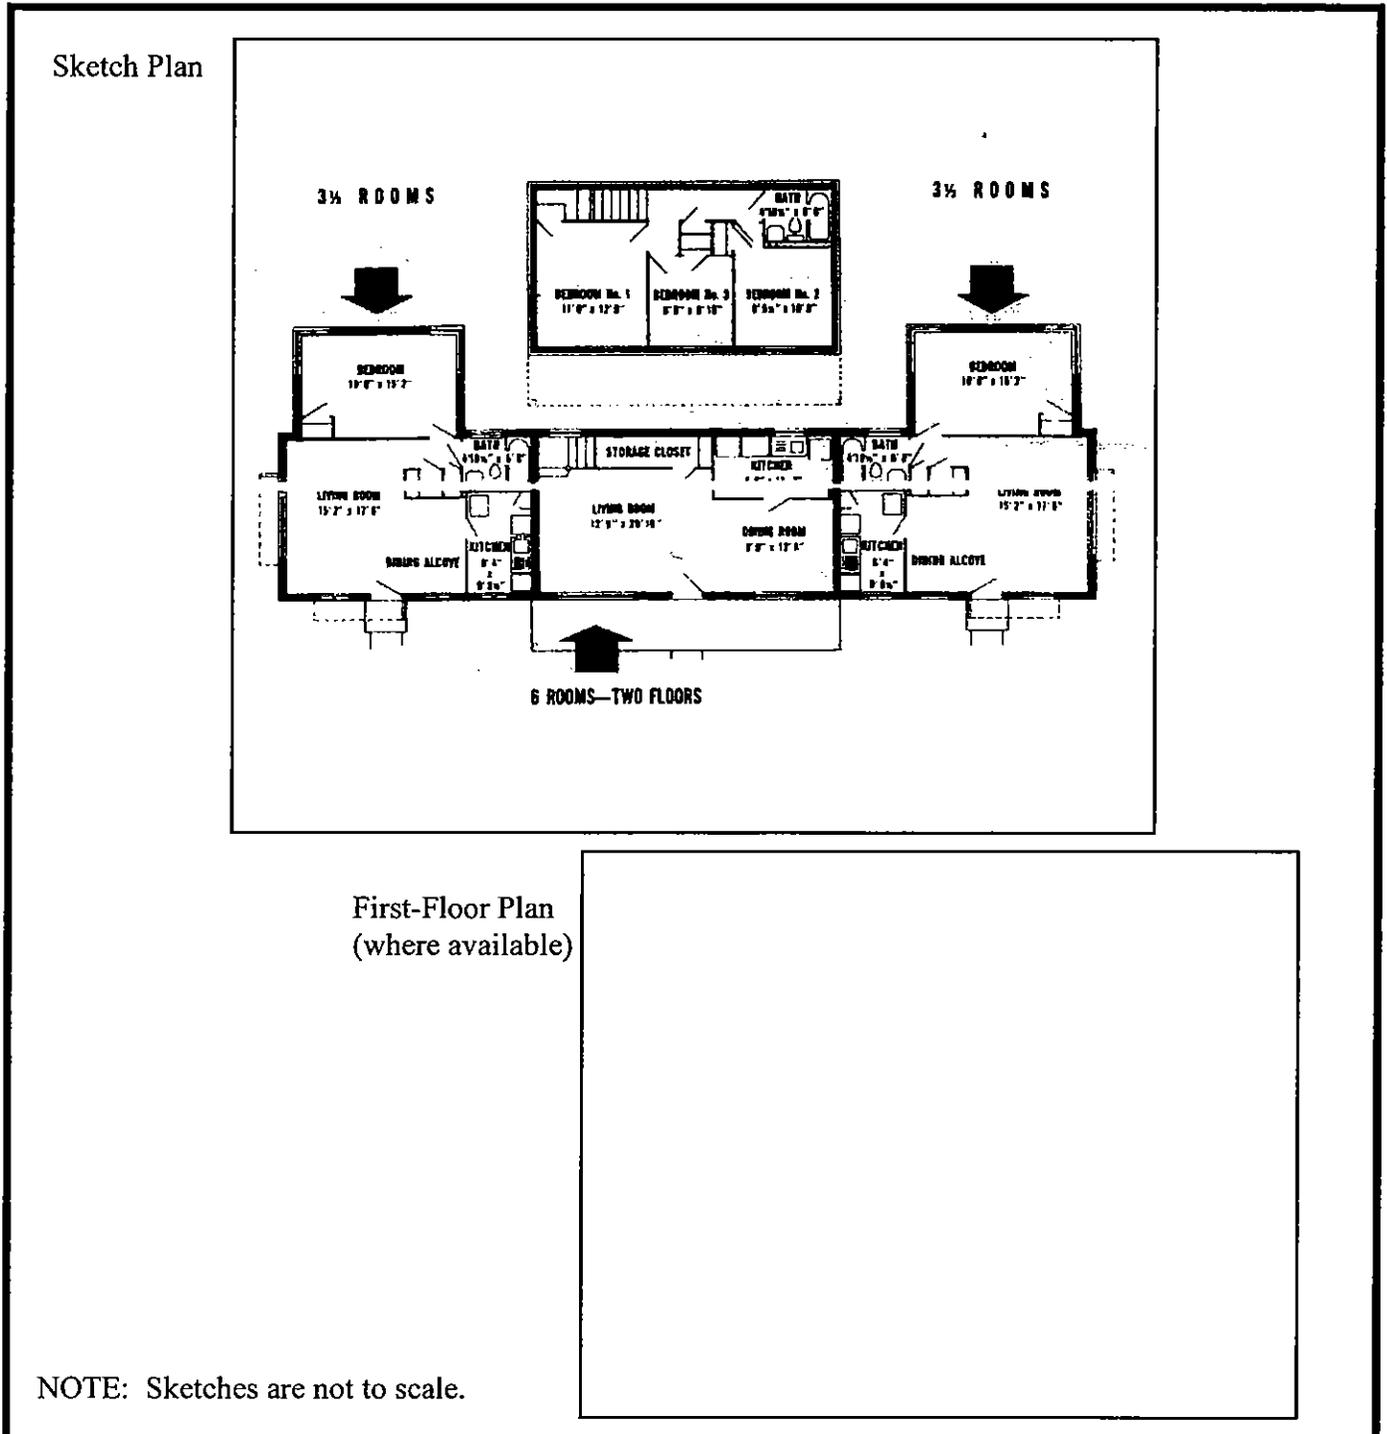



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .043


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)


INDICATE NORTH ON SKETCH

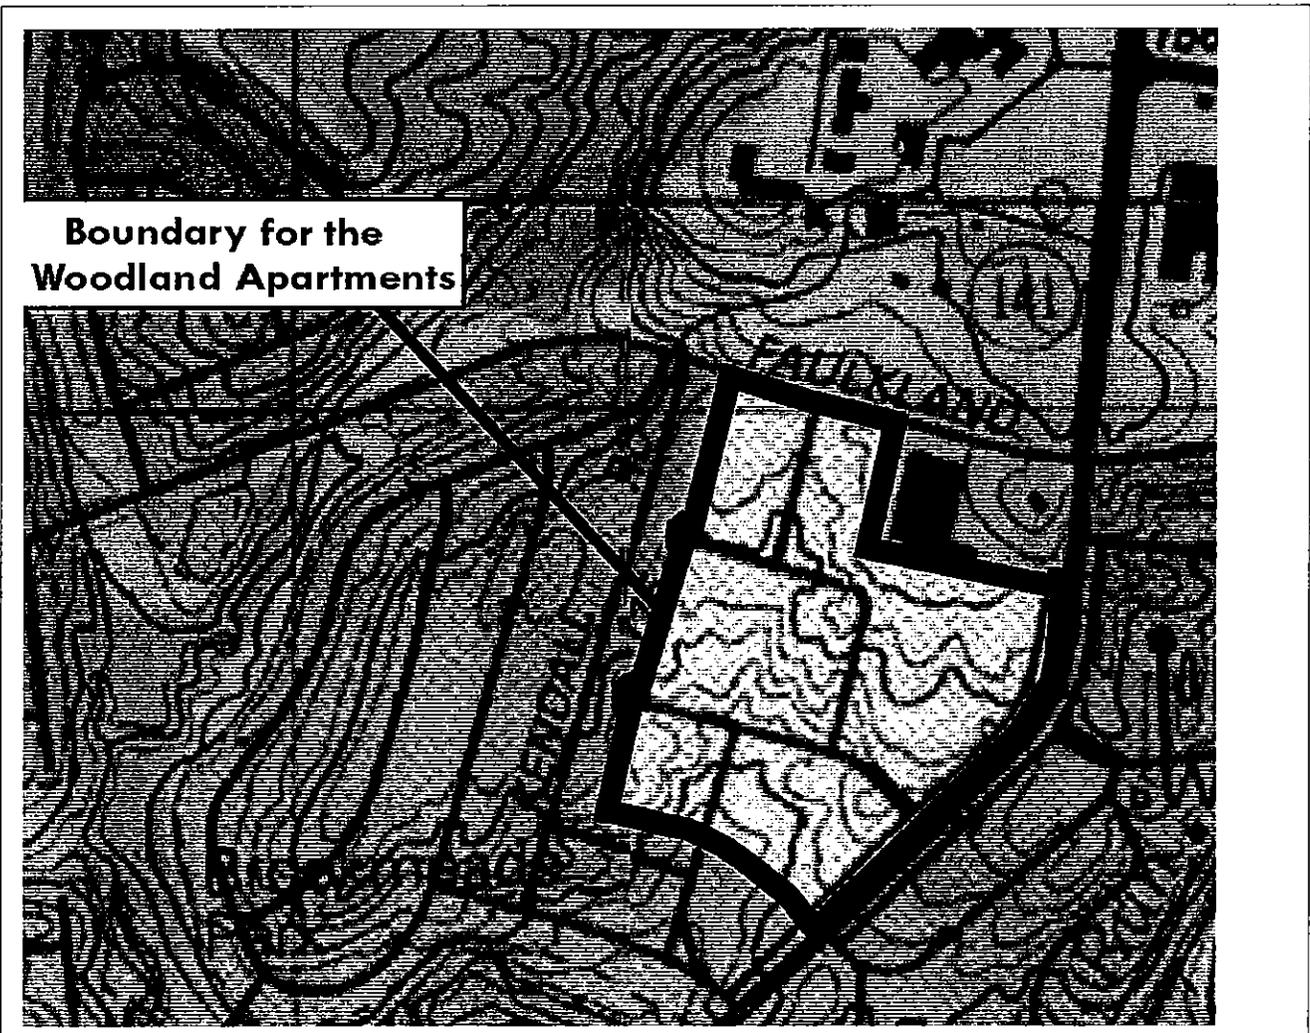

4. SITE PLAN:

CRS # N14270 .043

INDICATE NORTH ON PLAN

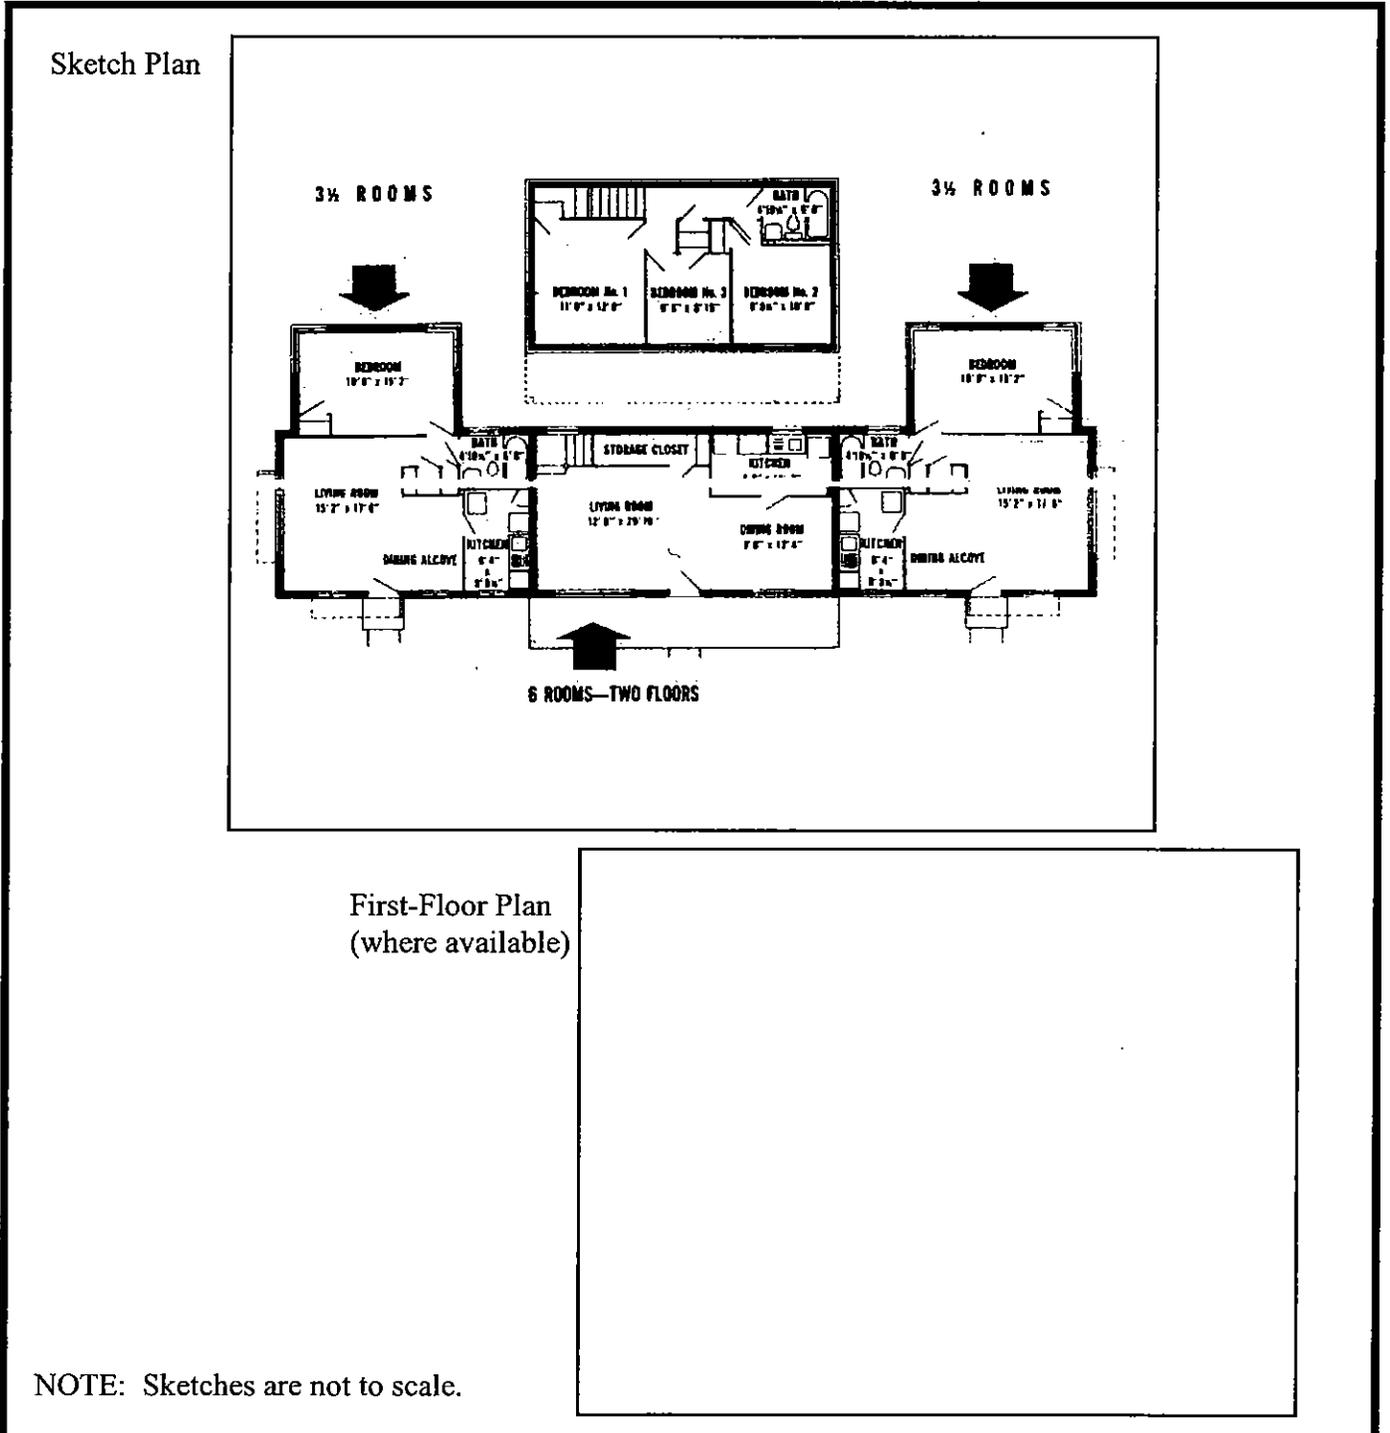



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .044


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)


INDICATE NORTH ON SKETCH

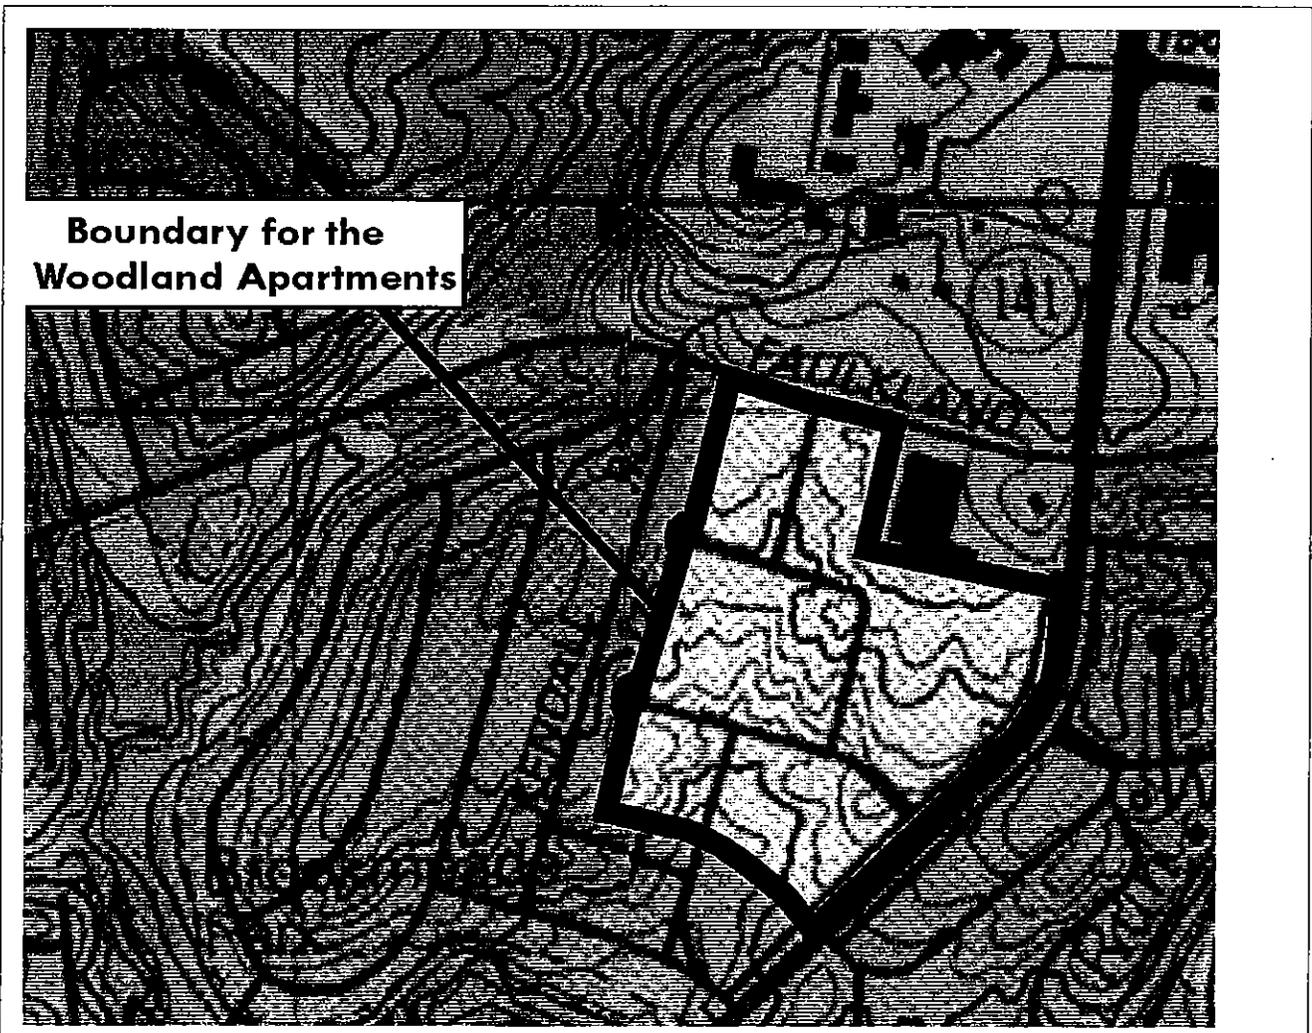


4. SITE PLAN:

CRS # N14270 .044

INDICATE NORTH ON PLAN

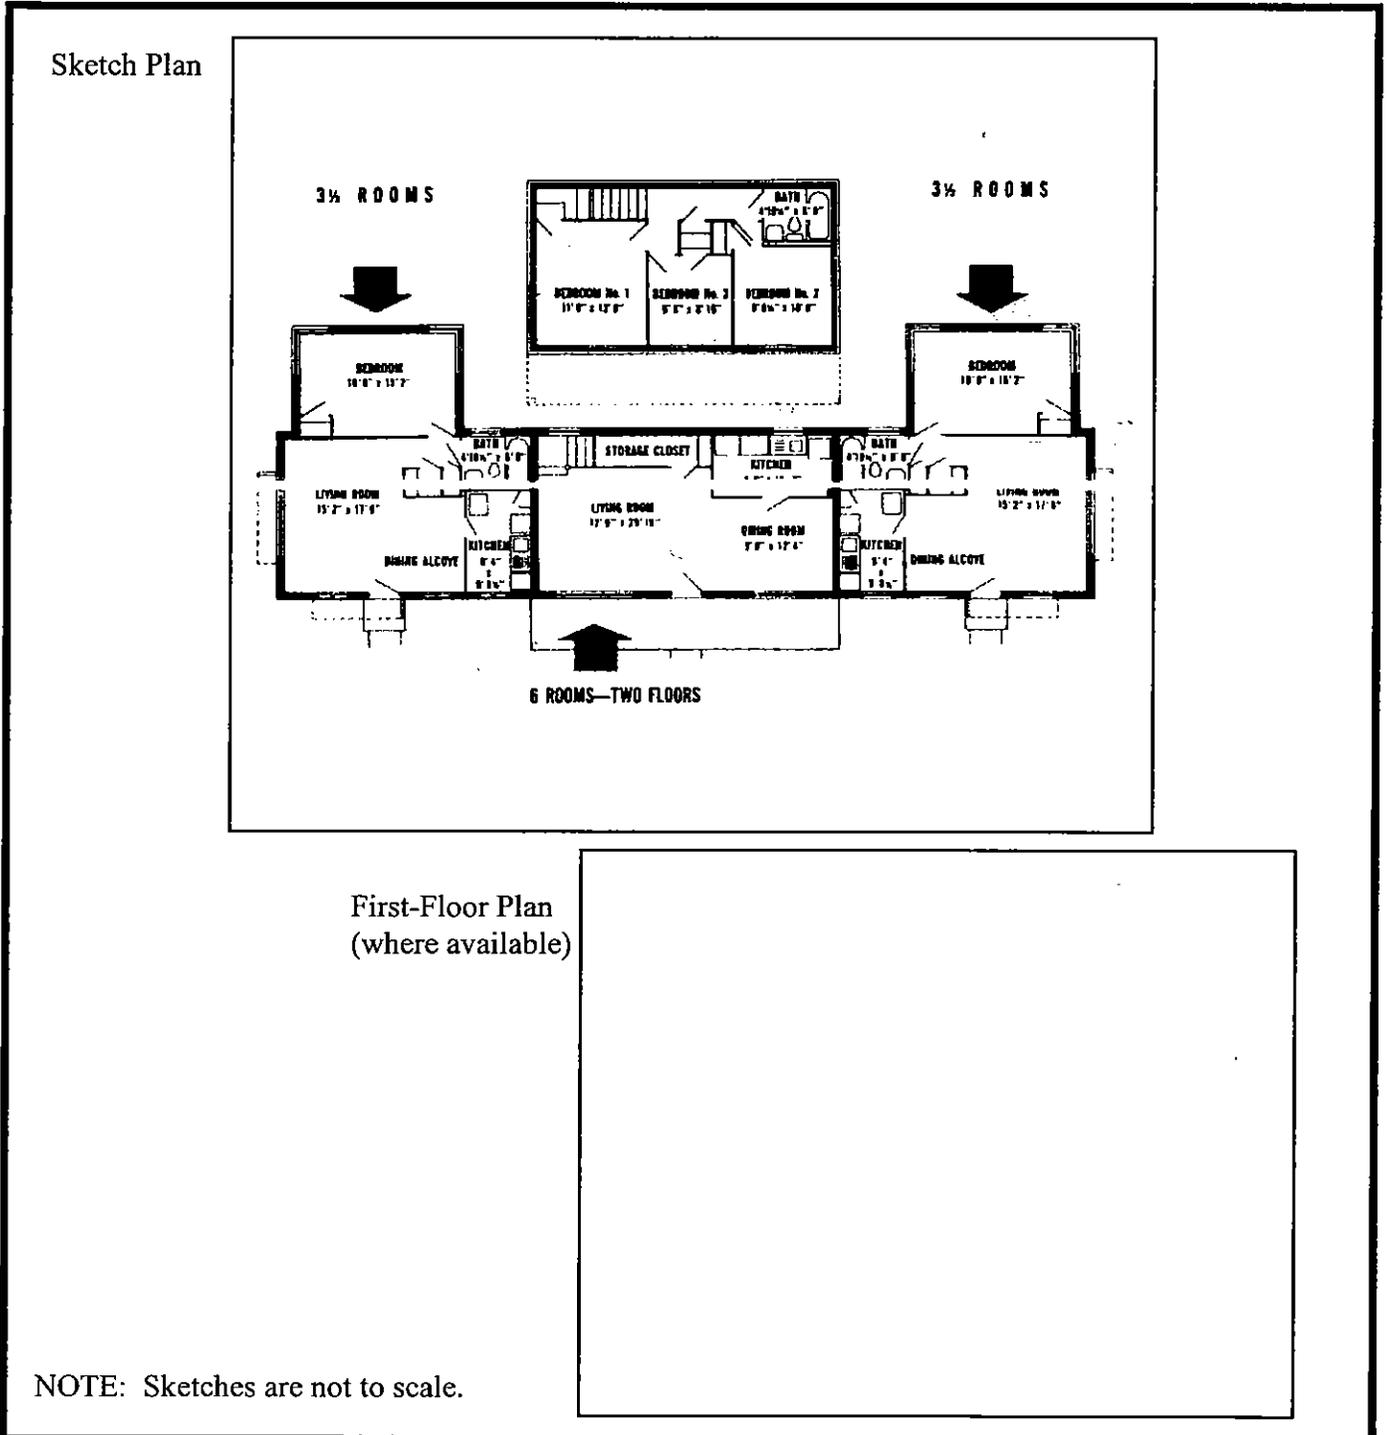

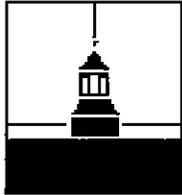

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .045


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)


INDICATE NORTH ON SKETCH

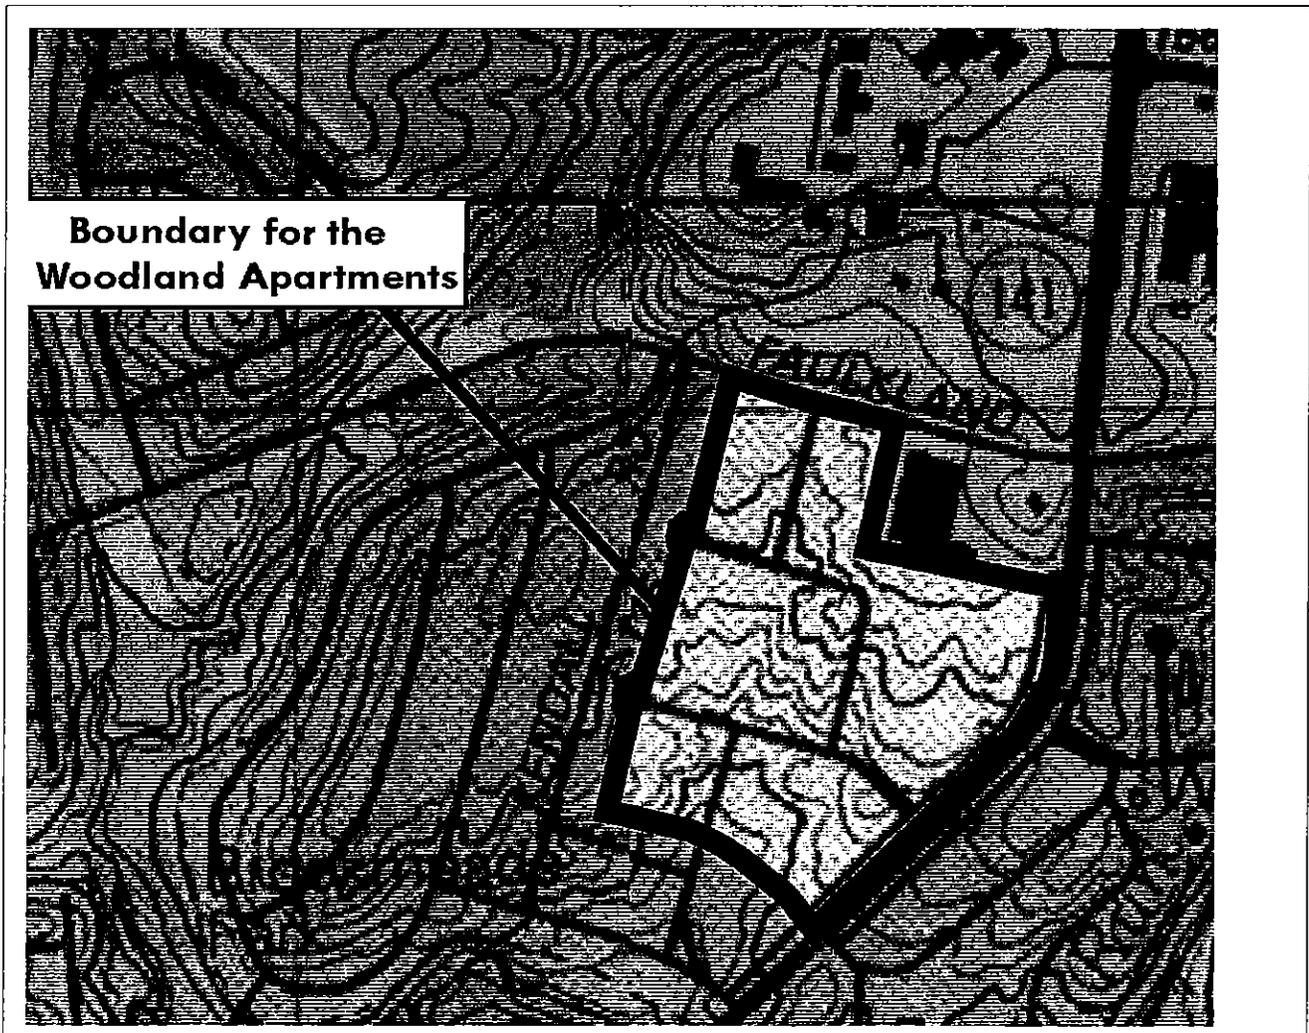

4. SITE PLAN:

CRS # N14270 .045

INDICATE NORTH ON PLAN

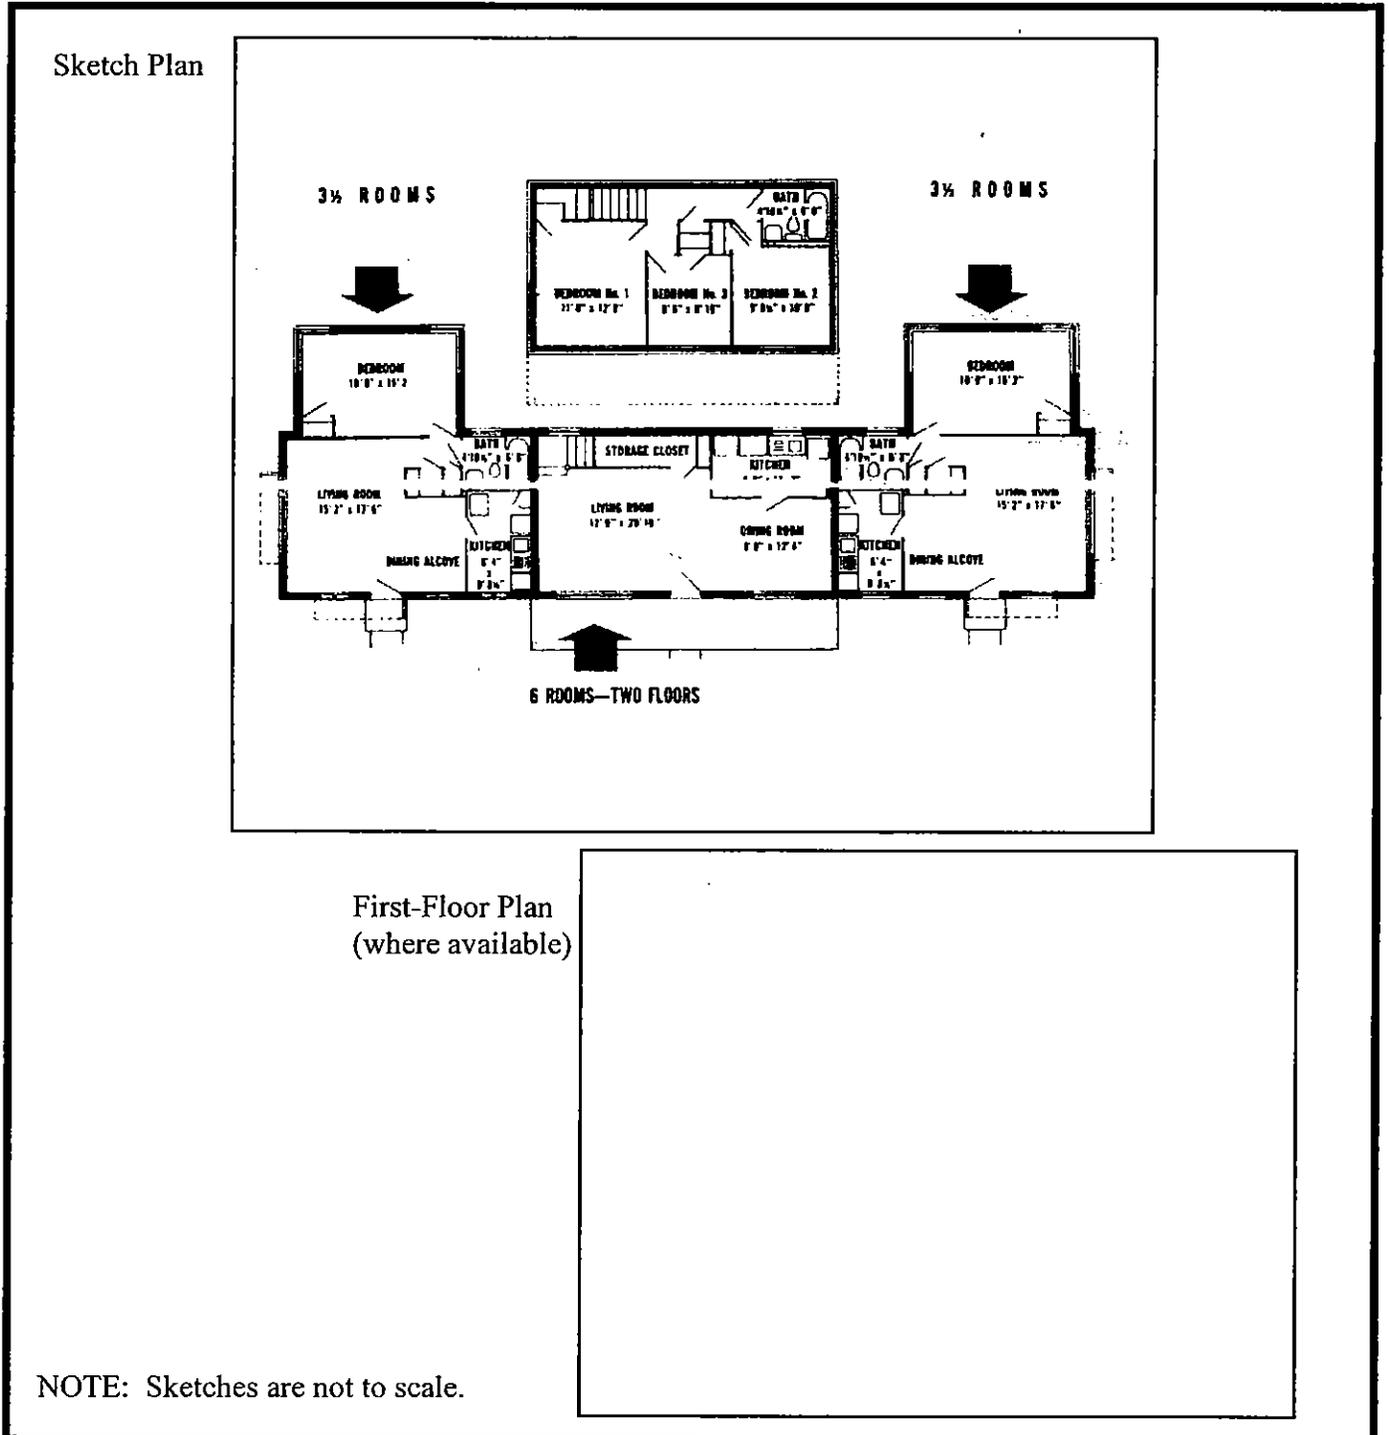



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .046

1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)


INDICATE NORTH ON SKETCH



4. SITE PLAN:

CRS # N14270 .046

INDICATE NORTH ON PLAN

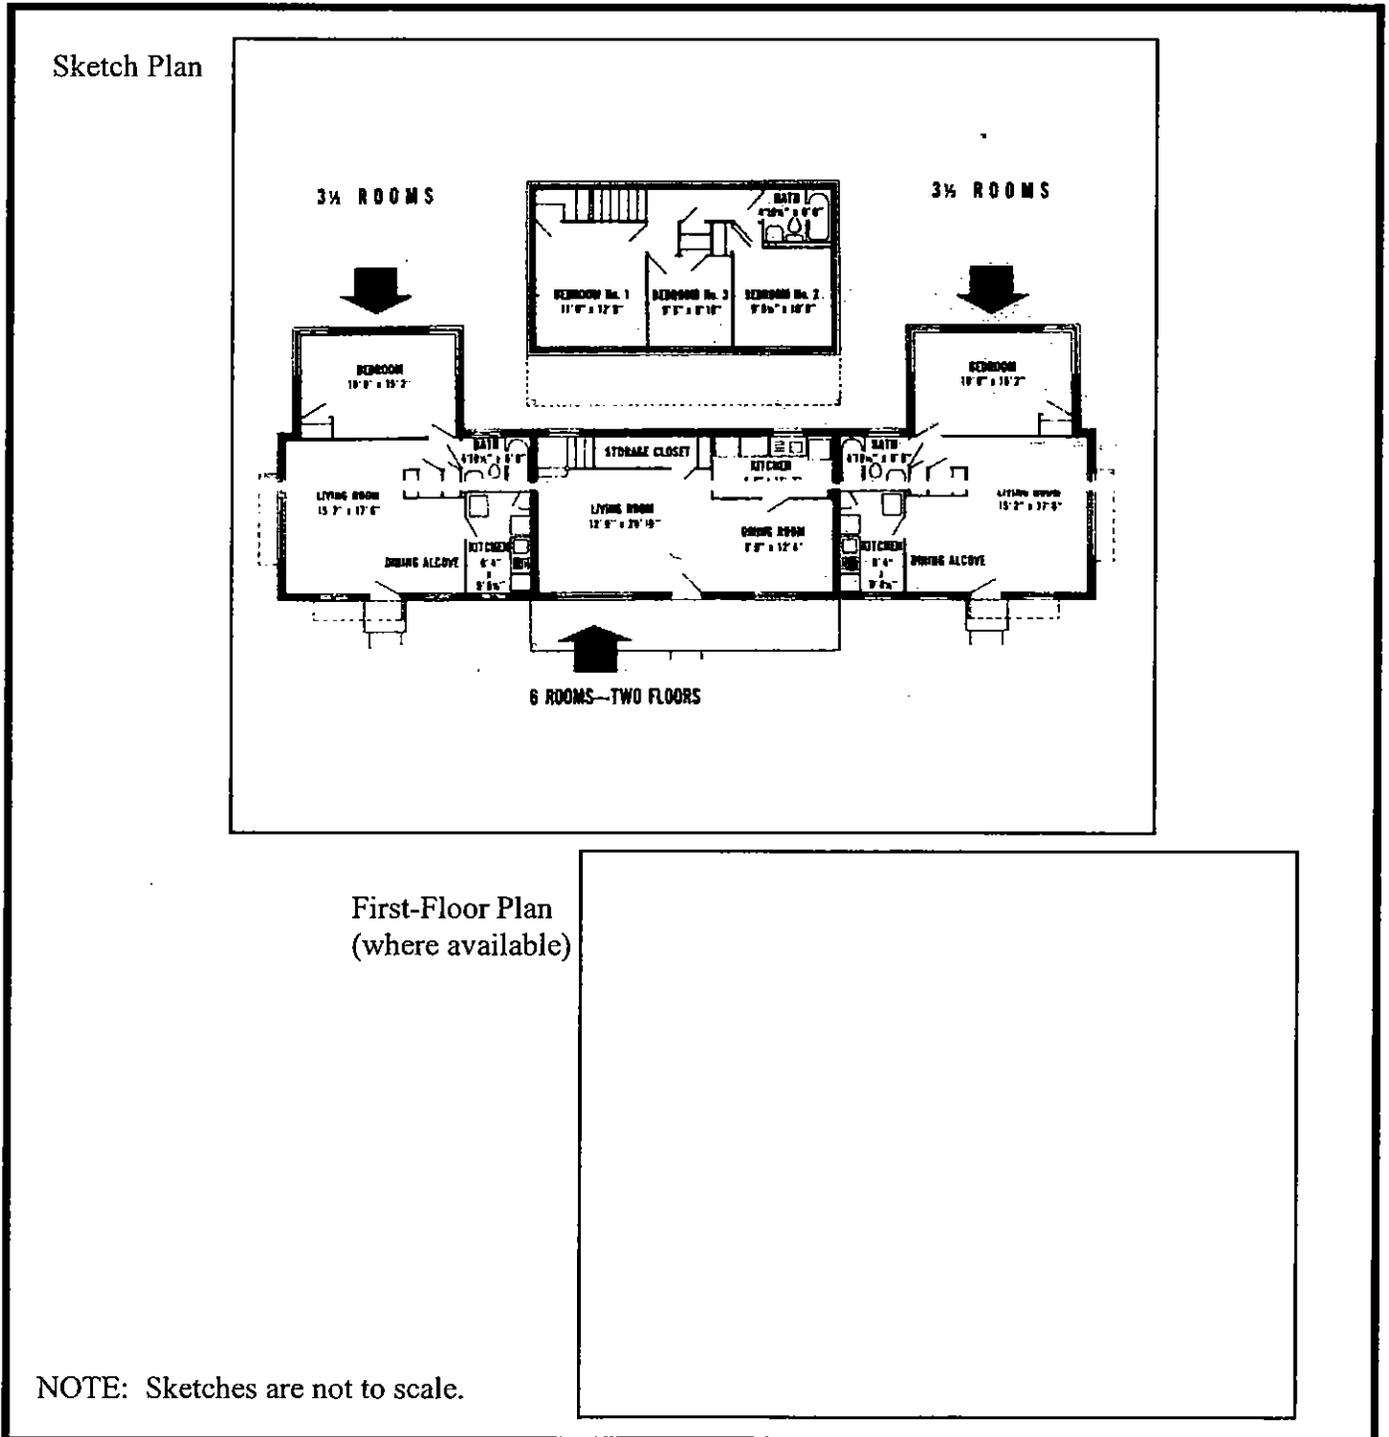



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .047


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

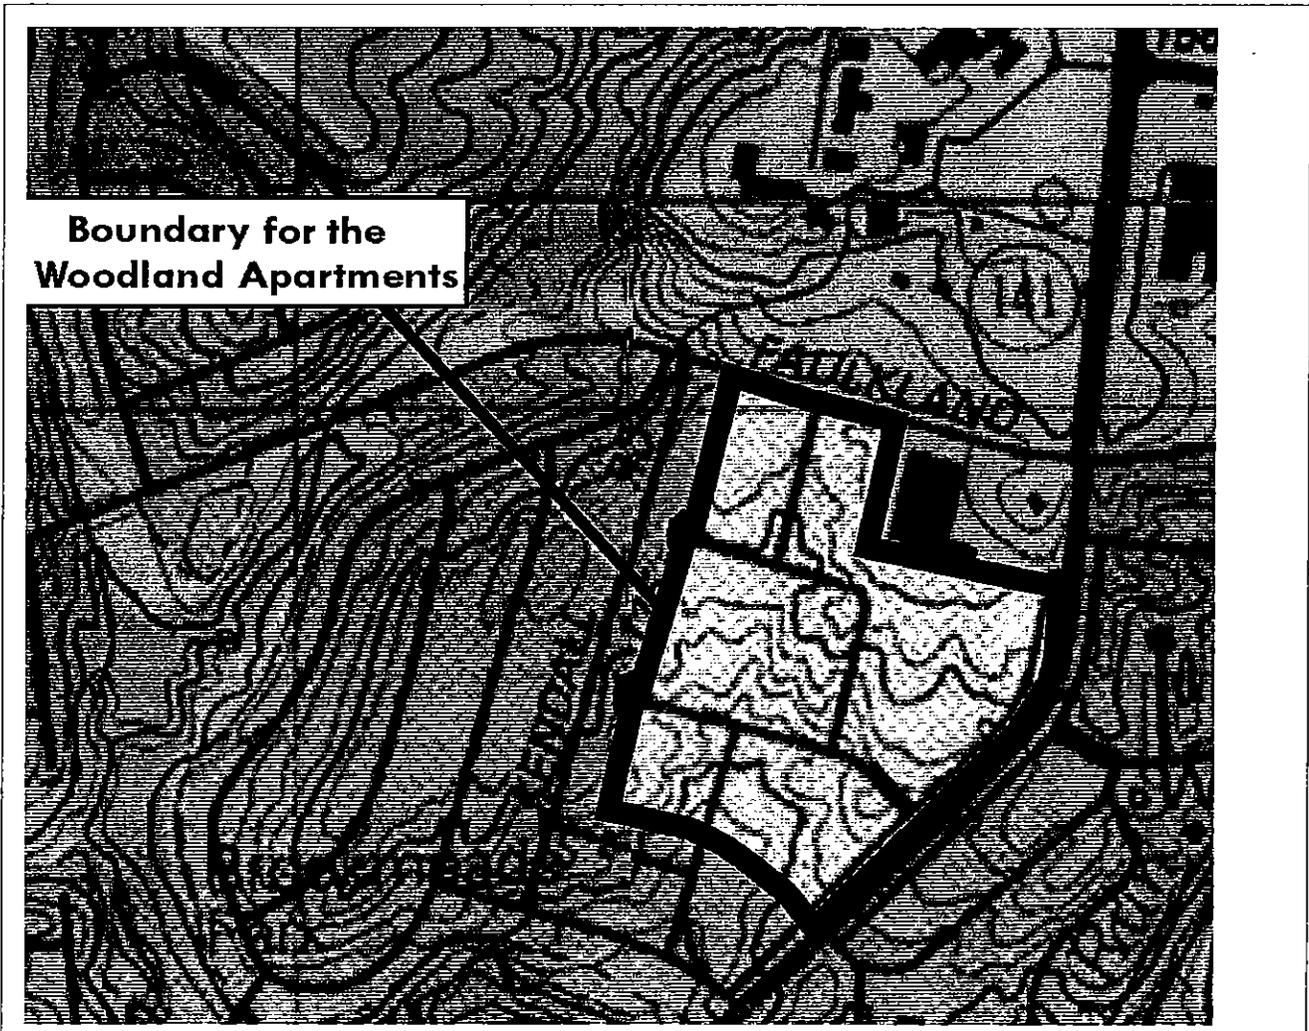


4. SITE PLAN:

CRS # N14270 .047


INDICATE NORTH ON PLAN

Sketch Plan

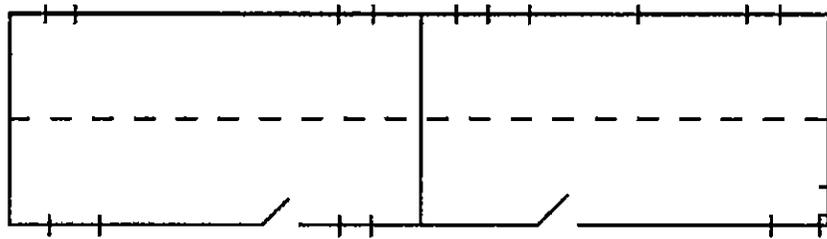

not to scale

First-Floor Plan
(where available)

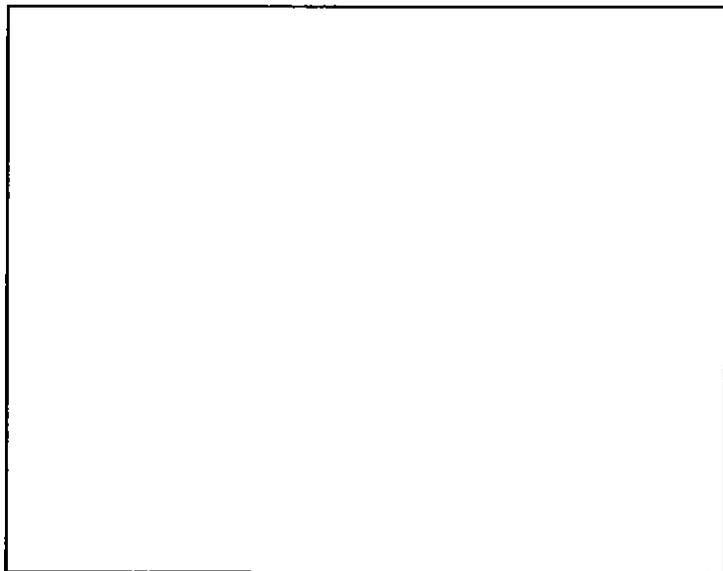


NOTE: Sketches are not to scale.

4. SITE PLAN:


CRS # N14270 .048

INDICATE NORTH ON PLAN


Sketch Plan

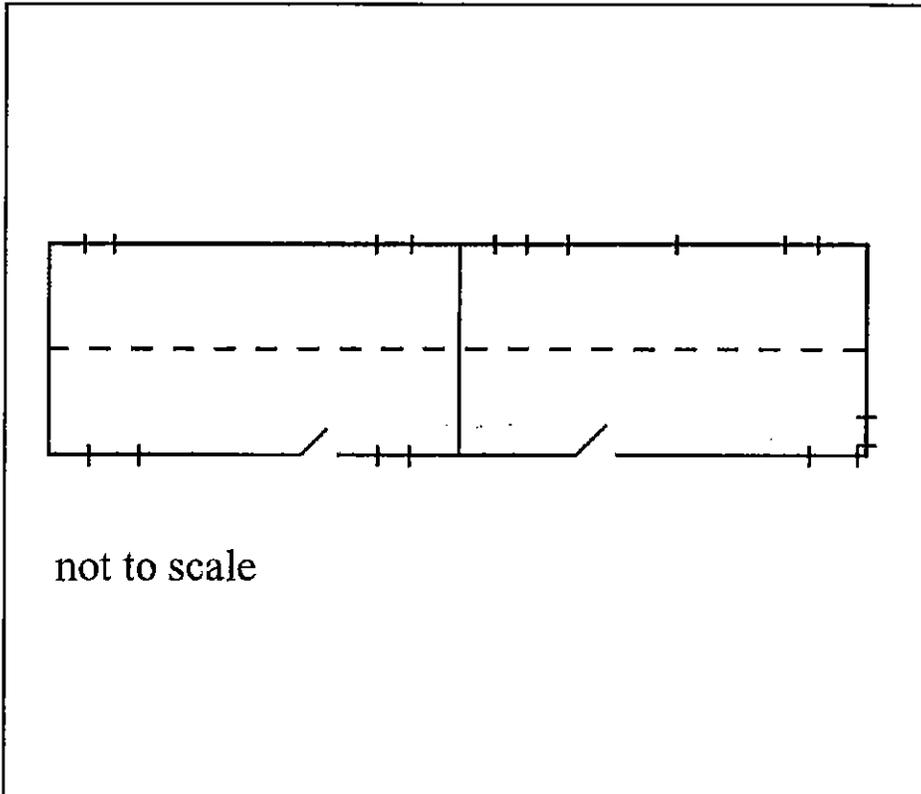

First-Floor Plan
(where available)

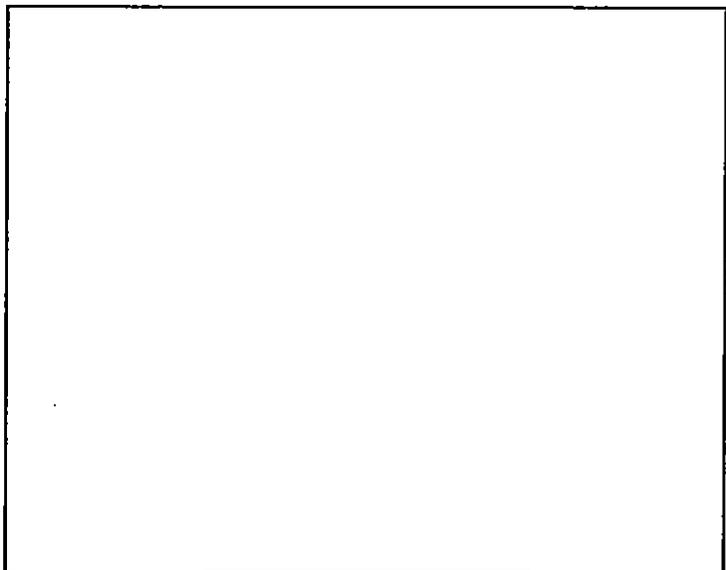

NOTE: Sketches are not to scale.

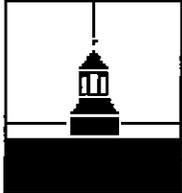

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .049


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

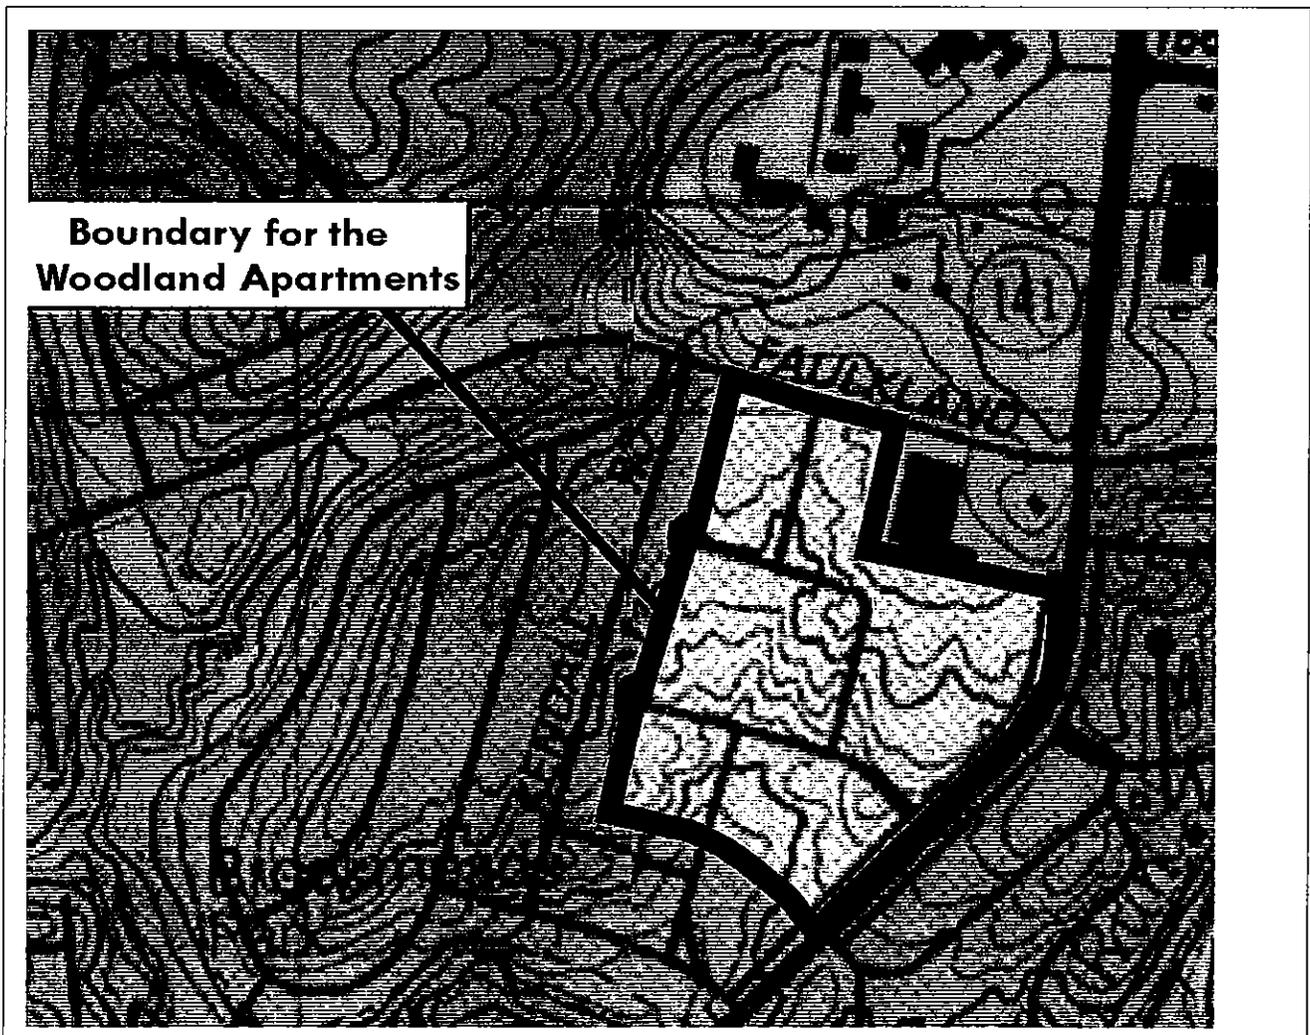


4. SITE PLAN:

CRS # N14270 .049

INDICATE NORTH ON PLAN


Sketch Plan

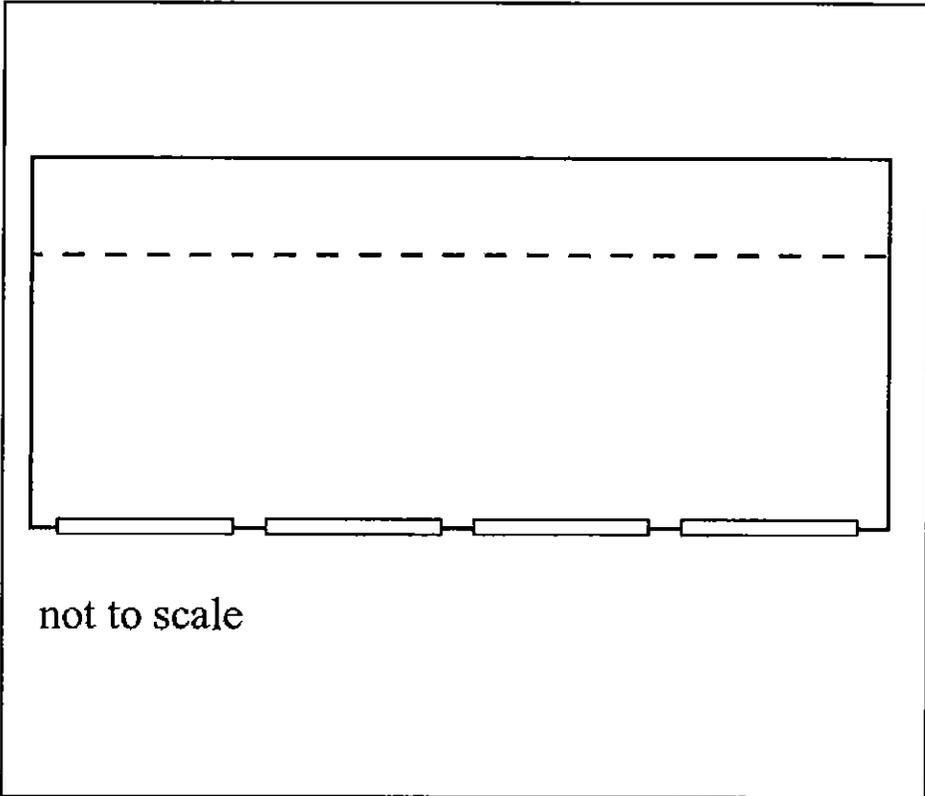

not to scale

First-Floor Plan
(where available)

NOTE: Sketches are not to scale.

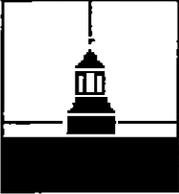

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .050


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

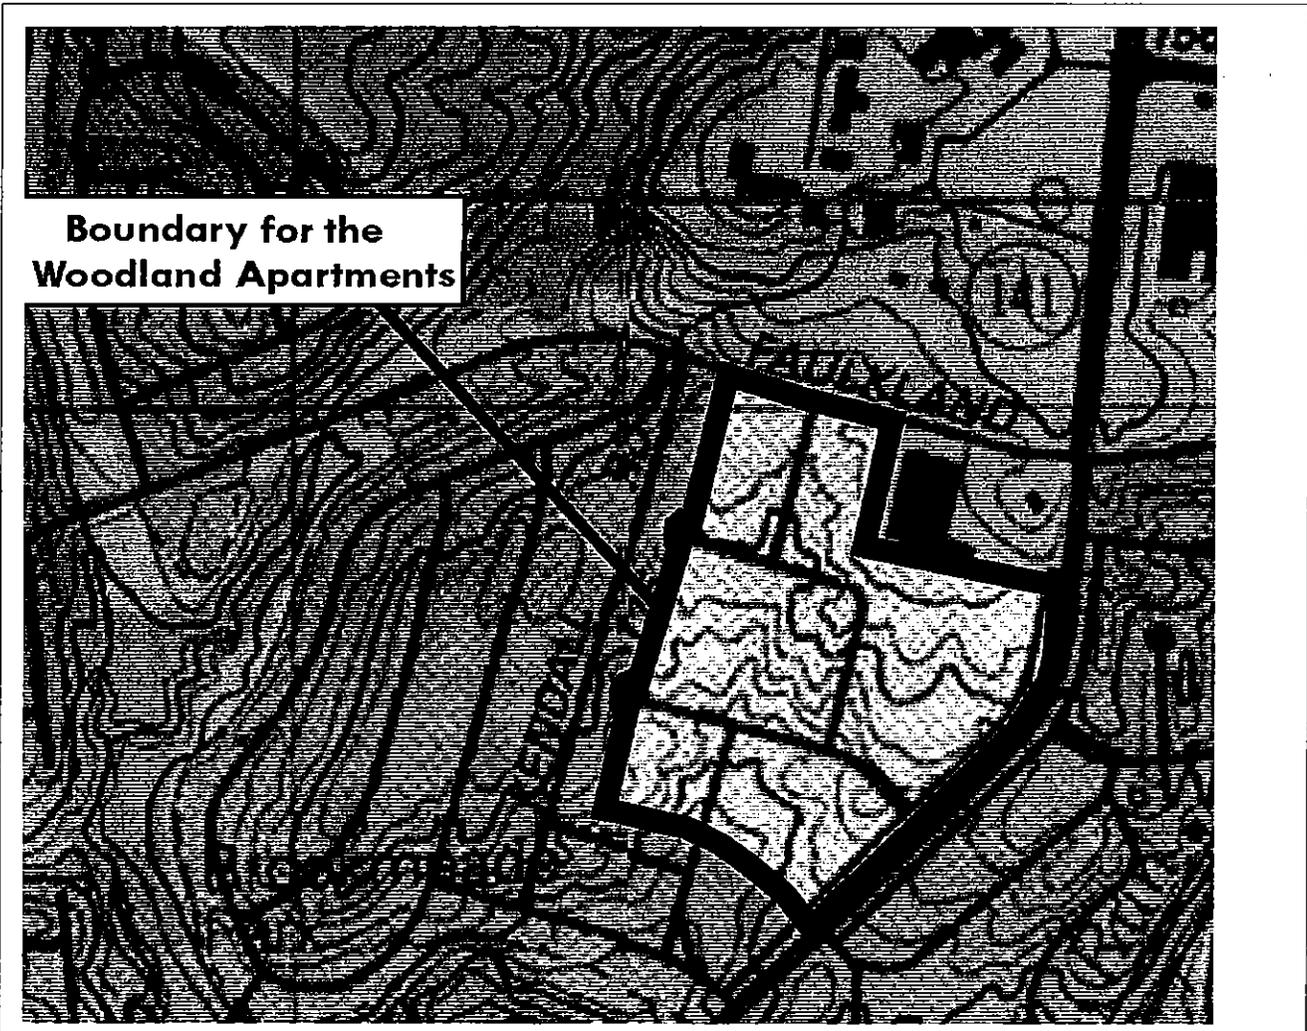


4. SITE PLAN:

CRS # N14270 .050

INDICATE NORTH ON PLAN


Sketch Plan

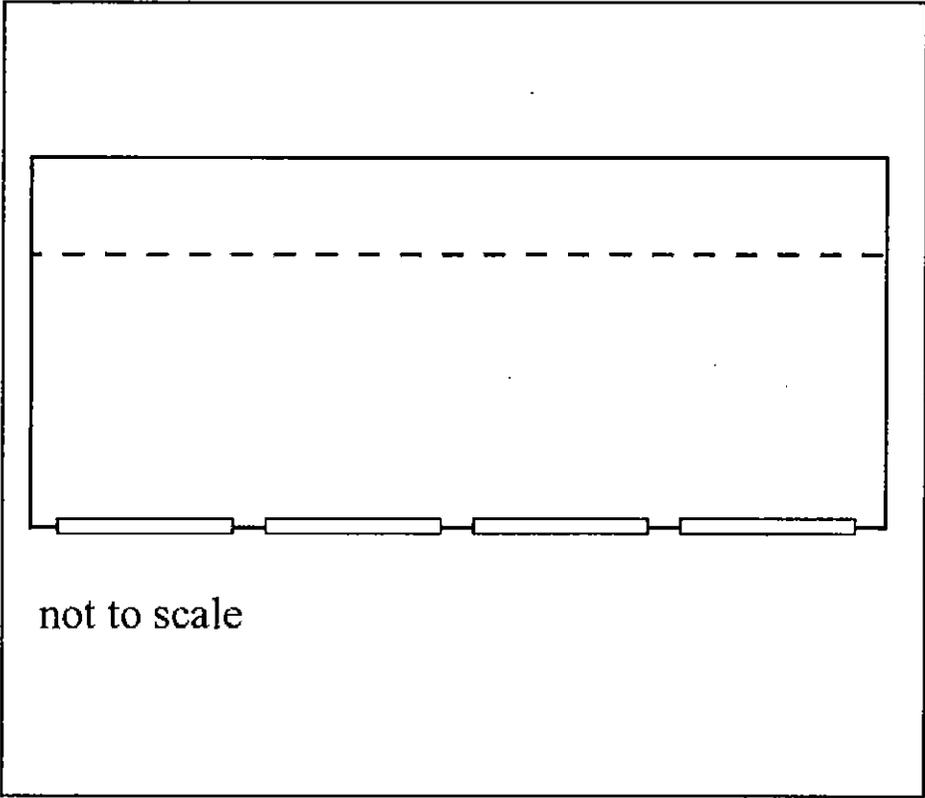

not to scale

First-Floor Plan
(where available)

NOTE: Sketches are not to scale.

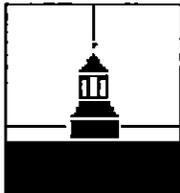

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .051


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

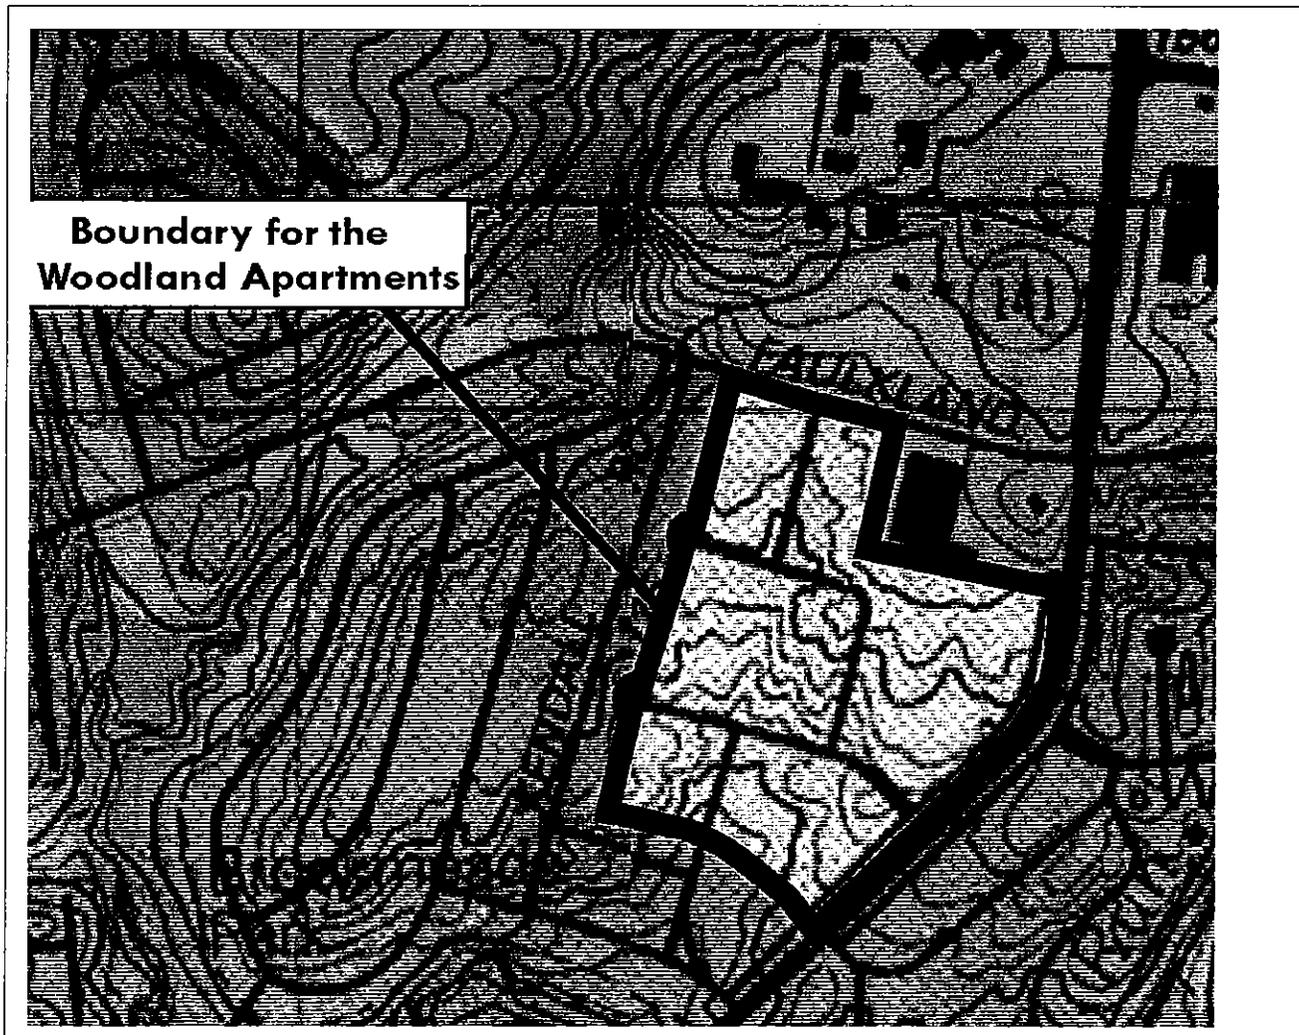


4. SITE PLAN:

CRS # N14270 .051


INDICATE NORTH ON PLAN

Sketch Plan

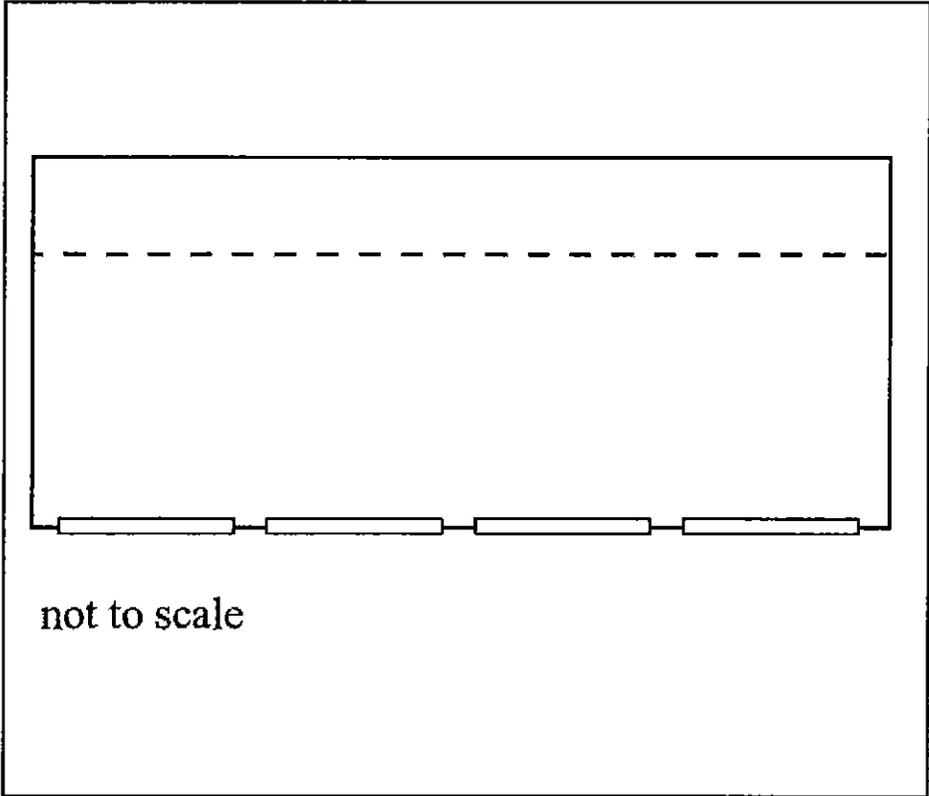


not to scale

First-Floor Plan
(where available)

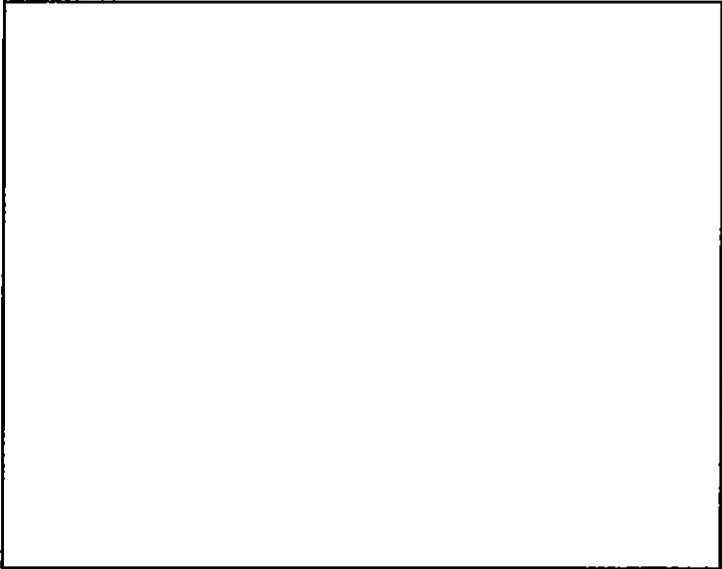

NOTE: Sketches are not to scale.

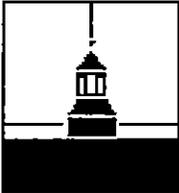

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .052


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

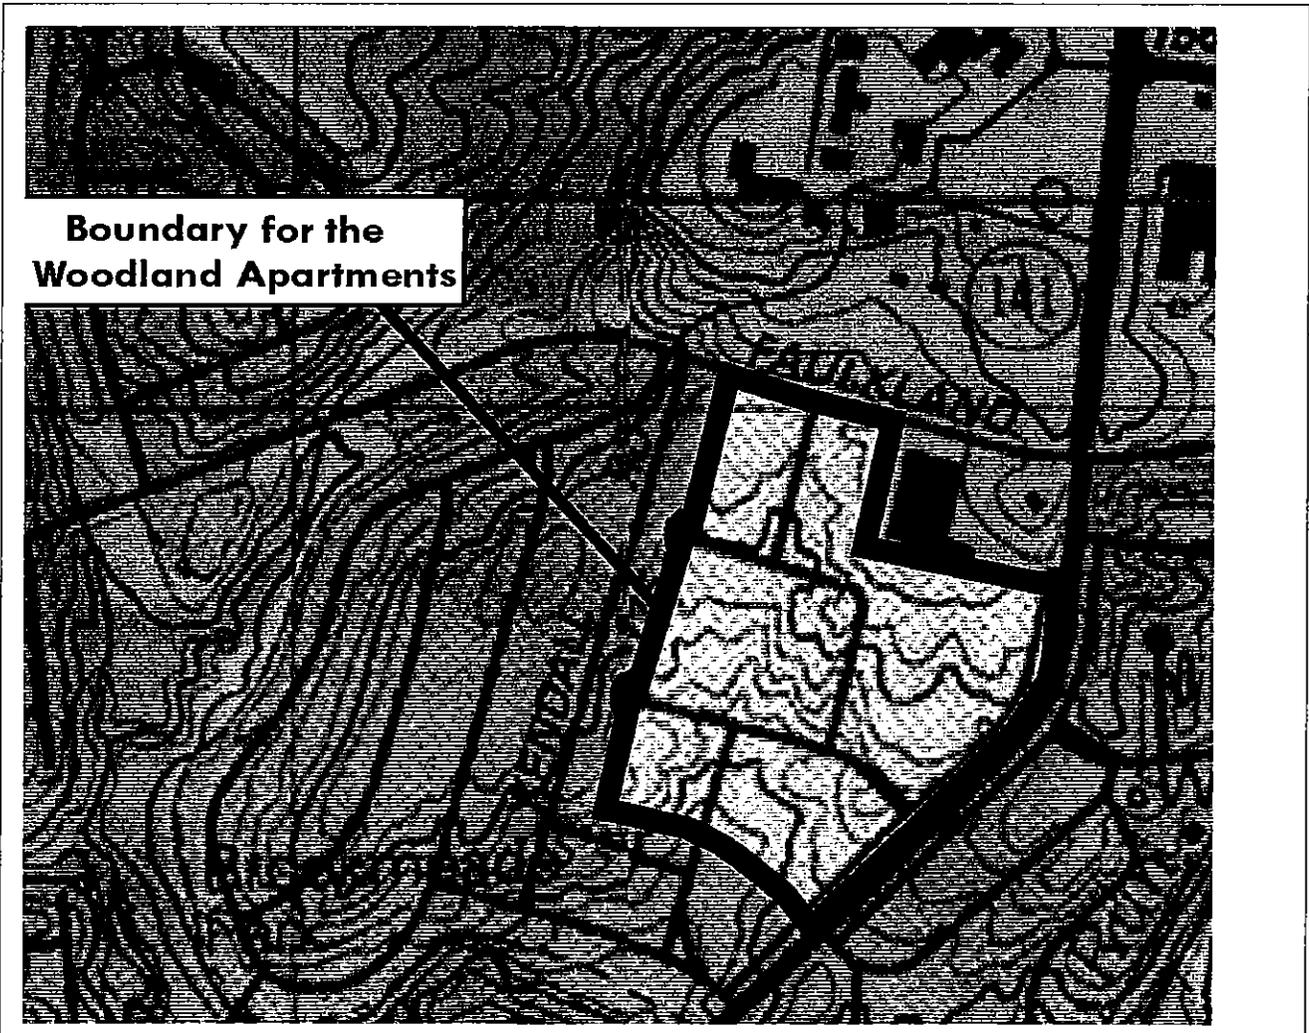


4. SITE PLAN:

CRS # N14270 .052


INDICATE NORTH ON PLAN

Sketch Plan

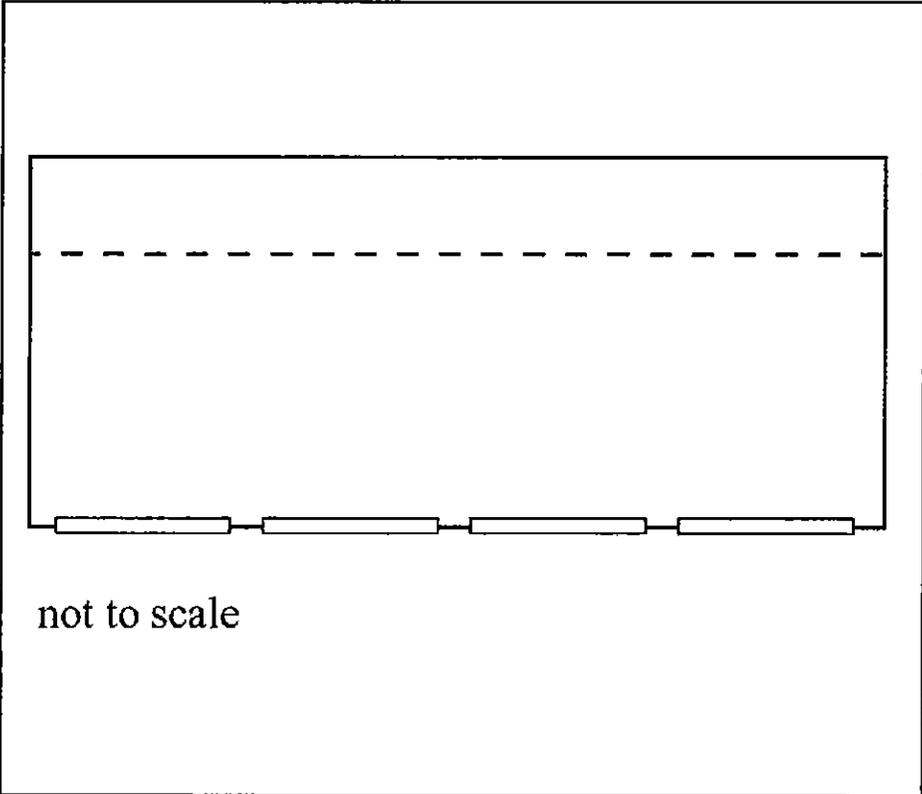

not to scale

First-Floor Plan
(where available)

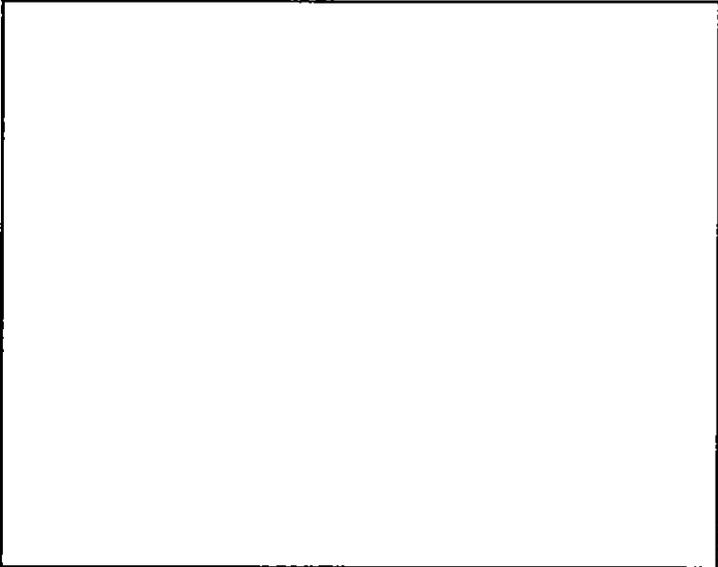


NOTE: Sketches are not to scale.

4. SITE PLAN:

CRS # N14270.053


INDICATE NORTH ON PLAN

Sketch Plan

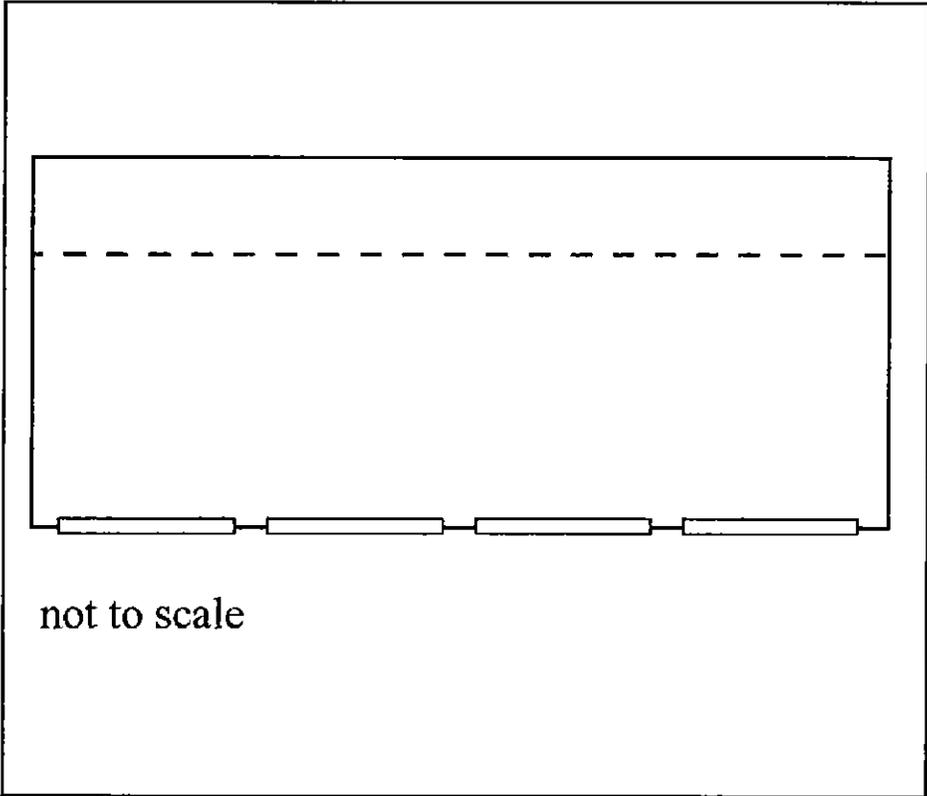


not to scale

First-Floor Plan
(where available)

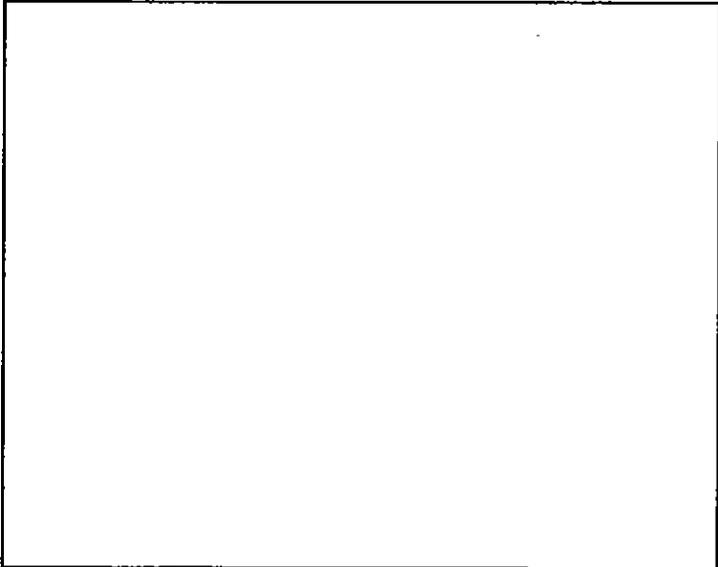

NOTE: Sketches are not to scale.

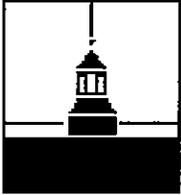

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .054


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

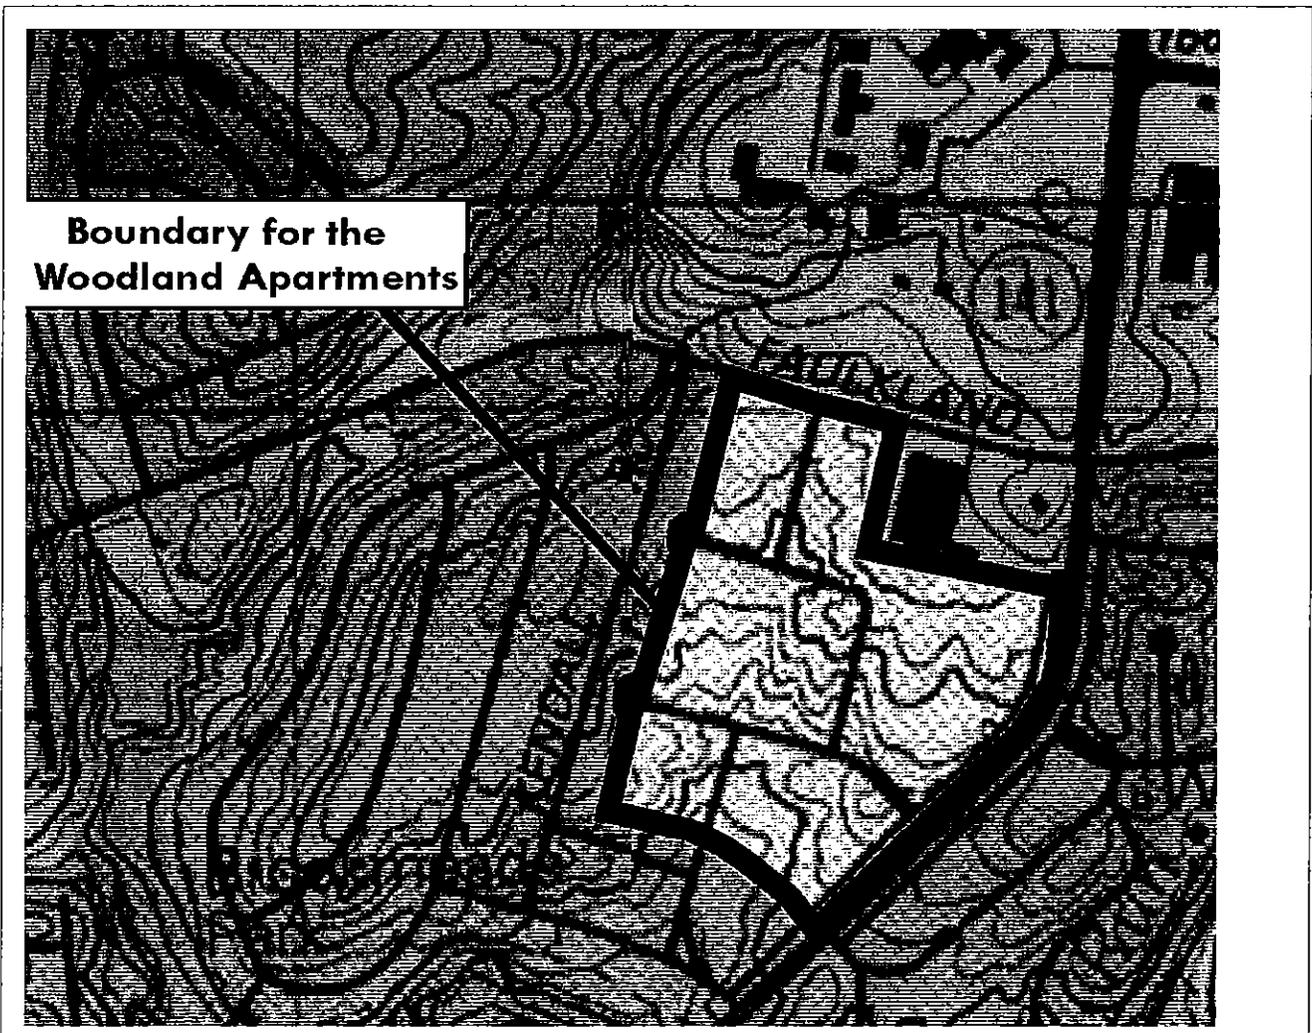


4. SITE PLAN:

CRS # N14270 .054


INDICATE NORTH ON PLAN

Sketch Plan

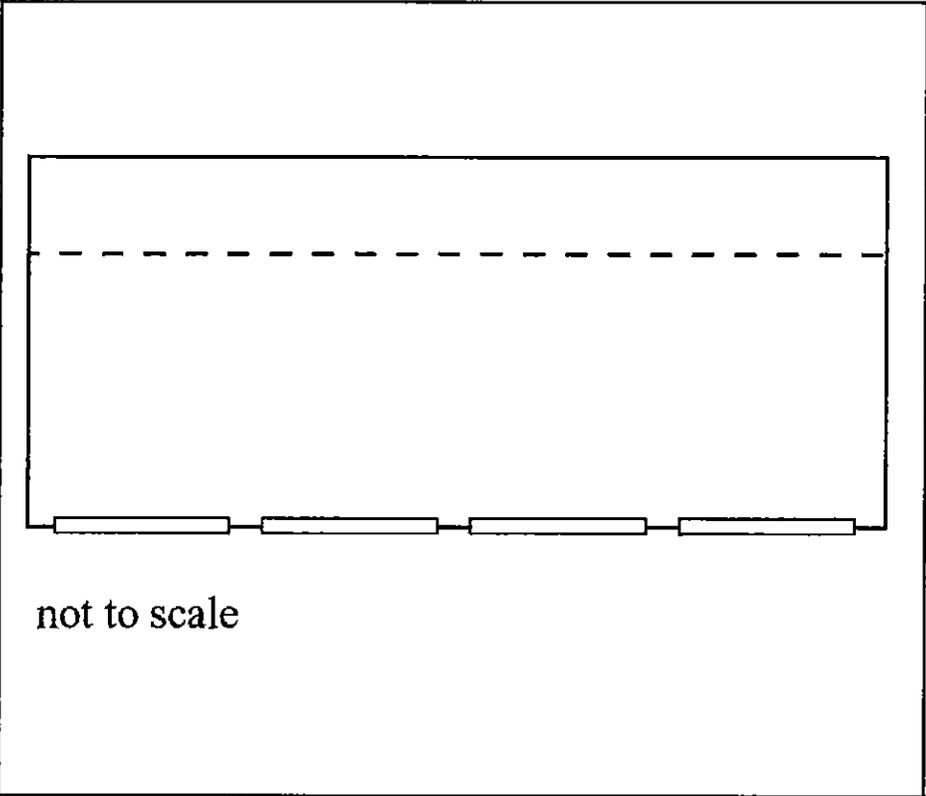


not to scale

First-Floor Plan
(where available)

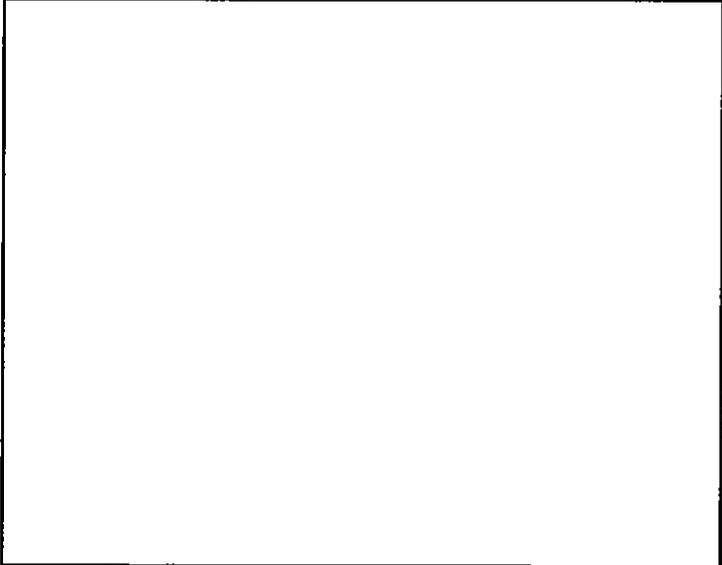

NOTE: Sketches are not to scale.

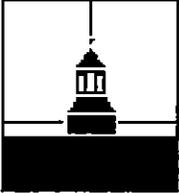

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .055


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION _____ reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

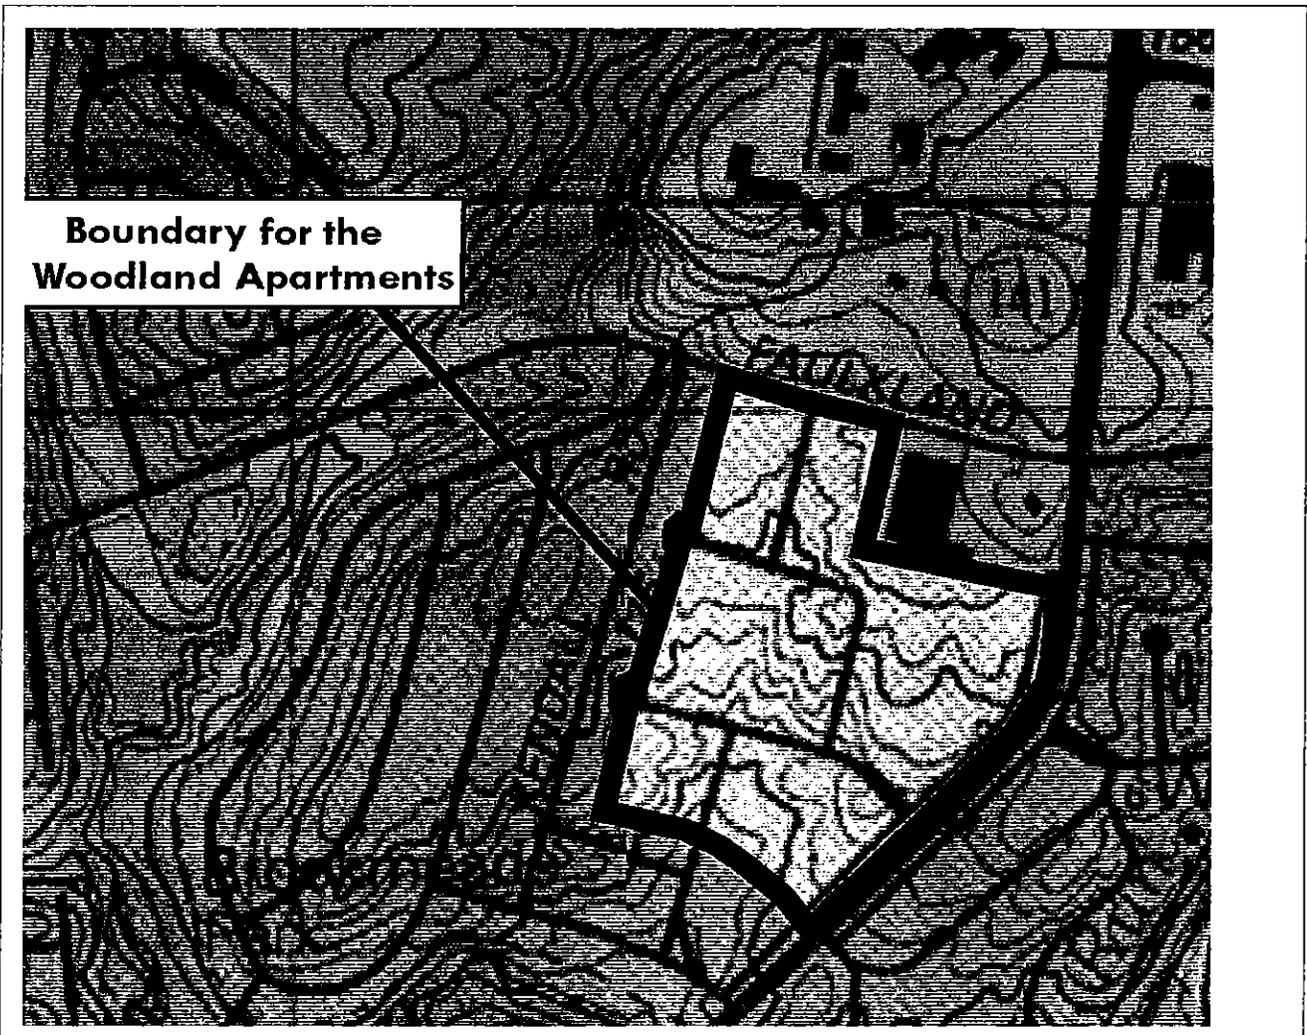


4. SITE PLAN:

CRS # N14270 .055


INDICATE NORTH ON PLAN

Sketch Plan

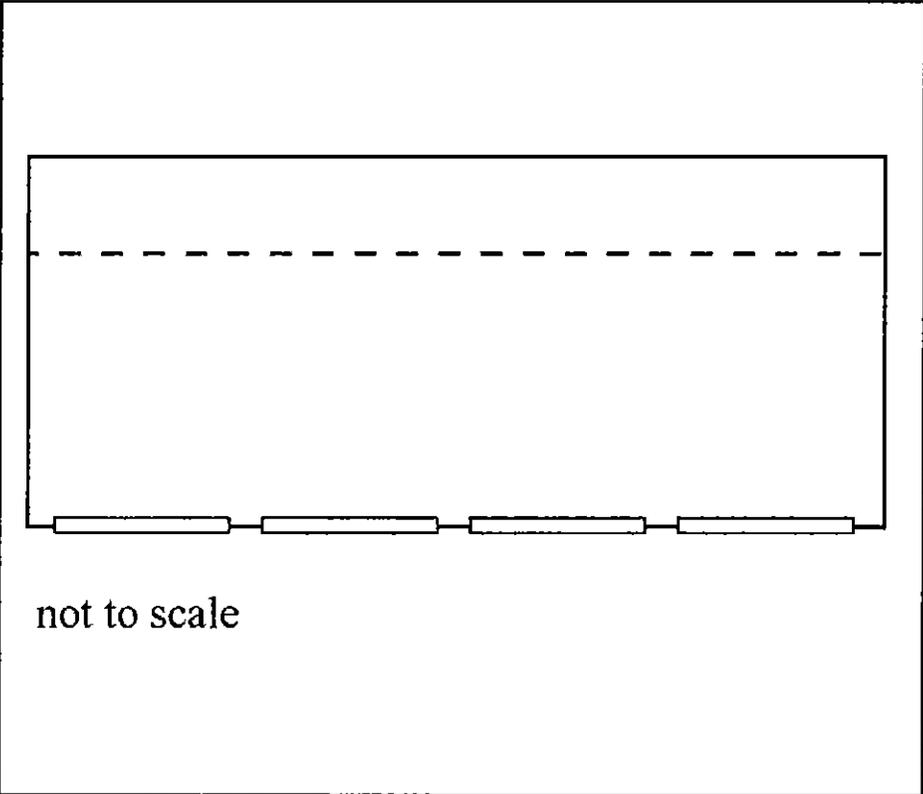


not to scale

First-Floor Plan
(where available)

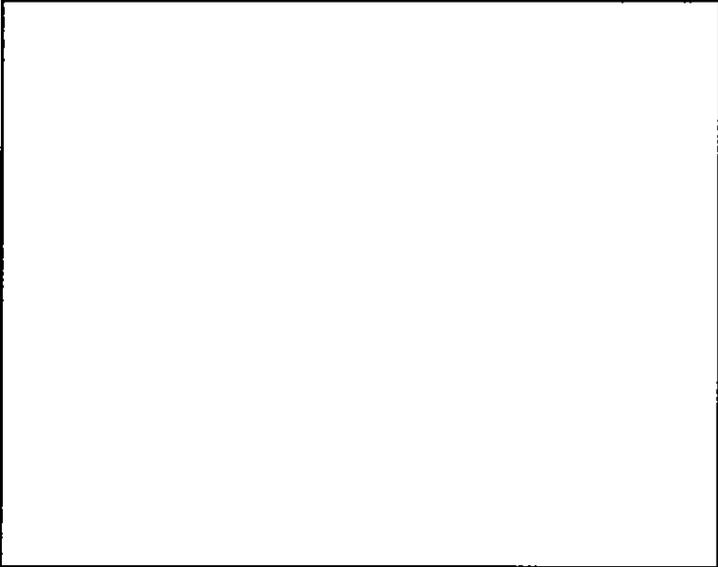

NOTE: Sketches are not to scale.

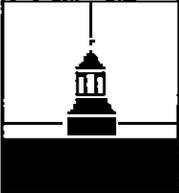

**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .056


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

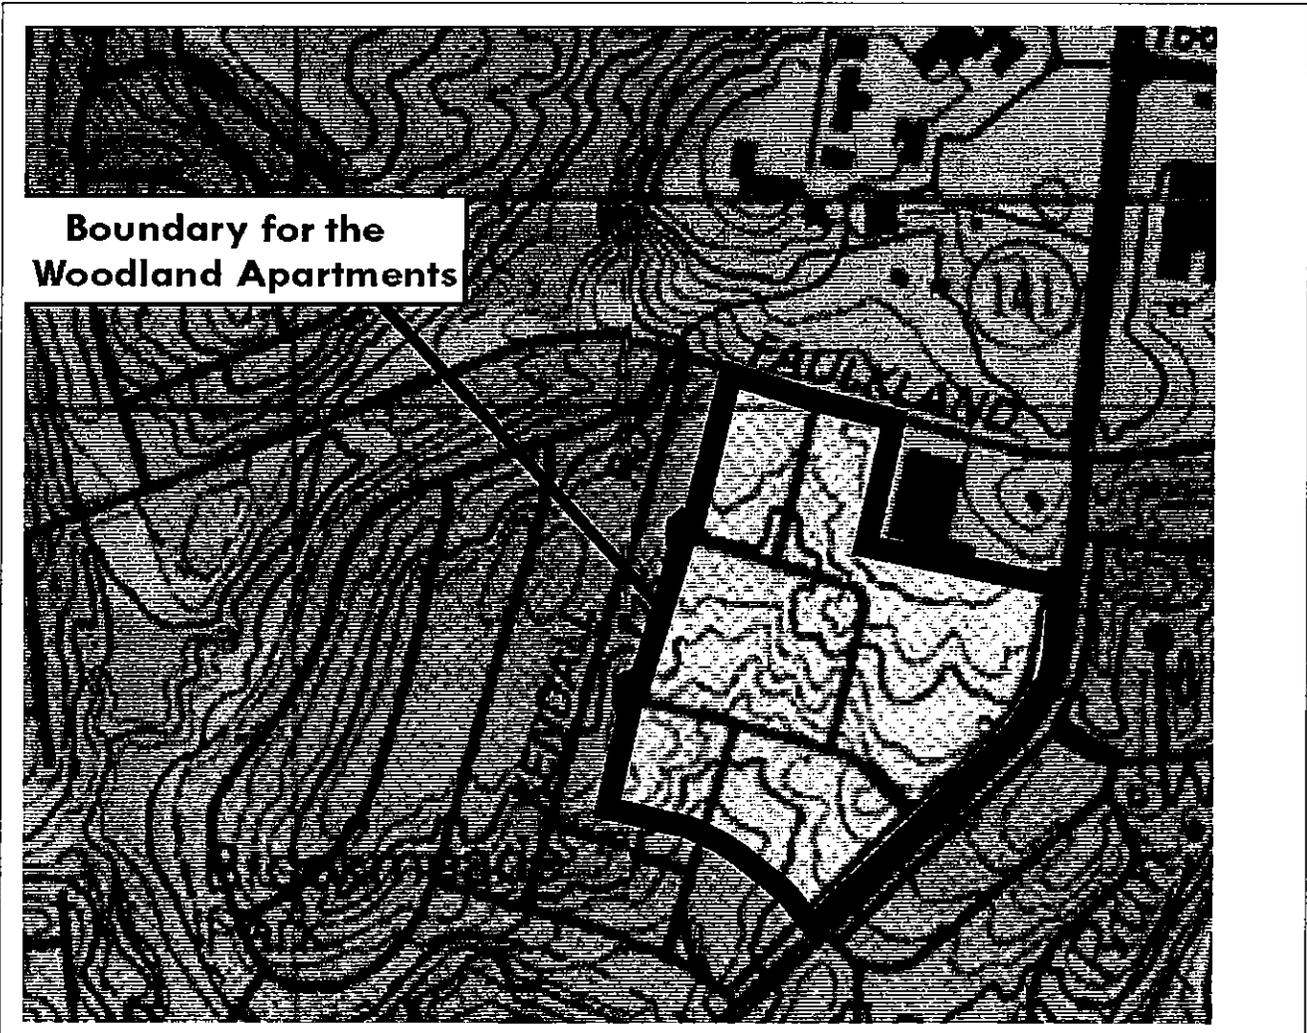


4. SITE PLAN:

CRS # N14270 .056


INDICATE NORTH ON PLAN

Sketch Plan

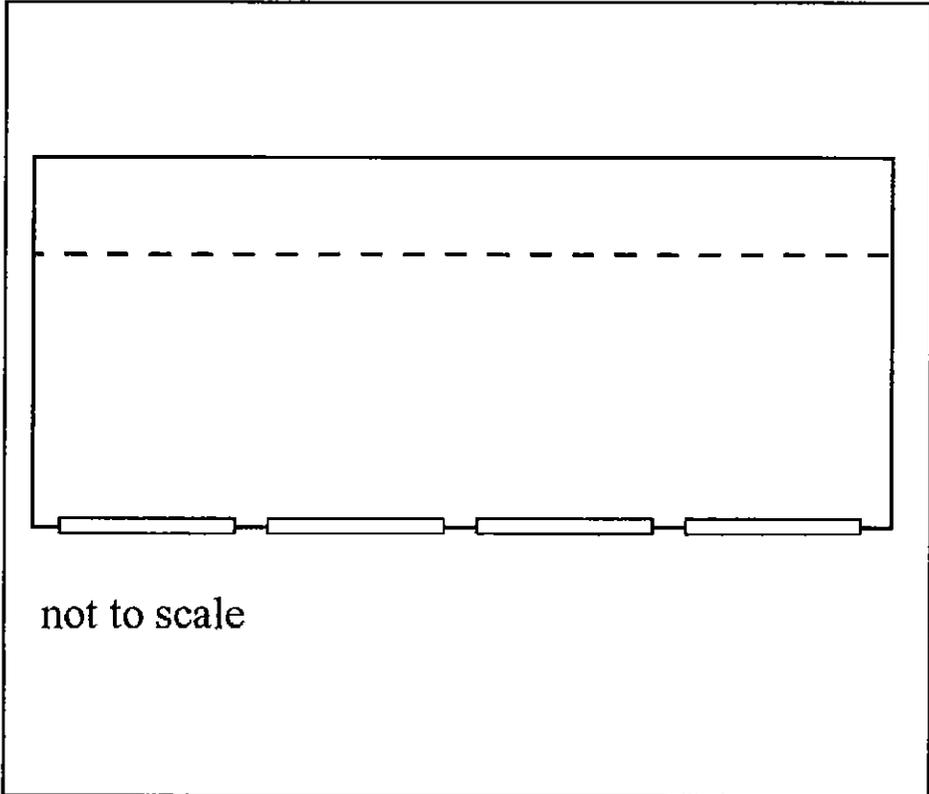

not to scale

First-Floor Plan
(where available)

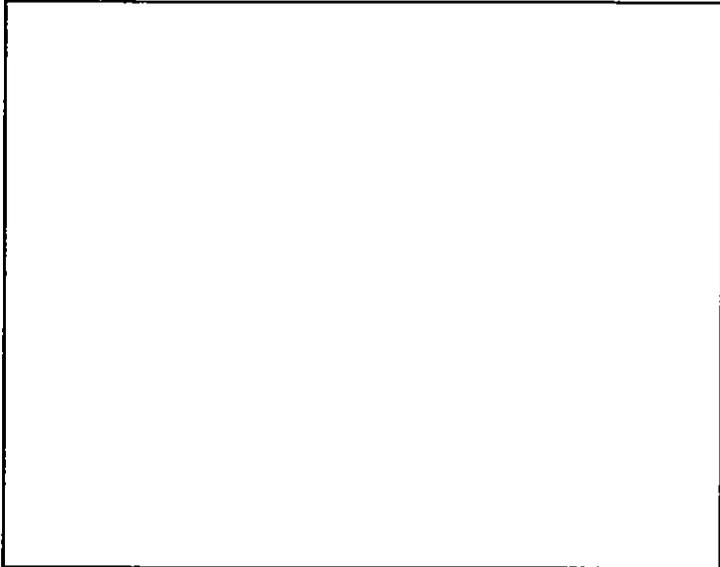

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .057


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical landmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

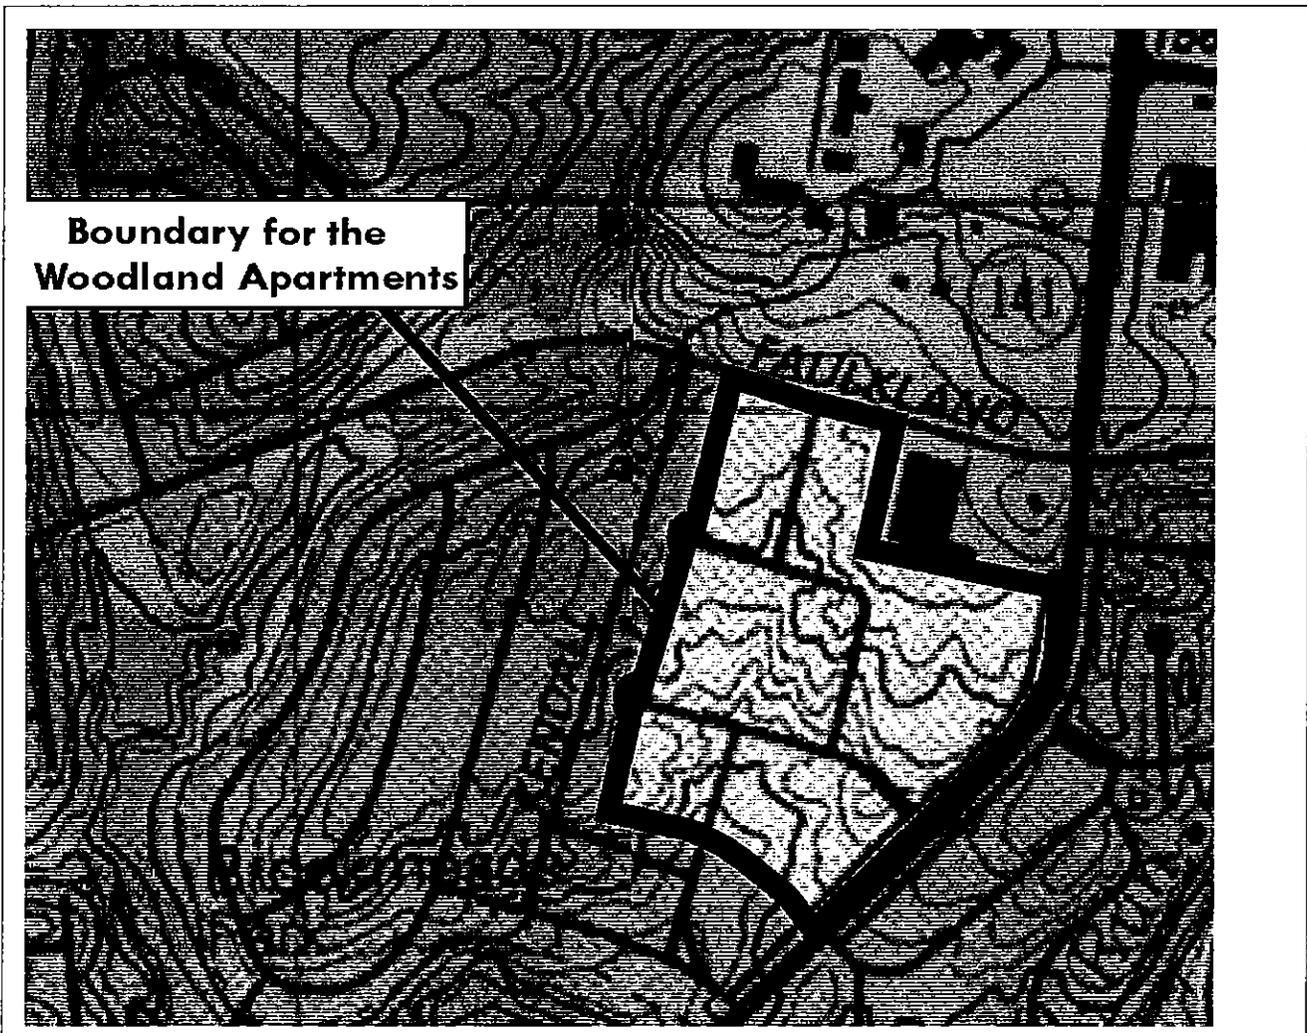


4. SITE PLAN:

CRS # N14270 .057

INDICATE NORTH ON PLAN

Sketch Plan

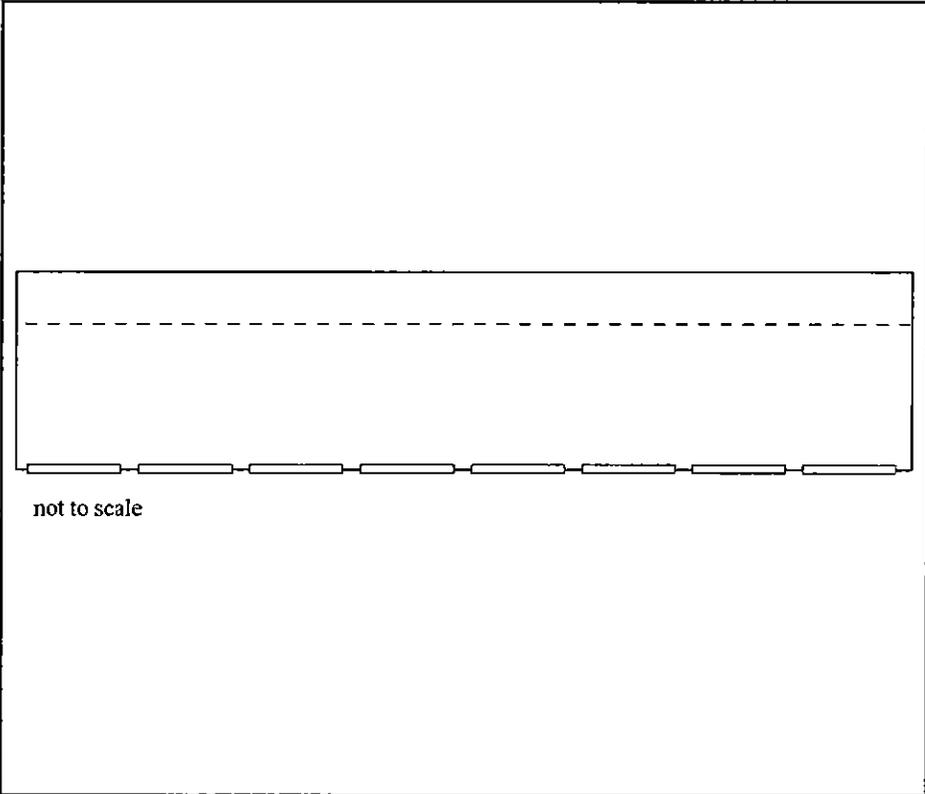

not to scale

First-Floor Plan
(where available)

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
MAP FORM**

CRS # N14270 .058


1. ADDRESS/LOCATION: 1201 Centre Road

2. NOT FOR PUBLICATION reason: _____

3. LOCATION MAP:

Indicate position of resource in relation to geographical andmarks such as streams and crossroads.
(attach section of USGS quad map with location marked or draw location map)

INDICATE NORTH ON SKETCH

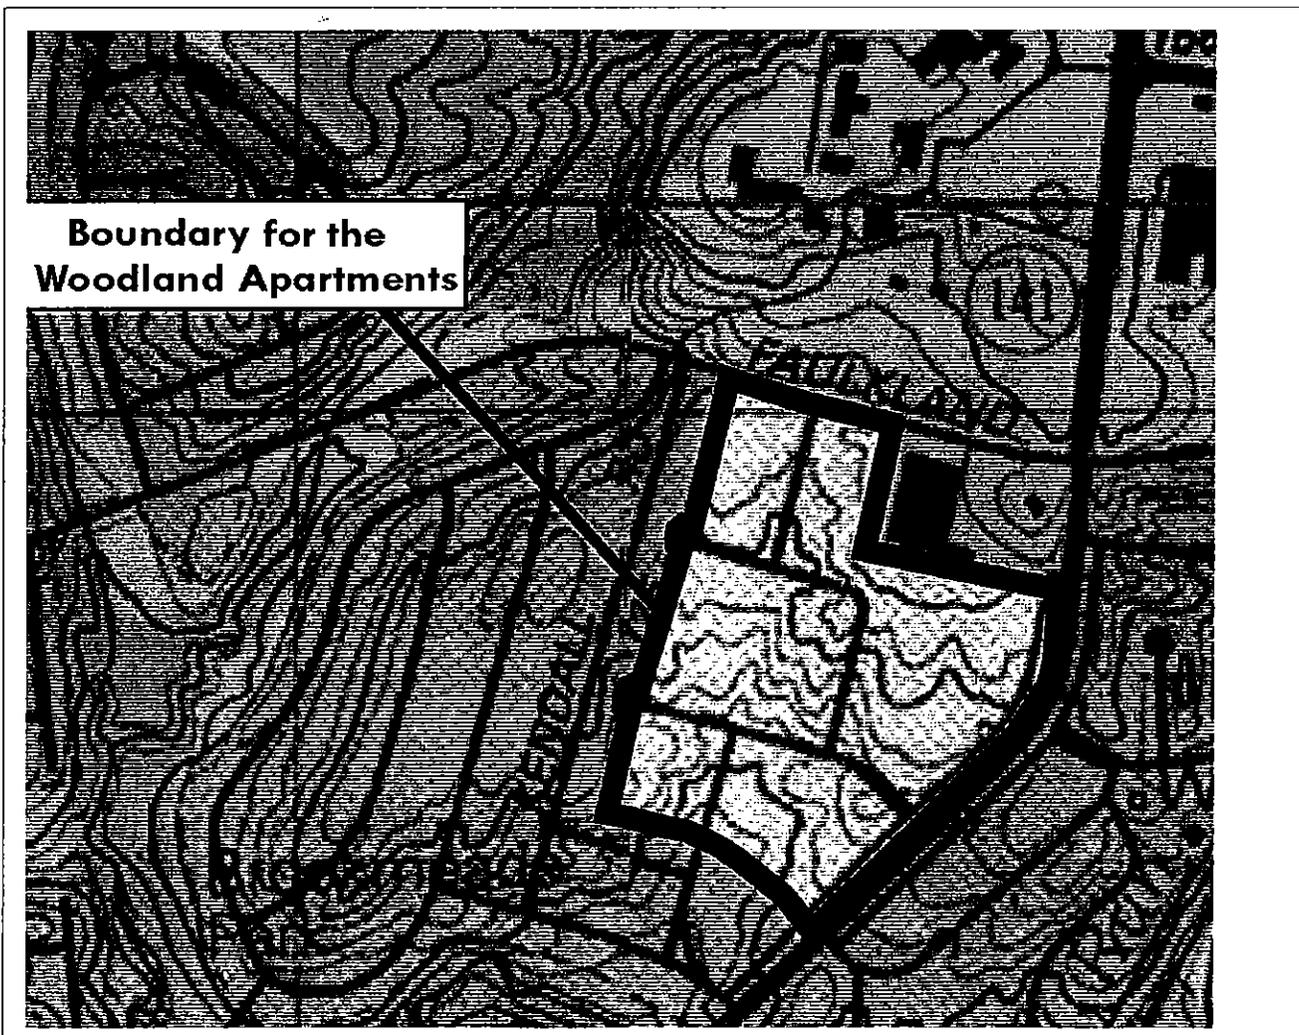


4. SITE PLAN:

CRS # N14270 .058

INDICATE NORTH ON PLAN

Sketch Plan

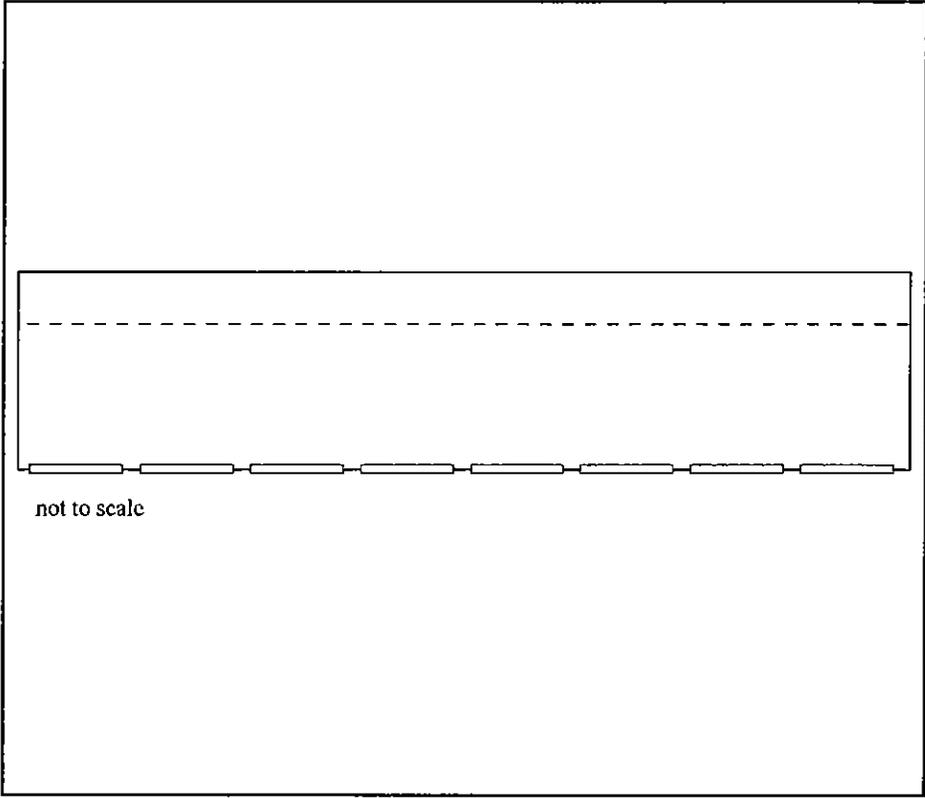

not to scale

First-Floor Plan
(where available)

NOTE: Sketches are not to scale.



**CULTURAL RESOURCE SURVEY
POTENTIAL DISTRICT FORM**

CRS # N14270
SPO Map 08-09-35
Hundred Christiana
Quad Wilmington South
Other _____

1. NAME OF PROPERTY: Woodland Apartments

2. BOUNDARY: _____

3. FUNCTION: residential: commercial: _____ religious: _____ archaeological: _____
recreational: _____ industrial: _____ governmental: _____ educational: _____
other: _____ describe: _____

4. REASON FOR SURVEY:
S.R.141/Centre Road Improvement Project

5. DOCUMENTATION:
a) Report title: Cultural Resources Survey, Centre Road (SR 141) Kirkwood Highway to Faulkland Road, Christiana Hundred, New Castle County, DE
b) Map showing boundary: attached
c) Cross-reference list of individual CRS#s (use ranges only for sequential numbers):

N14270.001 - N14270.058

6. Surveyor name: J. Davies; E. Burling; J. Kennedy; V. Zeoli PHONE: 215-790-1050

Principal investigator name: Johnette Davies, Director of Historical Services

Principal investigator signature: _____

Organization: Kise Straw & Kolodner DATE: _____